Sunshine Canyon Landfill Independent Monitor Quarterly Site Monitoring Status Report July 1, 2025 – September 30, 2025

Prepared For:

City of Los Angeles Department of City Planning

And

County of Los Angeles Department of Regional Planning



Prepared By:



16431 Scientific Way Irvine, California 92618

Prepared On:

December 17, 2025

CERTIFICATION STATEMENT

December 17, 2025

The attached Quarterly Site Monitoring Status Report for the Sunshine Canyon Landfill dated December 17 2025 is the Third Quarterly Report for 2025, issued by UltraSystems. This report covers the monitoring period from July 1 through September 30, 2025 and is prepared for the City of Los Angeles Department of City Planning and the County of Los Angeles Department of Regional Planning.

I, James T. Aidukas, Project Manager for the Mitigation Monitoring Services of the Sunshine Canyon Landfill, certify that the statements in the Quarterly Report and the referenced monthly reports reflect the site conditions observed, and compliance status noted by me and other qualified experts during the stated site visits.

Signed,

James T. Aidukas

Project Manager

Contents

Quarterly Status Report	
Site Visits During the Quarter	
Definition of Terms	
Status Summary	
Compliant	
Non-Compliant	
Further Review Needed	
Conclusions1	

Sunshine Canyon Landfill City Mitigation Monitoring Summary (see spreadsheet)

Sunshine Canyon Landfill County Mitigation Monitoring Summary (see spreadsheet)

Appendices

Appendix I Further Review Needed Comments: Reference I-g through I-i

Appendix II Photo Location Map and Relevant Site Photos

Appendix III Quarterly Site Visits

Attendees by Date and Mitigation Monitoring Site Reports

Quarterly Status Report

This Quarterly Status Report is a compilation of the period's monthly Site Monitoring. After each site visit, the UltraSystems monitors who went to the Sunshine Canyon Landfill site each wrote a Mitigation Monitoring Site Report. The Mitigation Monitoring Summary spreadsheets for the City and County of Los Angeles note any conditions and/or mitigation measures that need further review and document these areas in an appendix for that site visit date. Any issues that required immediate attention were reported to Republic Services (Republic) staff and the appropriate staff at the City of Los Angeles Planning Department, the County of Los Angeles Department of Regional Planning, the Los Angeles County Public Works and the Sunshine Canyon Landfill Local Enforcement Agency (SCL–LEA).

The Sunshine Canyon Landfill City and County Mitigation Monitoring Summary spreadsheets record by date each site visit and frequency of monitoring of specific conditions and/or mitigation measures. When a condition and/or mitigation measure is monitored, a check mark is made under the date that it was monitored, and the status of being compliant with the conditions and/or mitigation measures' requirements observed during monitoring is recorded. Tasks with a yearly or non-ongoing monitoring frequency are denoted by a forward slash (/) in subsequent date columns. In the status column, the letter "C" is put next to the task if it is Compliant; the letters "NC" are noted if the task status is Non-Compliant; and the letters "FRN" are used if Further Review is Needed for meeting the requirements of the conditions and/or mitigation measures.

Under the Further Review Needed/ Comment column, the conditions observed that have been noted as "FRN" in the status column refer to appendices which detail what was observed during the site monitoring. When the conditions and/or mitigation measures that were previously noted as "FRN" are fully compliant, an "R" is placed in the Resolved column and a "C" replaces the "FRN" in the status column. Also noted in the FRN–Comments column are those action items that would improve monitoring efficiency by having reports and documents readily available. These are summarized in the Mitigation Monitoring Summary spreadsheets and the Summary of Requested Documents section of the Quarterly Reports.

This Quarterly Report provides the City of Los Angeles Department of Planning and the County of Los Angeles Department of Regional Planning with a concise status of the Mitigation Measure Monitoring for the period of July 1, 2025 to September 30, 2025. It includes:

- 1. The City and County Mitigation Monitoring Summary spreadsheets for July 1, 2025 to September 30, 2025. These spreadsheets record the areas of monitoring completed and the status of being compliant during the third quarter of 2025;
- 2. A Status Summary of Non-Compliant, Further Review Needed and Compliant with the requirements of the conditions and/or mitigation measures;
- 3. Photo Location Map and Relevant Site Photos showing site conditions of key areas of the landfill during this quarter; and
- 4. Site visit attendees by date of site visit and the mitigation monitoring site report from each monitor.

Site Visits During the Quarter

Three site visits were performed by UltraSystems during the July 1, 2025 to September 30, 2025 quarter to observe operational site activities and determine compliance status with conditions and/or mitigation measures. They were performed on July 15, 2025; August 21, 2025; and September 25, 2025.

Definition of Terms

<u>Compliant</u> is defined as complying with the City and County conditions and/or mitigation measures.

Non-compliant is defined as not complying with the City and County conditions and/or mitigation measures.

<u>Further Review Needed</u> is defined as implementing plans (agency-approved, if required) to fully comply with a condition and/or mitigation measure. Some plans, especially vegetation, require an extended time frame, and immediate compliance is not possible.

<u>Resolved</u> is defined as action taken or activities completed to fully comply with conditions and/or mitigation measures.

Status Summary

This section summarizes the conditions and/or mitigation measures that were monitored during the quarterly reporting period and their respective statuses. The Sunshine Canyon Landfill Mitigation Monitoring Summary spreadsheets for the City and County show the conditions and/or mitigation measures monitored during the quarter. Also included in this report are relevant photos in Appendix II

Compliant

Most of the conditions and/or mitigation measures monitored were observed to be compliant. There are City and County conditions which are compliant but are noted as having corresponding comments that refer to the appendices. The Compliant with Comments section of the monitoring report provides a summary of activities being done onsite to construct or maintain facilities, and a summary of documents, reports and drawings that should be readily available onsite for monitoring reference.

Non-Compliant

During UltraSystems' site visits, no Non-Compliant conditions and/or mitigation measures were noted. Also, it must be understood that any monitoring related to landfill gas and odors is not part of the UltraSystems Monitoring Program at this time. These issues are currently being handled by a multi-agency team, which is led by the South Coast Air Quality Management District (SCAQMD).

Further Review Needed

The following conditions and/or mitigation measures were found not to be fully compliant but were being worked on to obtain full compliance. This section summarizes the progress being made toward being fully compliant. When a condition and/or mitigation measure progresses from "FRN" to fully compliant, it is noted as Resolved in this section, and on the City and County Mitigation Monitoring Summary spreadsheets.

Q-B.2.c (City)

Ancillary Uses and Facilities. The subject property may only be used for the following uses and facilities. These ancillary uses and facilities described in the July 1997 Draft Subsequent EIR, pages 2-38 through 2-43, and may be located on the applicant's property generally in conformance with the diagram attached as Exhibit e-4, and during the life of the landfill, may be moved or relocated following commencement of landfilling operations as necessary to accommodate development of the ultimate landfill footprint.

Geology-1.07 (County)

All grading activities shall be in compliance with specific requirements provided in a comprehensive geotechnical report for the proposed Project, including provisions for excavation approved by the County Department of Public Works, the County Local Enforcement Agency (LEA) and other Responsible Agencies.

Geology-1.11 (County)

Grading allows for ancillary facilities outside of the landfill footprint.

Biota-4.29 (County)

San Diego Horned Lizard: Impact on the San Diego horned lizard can be mitigated to a level of less than significant by restoring coastal sage scrub habitat. This will create a temporal loss of the species, but the population should recover following restoration of this habitat. Topsoils should be selected that are friable to suit lizard habitat requirements.

Biota-4.30 (County)

California Gnatcatcher: Surveys shall be conducted for California gnatcatchers prior to Game Permit onsite grading to determine the status of this Game species within development areas.

Biota-4.33 (County)

Migratory Bird Treaty Act: To prevent the loss of an active migratory bird nest, vegetation shall not be cleared during the breeding season (i.e. March 15 to August 1).

Biota-4.34 (County)

Raptor nests: If habitat removal is proposed during the raptor breeding season (i.e. March to July), a survey shall be conducted for active nesting areas.

<u>Current Status/Comment</u> – There was no grading outside of the approved landfill development limits during the 3rd Quarter. The road realignment to access the Administration area was within the Sunshine Canyon waste fill limits. There were alluvial water seeps at the road entrance. Grading up the canyon from the terminal basin was occurring while constructing the liner system from the new north liner to the Old City South Landfill slopes. The western edge of the Closure Turf was removed when doing the liner construction. This exposed old waste and leachate causing odors until construction was completed. The final toe berm has a completion date of late 2026 or early 2027. Alluvium soil removal in this area is to be verified by a qualified geologist. The new temporary access

road to the Administration offices area was extended to the scales installed at the old scale's location and used to weigh trucks hauling fire soil waste.

No City-approved drawings were available for review. Cells CC-4 Part 3, 4 and 5, CC-3, and CC-5A were accepting waste during the 3rd Quarter. The road around Basin E was paved, striped, had speed bumps installed and K-rail placed at the edge of the roadway. The new temporary access road to CC-4 Part 3, 4 and 5 was completed and paved. Posi-Shell and soil was applied to control landfill leachate seeps. On high wind days there was a significant amount of windblown litter on the southern internal ridgelines. No litter was observed leaving the site.

Q-C.3.h (City)

The access roads extended to new fill areas shall be surfaced with recycled asphalt, aggregate materials, or soft stabilization products to minimize the length of untreated dirt.

<u>Current Status/Comments</u> – In the 3rd Quarter, localized dust clouds occurred on dirt roads to and on the County top deck when soil importation trucks were delivering soil. These temporary roads did not have rock nor recycled concrete surfacing or soil stabilizer to control dust generation. Dust was not observed leaving the site from this location. On windy and dry days, dust clouds were observed coming from the cut slopes near the future toe berm location. These dust clouds could have left the site.

Q-C.5 (City)

Graffiti removal and deterrence on building and structures in public view.

<u>Current Status/Comments</u> – In the 3rd Quarter, there was no graffiti observed at the landfill site.

Q-C.10.c (City)

The operator shall submit, as part of its annual report, an evaluation of the feasibility of beneficial uses of the landfill gas collected at the site such as landfill-gas-to-energy.

Odor/Landfill Gas - 7.07 (County)

The permittee will recover and sell as much gas as is technically and economically feasible to reduce total air quality emissions from the landfill operations. It is expected that the technical and economic feasibility of commercial recovery and sale of landfill gas as a renewable energy resource will occur at levels below 40 MMCFD. The gas collection system will be installed in increments to allow for maximum gas recovery.

Gas - 52 (County)

To the extent technically and economically feasible, the Permittee shall use Landfill gas for energy generation at the Facility or other beneficial uses, rather than flaring, and shall obtain all applicable local, state, and/or federal approvals for any such use. Notwithstanding the forgoing, the Per be exempt from this Condition No. 52 if, as a 'part of its annual report required by Part X of the IMP, the Permittee determines that any such activity or project is infeasible, which determination shall be subject to the review and approval of the Director of Public Works.

The Permittee shall also install and maintain a landfill gas collection system complying with SCAQMD requirements, which uses best available control technology to control the lateral migration of gases to the satisfaction of the Director of Public Works, County LEA, and SCAQMD. In addition to the other requirements of this Condition No. 52, Landfill gas flares shall be installed below the adjacent interior ridges of the site, unless otherwise required by the SCAQMD, and the flames shall be totally contained

within the stacks. Flame arrestors shall be provided to the satisfaction of the County Forester and Fire Warden.

<u>Current Status/Comments</u> – During the 3rd Quarter, power outages and gas recovery system maintenance caused a fluctuation in gas recovery volumes recorded during the monitoring visits. Beneficial uses for gas being recovered and now flared, other than being used for gas to generate electric energy, were not further defined and proposed. Approximately 50% of the recovered gas is now flared. The current amount of gas generated is estimated to be approximately 70% of what will be produced during the final year of the approved landfill waste capacity.

T-4 (City)

Prepare a plot plan ["fire plan"] to the satisfaction of the Fire Department.
a. immediate access fire plan [now]
b. plot plan for the future facilities will be submitted when these are implemented

Fire Service - 12.03 (County)

The permittee shall maintain onsite fire response capabilities, construct access road, provide water tanks, water mains, fire hydrants and fire flows and perform brush clearance to the satisfaction of the County Forester and Fire Warden. The landfill will comply with all applicable County codes and ordinances which delineated the requirements for fire access, water mains, fire flows and fire hydrants, specifically defined by the County Fire Department. New construction water tanks, water mains and fire hydrants will be completed to meet the fire flow requirements of the Fire Department.

<u>Current Status/Comments</u> – An updated fire plan showing the locations of all facilities, and normal and emergency ingress and egress using the new temporary access road should be prepared and sent to the local City fire department station and City and County planning departments. The toe berm construction location, and Gas to Energy areas should be shown on the plan. Emergency egress should be posted for employees and customers.

M-4.1.1(2) (City)

Areas outside of and above the cut and fill as shown on the conceptual grading plan shall not be graded, except for the development of ancillary facilities or other related improvements. Additional grading may be necessary for slope stability or drainage purposes. Prior to undertaking any grading activities, the Department of Building and Safety shall be notified and approve any additional grading based on engineering studies (in accordance with CCR Title 27) provided by the project proponent and independently evaluated by the Department of Building and Safety.

M-4.1.1(4) (City)

Grading that allows for construction of ancillary facilities outside of the landfill footprint or that has the potential to impact property beyond the boundary of the landfill shall be approved by the Department of Building and Safety.

M-4.1.1(5) (City)

All grading activities shall be in compliance with specific requirements provided in a comprehensive geotechnical report prepared specifically for the proposed project, including provisions for excavation approved by the Department of Building and Safety, City Engineer, City LEA and other Responsible Agencies.

M-4.1.5(12) (City)

Geologic Hazards - Liquefaction

Alluvium in the canyon bottoms beneath the footprint of the waste containment system and beneath ancillary structures shall be excavated and, if necessary, replaced with compacted structural fill during construction. A qualified geologist shall be onsite during construction activities to observe removal and replacement of alluvium and verify that all alluvium within the landfill footprint has been removed prior to placement of any compacted fill or construction of any containment system elements.

M-4.14.1(155) (City)

Construction of the realigned access roadway shall not exceed 15 percent in grade. An access road shall be constructed and maintained around the working area of the landfill for emergency access for firefighting equipment.

Geology-1.07 (County)

All grading activities shall be in compliance with specific requirements provided in a comprehensive geotechnical report prepared specifically for the proposed Project, including provisions for excavation approved by the County Department of Public Works, the County Local Enforcement Agency (LEA) and other Responsible Agencies.

<u>Current Status/Comments</u> – There was no grading outside of the approved landfill development limits during the 3rd Quarter. Grading for the new main access road realignment in the small valley south of the current main access road was completed with road striping, speed bumps, and safety Krails. The access road and slopes around Basin E appeared to have uncontrolled rainwater impacts. Republic's final drainage design plans should include review of the current drainage impacts. The construction plans and supporting geotechnical reports were reviewed and approved by City Planning and the City Building Department. The City Building Department also approved brush and tree clearance and hillside grading. The technical reports and detailed plans were not available for review by the monitor. Compliance with County Geology – 1.07 documentation was not able to be verified by the monitor.

Access roads were being maintained around the working area for emergency access. The final perimeter access road construction on the westside was completed. Wet weather surfacing or paving was not done.

M-4.1.4(11) (City)

An operations checklist shall be used by a registered engineering geologist for surveys following all earthquake events measuring 5.0 on the Richter Scale or greater near the project site. A comparison of operating parameters and site conditions before and after major earthquake events shall be made to verify that systems are operational as designed. Final designs for major engineered structures shall be based on the results of the detailed stability analyses of potential seismic events.

Geology-1.16 (County)

An operations checklist will be used by a certified engineering geologist, registered civil engineer, or licensed surveyor for surveys following all earthquake events of 5.0 magnitude or greater.

<u>Current Status/Comments</u> – There were no earthquakes of 5.0 magnitude or greater in the area during the 3rd Quarter.

M-4.1.1(6) (City)

Revegetation and erosion control procedures on all exposed slopes shall be implemented. The erosion controls to be implemented at the site shall include soil stabilization measures and revegetation in

accordance with the approved revegetation plan as approved by the City Building and Safety Department. Interceptor ditches shall be designed to divert storm runoff to a sedimentation basin.

M-4.2.11(23) (City)

Disturbed areas shall be revegetated with an interim ground cover as specified in the proposed revegetation program. Excavation will proceed in a manner to reduce the number of graded areas at any given time.

M-4.2.12 (28) (City)

Site Erosion

- c. A temporary vegetation cover shall be established on all slopes that are to remain inactive for a period longer than 180 days.
- d. An SCAQMD approved soil stabilization (sealant) product shall be used to retard soil erosion and enhance revegetation. Soil sealant shall be applied when necessary to selected working areas of the landfill. The sealant will also be used as a binder or tackifier to hold seen during revegetation mulch, and fertilizers in-place until grasses become establish and stabilize on the landfill surface.

Geology-1.13 (County)

Revegetation and erosion control of all exposed slopes will be an ongoing process. The erosion controls to be implemented at the site will include soil stabilization measures and revegetation in accordance with the approved Revegetation Program. The installation of interceptor ditches shall be designed for the diversion of storm runoff to sedimentation basins. Sediment traps will be used at points of runoff concentration along the perimeter of exposed slopes surfaces.

Condition: Approval of drainage plan. Retention of a consulting horticulturalist/Registered Professional Forester and an independent qualified biologist by the permittee for ongoing supervision of revegetation programs. Review and monitoring of planting programs by County Forester.

Geology-1.14 (County)

To prevent soil erosion on the face of the landfill, interim vegetation measures will be taken after placement of the temporary soil layer (even though the area may be disturbed by future filling operations). Vegetative cover will be placed as in the approved Revegetation Program.

Condition: Retention of a consulting horticulturalist/Registered Professional Forester and an independent qualified biologist by the permittee for ongoing supervision of revegetation programs. Review and monitoring of planting programs by County Forester.

Biota - 4.42 (County)

Areas inactive for 180 days or longer will be planted with interim vegetation as approved by County biologist. Records will be kept to track fill areas of the site which are transferred to an inactive status so that appropriate dust control and revegetation measures can be implemented.

Air Quality - 6.02 (County)

Dust Control will also be accomplished through the temporary revegetation of the landfill surface. A temporary revegetation of the landfill surface, and a temporary vegetation cover will be established on all slopes that are to remain inactive for a period longer than 180 days. Specifications of temporary revegetation measures will be provided in the Revegetation Plan submitted to the County biologist for approval, the Closure and Postclosure Maintenance Plans, the Condition Use Permit, and Conditions of Project Approval.

Visual-10.08 (County)

Cover/Revegetation Requirements

The permittee shall comply with the following cover and re-vegetation requirements at the Landfill:

(1). The permittee shall apply a temporary hydroseed vegetation cover on any slope or other Landfill area that is projected to be inactive for a period greater than 180 days, as set forth in the IMP. The permittee shall promptly notify the County LEA and the Department of Public Works of any such slope or area:

Revegetation Requirements

- (5) Notwithstanding the foregoing, the permittee shall not be bound by the previous provisions of this Condition No. 44, but instead by the requirements of the County LEA, so long as the Limits of Fill are not exceeded, if in consultation with the Department of Public Works, the County LEA determines that a different re-vegetation design or plan:
- (1) would better protect public health and safety;
- (2) would enable revegetation of the final slopes at least as well as shown in Exhibit "B" described in subsection D, above; and/or experts, including an independent, qualified bio (3) would be required because the minimum standards adopted by the CIWMB have been amended;
- (6) the permittee shall employ an expert or biologist, to satisfy this Condition No. 44. Soil sampling and laboratory analysis shall be conducted in all areas that are required to be re-vegetated before any revegetation occurs to identify chemical or physical soil properties that may adversely affect plant growth or establishment. Soil amendments and fertilizer recommendations shall be applied and plant materials selected, based on the above referenced testing procedures and results. To the extent possible, plant types shall blend with species indigenous to the area, be drought tolerant, and be capable of rapid growth. The selected plants shall not include nonindigenous species that are likely to be invasive of adjacent natural areas.

Biota - Revegetation - 44.A (County)

A. The Permittee shall apply a temporary hydroseed vegetation cover on any slope or other Landfill area that is projected to be inactive for a period greater than 180 days, as set forth in the IMP. The Permittee shall promptly notify the SCL-LEA and the Department of Public Works of any such slope or area.

Revegetation - 44.F/44.F CUP (County)

F. The Permittee shall employ an expert or experts, including an independent, qualified biologist, to satisfy this Condition No. 44. Soil sampling and laboratory analysis shall be conducted in all areas that are required to be re-vegetated before any re-vegetation occurs to identify chemical or physical soil properties that may adversely affect plant growth or establishment. Soil amendments and fertilizer recommendations shall be applied and plant materials selected, based on the above-referenced testing procedures and results. To the extent possible, plant types shall blend with species indigenous to the area, be drought tolerant, and be capable of rapid growth. The selected plants shall not include non-indigenous species that are likely to be invasive of adjacent natural areas.

<u>Current Status/Comments</u> – During the 3rd Quarter, Closure Turf was being maintained that was not impacted by construction. The gas and liquid recovery systems under the turf were performing well. Portions of the western Closure Turf were removed for the installation of the new liner system and the tie-in to the existing northern liner. There were odors from old waste, gas emissions and odorous liquids that had to be handled during construction until the new liner system was completed and operational. These odors were localized and efforts were made to control them to not leave the site. Posi-Shell and soil were used to control landfill leachate seeps and old waste odors in areas where the next active area was planned. Hydroseeding and placement of straw waddles was done in some of the areas above the Posi-Shell that had reached intermediate cover elevations.

M-4.1.1 (7) (City)

Prior to the initiation of grading activities, the project proponent shall undertake, if necessary, reabandonment procedures as required by the California Department of Conservation, Division of Oil, Gas, and Geothermal Resources.

<u>Current Status/Comments</u> – The old, abandoned oil well casing adjacent to the north secondary access road from the Flare 11 site was not reabandoned. An evaluation of the need to reabandon this well should be done. This well was not leaking oil or gas and did not pose a current hazard. It is well beyond the approved landfill limits but inside the ridgeline of Sunshine Canyon. An unabandoned well could be a future problem.

M-4.1.6 / 18 (City)

Survey monuments shall be installed around the perimeters of the outer fill areas at points where they would not be subject to disturbance by landfill development and marking the 500-foot setback from the more restrictive zone. The exact spacing, location, and characteristics of the survey monuments shall be submitted to and approved by the City Local Enforcement Agency (LEA).

<u>Current Status/Comments</u> – A significant number of the landfill perimeter boundary survey PVC marker pipes have been removed in areas where Edison pole grading took place, near the Flare 11 site pad grading and near the CC-4 Part 3 buttress. All PVC boundary markers need to be verified and replaced if missing. New markers should also be placed at the final south double-lined boundary.

M-4.2.13/29, 30, 32, 33, 34 (City)

The natural biological processes that generate odors in a landfill through anaerobic decomposition cannot be prevented or avoided. However, the LFGs shall be prevented from escaping to the atmosphere through the use of control measures. These measures include using daily and intermediate cover material over deposited wastes, filling any surface cracks with clean dirt as necessary, and extracting LFG through the use of an LFG collection and recovery system and destroying collected gases by combustion.

Operational techniques shall be utilized to control odor sources at the landfill. The size of the working face shall be limited so that the area of waste exposed to the atmosphere is kept to a minimum.

The LFG collection and recovery system shall be installed in phases as each portion of the landfill site is filled. The final system shall contain a network of gas extraction wells, collection system piping, and flaring facilities. Because the LFG generation begins at lower levels of volume and increases during the landfill site life, the gas will be flared initially until sufficient quantities are available for processing into electricity.

If an odor problem should develop, appropriate control measures shall be implemented. These measures include the application of additional dirt daily cover material or more frequent application of the cover material to seal the landfill surface, or adjustments to the wells, equipment, and operation of the LFG collection and recovery system.

To ensure that odors are kept to a minimum, the following odor/LFG monitoring program shall be implemented for the proposed landfill project. The monitoring program shall comply with the requirements of SCAQMD Rule 1150.1 and include:

a. Sample Probe Installation: One monitoring probe per 1,000 feet or as identified by South Coast Air Quality Management District (SCAQMD) and/or Local Enforcement Agency (LEA) in the landfill expansion, and one probe per 650 feet or as identified by SCAQMD and/or LEA in the City Inactive landfill along the landfill perimeter, or whichever is more restrictive shall be installed to identify potential areas of subsurface landfill gas (LFG) migration. These probes shall be monitored to ensure that quantities of LFG beyond regulatory standards do not vent offsite through subsurface soils.

- b. Integrated Landfill Surface Sampling: The landfill surface shall be monitored to ensure that the average concentration of total organic compounds over the landfill surface does not exceed SCAQMD's standard of 25 ppm.
- c. Ambient Air Samples: 24-hour integrated gas samples and required meteorological data shall be taken to assess any impact the landfill is having on the ambient air quality at the landfill perimeter.
- d. Instantaneous Landfill Surface Monitoring: Spot checks on the landfill surface shall be made to determine the maximum concentration of total organic compounds measured as methane, measured at any one point on the surface of the landfill does not exceed the SCAQMD's standard of 500 ppm.
- e. Regular Monitoring and Annual Testing: LFG concentrations at perimeter probes, gas collection system headers, the landfill surface, and in ambient air downwind of the landfill shall be monitored once per month or less frequently (but no less than quarterly) as required by the SCAQMD. The LFG collection system shall be adjusted and improved based on quarterly monitoring data and annual stack testing results.

Odor/Landfill Gas - 7.06 (County)

If an odor problem should develop, appropriate control measures shall be implemented. These measures include the application of daily cover material or more frequent applicant of the cover material to seal the landfill surface, or adjustments to the wells, equipment, and operation of the LFG collection and recover system.

Amendment 45.N - 4.a, 4.c, 4.d (County)

Identify and provide status on the measures currently being implemented as required by the AQMD's Order for Abatement.

An odor patrol program, which would include the following at a minimum:

- Provide a trained technician to conduct odor patrols in the surrounding neighborhoods at a frequency of one patrol per hour from 6 a.m. to 10 a.m., Monday through Saturday, and during adverse wind conditions
- If odor is detected, identify its potential and/or actual source, including those that may not be related to the Landfill's operation, such as an odorous trash dumpster or transfer trucks.
- If odor is determined to be related to the Landfill's operation, take immediate action to reduce the odor. Document the streets patrolled on a map, time of the patrol, potential source of odor, and immediate actions taken by the Landfill.
- A landfill gas mitigation plan in preparation for the next rainy season since landfill gas emissions from either the landfill surface or landfill gas control equipment is cited as a potential contributor in the AQMD's Order for Abatement. The plan should include the following at a minimum:
- Description of the site's current Gas Monitoring and Control Plan, including a map showing locations of gas monitoring probes, gas extraction wells, horizontal and vertical gas collection lines, etc.
- Compliance history of the site's landfill gas migration control program from January 1, 2009, to the present quarter as well as any corrective actions.
- Discuss the impacts of the most recent heavy rains on the landfill gas collection system, including identifying locations of damage due to soil erosion, as well as any corrective actions or mitigation measures.
- A work plan that includes preventive measures, such as identifying and filling any surface cracks and installing additional extraction wells, as well as contingency measures.
- An implementation schedule for the above work plan.

Amendment 45.N - 5 (County)

Include in the Quarterly Dust and Odor Reports, which are required by CUP Condition No. 45.N, the status and effectiveness of mitigation measures 1 through 3 above, and the Odor Mitigation Plan.

10

<u>Current Status/Comments</u> – Compliance with these mitigation measures, concerning landfill gas monitoring and odor control and detection, is being monitored by a multi-agency team led by the SCAQMD. Only obvious gas emission sources, odorous operations related to gas and/or gas and landfill liquids, lack of cover, or exposed trash resulting in odors detected during the monitoring visits are reported in the monitors' site report.

On a random site visit during the 3rd Quarter, there were slight landfill odors detected in the adjacent neighborhood on the morning of May 20, near Constable Avenue and also at Timber Ridge Drive. All other neighborhood areas did not have any odors detected. On the other site visit days, there were no landfill odors detected.

The use of Closure Turf to seal inactive filled areas and function as intermediate cover also provided enhanced gas and liquids recovery and gas-related odor control. There were no gas or liquid odors detected coming from the fully operational Closure Turf areas.

M-4.3.1(37) (City)

As development of the site proceeds, surface drainage systems shall be maintained so that surface runoff is diverted away from working slopes and isolated from landfilled refuse. Onsite drainage channels would be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, §2533(C), and County of Los Angeles Public Works Department, Flood Control Division requirements.

Surface Water - 2.03 (County)

As development of the site proceeds, surface drainage systems shall be maintained so that surface runoff is diverted away from working slopes and isolated from landfilled refuse. Onsite drainage channels would be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, §2546(C), which mandates the requirements for a capital storm event (100-year 24-hour precipitation).

M-4.3.1(38) (City)

Permanent bench drainage ditches shall be installed when final cover is placed on completed portions of the landfill. These ditches shall be lined. Temporary unlined drainage facilities consisting of diversion ditches (V-ditches) where necessary shall directly intercept natural surface runoff. Any intermittent channel flow in the existing canyon bottom shall be captured, channeled, and conveyed into a sedimentation basin. Diversion ditches shall convey surface runoff from the undisturbed areas to the permanent perimeter ditches for safe transport around the landfill footprint. Surface covers of various types, from mulches to vegetation, shall be used to retard erosion from areas of disturbance. In addition, areas of disturbance shall be kept at a minimum during active filling operations.

Surface Water - 2.12 (County)

Permanent bench drainage ditches shall be installed when final cover is placed on completed portions of the landfill. These ditches shall be lined. Temporary unlined drainage facilities consisting of diversion ditches (V-ditches) where necessary shall directly intercept natural surface runoff. Any intermittent channel flow in the existing canyon bottom shall be captured, channeled, and conveyed into a sedimentation basin. Diversion ditches shall convey surface runoff from the undisturbed areas to the permanent perimeter ditches for safe transport around the landfill footprint. Surface covers of various types, from mulches to vegetation, shall be used to retard erosion from areas of disturbance. In addition, areas of disturbance shall be kept at a minimum during active filling operations.

<u>Current Status/Comments</u> – It is assumed by UltraSystems that the permanent drainage V-ditches and channels are designed in accordance with the referenced regulations. The design drawings and engineering reports should be available for review and use.

11

Surface drainage systems were in-place to intercept or divert rainwater away from prior landfill cells and current filling operations. Most of these were temporary systems in active areas, and most conveyance V-ditches were unlined. The construction of the final toe berm and main access road realignment project is ongoing. This is a two-year project and includes a new sediment Basin E, modification of the terminal basin, the construction of new drainage channels, and possibly a new upstream basin from the terminal basin. Possible construction activity could include drainage improvements in the ravine south of the current entrance and modification to the terminal basin's size and inlet sources. The design plans, design details and engineering calculations were submitted to the City for permit approval. The design plans and engineering reports were not available for review by the monitor nor submitted to the LACPW for approval. Compliance with Surface Water – 2.03 could not be verified. An engineering evaluation of the site's total surface drainage system should be done, which reflects the current system's modifications. Onsite drainage channels should be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, Section 2533(C), and Los Angeles County Public Works department, Flood Control requirements.

The rainwater control system for the new access road and slope around Basin E had uncontrolled rainwater impacts. Republic's final design and construction plans for the drainage system for this adjacent canyon development were not made available to be monitored. The Basin E water discharge pipe into the Terminal Basin was plugged with sediment in the 3rd Quarter. Drainage improvements, engineering calculations and plans for the whole landfill site were also not available to the monitor. Republic's engineering consultants should have drainage plans and engineering support calculations available for agencies' approval and monitors' review.

M-4.3.1(39) (City)

As filling operations progress upward in elevation and laterally across the canyon, both permanent and temporary drainage facilities shall be used to provide appropriate drainage protection. The lower elevation portions of the landfill working face shall be placed under final cover as soon as final grade is attained, and bench ditches shall be installed that will connect to adjacent, permanent perimeter ditches. These ditches shall connect directly to the temporary diversion drainage ditches that will protect the active landfill areas from natural surface runoff.

M-4.18 / 178 (City)

The maximum permitted elevations for the landfill shall not be allowed to be exceeded at any time during landfill development and shall be verified through survey control points.

<u>Current Status/Comments</u> – A site map showing areas that are at the final elevations, and which should have final cover should be available for review. A map showing other filled elevations should also be available onsite for review. The amount of stockpiled soil should also be indicated in recorded elevations.

M-4.3.1(40) (City)

In order to monitor the effectiveness of those measures designed to prevent pollution from entering the offsite stormwater system, the project proponent shall be required to apply for coverage under the SWRCB General Construction Activities Stormwater Permit Programs.

M-4.3.1(45) (City)

An erosion control plan would be implemented by the project proponent to prevent stormwater pollution from construction activity. Construction materials, equipment and vehicles would be stored or parked in areas protected from stormwater runoff. Construction material loading and unloading would be in designated areas to minimize any washout due to stormwater runoff. Pre-construction controls

would be implemented to include the use of a sandbagging system, including sandbag check dams and sandbag desilting basins, which would be used to limit runoff velocities and minimize sediment in stormwater runoff.

Surface Water 2.14 (County)

An erosion control plan would be implemented by the project proponent to prevent stormwater pollution from construction activity. Construction materials, equipment and vehicles would be stored or parked in areas protected from stormwater runoff. Construction material loading and unloading would be in designated areas to minimize any washout due to stormwater runoff. Pre-construction controls would be implemented to include the use of a sandbagging system, including sandbag check dams and sandbag desilting basins, which would be used to limit runoff velocities and minimize sediment in stormwater runoff.

<u>Current Status/Comments</u> - Surface drainage systems were in-place to intercept or divert rainwater away from prior landfill cells and current filling operations. Most of these were temporary systems in active areas, and most conveyance V-ditches were unlined. The construction of the final toe berm and main access road realignment project is ongoing. This is a two-year project and includes the new basin E, modification of the terminal basin to accept rainwater and control the drainage water energy, and the construction of new drainage channels, and possibly a new upstream basin prior to the terminal basin. The road realignment will entail the construction of a new main access road, the 350,000-cubic-foot sedimentation basin E, drainage improvements in the ravine south of the current entrance, and modifications to the terminal basin's size and inlet sources. The design plans, design details and engineering calculations were submitted to the City for permit approval. The design plans and engineering reports were not available for review by the monitor or submitted to LACPW for approval. Compliance with Surface Water – 2.03 could not be verified. An engineering evaluation of the total site's surface drainage system should be done, which reflects the current system's modifications. Onsite drainage channels should be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, Section 2533(C), and Los Angeles County Public Works department, Flood Control requirements.

M-4.3.1(41) (City)

The surface water collection system shall be designed to collect runoff and collect/retain suspended solids. Water leaving the sedimentation basins shall be monitored in accordance with NPDES requirements.

M-4.3.1(43) (City)

Sediment shall be cleaned out of the sedimentation basins after every significant storm.

Surface Water 2.10 (County)

The surface water collection system shall be designed to collect runoff and collect/retain suspended solids. Water leaving the sedimentation bans shall be monitored in accordance with NPDES requirements. Sediment shall be cleaned out of the sedimentation basins after every significant storm.

<u>Current Status/Comments</u> – In the 3rd Quarter, all the basins, except for basin E, were cleared of sediment. A minor amount of standing water was observed in the Terminal Basin. The water inlet structure and energy dissipater in the basin were being constructed. Basin E had standing water and sediment. Major modifications were made to the Terminal Basin and its inlet channels. No hydrology reports were available to the monitor or the County that would show the current rainwater handling capacities and what future rainwater control improvements would be needed and their capacities.

M-4.3.1(46) (City)

A preventive maintenance program would be implemented by the project proponent, including inspection of facility equipment, systems, and stormwater management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater. This program applies to the onsite drainage ditches; rip-rap; berms and dikes; dust control; silt fences; diversion grading; and pavement surfaces. Each system and piece of stationary equipment would be inspected monthly. Procedures for inspection would vary, due to the piece of equipment or system. However, the major elements of the inspection program would include checking for cracks or structural failures, inspecting parts or pieces of equipment nonfunctioning, checking for the degradation or deterioration of operating units, and investigating the need for cleaning or emptying units. A summary report of these monitoring results and the corrective actions taken will be disseminated in each newsletter with a more detailed report on the website and in the annual report.

Surface Water 2.15 (County)

Surface Water Preventive Maintenance Program

A preventive maintenance program will be implemented by the permittee, including inspection of facility equipment, systems, and stormwater management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater. This program applies to the onsite drainage ditches, rip-rap, berms and dikes, dust control, silt fences, diversion grading, and pavement surfaces. Each system and piece of equipment will be inspected monthly.

Procedures for inspection would vary based on the piece of equipment or system. However, the major elements of the inspection program will include checking for cracks or structural failures, inspecting parts or pieces of equipment nonfunctioning, checking for the degradation or deterioration of operating units, and investigating the need for cleaning or emptying units.

<u>Current Status/Comments</u> – A preventative maintenance program with inspection of facility equipment, systems and storm water management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater should be performed monthly, with a summary report issued on a quarterly basis. These reports were not reviewed in the 3rd Quarter.

In the 3rd Quarter, it was observed that vegetation was growing out of numerous cracks in the water retention basins and drainage conveyance channels' concrete. There were areas of the channels and basins that needed the growing vegetation to be removed, and repair of concrete and sealing of cracks. These clean-up and maintenance tasks are put on the Republic's monthly preventative maintenance program work list. The concrete drainage channel wall south of Basin B had been repaired. There were numerous items on the preventative maintenance program list to accomplish at this location. All the maintenance was completed in July of the 3rd Quarter.

M-4.3.2(50) (City)

The LCRS shall be installed at the base and side slopes of the landfill. This system shall be designed and installed to collect generated leachate for disposal consistent with LARWQCB requirements. The collection system shall consist of a filter rock blanket embedded with a system of collection pipes or a blanket embedded with a system of collection pipes or geosynthetic alternative that collects and transports the fluid to a holding tank. In accordance with RCRA, Subtitle D, 40 CFR, Part 258, the collection systems shall be designed to limit the hydraulic head on the liner to less than 12 inches. Collection pipes shall be sized and spaced to reduce the hydraulic head in the leachate collection system as specified in WDRs. Leachate shall be recovered and treated onsite. The treated leachate shall be sampled prior to discharge from the holding tank in accordance with the WDRs to determine suitability

for reuse onsite per LAWRQCB requirements. Summary results of this sampling shall be disseminated in the newsletter with more detailed reporting on the website and in the Annual Report.

<u>Current Status/Comment</u> – The old City North top deck has a tank farm of 16 Adler storage tanks for processing recovered leachate and condensate, with a double-wall pipeline to the sewer connection at the entrance near San Fernando Road. This system operated with no odors detected at the tank farm nor the sewer connection during the 3rd Quarter. Tank farm liquids were being treated with 30% hydrogen peroxide at the tank farm prior to the connection of the City of Los Angeles sewer connection. A remote shut-off safety system to close the hydrogen peroxide holding vessel's outlet valves was not installed.

M-4.4.1(60) (City)

Venturan Coastal Sage Scrub

A detailed conceptual mitigation plan shall be prepared by the project proponent and contain specific information on planting, maintenance, and monitoring. A revegetation plan that includes Coastal sage scrub restoration can feasibly occur onsite. The implementation of this plan will provide onsite mitigation greater than 1:1 to offset the loss of coastal sage scrub.

Biota - 4.27 (County)

Venturan Coastal Sage Scrub: A detailed conceptual mitigation plan shall be prepared by the permittee and shall contain specific information on planting, maintenance, and monitoring. A revegetation plan that includes coastal sage scrub restoration can feasibly occur onsite. The implementation of this plan will provide onsite mitigation greater than 1:1 to offset the loss of coastal sage scrub.

<u>Current Status/Comments</u> – During the 3rd Quarter, City sage mitigation area decks B and C were being maintained by the removal of non-native vegetation. Native vegetation was doing well. Bare spots are being filled in from seeds and spreading of prior planted native plants. The condition of the PM-10 oak trees was still being evaluated by Republic's consulting biologists. There was a substantial amount of dead and missing PM-10 trees observed by the monitor. No schedule for tree replacement has been issued. Their yearly Oak tree and Big Cone Fir mitigation status report was being prepared. There was no activity in the County sage mitigation area. Native plants were doing well in the County sage area, repopulating in the areas where they naturally came back. No grading of the hillside slopes to have benches and mitigation revegetation planting activity was done for this area in the 3rd Quarter. Areas of City decks B and C were graded for the new temporary waste hauling access roads. There appears to be minimal impacts to the sage mitigation areas.

M-4.4.3/72 (City)

Native tree species shall be replaced at a 2:1 (replacement: removal) ratio, consisting of 15-gallon or 5:1 3-gallon container trees. Mitigation trees shall be planted prior to impacted trees being removed, thus allowing trees to grow to specimen size in the field. A specimen-size tree shall be defined as a 15-gallon tree with a minimum trunk caliper of 1-inch measured 1-foot above ground. All mitigation trees shall be specimen size within 1 year after tree removal.

Biota - 4.10 (County)

The permittee shall comply with all terms and Conditions of Oak Tree Permit No. 86-312-(5). The permittee is authorized to remove oak trees within the project areas as necessary to conduct landfill operations authorized by this grant and subject to the requirements of Part VII of the Implementation and Monitoring Program attached to Oak Tree Permit 86-312-(5). Prior to approving any excavation of more than five acres containing significant stands of oak and/or Douglas fir trees, the Director of Public Works shall confer with the Los Angeles County Forester and Fire Warden.

<u>Current Status/Comments</u> – In the 3rd Quarter, Republic's biologist consultant had not yet issued an updated mitigation tree report. The number and type of trees that will need to be replaced and the schedule of planting will be addressed in their report. There are coast live oak and bigcone Douglas-fir trees that are addressed in the tree mitigation report. The PM-10 dead and missing trees are not addressed in any report.

M-4.4.2/69 (City)

Potential candidate mitigation sites have been identified by the project proponent in conjunction with resource agencies for consideration to compensate for impacts on riparian and wetland resources as a result of project development. These sites include Bull Creek, Bee Canyon and East Canyon, which are located proximate to the project site. Prior to the development of any detailed mitigation plans and drawings, the final selection will be determined cooperatively by the CDFW, Corps, SWRCB, and other regulatory agencies in conjunction with the City and project proponent.

<u>Current Status/Comments</u> – The status of providing offsite wetland and riparian mitigation has not changed in the 3rd Quarter. The City of Los Angeles was proceeding with writing and adopting an ordinance to allow the wetlands and riparian mitigation to be created in the Chatsworth Reservoir. All environmental analysis has been completed. Republic stated that there has been no progress in finalizing and adopting the ordinance. The delay in the issuance of the City ordinance is delaying any progress in creating the required wetlands and riparian mitigation. Time extension letters from the US Corps of Engineers and the California Department of Fish and Wildlife were in-place for 2019. New extension letters have not been obtained since then. The feasibility of the Chatsworth Dam mitigation site needs to be evaluated as still being a potential mitigation site.

M-4.9.3(110) (City)

Landfill employees shall watch for any illegal dumping activities on or around the project site. The landfill litter control crew shall provide cleanup services for areas within one mile of the project site. The phone number where this service will be requested will be provided in the quarterly newsletter and on the website.

<u>Current Status/Comments</u> – In the 3rd Quarter, there was no litter or illegal dumping observed in the adjacent neighborhood. There was illegal dumping on the shoulder of Sierra Highway near the I-14 overpass. There was illegal parking of junk cars (20 or more) along the roadway near a salvage company.

M-4.9.4(125) (City)

The landfill operator shall maintain perimeter fencing in and around the site in accordance with CCR, Title 14, § 17658 to discourage illegal entry to the landfill. Where existing topography conditions create an effective barrier, no perimeter fencing shall be installed. Entrance and access gates shall remain locked when the landfill facility is not in operation. All existing perimeter fencing shall be inspected on a routine basis by the landfill operator, and necessary repairs shall be made to ensure a continued deterrent for unauthorized entry to the project site. Additionally, the landfill operator shall maintain posted "no trespassing" signage at the exterior perimeter fencing nearest the project site entrance.

<u>Current Status/Comments</u> – During the 3rd Quarter, the north perimeter gate was observed to be closed but not locked.

M-4.19.2(191) (City)

Prior to the commencement of initial earth excavation, specific sections of the City/County Landfill Project area shall be resurveyed as a precautionary measure to minimize potential loss of undiscovered paleontological resources. Specific sections of the project area to be resurveyed shall be as determined by the intended cut-and-fill areas proposed for landfill development. As new areas for excavation are identified by the project proponent, an evaluation of those areas shall be made based on the prior survey results and consultation with appropriate technical specialists.

Ecological Significance 62 (County)

The Permittee shall develop and implement a program to identify and conserve all significant archaeological and paleontological materials found onsite pursuant to Part VII of the IMP. If the Permittee finds any evidence of aboriginal habitation or fossils during earthmoving activities, Landfill operations shall immediately cease in that immediate area, and the evidence and area shall be preserved until a qualified archaeologist or paleontologist, as appropriate, makes a determination as to the significance of the evidence. If the determination indicates that the archaeological or paleontological resources are significant, the resources shall be recovered to the extent practicable prior to resuming Landfill operations in that immediate area of the Landfill.

<u>Current Status/Comments</u> – During the 3rd Quarter, grading was performed in native undisturbed areas that required archeological and paleontological monitoring. Reports were not available for review.

Alternative Fuel Vehicles 77.A-H (County)

As part of its annual report to the TAC required by the IMP, the Permittee shall submit an ongoing evaluation of its compliance with each component of this Condition No. 77. The Permittee may appeal the requirements of this Condition No. 77 to the Director of the Department in accordance with the procedure described in Condition No. 11 for the appeal of a notice of Violation, but only on the bases of whether a particular alternative fuel is technologically or economically feasible.

<u>Current Status/Comments</u> – An annual report showing Compliance with each component of Condition 77 should be prepared and submitted to the TAC.

Conclusions

In this reporting period, UltraSystems has monitored the conditions and/or mitigation measures for the City and County, as shown on the Mitigation Monitoring Summary spreadsheets.

As shown by the Non-Compliant and Further Review Needed sections above, the landfill is actively working toward being fully compliant with conditions and/or mitigation measures. Non-compliant conditions were observed: M-4.1.6(18) survey monuments; M-4.4.2(69) offsite wetlands and riparian mitigation; and M-4.4.3(72) tree replacement and PM- 10 mitigation. Furthermore, monitoring of the tasks on these Mitigation Monitoring Summary spreadsheets track progress toward being fully compliant. Notwithstanding the above, air quality compliance status is not being actively monitored by UltraSystems. Review of design plans, specifications, engineering support documents, and City-approved plans were not provided for the monitor to verify compliance with all City and County CUP conditions. The CUP conditions have special and unique construction requirements that the landfill site location requires. Access to engineering data and plans being implemented, and Hydrologist and Geologist construction reports are necessary to verify compliance with City and County CUP conditions and important construction activity.

ring this quarterly period.	and

								Se	COI	nd Q	uarter	202	25			T				T	hire	d Qu	arter 2	2025	5			\neg
Line#	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
1	Project Manager																											
2																												
3																												
4	Q - A.3.		Definitions	info	/				/				/				/				/				/			
5	Q - A.6.		Submit Annual Reports	June yearly	/				/				/				/				/				/			
6	Q - A.10.		Provision of Fees	yearly	/				/				/				/				/				/			
7	Q - B.1.		Permitted/Prohibited Landfill Uses	yearly	/				/				/				/				/				/			
8	Q - B.2		Approval of Landfill	ongoing	✓	С	I-d		✓	С	I-e		✓	С	l-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
9	Q - B.2.c.		Ancillary Uses and Facilities	ongoing	✓	С	l-d		✓	С	l-e		✓	С	l-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
10			Ancillary Uses and Facilities																									
11	Q - B.2.d (3)		10 Year Phase Review	2015	✓	С	NONE																					
12			10 Year Phase Review																									
13	Q - B.4.d.		Inert/Exempt Materials	info	/				/				/				/				/				/			
14	Q - B.5.a.		Prohibited Waste	info	/				/				/				/				/				/			
15	Q - B.6.		Waste Diversion	ongoing	✓	С	NONE																					
16	Q - C.3.g.		Paved Access Roads	ongoing	✓	NC	I-d		✓	NC	I-e		✓	NC	l-f		✓	NC	I-g		✓	NC	l-h		✓	NC	l-i	
17	Q - C.3.h.		Surfacing of Access Roads	ongoing	✓	NC	l-d		✓	NC	l-e		✓	NC	l-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
18	Q - C.5.		Graffiti Removal and Deterrence	ongoing	✓	С	NONE																					
19	Q - C.10.c.		Evaluation of Beneficial Gas Usage	June yearly	✓	NC	l-d		✓	NC	l-e		✓	NC	l-f		✓	С	NONE		✓	С	NONE		✓	С	NONE	
20	Q - C.10.d. (1)		Alternative Fuel Vehicles	status																								
21	Q - C.10.d. (2)		Alternative Fuel Refuse Collection Trucks	status																								

 $[\]begin{tabular}{ll} * C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved \\ \end{tabular}$

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	eco:	nd Q	uarter	202	25							7	[hir	d Qu	arter 2	2025	5			$\overline{}$
Line#	Reference#	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
22	Q - C.12.a.		Technical Advisory Committee	info	/				/				/				/				/				/			
23	Q - C.12.c.		Contract for Mitigation Monitoring	info	/				/				/				/				/				/			
24	Q - C.12.c.		Contract for Mitigation Monitoring-5 years	info	/				/				/				/				/				/			
25																												
26	T - 4		Fire Plan	status	✓	FRN	I-d		✓	FRN	I-e		>	NC	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	NC	l-i	
27	T - 5.j.		Trip Diversion	status	✓	С	NONE		✓	С	NONE		>	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
28	T - 6		Satisfactory Street Lighting	status	/				/				/				/				/				/			
29																												
30	M - 4.1.1	7	Reabandonment Procedures	status	✓	С	l-d		✓	С	l-e		✓	С	l-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
31	M - 4.1.4	11	Post-5.0 Earthquake Analysis	upon event	✓	С	NONE		✓	С	NONE		>	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
32	M - 4.2.12	27	Heavy Equipment Operations	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
33	M - 4.2.12		Heavy Equipment Operations	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
34	M - 4.2.12	28	Site Erosion-Cover	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
35	M - 4.2.12		Site Erosion-Cell Height	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
36	M - 4.2.12		Site Erosion-Sealant	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
37	M - 4.2.13	29	LFG Control Measures	ongoing	✓	NC	l-d		✓	NC	I-e		✓	NC	l-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
38	M - 4.2.13	30	Operational Odor Control Techniques	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
39	M - 4.2.13	31	Solid Waste Compaction	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
40	M - 4.2.13	32	LFG Collection and Recovery System	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
41	M - 4.2.13	33	Odor Control Measures	ongoing	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

								Se)COI	nd Q	uarter	202	25							1	Γhir	d Qu	arter 2	2025	5			\neg
Line#	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
42	M - 4.2.13	34	Odor/LFG Monitoring	ongoing	/		l-d		/		I-e		/		l-f		/		I-g		/		l-h		/		l-i	
43			Periodic LFG Monitoring		/		l-d		/		I-e		/		I-f		/		l-g		/		l-h		/		I-i	
44	M - 4.3.2	52	LFG Migration Mitigation	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
45	M - 4.3.2	57	Dust Control Water	ongoing	✓	С	l-d		✓	С	l-e		✓	С	l-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
46	M - 4.4.2	69	Offsite Mitigation Sites	status	✓	NC	l-d		✓	NC	l-e		✓	NC	l-f		✓	NC	I-g		✓	NC	l-h		✓	NC	l-i	
47	M - 4.4.2	70	Purchasing Wetland Credit	status	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	I-i	
48	M - 4.4.2	71	Funding-Invasive Species Eradication Program	status	/				/				/				/				/				/			1
49	M - 4.6	85	Site Lighting	status	✓	NC	NONE																					
50	M - 4.7.1	86	Open Space Buffer Area	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
51	M - 4.9.3	106	Litter Minimization	ongoing	✓	С	NONE		✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
52	M - 4.9.3	107	Litter/Debris Containment	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	I-i	
53	M - 4.9.3	108	Vehicle Tarping Requirements	ongoing	✓	С	NONE																					
54	M - 4.9.3	109	Periodic Offsite Litter Pickup	ongoing	✓	С	NONE																					
55	M - 4.9.3	110	Illegal Dumping Activities	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
56	M - 4.9.3	111	Radio Dispatch Litter Control	ongoing	✓	С	NONE																					
57	M - 4.9.3	112	Litter Control	ongoing	✓	FRN	I-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
58	M - 4.9.5	127	Address Concerns of Citizens' Advisory Committee	ongoing	/				/				/				/				/				/			
59	M - 4.9.6	128	Landfill Gas/Collection System-Unsafe Methane Levels Monitoring	ongoing	✓	С	NONE																					
60	M - 4.9.6	129	Landfill Gas/Collection System- Detection/Training	ongoing	✓	С	NONE																					
61	M - 4.9.6	130	Landfill Gas/Collection System-Risk Mitigation	ongoing	✓	С	NONE																					

 $[\]begin{tabular}{ll} * C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved \\ \end{tabular}$

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Sc	ecol	nd Q	uarter	202	25							7	Γhir	d Qu	arter 2	202	5			\neg
Line#	Reference#	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
62	M - 4.16.4	176	Reclaimed Water	status	/				/				/				/				/				/			
63 64	M - 4.16.4	177	Water Conservation	ongoing	✓	С	NONE																					
	Civil & Geotechnical E	ngineer																										
66																												
67	M - 4.1.1	2	Grading Outside of Conceptual Grading Plan Area	ongoing	✓	С	l-d		√	С	l-e		✓	С	l-f		6	С	l-g		√	С	l-h		√	С	l-i	
69	M - 4.1.1	3	Unsuitable Material Removal/Buffer Zones	ongoing																								
70	M - 4.1.1	4	Grading Outside of Landfill Footprint	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
71	M - 4.1.1	5	Grading Activity Compliance	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	l-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
72	M - 4.1.2	8	Landslide Guidelines	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
73	M - 4.1.2	9	Soil Stabilization	ongoing																								
74	M - 4.1.4	10	Landfill Design	ongoing																								
75	M - 4.1.4	11	Earthquake Operations Checklist	upon event	✓	С	NONE																					
76	M - 4.1.5	12	Geologic Hazards - Liquefaction	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
77	M - 4.1.5	13	Design/Construction-Liquefaction	ongoing		_																						
78	M - 4.1.5	14	Design/Construction-Containment Structures	ongoing																								
79	M - 4.1.6	15	Refuse Slope Gradients	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		С	l-g		✓	С	l-h		✓	С	l-i	l-i	
80	M - 4.1.6	16	Cut and Fill Slope Gradients	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		С	I-g		✓	С	l-h		✓	С	l-i	l-i	
81	M - 4.1.6	17	Final Slope Factors of Safety	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
82	M - 4.1.6	18	Survey Monuments	ongoing	✓	NC	l-d		✓	NC	l-e		✓	NC	l-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
83	M - 4.3.2	47	Landfill Liner	ongoing																								

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	COI	nd Q	uarter	202	25							7	[hir	d Qu	arter 2	202	5			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
84	M - 4.3.2	48	Landfill Liner	ongoing																								
85	M - 4.3.2	54	Preliminary Closure/Postclosure Plan	status																								
86	M - 4.3.2	55	Landfill Design/Operation/Final Closure Monitoring	status																								
87	M - 4.3.2	56	Cover Application	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
88	M - 4.14.1	155	Access Roadway Grade	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		С	I-g		✓	С	l-h		✓	С	l-i	l-i	
89	M - 4.18	178	Landfill Elevation Exceedance	ongoing	✓	С	l-d		✓	С	I-e		✓	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
90																												
91	Hydrologist																											
92																												
93																												
94	M - 4.1.4	11	Earthquake Operations Checklist	upon event	✓	С	NONE																					
95	M - 4.3.1	36	Surface Water Infiltration Minimization	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
96	M - 4.3.1	37	Surface Drainage Systems	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
97	M - 4.3.1	38	Permanent/Temporary Ditches	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
98	M - 4.3.1	39	Drainage Protection	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
99	M - 4.3.1	40	SWRCB Permit Coverage	ongoing	✓	С	l-d		✓	С	l-e		✓	С	l-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
100	M - 4.3.1	41	Surface Water Collection System	ongoing																								
101	M - 4.3.1	42	Surface Water Quality Monitoring	ongoing																								
102	M - 4.3.1	43	Sediment Basin Maintenance	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
103	M - 4.3.1	44	Final Landfill Cover	ongoing																								
104	M - 4.3.1	45	Erosion Control Plan	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
105	M - 4.3.1	46	Preventive Maintenance Program	ongoing	✓	NC	l-d		✓	NC	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	NC	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	ecol	nd Q	uarter	202	25							7	hir	d Qu	arter 2	202	5			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
106	M - 4.3.2	49	Interception of Groundwater Seepage	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
107	M - 4.3.2	50	LCRS/Leachate Monitoring	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
108	M - 4.3.2	51	LCRS Monitoring	ongoing																								
109																												Н
110	Biologist																											l
111																												
112																												
113	M - 4.1.1	6	Slope Erosion Control	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
114	M - 4.2.11	23	Revegetation/Excavation	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
115	M - 4.2.12		Temporary Vegetation Cover	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	I-i	
116	M - 4.4.1	60	Coastal Sage Scrub Mitigation Plan	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	I-i	
117	M - 4.4.1	61	Coastal Sage Scrub Seeding	ongoing																								
118	M - 4.4.1	62	Mariposa Lily Mitigation Plan	ongoing	✓	С	l-d		✓	С	I-e		✓	С	l-f		✓	С	l-g		✓	С	l-h		✓	С	I-i	
119	M - 4.4.1	63	San Diego Horned Lizard Mitigation	ongoing	✓	С	I-d		✓	С	<u>-</u> e		\	С	l-f		✓	С	l-g		✓	О	l-h		✓	С	l-i	
120	M - 4.4.1	64	California Gnatcatcher Surveys	ongoing	/				/				/				/				/				/			
121	M - 4.4.1	65	Least Bell's Vireo Surveys	ongoing	/				/				/				/				/				/			
122	M - 4.4.1	66	Western Burrowing Owl Surveys	ongoing	/				/				/				/				/				/			
123	M - 4.4.1	67	Migratory Bird Treaty Act	ongoing	/				/				/				/				/				/			
124	M - 4.4.1	68	Raptor Nests Habitat	ongoing	/				/				/				/				/				/			
125	M - 4.4.3	72	Native Tree Mitigation	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
126	M - 4.4.3	73	Nonnative Tree Mitigation	status	✓	С	NONE																					
127	M - 4.4.3	74	Mitigation Tree Planting	ongoing	✓	С	NONE																					

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	eco:	nd Q	uarter	202	25							T	hir	d Qu	arter 2	202	5			\neg
Line #	Reference#	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
128	M - 4.4.3	75	Tree Planting Mitigation Site Prep	ongoing	✓	С	NONE																					
129	M - 4.4.3	76	Poultry Wire Screen	ongoing	✓	С	NONE																					
130	M - 4.4.3	77	Backfill Material	ongoing	✓	С	NONE		✓	С	NONE	Ш																
131	M - 4.4.3	78	Tree Planting Procedure	ongoing	✓	С	NONE																					
132	M - 4.4.3	79	Tree Area Mulching	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
133	M - 4.4.3	80	Tree Irrigation/Fertilization	ongoing	✓	С	NONE																					
134	M - 4.4.3	81	Irrigation System	ongoing	✓	С	NONE																					
135	M - 4.4.3	82	Annual Tree Monitoring Report	annual	✓	NC	I-d		✓	NC	l-e		✓	NC	I-f		✓	NC	I-g		✓	NC	l-h		✓	NC	l-i	
136	M - 4.9.2	96	Vector Activity Monitoring	ongoing	✓	FRN	I-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
137	M - 4.9.2	97	Vector Elimination	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	C	NONE		✓	С	NONE	
138	M - 4.9.2	98	Fly Control	ongoing																								
139	M - 4.9.2	99	Rodent Control	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
140	M - 4.9.2	100	Operational Vector-Limiting Activity	ongoing																								
141	M - 4.9.2	101	Equipment Cleanliness/Maintenance	ongoing	✓	C	NONE		✓	С	NONE																	
142	M - 4.9.2	102	Storage of Vector-Attracting Items	ongoing																								
143	M - 4.9.2	103	Salvaged Material Storage-Vector Control	ongoing	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	
144	M - 4.9.2	104	Periodic Vector Inspections	ongoing																								
145	M - 4.9.2	105	Implementation of Vector Control Measures	ongoing																								
146																												
147	Air Quality & Noise Sp	ecialist																										
148																												
149																												

 $[\]begin{tabular}{ll} * C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved \\ \end{tabular}$

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	COI	nd Q	uarter	202	25							1	Γhir	d Qu	arter	202	5			$\overline{}$
Line#	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
150	M - 4.2.11	19	Emissions Mitigation Measures	ongoing	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE													
151	M - 4.2.11	19	Construction Curtailing due to Pollution	ongoing	/	NA	NONE																					
152	M - 4.2.11	20	Dust Lofting Minimization	ongoing																							<u> </u>	
153	M - 4.2.11	21	Wind Speed Monitoring	ongoing	✓	С	NONE																					
154	M - 4.2.11	22	Grading-Dust Reduction	ongoing	✓	С	NONE																					
155	M - 4.2.12	24	Construction Equipment Maintenance	ongoing	✓	С	NONE																					
156	M - 4.2.12		Construction Curtailing due to Pollution	ongoing	/	NA	NONE																					
157	M - 4.2.12	25	Refuse Trucks-Maintenance	ongoing																								
158	M - 4.2.12		Refuse Trucks-Engine	ongoing																								
159	M - 4.2.12		Refuse Trucks-Fee Schedule	ongoing																								
160	M - 4.2.12		Refuse Trucks-Fee Schedule Delivery Time	ongoing																								
161	M - 4.2.12		Refuse Trucks-Idling	ongoing																								
162	M - 4.2.12		Refuse Trucks-Emissions	ongoing																								
163	M - 4.2.12	26	Truck Travel and Fugitive Dust Emissions	ongoing	✓	NC	l-d		✓	NC	l-e		✓	NC	I-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
164	M - 4.2.12		Truck Travel and Fugitive Dust Emissions	ongoing																								
165	M - 4.2.12		Truck Travel and Fugitive Dust Emissions	ongoing																								
166	M - 4.2.12		Truck Travel and Fugitive Dust Emissions	ongoing																								
167	M - 4.5.2	83	Landfill Hours	info	/				/				/				/				/				/			
168	M - 4.5.2	84	Landfill Equipment-Noise Reduction	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE													
169																												$\vdash \vdash$
170	Hydrology, Hazardous	s Waste /	Risk of Upset																									

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	COI	nd Q	uarter	202	25							7	Chir	d Qu	arter 2	2025	5			
Line #	Reference#	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
171																												
172																												
173	M - 4.3.2	53	Groundwater Monitoring Wells	ongoing													✓	С	NONE		✓	С	NONE		✓	С	NONE	Ш
174	M - 4.3.2	58	Operation as Class III Landfill	ongoing	✓	С	NONE		✓	С	NONE	Ш																
175	M - 4.3.2	59	Underground Fuel Storage	ongoing	/	NA	NONE																					
176	M - 4.9.1	90	Refuse Inspection Program	ongoing																								Ш
177	M - 4.9.1	91	Hazardous Waste Load-Checking	status																								Ш
178	M - 4.9.1	93	Hazardous Waste Detection Training	status																								
179	M - 4.9.1	94	Spill Response Program	status	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	I-i	
180	M - 4.9.4	115	Safety Inspections/Checklists	ongoing																								
181	M - 4.9.4	118	Accident/Injury reports, Inspections	status																								Ш
182	M - 4.9.4	121	Fire Prevention Plan	ongoing	✓	FRN	NONE																					
183	M - 4.9.4	123	Personal Protective Equipment	ongoing																								
184	M - 4.9.4	125	Site Access/Fencing	ongoing	✓	С	NONE		✓	С	NONE		✓	FRN	I-f		✓	С	NONE		✓	С	NONE		✓	FRN	I-i	Ш
185	M - 4.14.1	147	Fire Response Capabilities	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	I-i	
186	M - 4.14.1	148	Hydrant Installation	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	I-i	
187																												
188	Archaeologist																											
189																												
190																												
191	M - 4.19.1	183	Archaeological Resurvey	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
192	M - 4.19.1	184	Onsite Archaeologist	ongoing	✓	С	NONE																					
193	M - 4.19.1	185	Archaeological Resources	ongoing	/	NA	NONE																					

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	COI	nd Q	uarter	202	25							٦	Γhir	d Qu	arter 2	2025	5			
Line#	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
194	M - 4.19.1	186	Archaeological Resources	ongoing	/	NA	NONE																					
195																												
196	Paleontologist																											
197																												
198																												
199	M - 4.19.2	187	Paleontological Resources Resurvey	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
200	M - 4.19.2	188	Paleontological Resources Excavation	ongoing	/	NA	NONE																					
201	M - 4.19.2	189	Paleontological Resources Training	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE													
202	M - 4.19.2	190	Paleontological Resources Recovery	ongoing																								
203	M - 4.19.2	191	Paleontological Resources Inspection	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

					C NONE C NONE								Third Quarter 2025															
Line #	Reference#	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Keview Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
1	Project Manager																										 	
2																												
3																												
4	Amendment 45.N - 1	45N	Daily Cover Materials	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	C N	IONE		✓	С	NONE		✓	С	NONE	
5	Amendment 45.N - 3	45N	Daily Cover Procedure	ongoing	✓	С	NONE		~	С	NONE		~	С	NONE		✓	CN	IONE		✓	С	NONE		✓	С	NONE	
6	Amendment 45.N - 4.a	45N	Order for Abatement Status	ongoing	/		l-d		/		l-e		/		I-f		/		l-g		/		l-h		/		l-i	
7	Amendment 45.N - 4.c	45N	Odor Patrol Program	ongoing	/		l-d		/		l-e		/		I-f		/		l-g		/		l-h		/		l-i	
8	Amendment 45.N - 4.d	45N	Landfill Gas Mitigation Plan	ongoing	/		l-d		/		l-e		/		I-f		/		l-g		/		l-h		/		l-i	
9	Amendment 45.N - 5	45N	Dust and Odor Reports	ongoing	✓	FRN	l-d		>	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
10																												
11	Combined Site & Bridge Area -20.A	20.A	Joint Powers Authority	info	~	FRN	l-d		>	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	ij	
12	Combined Site & Bridge Area -20.F	20.F	Mitigation Reporting and Monitoring Program Amendment	status	/				/				/				/				/				/			
13	Landfill Capacity - 27	27	Tipping Fees for Partial Loads/Peak Hours	status																								
14	Grading & Drainage-41.AD	41A-D	Water Conservation	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
15	Revegetation - 44.F	44.F	Revegetation	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
16	Fugitive Dust - 45.B	45.B	Working Face Areas	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	C N	IONE		✓	С	NONE		✓	С	NONE	
17	Fugitive Dust - 45.F	45.F	Inactive Areas Monitoring	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
18	Fugitive Dust - 45.I	45.I	Cleaning of Roads	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	C N	IONE		✓	С	NONE		✓	С	NONE	
19	Litter Control - 46.AD	46A-D	Litter Control Program	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
20	Gas - 52	52	Landfill Gas Collection System	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
21	Traffic - 57	57	Traffic Improvements	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
22	Traffic - 60	60	Street Light Installation	status	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	C N	IONE		✓	С	NONE		✓	С	NONE	
23	Traffic - 61	61	Traffic Minimization	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
24	Permittee Fees - 64 - 72	64-72	Permittee Fees	info	/				/				/				/				/				/			

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

																			Thire	d Qu	arter 2	2025	}			\neg		
Line#	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
25	Permittee Fees - 69	69	Permittee Fees-Contributions	info	/				/				/				/				/				/			
26	Permittee Fees - 70	70	Permittee Fees	info	/				/				/				/				/				/			
27	Permittee Fees - 72	72	Permittee Fees	info	/				/				/				/				/				/			
28	Alternative Fuel Vehicles - 77.A	77.A	Alternative Fuel Vehicles-Light Duty	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
29	Alternative Fuel Vehicles - 77.B	77.B	Alternative Fuel Vehicles-Refuse/Collection Trucks	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
30	Alternative Fuel Vehicles - 77.C	77.C	Alternative Fuel Vehicles-Report	status																								
31	Alternative Fuel Vehicles - 77.D	77.D	Alternative Fuel Vehicles-heavy-duty, alternative fuel off-road equipment pilot program	status																								
32	Alternative Fuel Vehicles - 77.E	77.E	Alternative Fuel Vehicles-Non-diesel Requirements	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
33	Alternative Fuel Vehicles - 77.F	77.F	Alternative Fuel Vehicles-Non-diesel Truck Trip Requirements	status	✓	FRN	l-d		√	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		√	FRN	l-i	
34	Alternative Fuel Vehicles - 77.G	77.G	Alternative Fuel Vehicles-Clean Fuel Demo Program	status																								
35	Alternative Fuel Vehicles - 77.H	77.H	Alternative Fuel Vehicles-Compliance Evaluation	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
36	Air Quality Monitoring - 81	81	Air Quality Monitoring-Testing	ongoing	/				/				/				/				/				/			
37			Air Quality Monitoring-Testing																									
38	IMP - Part I.A	IMP1	Air Quality Monitoring-Testing	ongoing	/				/				/				/				/				/			
39			Air Quality Monitoring-Testing																									
40	IMP - Part VI	IMP6	Air Quality Monitoring-Testing	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
41																												
42	MMRS-12/01/06		Mitigation Monitoring and Reporting Summary	info	/				/				/				/				/				/			
43			Permits																									
44	Geology - 1.15		Permittee's On-site Solid Waste Recovery and Recycling Program	status	/				/				/				/				/				/			
45	Surface Water - 2.09		SWRCB Permit Coverage	ongoing	~	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
46	Surface Water - 2.15		Surface Water Preventive Maintenance Program	ongoing	✓	NC	l-d		√	NC	l-e		~	NC	l-f		~	NC	I-g		✓	NC	l-h		~	NC	l-i	
47	Groundwater - 3.13		Groundwater-LFG Migration Mitigation	ongoing	✓	С	l-d		✓	С	l-e		✓	С	l-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

					Status FRN I-d FRN I-e FRN I-f									Third Quarter 2025														
Line#	Reference#	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
48	Groundwater - 3.14		Groundwater-Monitoring Wells	ongoing	✓	FRN	l-d		>	FRN	l-e		>	FRN	l-f		>	FRN	l-g		✓	FRN	l-h		>	FRN	l-i	
49	BIOTA – 4.05		Annual Fee Submission for SEA Studies	status	/				/				/				/				/				/			
50	BIOTA – 4.06		Buffer Zone Maintenance as Nature Preserve	ongoing	√	FRN	l-d		√	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
51	BIOTA – 4.07		Buffer Zone Maintenance-Vegetation	ongoing	✓	С	l-d		✓	С	l-e		✓	С	l-f		~	С	I-g		✓	С	l-h		✓	С	l-i	
52	BIOTA – 4.08		Ridgeline Maintenance-Remain Undisturbed	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
53	BIOTA – 4.47		Cleaning of Equipment	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
54	BIOTA – 4.48		Monitoring of Vector-Attracting Items	ongoing																								
55	BIOTA – 4.49		Salvaged Material Storage-Vector Control	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
56	BIOTA – 4.50		Vector Activity Monitoring	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
57	Air Quality - 6.03		Dust Emission Minimization	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
58	Air Quality - 6.04		Usage of Cut Material for Cover	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		~	С	NONE	
59	Air Quality - 6.05		Operations in Accordance with SCAQMD/DOPW Requirements	info	/				/				/				/				/				/			
60	Air Quality - 6.06		Landfill Gas Control/Extraction System/Monitoring	ongoing	/				/				/				/				/				/			
61	Air Quality - 6.07		Flaring Systems	info	/				/				/				/				/				/			
62	Air Quality - 6.08		Management of Truck Arrivals	ongoing																								
63	Air Quality - 6.10		Refuse Truck Mitigation	status																								
64	Air Quality - 6.11		Light Duty Alternative Fuel Vehicles	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
65	Air Quality - 6.11		Alternative Fuel Refuse Collection/Transfer Trucks	status																								
66	Air Quality - 6.11		Alternative Fuel Vehicle Report Submission	status																								
67	Air Quality - 6.11		Heavy-duty, Alternative Fuel Off-Road Equipment Pilot Program	status																								
68	Air Quality - 6.11		Non-Diesel, Alternative Fuel Vehicles- Transfer/Collection Trucks	status																								
69	Air Quality - 6.11		Non-Diesel, Alternative Fuel Vehicles Truck Trips	status																								
70	Air Quality - 6.11		Clean Fuel Demonstration Program	status																								

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

					FRN I-d FRN I-e FRN I-f FRN															Thir	d Qu	arter 2	2025	;				
Line #	Reference#	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	8/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
71	Air Quality - 6.11		Compliance Evaluation	status																								
72	Odor/Landfill Gas – 7.01		Landfill Gas Escape Prevention	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
73	Odor/Landfill Gas – 7.02		Landfill Gas Collection System	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
74	Odor/Landfill Gas – 7.04		Gas Collection/Flare System Risk Mitigation	ongoing																								
75	Odor/Landfill Gas – 7.05		Wellhead Awareness	status	~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
76	Odor/Landfill Gas – 7.06		Odor Control Measures	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
77	Odor/Landfill Gas – 7.07		Gas Recovery and Sale	status	✓	NC	l-d		✓	NC	l-e		✓	NC	l-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
78	Traffic/Circulation – 8.03		Street Light Installation	status	✓	С	l-d		✓	С	l-e		✓	С	l-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
79	Traffic/Circulation – 8.04		Truck Traffic Minimization	status																								
80	Traffic/Circulation – 8.08		Tipping Fees for Partial Loads/Peak Hours	status																								
81	Traffic/Circulation – 8.10		Nighttime Landfill Operations Feasibility	status	/				/				/				/				/				/			
82	Traffic/Circulation – 8.11		Parking Management along San Fernando Road	status	/				/				/				/				/				/			
83	Traffic/Circulation – 8.13		Adequate Queuing	status																								
84	Visual – 10.03		Landfill Flare Locations	status	/				/				/				/				/				/			
85	Visual – 10.04		Confinement of Excavation Cover Material	status																								
86	Visual – 10.05		Lighting Requirements	status	✓	NC	l-d		✓	NC	l-e		✓	NC	I-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
87	Visual – 10.11		Litter Control Program	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
88	Visual – 10.11		Solid Waste Load Procedures-Improperly Covered/Contained	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		~	С	NONE	
89	Visual – 10.11		Debris Removal at Entrance	ongoing	✓	FRN	l-d		√	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
90	Visual – 10.11		Litter Control-Fencing	ongoing	✓	FRN	С		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	С		✓	FRN	l-h		✓	FRN	l-i	
91	Visual – 10.11		Periodic Litter Pickup	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
92	Visual – 10.11		Litter Control-Additional Measures	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
93	Visual – 10.12		Discharge Control/Litter Recovery	status																								

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

					ing										Third Quarter 2025													
Line #	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	8/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
94	Water Conserv 11.01		Water Conservation	ongoing	✓	FRN	l-d		~	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
95	Recycling - 14.01		On-site Waste Diversion/Recycling	ongoing	✓	С	NONE		✓	С	NONE		√	О	NONE		✓	С	NONE		✓	С	NONE		<	С	NONE	
96	Recycling - 14.03		Tonnage Disposal Determination	info	/				/				/				/				/				/			
97	Recycling - 14.04		Recycling-Various Tasks	info	/				/				/				/				/				/			
98			Clean Dirt Procedures																									
99	Site - 15.11		Reclaimed Water Utilization	status	/				/				/				/				/				/			
100	Site - 15.12		Water Conservation Measures	ongoing	✓	FRN	l-d		>	FRN	l-e		>	FRN	l-f		>	FRN	l-g		✓	FRN	l-h		~	FRN	l-i	
101	Admin Rpts/Pgms - 17.4		Operation Compliance	info	/				/				/				/				/				/			
102	Admin Rpts/Pgms -17.10		Fill Sequencing Plans	status																								
103	Admin Rpts/Pgms-17.15		Quarterly Newsletter	status	✓	FRN	NONE		>	FRN	NONE		>	FRN	NONE		>	FRN	NONE		✓	FRN	NONE		~	FRN	NONE	
	Landfill Operation - 18.7		Graffiti Removal/Deterrent Plan	ongoing	~	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
122	Chill 9 Control puised Frances																									\vdash		
	Civil & Geotechnical Engineer																											
124 125																												
	Revegetation - 44.C	44.C	Cut Slope Requirements	ongoing	√	FRN	l-d		√	FRN	l-e		√	FRN	l-f		√	FRN	l-g		√	FRN	l-h		√	FRN	l-i	
127			out didpo requirements																									
128	Geology - 1.01		Survey Monument Locations	ongoing	√	NC	l-d		√	NC	l-e		√	NC	l-f		1	NC	l-g		√	NC	l-h		✓	NC	l-i	
129	Geology - 1.02		Seismic Design	ongoing																								
130	Geology - 1.03		Maximum Refuse Slope Gradients	ongoing	✓	FRN	l-d		√	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
131	Geology - 1.04		Maximum Refuse Slope Gradients	ongoing	✓	FRN	I-d		√	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
132	Geology - 1.05		Unsuitable Material Procedures	ongoing																								
133	Geology - 1.06		Grading Activities Procedures	ongoing	√	FRN	l-d		1	FRN	l-e		√	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
134	Geology - 1.07		Grading Activities Procedures	ongoing	✓	FRN	l-d		~	FRN	l-e		~	FRN	l-f		~	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
135	Geology - 1.09		Outer Perimeter Ridgeline Requirements	info	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	econ	nd Q	uarter	202	5							-	Thir	d Qu	arter 2	:025	,			\neg
Line#	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
136	Geology - 1.12		Soil Stabilization	ongoing	✓	FRN	I-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
137	Geology - 1.16		Checklists/Surveys Following Earthquake	upon event	✓	NA	NONE		~	NA	NONE		✓	NA	NONE		✓	NA	NONE		✓	NA	NONE		~	NA	NONE	
138	Geology - 1.18		Alluvium-Removal/Replacement	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
139	Geology - 1.19		Landfill Design/Construction	ongoing																								
140	Geology - 1.20		Landfill Design/Construction-Foundations	ongoing																								
141	Surface Water - 2.03		Surface Drainage Control Facilities	ongoing	✓	FRN	I-d		<	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		<	FRN	l-i	
142	Surface Water - 2.05		Underdrain Requirements	ongoing	~	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		~	FRN	l-h		✓	FRN	l-i	
143	Surface Water - 2.06		Final Cover for Surface Water Runoff Control	ongoing																								
144	Groundwater - 3.02		Liner System Requirements	ongoing																								
145	Groundwater - 3.04		Onsite Inspector for Liner Installation	ongoing																								
146	Groundwater - 3.09		Alluvium Removal	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
147	Visual – 10.01		Landfill Elevations	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		~	FRN	l-h		✓	FRN	l-i	
	Visual – 10.02		Final Fill Elevations	ongoing	~	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		~	FRN	l-h		✓	FRN	l-i	
149	Hardrada viet																									$\vdash \vdash$		\dashv
151	Hydrologist																											
152																												
153	Grading & Drainage - 38	38	Installation of Drainage Structures	ongoing																								
154																												
155	Geology - 1.17		Landfill Design/Construction-Seismic	ongoing																								\neg
156	Surface Water - 2.01		Surface Water Runoff Interception	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
157	Surface Water - 2.02		Surface Water Runoff Collection	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
158	Surface Water - 2.03		Surface Drainage Control-Maintenance	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
159	Surface Water - 2-04		Sedimentation Basin Capabilities	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		~	FRN	l-h		✓	FRN	l-i	
160	Surface Water - 2.05		Underdrain Placement	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	ecor	nd Q	uarter	202	:5							-	Thir	d Qu	arter 2	2025	}			\neg
Line#	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
161	Surface Water - 2.07		Drainage Control System Design Approval	ongoing	✓	FRN	l-d		~	FRN	l-e		✓	FRN	I-f		~	FRN	l-g		✓	FRN	l-h		~	FRN	I-i	
162	Surface Water - 2.08		Surface Water Runoff-Drainage System	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		√	FRN	l-i	
163	Surface Water - 2.10		Surface Water Collection System-Monitoring	ongoing	~	FRN	l-d		√	FRN	l-e		~	FRN	I-f		✓	FRN	l-g		>	FRN	l-h		~	FRN	l-i	
164	Surface Water - 2.11		Surface Water Quality-Collection/Monitoring	ongoing																								
165	Surface Water - 2.12		Permanent/Temporary Drainage Facilities	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
166	Surface Water - 2.13		Permanent/Temporary Drainage Facilities	ongoing																								
167	Surface Water - 2.14		Erosion Control Plan	ongoing	✓	FRN	l-d		~	FRN	l-e		✓	FRN	I-f		~	FRN	l-g		✓	FRN	l-h		~	FRN	I-i	
168	Groundwater - 3.03		Interception of Groundwater Seepage	ongoing																								
	Groundwater - 3.06		Monitoring Wells	ongoing																								
170																												
	Biologist																											
172																												
173	Revegetation - 44	44	December 100 and December 100 and 100	ongoing																								
\vdash	Revegetation - 44.A	44.A	Revegetation/Cover Requirements	ongoing	_	FRN	l-d		_	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		√	FRN	I-h		·	FRN	l-i	
	Revegetation - 44.B	44.A 44.B	Temporary Hydroseed Vegetation Interim Reclamation/Revegetation Plan-Sold	ongoing		I IXIN	I-u		,	I IXIN	1-6			TIXIN	1-1		<u> </u>	TIXIN	1-y			TIXIN	1-11			TIXIN	1-1	\vdash
177	Revegetation - 44.D	44.D	Waste Final Fill Slope Requirements	ongoing	✓	FRN	l-d		√	FRN	l-e		√	FRN	I-f		✓	FRN	I-g		√	FRN	I-h		√	FRN	l-i	
178	Revegetation - 44.E	44.E		ongoing																								
179																												
180	Geology - 1.13		Drainage Plan Approval	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		√	FRN	l-h		✓	FRN	l-i	
181	Geology - 1.14		Personnel Retention for Monitoring Soil Erosion	ongoing	✓	С	l-d		✓	С	l-e		√	С	I-f		✓	С	l-g		√	С	l-h		✓	С	l-i	
182	Groundwater - 3.11		Irrigation/Revegetation Management- Personnel Retention	ongoing																								
183	BIOTA – 4.10		Oak Tree Permit	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
184	BIOTA – 4.11		Oak Tree Mitigation Plan	ongoing	~	FRN	l-d		✓	FRN	l-e		√	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
185	BIOTA – 4.13		Oak Tree Mitigation Counting	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	ecol	nd Q	uarter	202	5							T	hird	Qua	arter 2	2025	;			
Line#	Reference#	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Kesolved	0707(01)	Status* Further Review	Needed/Comments**	Kesolved	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
186	BIOTA – 4.20		Poultry Wire Screen	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
187	BIOTA – 4.24		Drip Irrigation	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
188	BIOTA – 4.27		Coastal Sage Scrub Mitigation Plan	ongoing	✓	FRN	I-d		✓	FRN	l-e		✓	FRN	I-f		/ F	RN I-	9		✓	FRN	l-h		✓	FRN	l-i	
189	BIOTA – 4.28		Coastal Sage Scrub Seeding	ongoing																								
190	BIOTA – 4.29		San Diego Horned Lizard Mitigation	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
191	BIOTA – 4.30		California Gnatcatcher Surveys	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
192	BIOTA – 4.31		Least Bell's Vireo Surveys	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
193	BIOTA – 4.32		Western Burrowing Owl Surveys	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
194	BIOTA – 4.33		Migratory Bird Treaty Act	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
195	BIOTA – 4.34		Raptor Nests Habitat	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
196	BIOTA – 4.36		Personnel Retention for Monitoring Revegetation Plan	ongoing																								
197	BIOTA – 4.37		Personnel Retention for Monitoring Revegetation Plan, Onsite Plants	status																								
198	BIOTA – 4.38		Green Waste Material	ongoing																								
199	BIOTA – 4.39		Revegetation of Slopes/Fill Areas	ongoing																								
200	BIOTA – 4.41		Revegetation Plan-Replacement Cover	ongoing																								
201	BIOTA – 4.42		Interim Vegetation	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		/ F	RN I-	9		✓	FRN	l-h		✓	FRN	l-i	
202	BIOTA – 4.43		Replacement Riparian Habitat	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		/ F	RN I-	9		✓	FRN	l-h		✓	FRN	l-i	
203	Air Quality - 6.02		Dust Control	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		/	C I-	9		✓	С	l-h		✓	С	l-i	
204	Visual – 10.06		Upper Ridge Planting/Revegetation	ongoing																								
205	Visual – 10.07		Tree Planting Around Perimeter	ongoing	✓	FRN	I-d		✓	FRN	l-e		✓	FRN	l-f		/ F	RN I-	3		✓	FRN	l-h		✓	FRN	l-i	
206	Visual – 10.08		Cover/Revegetation Requirements	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		⁄ F	RN I-	9		✓	FRN	l-h		✓	FRN	l-i	
207	Visual – 10.08		Solid Waste Disposal Procedures	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		/	C NO	NE		✓	С	NONE		✓	С	NONE	
208	Visual – 10.08		Final Cut Slope Steepness	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		/ F	RN I-	9		✓	FRN	l-h		✓	FRN	l-i	
209	Visual – 10.08		Final Fill Slopes-Reclamation/Revegetation	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		/ F	RN I-	9		√	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	ecor	nd Q	uarter	202	:5							-	Thir	d Qu	arter 2	2025	}			
Line#	Reference#	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
210	Visual – 10.08		Revegetation Requirements	status	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
211	Visual – 10.09		Final Cover Composition Requirements	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		>	FRN	l-g		>	FRN	l-h		~	FRN	l-i	
212	Visual – 10.10		Buffer Zone Maintenance	ongoing	✓	FRN	l-d		~	FRN	l-e		~	FRN	l-f		✓	FRN	l-g		~	FRN	l-h		✓	FRN	l-i	
213	Water Conservation - 11.02		Plant Species	ongoing																								
	Fire Service - 12.01		Brush Clearance Measures	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
215																												\vdash
	Air Quality & Noise Specialist																											
217																												
218																												\blacksquare
219	Fugitive Dust - 45.F	45.F	Fugitive Dust Monitoring	ongoing	~	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	Ш
220	Fugitive Dust - 45.I	45.I	Paved Roads-Cleaning	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	Ш
221	Fugitive Dust - 45.N	45.N	Report Submission-Dust/Odor	every quarter																								1
222	Air Quality Monitoring - 81	81	Air Quality Monitoring-Tests	ongoing																								
223																												
224																												
225	Air Quality – 6.01		Fugitive Dust Aversion	ongoing	√	FRN	l-d		✓	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		√	FRN	l-h		✓	FRN	l-i	
226	Air Quality – 6.01		Working Face Requirements	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
227	Air Quality – 6.01		Erosion Control-Daily Cover	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
228	Air Quality – 6.01		Soil Stockpile Requirements	ongoing	✓	С	NONE		✓	С	NONE		√	С	NONE		~	С	NONE		~	С	NONE		~	С	NONE	
229	Air Quality – 6.01		Active Area Fill	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		~	С	NONE		~	С	NONE		~	С	NONE	
230	Air Quality – 6.01		Soil Sealant	ongoing																								
231	Air Quality – 6.01		Dust Emissions-Road Maintenance	ongoing	✓	С	l-d		✓	С	l-e		✓	С	l-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
232	Air Quality – 6.01		Access Roads-Paving	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
233	Air Quality – 6.01		Dust Generation-Dumping	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		~	С	NONE		✓	С	NONE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	ecor	ıd Q	uarter	202	:5							-	Third	i Qu	arter 2	2025	}			
Line#	Reference#	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
234	Air Quality – 6.01		Water Tanks/Piping Maintenance	ongoing	✓	С	NONE																					
235	Air Quality – 6.01		Wind Speed Monitoring	ongoing	✓	С	NONE		✓	С	NONE		~	С	NONE													
236	Air Quality – 6.01		Report Submission-Dust/Odor	every quarter	/				/				/				/				/				/			
237	Odor/Landfill Gas – 7.03		Odor/Landfill Gas Monitoring Program	ongoing	/				/				/				/				/				/			
238	Odor/Landfill Gas - 7.03		Landfill Surface Sampling	ongoing	/				/				/				/				/				/			
239	Odor/Landfill Gas – 7.03		Landfill Perimeter Air Samples	ongoing	/				/				/				/				/				/			
240	Odor/Landfill Gas – 7.03		Landfill Surface Monitoring	ongoing	/				/				/				/				/				/			
241	Odor/Landfill Gas – 7.03		LFG Collection System Monitoring	ongoing	/				/				/				/				/				/			
242	Noise – 9.01		Landfill Access/Operation	info	/				/				/				/				/				/			
243	Noise – 9.03		Landfill Equipment-Mufflers/Silencers	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		√	С	NONE	
244	Admin Rpts/ Pgms-17.16		Air Quality Monitoring-Corrective Action Plan	ongoing	/				/				/				/				/				/			
246	Ibodustano Harandana Wasta / Dist	-£114														-												\dashv
	Hydrology, Hazardous Waste / Risk	or upset														4												
248																1												
	IMP - Part IV.E	IMP4	Land language Pandan Magual	ongoing												1												
251			Load Inspection-Random Manual	0 0																								
	Groundwater - 3.05		Local de O Harling and Donard O stars	ongoing																								
	Groundwater - 3.15		Leachate Collection and Removal System	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE	1	/	NA	NONE		/	NA	NONE		/	NA	NONE	-
	Fire Service - 12.02		Underground Diesel Fuel Storage Tanks On-site Fire Response Capabilities-Operating	ongoing	✓	С	NONE		√	С	NONE		✓	С	NONE	1	✓		NONE		· ·	С	NONE		·	С	NONE	\dashv
	Fire Service - 12.03		Equipment On-site Fire Response Capabilities-	ongoing	√	FRN	I-d		✓	FRN	l-e		√	FRN	I-f	-	✓	FRN	l-g		✓	FRN	l-h		√	FRN	l-i	\dashv
	Fire Service - 12.04		Roads/Water	ongoing	✓	С	NONE		√	С	NONE		√	С	NONE	-	✓ ·		NONE		✓	С	NONE		√	С	NONE	\dashv
	Fire Service - 12.05		On-site Fuel Storage Tanks-Permit Issuance	ongoing	· ·	С	NONE		·	С	NONE		· ·	С	NONE	+	· ·		NONE		· ·	С	NONE		· ·	С	NONE	\dashv
			Building Limits		./	С	NONE		· ·	С	NONE		✓	С	NONE	+	·				· ·	С	NONE		· ·	С	NONE	\dashv
258	Fire Service - 12.06		Methane Gas Monitoring-On-site Structures	ongoing	Ľ	U	INUNE		•	U	INOINE		Ľ	U	NONE		*	U	NONE		٧	U	NONE	Ш	~	U	NUNE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	econ	id Q	uarter	202	:5							-	Thir	1 Qu	arter 2	025				\neg
Line#	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
259	Hazardous Materials – 13.02		Waste Load Checking Program	ongoing																								
260	Hazardous Materials – 13.05		Hazardous Waste Disposal	ongoing																								
261	Hazardous Materials – 13.10		Hazardous Waste-Procedures	ongoing																								
262	Hazardous Materials – 13.11		Spill Response Program	ongoing																								
263	Safety - 16.02		Injury and Illness Prevention Program	status																								
264	Safety - 16.03		Working Conditions-Monitoring	status																								
265	Safety - 16.04		Inspection Checklist-Work Area Exposure	status																								
266	Safety - 16.07		Accident/Injury Reports	status																								
267	Safety - 16.08		First-aid Kits	ongoing																								
268	Safety - 16.10		Lockout/Blackout Procedures	status																								
269	Safety - 16.11		Personal Protective Equipment	status																								
	Landfill Operation - 18.8		Prohibited Waste Procedures	ongoing																								
271	A coloreda																									\dashv		$\vdash \vdash$
	Archaeologist																											
273 274																												
	Ecological Significance - 62	62	Archaeological/Paleontological Identification/Conservation Program	ongoing	√	FRN	l-d		√	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		√	FRN	l-i	
276	IMP - Part VII.B	IMP7	Archaeological/Paleontological Report Submission	ongoing	~	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		~	FRN	l-h		✓	FRN	l-i	
277	Archaeological – 5.01		Archaeological Resurvey	ongoing	/	NA	NONE		/	NA	NONE																	
278	Archaeological – 5.02		Onsite Archaeologist	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		~	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
279	Archaeological – 5.03		Onsite Paleontologist	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
280	Archaeological – 5.04		Archaeological/Paleontological Identification Instruction	ongoing	/	NA	NONE		/	NA	NONE																	
	Archaeological – 5.05		Archaeological Resource Curation	ongoing	/	NA	NONE		/	NA	NONE																	
282																												

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	econ	ıd Qı	ıarter	202	.5								Third	d Qu	arter 2	2025				
Line#	Reference#	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/24/2025	Status*	Further Review Needed/Comments**	Resolved*	5/20/2025	Status*	Further Review Needed/Comments**	Resolved*	6/18/2025	Status*	Further Review Needed/Comments**	Resolved*	7/15/2025	Status*	Further Review Needed/Comments**	Resolved*	8/21/2025	Status*	Further Review Needed/Comments**	Resolved*	9/25/2025	Status*	Further Review Needed/Comments**	Resolved*
283	Paleontologist																											
284																												
285																												
286	Ecological Significance - 62	62	Archaeological/Paleontological -Material Identification/Conservation	ongoing	√	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
287	IMP - Part VII.B	IMP7	Archaeological/Paleontological-Report Submission	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

Appendix I

Further Review Needed Comments: Reference I-g through I-i Third Quarter 2025 Site Visits

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Project Manager	Q – B.2.c		City Planning	I-g through I-i: There was no grading outside of the approved landfill development limits during the 3rd Quarter. Grading up the canyon from the terminal basin was occurring while constructing the final toe berm and lining the area from the new liner to the Old City South landfill. Cells CC-4 Parts 3, 4 and 5 and CC-3 were accepting waste during the 3rd Quarter. Cell CC-3 was allowing transfer trucks with moving floors and trucks that require a tipper. The western edge of the Closure Turf was removed for the Cell CC-3 construction adjacent to the Southern Old City Landfill slopes. Tying into the existing landfill liner system caused exposure to old waste and liquids. Gas odors and landfill liquids were difficult to control. The new temporary access road to CC-4 Part 3, 4 and 5 was paved. All prior active areas in Cells CC-3 and CC-4 were prepared for winter rains by grading, installing drainage control systems which included straw waddles, hydroseeding and V-ditches, and the application of Posi-Shell and soil was used to control landfill leachate seeps. On high wind days, litter control was a concern. No litter was observed leaving the site. On an average monitoring day, two gas recovery flares were not operating. The terminal sediment basin was having a water flow control structure installed to dissapate energy and deliver site rainwater at the terminal basin.
		Geology - 1.07	County DPW EPD/SCL-LEA	I-g through I-i: See Q – B.2.c above.
		Geology - 1.12	County DPW EPD/SCL-LEA	I-g through I-i: See Q – B.2.c above.
	Q - C.3.h		City Planning	I-g through I-i: In the 3rd Quarter, localized dust clouds occurred on dirt roads to and on the County top deck when soil importation trucks were delivering soil. These temporary roads did not have rock or recycled concrete surfacing or soil stabilizer to control dust generation. The dust was not observed leaving the site from this location. On windy and dry days, dust clouds were observed coming from the cut slopes near the future toe berm location. The top deck of the bowl area was accepting fire soil and ash debris and using dirt roads.
	Q - C.10.c		City Planning	I-g through I-i: During the 3rd Quarter, flares were offline because of power outages or gas recovery maintenance that caused a fluctuation in gas recovery and an impact on odor control. An evaluation of the feasibility of a new beneficial use for the landfill gas was not done.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Project Manager		Odor/Landfill Gas - 7.07	County Planning/SCAQMD SCL-LEA	I-g through I-i See Q - C.10.c above.
		Gas - 52	County DPW EPD/SCL-LEA County Forester Fire Warden	I-g through I-i: See Q - C.10.c above.
	T-4		City Planning, City Fire Department	I-g through I-i: An updated fire plan showing the locations of all facilities, and normal and emergency ingress and egress using the new temporary access road should be prepared and sent to the local City fire department station and City and County planning departments. The toe berm construction location, and Gas to Energy areas should be shown on the plan. Emergency egress should be posted for employees and customers.
		Fire Service - 12.03	County DPW EPD/SCL-LEA County Forester Fire Warden	I-g through I-i: See T-4 above.
	M - 4.1.1 / 4	M - Earth Resources	City Department of Building and Safety	I-g through I-i: The rainwater control system for the new access road and slope around Basin E had uncontrolled rainwater impacts. Republic's final design and construction plans for the drainage system for this adjacent canyon development were not made available to be monitored. The Basin E water will discharge into the Terminal Basin. Drainage improvements, engineering calculations and plans for the whole landfill site were also not available to the monitor. Republic's engineering consultant should have drainage plans and engineering support calculations available for agencies' approval and monitors' review.
	M - 4.1.1 / 7		City Planning, DOGGR	I-g through I-i: The old abandoned oil well casing adjacent to the north secondary access road from the Flare 11 site was not reabandoned. An evaluation of the need to reabandon this well should be done. This well was not leaking oil or gas, and did not pose a current hazard. It is well beyond the approved landfill limits but inside the ridgeline of Sunshine Canyon.
		Re-abandonment Procedures	County Planning, County DPW EPD/SCL-LEA, DOGGR	I-g through I-i: See M - 4.1.1 / 7 above.
	M - 4.1.4 / 11	Post-5.0 Earthquake Analysis	City Planning	I-g through I-i: There were no earthquakes of 5.0 or greater during this monitoring period.
	M - 4.2.12 / 26 and 28		City Planning/SCAQMD	I-g through I-i: During the 3rd Quarter, Closure Turf was being maintained, and gas and liquids recovery systems under the turf were performing well. The future western portion of the Closure Turf was removed for the tie-in to the existing landfill liner systems to the Old City South slopes. This was an odorous construction effort due to the landfill gas, leachate and old waste encountered to install the new liner.
		Fugitive Dust - 45.F	County DPH/County LEA County DPW-EPD County Biologist	I-g through I-i: See M - 4.2.12 / 28 above.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Project Manager	M -4.2.13/ 29, 30, 32, 33, and 34		City Planning/SCL-LEA/SCAQMD	I-g through I-i: Compliance with these mitigation measures, concerning landfill gas monitoring and odor control and detection, is being monitored by a multi-agency team led by the SCAQMD. Only obvious gas emission sources, odorous operations related to gas and/or gas and landfill liquids, lack of cover, or exposed trash resulting in odor observed during the monitoring visit are reported.
		Amendment 45.N-4.a, 4.c, 4.d	County DPW-EPD	I-g through I-i: See M -4.2.13/ 29, 30, 32, 34 above.
		Amendment 45.N-5	County DPW-EPD	I-g through I-i: See M -4.2.13/ 29, 30, 32, 34 above.
	M - 4.2.13 / 33		City Planning/SCAQMD	I-g through I-i: On our random days of site visits during the 3rd Quarter, there were no landfill odors detected in the adjacent neighborhood. There were localized onsite odors at the west side of the Closure Turf from leachate seeps coming from the slope covered with Posi-Shell and the uncovered Closure Turf. These odors were caused by ongoing liner construction.
	M - 4.2.13 / 34		City Planning/SCAQMD	I-g through I-i: See M-4.2.13/29, 30, and 32 above.
		Odor/Landfill Gas - 7.06	County DPW-EPD/SCL- LEA/SCAQMD	I-g through I-i: See M-4.2.13/33 above.
		Amendment 45.N - 4.a, 4.c, 4.d	County DPW-EPD	I-g through I-i: See M-4.2.13/29, 30, 32, and 34 above.
		Amendment 45.N - 5	County DPW-EPD	I-g through I-i See M-4.2.13/29, 30, 32, and 34 above.
		Surface Water - 2.15	County DPW EPD/ LARWQCB, SCL- LEA	I-g through I-i: A preventative maintenance program with inspection of facility equipment, systems and storm water management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater should be performed on a monthly basis, with a summary report issued on a quarterly basis. These reports were not reviewed in the 3rd Quarter.
				In the 3rd Quarter, it was observed that some vegetation was growing out of numerous cracks and sediment in the water retention Basins A, B, C and E. The basins were ready for winter rain events. The concrete drainage channel wall south of Basin B which had the soil supporting the wall being washed away by rain was repaired. Oterh areas of the wall are cracked and have not been repaired.
	M - 4.4.2/ 69			I-g through I-i: The status on providing offsite wetland and riparian mitigation has not changed in the 3rd Quarter. The City was proceeding with writing and adopting an ordinance to allow the wetlands and riparian mitigation to be created in the Chatsworth Reservoir. All environmental analysis has been completed. Republic stated that there has been no progress in finalizing and adopting the ordinance. The delay in the issuance of the City ordinance is delaying any progress in creating the required wetlands and riparian mitigation. Time extension letters from the US Corps of Engineers and the California Department of Fish and Wildlife were in place for 2019. New extension letters were not obtained since then. The feasibility of the Chatsworth Dam mitigation site needs to be evaluated as still being a potential mitigation site.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Civil and Geotechnical		Biota - 4.4.3	CDFW	I-g through I-i: See M - 4.4.2 / 69 above.
Engineer	M - 4.9.3 / 110		City Planning/City LEA	I-g through I-i: In the 3rd Quarter, there was no litter or illegal dumping in the adjacent neighborhood. There was illegal dumping on the shoulders near the I-14 overpass. There also was illegal parking of junk cars (20 or more) along the roadway by a nearby salvage company.
	M - 4.1.1 / 2		City Building and Safety City Planning	I-g through I-i: See M - 4.1.1 / 5 below.
	M - 4.1.1 / 4		City Planning/LARWQCB Cal Recycle	I-g through I-i: See M - 4.1.1 / 5 below.
	M - 4.1.1 / 5		City Planning/ LARWQCB Cal Recycle	I-g through I-i: There was no grading outside of the approved landfill development limits during the 3rd Quarter. There was grading for a new access road from the entrance to the administration facilities area. The road was also to be used for 10-ton dump trucks to haul fire soil and debris for disposal. There was continuing work on the final toe berm. The construction plans and supporting geotechnical reports were reviewed and approved by City Planning and the City Building Department. Cell CC-5A is the start of the disposal fill of the north liner system to the southern Old City Landfill.
		Geology - 1.07	County DPW EPD/ County LEA	I-g through I-i: See M - 4.1.1 / 5 above.
	M - 4.1.5 / 12		City Planning/LARWQCB Cal Recycle	I-g through I-i: See M - 4.1.1 / 5 above.
	M - 4.1.6 / 18			I-g through I-i: A significant number of the landfill perimeter boundary survey PVC marker pipes have been removed in areas where Edison power pole grading took place, near the Flare 11 site pad grading and near the CC-4 Part 3 buttress. All PVC boundary markers need to be verified and replaced if missing. New markers should be also placed at the final south double-lined boundary.
	M - 4.14.1 / 155		City Planning/Cal Recycle PW-BOE LADBS City LEA	I-g through I-i: Access roads were being maintained around the working area for emergency access. The final perimeter access road construction on the westside was completed. Wet weather surfacing or paving was not done.
	M - 4.18 / 178		City Planning/City LEA	I-g through I-i: A site map showing areas that are at the final elevations and which should have final cover should be available for review. A map showing other filled elevations should also be available onsite for review. The amount of stockpiled soil should also be indicated in recorded elevations.
		Visual - 10.01 Visual - 10.02	County DPW EPD/ LARWQCB SCL-LEA	I-g through I-i: See M - 4.18 / 178 above.


Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Civil and Geotechnical Engineer	M - 4.3.1/37,38		City Planning/ LARWQCB CalRecycle SCL-LEA PW-BOE	I-g through I-i: Surface drainage systems were in-place to intercept or divert rainwater away from prior landfill cells and current filling operations. Most of these were temporary systems in active areas, and most conveyance V-ditches were unlined. The construction of the final toe berm and main access road realignment project is ongoing. This is a two-year project and includes the new Basin E, modification of the terminal basin, the construction of new drainage channels, and possibly a new upstream basin from the terminal basin. The construction of the sedimentation Basin E includes drainage improvements in the ravine south of the current entrance, and modifications to the terminal basin's size and inlet sources. The design plans, design details and engineering calculations were submitted to the City for permit approval. The design plans and engineering reports were not available for review by the monitor or submitted to the LACPW for approval. Compliance with Surface Water - 2.03 could not be verified. An engineering evaluation of the total site's surface drainage system should be done which reflects the current system's modifications. Onsite drainage channels should be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, Section 2533(C), and County of Los Angeles Public Works Department, Flood Control requirements.
Hydrologist		Surface Water - 2.03 Surface Water - 2.12	County DPW EPD/ LARWQCB SCL-LEA	I-g through I-i: See M - 4.3.1/37, 38 above.
	M - 4.3.1 / 39		City Planning/LARWQCB Cal Recycle	I-g through I-i: See M - 4.3.1/37, 38 above.
	M - 4.3.1 / 40		City Planning/ LARWQCB CalRecycle SCL-LEA PW-BOE LADBS	I-g through I-i: See M - 4.3.1/ 37, 38 above.
	M - 4.3.1 / 43		City Planning/ LARWQCB CalRecycle SCL-LEA	I-g through I-i: In the 3rd Quarter, all of the basins except for basin E were cleared of sediment. No hydrology reports were available to the monitor or the County that would show future rainwater control improvements and capacities.
		Surface Water - 2.10	LARWQCB / County DPW EPD	I-g through I-i: See M - 4.3.1/ 37, 38 and 43 above.
		Surface Water - 2.14	LARWQCB / County DPW EPD	I-g through I-i: See M - 4.3.1/37, 38 and 43 above.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Hydrologist	M - 4.3.1/ 46		City Planning/ LARWQCB CalRecycle PW-BOE	I-g through I-i: See 2.15 above.
	M - 4.3.2 / 50		City Planning/ LARWQCB CalRecycle SCL-LEA	I-g through I-i: The old City North top deck has a tank farm of 16 Adler storage tanks for processing recovered leachate and condensate, with a double-wall pipeline to the sewer connection at the entrance near San Fernando Road. This system operated with no odors detected at the tank farm nor the sewer connection during the 3rd Quarter. New tanks were placed in the Tank farm. The liquids in the tanks were being treated with 30% hydrogen peroxide at the tank farm and at the sewer connection. A remote shut-off safety system to close the holding vessel's valves was not observed being installed.
Biologist	M - 4.1.1 / 6		City Planning/ LARWQCB CalRecycle SCL-LEA LADBS	I-g through I-i: See M - 4.2.12 / 28 above.
		Geology - 1.14	LARWQCB/ County Forester	I-g through I-i: See M - 4.2.12 / 28 above.
	M - 4.2.11 / 23		City Planning	I-g through I-i: See M - 4.2.12 / 28 above.
		Geology - 1.13	County DPW EPD/ County Forester LARWQCB	I-g through I-i: See M - 4.2.12 / 28 above.
	M - 4.2.12		SCL-LEA/ City Planning	I-g through I-i: See M - 4.2.12 / 28 above.
		Revegetation - 44.A	SCL-LEA/ County DPW EPD Regional Planning County Biologist	I-g through I-i: See M - 4.2.12 / 28 above.
		Revegetation - 44.F	SCL-LEA/ County DPW EPD Regional Planning County Biologist	I-g through I-i: See M - 4.2.12 / 28 above.
		Biota - 4.42	SCL-LEA	I-g through I-i: See M - 4.2.12 / 28 above.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Biologist		Air Quality - 6.02	SCAQMD/ SCL-LEA	I-g through I-i: See M - 4.2.12 / 28 above.
		Visual - 10.08	County Forester	I-g through I-i: See M - 4.2.12 / 28 above.
	M - 4.4.1 / 60		City Planning	I-g through I-i: During the 3rd Quarter, City sage mitigation area decks B and C were being maintained. However, the removal of non-native mustard and other non-native vegetation in adjacent areas was not controlled. Native vegetation was doing well. Bare spots are being filled-in from seeds and spreading of prior planted native plants. The condition of the PM-10 berm oak trees was still being evaluated by Republic's consulting biologists. Their yearly mitigation tree status report was being prepared. There was a substantial amount of dead PM-10 trees observed by the monitor. No schedule for replacement of the dead oak trees has been given. There was no activity on the County sage mitigation area. Native plants were doing well in the County sage area, repopulating in the areas where they naturally came back. No mitigation revegetation activity was done for this area in the 3rd Quarter. Areas of City Decks B and C were being graded for the new temporary waste hauling access road. There appears to be minimal impacts to the sage mitigation areas. The status report on replacement of Coast Live Oak trees and Bigcone Douglas Fir trees was not available.
		Biota - 4.27	County LEA/CDFW	I-g through I-i: See M - 4.4.1 / 60 above.
		Biota - 4.10	County LEA/CDFW	I-g through I-i: Republic's biologist consultant has not yet issued an updated mitigation tree report. The number and type of trees that will need to be replaced and schedule of planting will be addressed in this report.
	M - 4.4.3 / 72		City Planning	I-g through I-i: See Biota - 4.10 above.
	M - 4.9.4 / 121		City Planning/Cal Recycle Cal OSHA LAFD City LEA	I-g through I-i: See T-4 above.
	M-4.9.4/ 125		City Planning/ CalRecycle Cal OSHA SCL-LEA	I-g through I-i: During the 3rd Quarter, the north perimeter gate was observed to be closed but not locked.
Paleontologist	M-4.19.2/ 191		City Planning	I-g through I-i: During the 3rd Quarter, grading was performed in native undisturbed areas that required archeological and paleontological monitoring. Reports were not available for review.
		Ecological Significance 62	County Planning	I-g through I-i: See M-4.19.2/ 191 above.

Appendix II

Relevant Site Photos

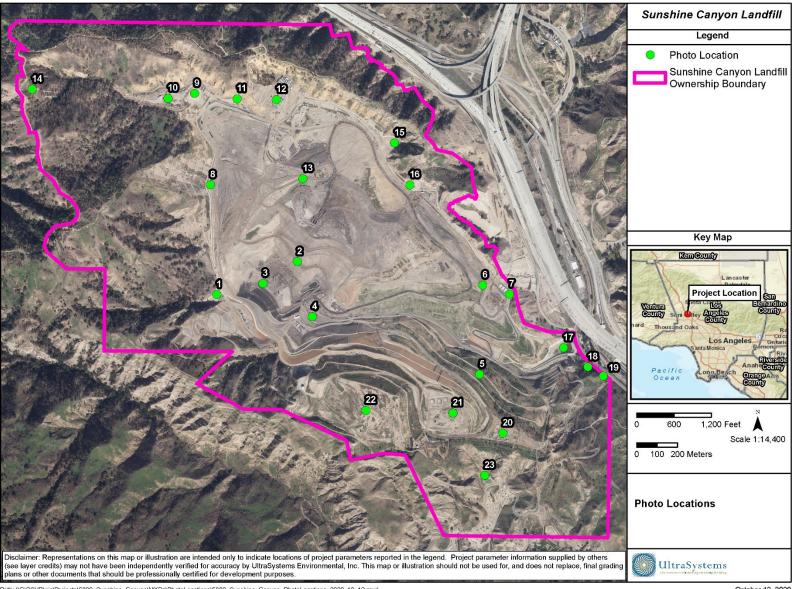

Path: \(\text{IIGISSVR\gis\Projects\5800}\) \(\text{Sunshine}\) \(\text{Canyon\IMXDs\PhotoLocations\5800}\) \(\text{Sunshine}\) \(\text{Canyon\Implies}\) \(\text{Projects\5800}\) \(\text{Sunshine}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\tex

October 12, 2020

Photo Location Map Key

Map Location	Title	Photo Number
1	Basin A	1 - 26
2	Working Area, CC4 Part 1/2	_
3	Working Area, CC-4 Part 3	_
4	Working Area, CC-4 Part 4/5, CC-5A	27 - 169
5	Closure Turf	170 – 176
6	Office and Scales Location	178
7	Alder Tank Liquids Treatment System	179 - 180
8	County Sage Mitigation Area and Westside Drainage Channels	181 – 212
9	Basin D	_
10	Basin D Material Storage Area	-
11	Basin D Outlet Channel	_
12	Flares 9, 10, 11 and Gas-to-Energy Facility	213 - 248
13	County Top Deck	249 – 273
14	North Access Road	_
15	Basin B	274 - 304
16	Eastside Drainage Channel	305 - 320
17	Terminal Basin	321 - 375
18	Greywater Sewer Connection	_
19	Retaining Wall at San Fernando Road	_
20	Sage Mitigation, Deck C	376 - 381
21	Sage Mitigation, Deck B	382 - 388
22	Sage Mitigation, Deck A	_
23	Southern Ownership Buffer	389 - 399
-	General Site	400 - 640



Photo 1: Basin A: July 15, 2025



Photo 3: Basin A: July 15, 2025



Photo 2: Basin A: July 15, 2025



Photo 4: Basin A: July 15, 2025



Photo 5: Basin A: July 15, 2025



Photo 7: Basin A: July 15, 2025



Photo 6: Basin A: July 15, 2025



Photo 8: Basin A: July 15, 2025



Photo 9: Basin A: August 21, 2025



Photo 11: Basin A: August 21, 2025



Photo 10: Basin A: August 21, 2025



Photo 12: Basin A: August 21, 2025



Photo 13: Basin A: August 21, 2025



Photo 15: Basin A: August 21, 2025



Photo 14: Basin A: August 21, 2025



Photo 16: Basin A: August 21, 2025



Photo 17: Basin A: August 21, 2025



Photo 19: Basin A: September 25, 2025



Photo 18: Basin A: September 25, 2025



Photo 20: Basin A: September 25, 2025



Photo 21: Basin A: September 25, 2025



Photo 23: Basin A: September 25, 2025



Photo 22: Basin A: September 25, 2025



Photo 24: Basin A: September 25, 2025



Photo 25: Basin A: September 25, 2025



Photo 27: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 26: Basin A: September 25, 2025



Photo 28: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 29: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 31: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 30: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 32: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 33: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 35: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 34: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 36: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 37: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 39: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 38: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 40: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 41: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 43: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 42: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 44: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 45: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 47: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 46: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 48: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 49: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 51: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 50: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 52: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 53: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 55: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 54: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 56: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 57: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 59: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 58: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 60: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 61: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 63: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 62: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 64: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 65: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 67: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 66: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 68: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 69: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 71: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 70: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 72: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 73: Working Area, CC-4 Part 4/5, CC-5A: July 15, 2025



Photo 75: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 74: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 76: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 77: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 79: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 78: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 80: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 81: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 83: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 82: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 84: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 85: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 87: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 86: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 88: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 89: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 91: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 90: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 92: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 93: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 95: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 94: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 96: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 97: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 99: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 98: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025

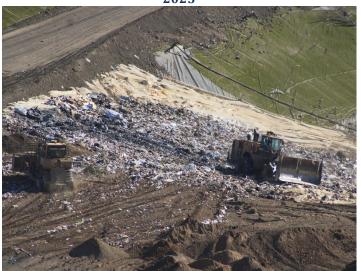


Photo 100: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 101: Working Area, CC-4 Part 4/5, CC-5A: August 21, 2025



Photo 103: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 102: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 104: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 105: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 107: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 106: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 108: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 109: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 111: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 110: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 112: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 113: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 115: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 114: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 116: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 117: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 119: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 118: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 120: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 121: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 123: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 122: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 124: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 125: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 127: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 126: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 128: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 129: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 131: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 130: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 132: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 133: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 135: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 134: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 136: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 137: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 139: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 138: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 140: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 141: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 143 Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 142: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 144: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 145: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 147: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 146: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 148: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 149: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 151: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 150: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 152: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 153: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 155: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 154: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 156: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 157: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 159: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 158: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 160: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 161: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 163: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 162: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 164: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 165: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 167: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 166: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 168: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 169: Working Area, CC-4 Part 4/5, CC-5A: September 25, 2025



Photo 171: Closure Turf: July 15, 2025



Photo 170: Closure Turf: July 15, 2025



Photo 172: Closure Turf: July 15, 2025



Photo 173: Closure Turf: July 15, 2025



Photo 175: Closure Turf: July 15, 2025



Photo 174: Closure Turf: July 15, 2025



Photo 176: Closure Turf: July 15, 2025



Photo 177: Closure Turf: July 15, 2025



Photo 179: Alder Tank Liquids Treatment System: August 21, 2025



Photo 178: Office & Scales Location: August 21, 2025



Photo 180: Alder Tank Liquids Treatment System: August 21, 2025



Photo 181: County Sage Mitigation Area & Westside Drainage: July 15, 2025



Photo 183: County Sage Mitigation Area & Westside Drainage: July 15, 2025



Photo 182: County Sage Mitigation Area & Westside Drainage: July 15, 2025



Photo 184: County Sage Mitigation Area & Westside Drainage: July 15, 2025



Photo 185: County Sage Mitigation Area & Westside Drainage: July 15, 2025



Photo 187: County Sage Mitigation Area & Westside Drainage: July 15, 2025



Photo 186: County Sage Mitigation Area & Westside Drainage: July 15, 2025



Photo 188: County Sage Mitigation Area & Westside Drainage: July 15, 2025

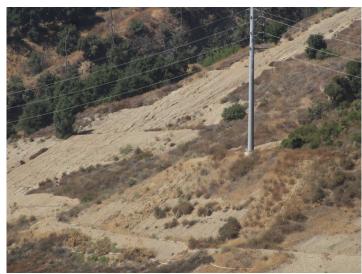


Photo 189: County Sage Mitigation Area & Westside Drainage: August 21, 2025



Photo 191: County Sage Mitigation Area & Westside Drainage: August 21, 2025



Photo 190: County Sage Mitigation Area & Westside Drainage: August 21, 2025



Photo 192: County Sage Mitigation Area & Westside Drainage: August 21, 2025



Photo 193: County Sage Mitigation Area & Westside Drainage: August 21, 2025



Photo 195: County Sage Mitigation Area & Westside Drainage: August 21, 2025



Photo 194: County Sage Mitigation Area & Westside Drainage: August 21, 2025



Photo 196: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 197: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 199: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 198: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 200: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 201: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 203: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 202: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 204: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 205: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 207: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 206: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 208: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 209: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 211: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 210: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 212: County Sage Mitigation Area & Westside Drainage: September 25, 2025



Photo 213: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 215: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 214: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 216: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 217: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 219: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 218: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 220: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 221: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025

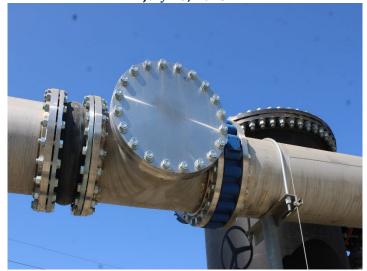


Photo 223: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 222: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 224: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 225: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 227: Flares 9, 10, 11 and Gas-to-Energy Facility County: July 15, 2025



Photo 226: Flares 9, 10, 11 and Gas-to-Energy Facility County:

July 15, 2025



Photo 228: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 229: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025

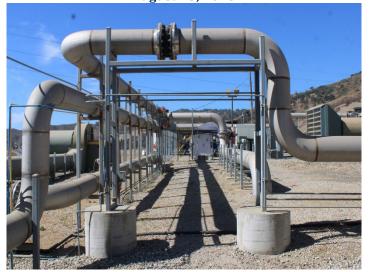


Photo 231: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 230: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 232: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 233: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 235: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 234: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 236: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 237: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 239: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 238: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 240: Flares 9, 10, 11 and Gas-to-Energy Facility County: August 15, 2025



Photo 241: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025



Photo 243: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025



Photo 242: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025



Photo 244: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025

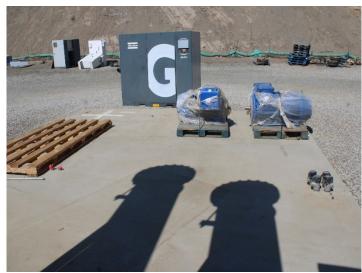


Photo 245: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025



Photo 247: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025



Photo 246: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025



Photo 248: Flares 9, 10, 11 and Gas-to-Energy Facility County: September 25, 2025



Photo 249: County Top Deck: July 25, 2025



Photo 251: County Top Deck: July 25, 2025



Photo 250: County Top Deck: July 25, 2025



Photo 252: County Top Deck: July 25, 2025



Photo 253: County Top Deck: July 25, 2025



Photo 255: County Top Deck: July 25, 2025



Photo 254: County Top Deck: July 25, 2025



Photo 256: County Top Deck: July 25, 2025



Photo 257: County Top Deck: July 25, 2025



Photo 259: County Top Deck: July 25, 2025



Photo 258: County Top Deck: July 25, 2025



Photo 260: County Top Deck: August 21, 2025



Photo 261: County Top Deck: August 21, 2025



Photo 263: County Top Deck: September 25, 2025



Photo 262: County Top Deck: August 21, 2025



Photo 264: County Top Deck: September 25, 2025



Photo 265: County Top Deck: September 25, 2025



Photo 267: County Top Deck: September 25, 2025



Photo 266: County Top Deck: September 25, 2025



Photo 268: County Top Deck: September 25, 2025



Photo 269: County Top Deck: September 25, 2025



Photo 271: County Top Deck: September 25, 2025



Photo 270: County Top Deck: September 25, 2025



Photo 272: County Top Deck: September 25, 2025



Photo 273: County Top Deck: September 25, 2025



Photo 275: Basin B: July 15, 2025



Photo 274: Basin B: July 15, 2025



Photo 276: Basin B: July 15, 2025



Photo 277: Basin B: July 15, 2025



Photo 279: Basin B: July 15, 2025



Photo 278: Basin B: July 15, 2025



Photo 280: Basin B: July 15, 2025



Photo 281: Basin B: July 15, 2025



Photo 283: Basin B: August 21, 2025



Photo 282: Basin B: August 21, 2025



Photo 284: Basin B: August 21, 2025



Photo 285: Basin B: August 21, 2025



Photo 287: Basin B: August 21, 2025



Photo 286: Basin B: August 21, 2025



Photo 288: Basin B: August 21, 2025



Photo 289: Basin B: August 21, 2025



Photo 291: Basin B: August 21, 2025



Photo 290: Basin B: August 21, 2025



Photo 292: Basin B: August 21, 2025



Photo 293: Basin B: September 25, 2025



Photo 295: Basin B: September 25, 2025



Photo 294: Basin B: September 25, 2025



Photo 296: Basin B: September 25, 2025



Photo 297: Basin B: September 25, 2025



Photo 299: Basin B: September 25, 2025



Photo 298: Basin B: September 25, 2025



Photo 300: Basin B: September 25, 2025



Photo 301: Basin B: September 25, 2025



Photo 303: Basin B: September 25, 2025



Photo 302: Basin B: September 25, 2025



Photo 304: Basin B: September 25, 2025



Photo 305: Eastside Drainage Channel: July 15, 2025



Photo 307: Eastside Drainage Channel: July 15, 2025



Photo 306: Eastside Drainage Channel: July 15, 2025



Photo 308: Eastside Drainage Channel: July 15, 2025



Photo 309: Eastside Drainage Channel: July 15, 2025



Photo 311: Eastside Drainage Channel: July 15, 2025



Photo 310: Eastside Drainage Channel: July 15, 2025



Photo 312: Eastside Drainage Channel: August 21, 2025



Photo 313: Eastside Drainage Channel: August 21, 2025



Photo 315: Eastside Drainage Channel: September 25, 2025



Photo 314: Eastside Drainage Channel: August 21, 2025



Photo 316: Eastside Drainage Channel: September 25, 2025



Photo 317: Eastside Drainage Channel: September 25, 2025



Photo 319: Eastside Drainage Channel: September 25, 2025



Photo 318: Eastside Drainage Channel: September 25, 2025



Photo 320: Eastside Drainage Channel: September 25, 2025



Photo 321: Terminal Basin: July 15, 2025



Photo 323: Terminal Basin: July 15, 2025



Photo 322: Terminal Basin: July 15, 2025



Photo 324: Terminal Basin: July 15, 2025



Photo 325: Terminal Basin: July 15, 2025



Photo 327: Terminal Basin: July 15, 2025



Photo 326: Terminal Basin: July 15, 2025



Photo 328: Terminal Basin: July 15, 2025



Photo 329: Terminal Basin: July 15, 2025



Photo 331: Terminal Basin: July 15, 2025





Photo 332: Terminal Basin: July 15, 2025







Photo 335: Terminal Basin: July 15, 2025



Photo 334: Terminal Basin: July 15, 2025



Photo 336: Terminal Basin: July 15, 2025



Photo 337: Terminal Basin: July 15, 2025



Photo 339: Terminal Basin: August 21, 2025



Photo 338: Terminal Basin: July 15, 2025



Photo 340: Terminal Basin: August 21, 2025

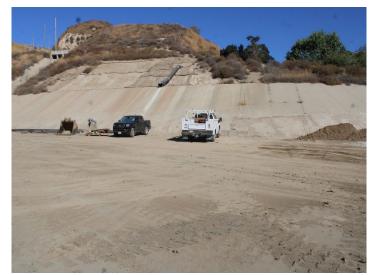


Photo 341: Terminal Basin: August 21, 2025



Photo 343: Terminal Basin: August 21, 2025



Photo 342: Terminal Basin: August 21, 2025



Photo 344: Terminal Basin: August 21, 2025



Photo 345: Terminal Basin: August 21, 2025



Photo 347: Terminal Basin: August 21, 2025



Photo 346: Terminal Basin: August 21, 2025



Photo 348: Terminal Basin: August 21, 2025



Photo 349: Terminal Basin: August 21, 2025



Photo 351: Terminal Basin: September 25, 2025



Photo 350: Terminal Basin: August 21, 2025



Photo 352: Terminal Basin: September 25, 2025



Photo 353: Terminal Basin: September 25, 2025



Photo 355: Terminal Basin: September 25, 2025



Photo 354: Terminal Basin: September 25, 2025



Photo 356: Terminal Basin: September 25, 2025



Photo 357: Terminal Basin: September 25, 2025



Photo 359: Terminal Basin: September 25, 2025



Photo 358: Terminal Basin: September 25, 2025



Photo 360: Terminal Basin: September 25, 2025



Photo 361: Terminal Basin: September 25, 2025



Photo 363: Terminal Basin: September 25, 2025



Photo 362: Terminal Basin: September 25, 2025



Photo 364: Terminal Basin: September 25, 2025



Photo 365: Terminal Basin: September 25, 2025



Photo 367: Terminal Basin: September 25, 2025



Photo 366: Terminal Basin: September 25, 2025



Photo 368: Terminal Basin: September 25, 2025



Photo 369: Terminal Basin: September 25, 2025



Photo 371: Terminal Basin: September 25, 2025



Photo 370: Terminal Basin: September 25, 2025



Photo 372: Terminal Basin: September 25, 2025



Photo 373: Terminal Basin: September 25, 2025



Photo 375: Terminal Basin: September 25, 2025



Photo 374: Terminal Basin: September 25, 2025



Photo 376: Sage Mitigation, Deck C: July 15, 2025



Photo 377: Sage Mitigation, Deck C: July 15, 2025



Photo 379: Sage Mitigation, Deck C: September 25, 2025



Photo 378: Sage Mitigation, Deck C: July 15, 2025



Photo 380: Sage Mitigation, Deck C: September 25, 2025



Photo 381: Sage Mitigation, Deck C: September 25, 2025



Photo 383: Sage Mitigation, Deck B: July 15, 2025



Photo 382: Sage Mitigation, Deck B: July 15, 2025



Photo 384: Sage Mitigation, Deck B: July 15, 2025



Photo 385: Sage Mitigation, Deck B: July 15, 2025



Photo 387: Sage Mitigation, Deck B: September 25, 2025



Photo 386: Sage Mitigation, Deck B: September 25, 2025



Photo 388: Sage Mitigation, Deck B: September 25, 2025



Photo 389: Southern Ownership Buffer: July 15, 2025



fPhoto 391: Southern Ownership Buffer: July 15, 2025



Photo 390: Southern Ownership Buffer: July 15, 2025



Photo 392: Southern Ownership Buffer: July 15, 2025



Photo 393: Southern Ownership Buffer: July 15, 2025



Photo 395: Southern Ownership Buffer: July 15, 2025



Photo 394: Southern Ownership Buffer: July 15, 2025



Photo 396: Southern Ownership Buffer: July 15, 2025



Photo 397: Southern Ownership Buffer: July 15, 2025



Photo 399: Southern Ownership Buffer: September 25, 2025



Photo 398: Southern Ownership Buffer: September 25, 2025



Photo 400: General Site: July 15, 2025



Photo 401: General Site: July 15, 2025



Photo 403: General Site: July 15, 2025



Photo 402: General Site: July 15, 2025



Photo 404: General Site: July 15, 2025



Photo 405: General Site: July 15, 2025



Photo 407: General Site: July 15, 2025



Photo 406: General Site: July 15, 2025



Photo 408: General Site: July 15, 2025



Photo 409: General Site: July 15, 2025



Photo 411: General Site: July 15, 2025



Photo 410: General Site: July 15, 2025



Photo 412: General Site: July 15, 2025



Photo 413: General Site: July 15, 2025



Photo 415: General Site: July 15, 2025



Photo 414: General Site: July 15, 2025



Photo 416: General Site: July 15, 2025



Photo 417: General Site: July 15, 2025



Photo 419: General Site: July 15, 2025



Photo 418: General Site: July 15, 2025



Photo 420: General Site: July 15, 2025



Photo 421: General Site: July 15, 2025



Photo 423: General Site: July 15, 2025



Photo 422: General Site: July 15, 2025



Photo 424: General Site: July 15, 2025



Photo 425: General Site: July 15, 2025



Photo 427: General Site: July 15, 2025



Photo 426: General Site: July 15, 2025



Photo 428: General Site: July 15, 2025



Photo 429: General Site: July 15, 2025



Photo 431: General Site: July 15, 2025



Photo 430: General Site: July 15, 2025



Photo 432: General Site: July 15, 2025



Photo 433: General Site: July 15, 2025



Photo 435: General Site: July 15, 2025



Photo 434: General Site: July 15, 2025



Photo 436: General Site: July 15, 2025



Photo 437: General Site: July 15, 2025



Photo 439: General Site: July 15, 2025



Photo 438: General Site: July 15, 2025



Photo 440: General Site: July 15, 2025



Photo 441: General Site: July 15, 2025



Photo 443: General Site: July 15, 2025



Photo 442: General Site: July 15, 2025



Photo 444: General Site: July 15, 2025



Photo 445: General Site: July 15, 2025



Photo 447: General Site: July 15, 2025



Photo 446: General Site: July 15, 2025



Photo 448: General Site: July 15, 2025



Photo 449: General Site: July 15, 2025



Photo 451: General Site: July 15, 2025



Photo 450: General Site: July 15, 2025



Photo 452: General Site: July 15, 2025



Photo 453: General Site: July 15, 2025



Photo 454: General Site: July 15, 2025



Photo 454: General Site: July 15, 2025



Photo 456: General Site: July 15, 2025



Photo 457: General Site: July 15, 2025



Photo 459: General Site: July 15, 2025



Photo 458: General Site: July 15, 2025



Photo 460: General Site: July 15, 2025



Photo 461: General Site: July 15, 2025



Photo 463: General Site: July 15, 2025



Photo 462: General Site: July 15, 2025



Photo 464: General Site: July 15, 2025



Photo 465: General Site: July 15, 2025



Photo 467: General Site: July 15, 2025



Photo 466: General Site: July 15, 2025



Photo 468: General Site: July 15, 2025



Photo 469: General Site: July 15, 2025



Photo 471: General Site: August 21, 2025



Photo 470: General Site: August 21, 2025



Photo 472: General Site: August 21, 2025



Photo 473: General Site: August 21, 2025



Photo 475: General Site: August 21, 2025



Photo 474: General Site: August 21, 2025



Photo 476: General Site: August 21, 2025



Photo 477: General Site: August 21, 2025



Photo 479: General Site: August 21, 2025



Photo 478: General Site: August 21, 2025



Photo 480: General Site: August 21, 2025





Photo 483: General Site: August 21, 2025



Photo 482: General Site: August 21, 2025



Photo 484: General Site: August 21, 2025



Photo 485: General Site: August 21, 2025



Photo 487: General Site: August 21, 2025



Photo 486: General Site: August 21, 2025



Photo 488: General Site: August 21, 2025



Photo 489: General Site: August 21, 2025



Photo 491: General Site: August 21, 2025



Photo 490: General Site: August 21, 2025



Photo 492: General Site: August 21, 2025



Photo 493: General Site: August 21, 2025



Photo 495: General Site: August 21, 2025



Photo 494: General Site: August 21, 2025



Photo 496: General Site: August 21, 2025



Photo 497: General Site: August 21, 2025



Photo 499: General Site: August 21, 2025



Photo 498: General Site: August 21, 2025



Photo 500: General Site: August 21, 2025



Photo 501: General Site: August 21, 2025



Photo 503: General Site: August 21, 2025



Photo 502: General Site: August 21, 2025



Photo 504: General Site: August 21, 2025



Photo 505: General Site: August 21, 2025



Photo 507: General Site: August 21, 2025



Photo 506: General Site: August 21, 2025



Photo 508: General Site: August 21, 2025



Photo 509: General Site: August 21, 2025



Photo 511: General Site: August 21, 2025



Photo 510: General Site: August 21, 2025



Photo 512: General Site: August 21, 2025



Photo 513: General Site: August 21, 2025



Photo 515: General Site: August 21, 2025



Photo 514: General Site: August 21, 2025



Photo 516: General Site: August 21, 2025



Photo 517: General Site: August 21, 2025



Photo 519: General Site: August 21, 2025



Photo 518: General Site: August 21, 2025



Photo 520: General Site: August 21, 2025



Photo 521: General Site: August 21, 2025



Photo 523: General Site: August 21, 2025



Photo 522: General Site: August 21, 2025



Photo 524: General Site: August 21, 2025



Photo 525: General Site: August 21, 2025



Photo 527: General Site: August 21, 2025



Photo 526: General Site: August 21, 2025



Photo 528: General Site: August 21, 2025



Photo 529: General Site: August 21, 2025



Photo 531: General Site: August 21, 2025



Photo 530: General Site: August 21, 2025



Photo 532: General Site: August 21, 2025



Photo 533: General Site: August 21, 2025



Photo 535: General Site: August 21, 2025



Photo 534: General Site: August 21, 2025



Photo 536: General Site: August 21, 2025



Photo 537: General Site: August 21, 2025



Photo 539: General Site: August 21, 2025



Photo 538: General Site: August 21, 2025



Photo 540: General Site: August 21, 2025

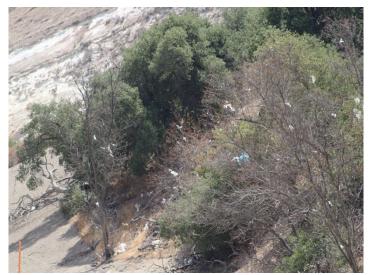


Photo 541: General Site: August 21, 2025



Photo 543: General Site: August 21, 2025



Photo 542: General Site: August 21, 2025



Photo 544: General Site: August 21, 2025



Photo 545: General Site: August 21, 2025



Photo 547: General Site: August 21, 2025



Photo 546: General Site: August 21, 2025



Photo 548: General Site: August 21, 2025



Photo 549: General Site: August 21, 2025



Photo 551: General Site: August 21, 2025



Photo 550: General Site: August 21, 2025

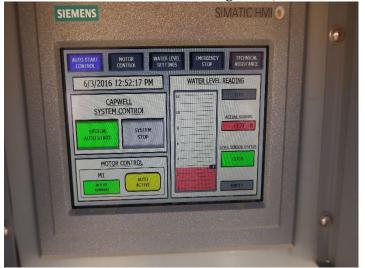


Photo 552: General Site: August 21, 2025



Photo 553: General Site: August 21, 2025



Photo 555: General Site: September 25, 2025



Photo 554: General Site: September 25, 2025



Photo 556: General Site: September 25, 2025



Photo 557: General Site: September 25, 2025



Photo 559: General Site: September 25, 2025



Photo 558: General Site: September 25, 2025



Photo 560: General Site: September 25, 2025



Photo 561: General Site: September 25, 2025



Photo 563: General Site: September 25, 2025



Photo 562: General Site: September 25, 2025



Photo 564: General Site: September 25, 2025



Photo 565: General Site: September 25, 2025



Photo 567: General Site: September 25, 2025



Photo 566: General Site: September 25, 2025



Photo 568: General Site: September 25, 2025



Photo 569: General Site: September 25, 2025



Photo 571: General Site: September 25, 2025



Photo 570: General Site: September 25, 2025



Photo 572: General Site: September 25, 2025



Photo 573: General Site: September 25, 2025



Photo 575: General Site: September 25, 2025



Photo 574: General Site: September 25, 2025



Photo 576: General Site: September 25, 2025



Photo 577: General Site: September 25, 2025



Photo 579: General Site: September 25, 2025



Photo 578: General Site: September 25, 2025



Photo 580: General Site: September 25, 2025



Photo 581: General Site: September 25, 2025



Photo 583: General Site: September 25, 2025



Photo 582: General Site: September 25, 2025



Photo 584: General Site: September 25, 2025



Photo 585: General Site: September 25, 2025



Photo 587: General Site: September 25, 2025



Photo 586: General Site: September 25, 2025



Photo 588: General Site: September 25, 2025



Photo 589: General Site: September 25, 2025



Photo 591: General Site: September 25, 2025



Photo 590: General Site: September 25, 2025



Photo 592: General Site: September 25, 2025



Photo 593: General Site: September 25, 2025



Photo 595: General Site: September 25, 2025



Photo 594: General Site: September 25, 2025



Photo 596: General Site: September 25, 2025



Photo 597: General Site: September 25, 2025



Photo 599: General Site: September 25, 2025



Photo 598: General Site: September 25, 2025



Photo 600: General Site: September 25, 2025



Photo 601: General Site: September 25, 2025



Photo 603: General Site: September 25, 2025



Photo 602: General Site: September 25, 2025



Photo 604: General Site: September 25, 2025



Photo 605: General Site: September 25, 2025



Photo 607: General Site: September 25, 2025



Photo 606: General Site: September 25, 2025



Photo 608: General Site: September 25, 2025



Photo 609: General Site: September 25, 2025



Photo 611: General Site: September 25, 2025



Photo 610: General Site: September 25, 2025



Photo 612: General Site: September 25, 2025



Photo 613: General Site: September 25, 2025



Photo 615: General Site: September 25, 2025



Photo 614: General Site: September 25, 2025



Photo 616: General Site: September 25, 2025



Photo 617: General Site: September 25, 2025



Photo 619: General Site: September 25, 2025



Photo 618: General Site: September 25, 2025



Photo 620: General Site: September 25, 2025



Photo 621: General Site: September 25, 2025



Photo 623: General Site: September 25, 2025



Photo 622: General Site: September 25, 2025



Photo 624: General Site: September 25, 2025



Photo 625: General Site: September 25, 2025



Photo 627: General Site: September 25, 2025



Photo 626: General Site: September 25, 2025



Photo 628: General Site: September 25, 2025



Photo 629: General Site: September 25, 2025



Photo 631: General Site: September 25, 2025



Photo 630: General Site: September 25, 2025



Photo 632: General Site: September 25, 2025



Photo 633: General Site: September 25, 2025



Photo 635: General Site: September 25, 2025



Photo 634: General Site: September 25, 2025



Photo 636: General Site: September 25, 2025



Photo 637: General Site: September 25, 2025



Photo 639: General Site: September 25, 2025



Photo 638: General Site: September 25, 2025



Photo 640: General Site: September 25, 2025



Photo 641: General Site: September 25, 2025

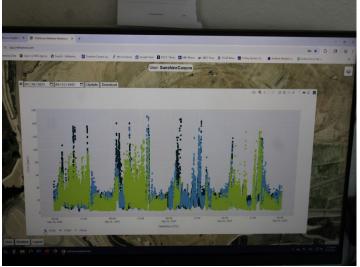


Photo 642: General Site: September 25, 2025

Appendix III

Quarterly Site Visits: Site Visit Attendees by Date of Site Visit/ Mitigation Monitoring Site Reports

July 2025

Monitor: James Aidukas		Page:	1	of	2	
Discipline:	Project Manager	Date: 7-15-2	2025			
Site Condition	ons: 60- 80° F, 0-10 mph		*		T. Comments	
		SITELOG	The state of the s			

Drove the Granada Hills area near Woodley Avenue, the adjacent neighborhood, and school areas from 6:45 to 7:30 a.m. There was no landfill odors detected at Balboa Blvd and Woodley or in the adjacent neighborhood. Observed numerous junk cars parked on the roadway shoulder or Sierra Highway near the I-14 overpass. It appears that a car recycling business on Sierra Highway is using the shoulder for junk car storage. Met with Mike Lindsay (UltraSystems), Phillip Chen, and Christina Nguyen (LACDRP), Alex Fitchmun (LACPW) and Dave Thompson (City LEA). We then proceeded to monitor the site and observed the following:

- There was a new paved road to the Administration area facilities and new scale facilities
 for 10-yard dump trucks to weigh in and out for disposal of fire soil in the County's
 northeast bowl area. The old access road was removed to allow for further liner
 placement and disposal capacity.
- There was an iron oxide Old City South slope seep observed when entering this new road. This seep could be an alluvial source.
- Along this new road above the Terminal Basin was a control panel labeled "Cap Well". The operating function of this control panel is not known.
- It was observed that lighting for the permanent scales had no lighting shields on the light fixture. The CUP conditions require downward facing shields.
- The Adler Tank leachate and condensate treatment system was operating. There were no odors detected coming from the south area of the tank farm. The hydrogen peroxide storage vessel had an emergency shutdown switch located near the vessel. There was no remote safety switch.
- Observed Cell CC-5A from a bench road south of the Cell. Moving Floor and Tipper transfer trucks along with Packer trucks were placing waste in this area.
- The active area near the top deck of the bowl area was accepting fire soil and ash debris that was approved for disposal. Waste scales were installed at the old City and County scale location for weighing all fire soil and ash.
- The upper slopes of the prior filled CC-4 Parts 3, 4, and 5 areas were graded, and straw wattles were placed for erosion control. This area was also hydro-seeded above an area that was covered with Posi-Shell.
- There were some seeps of leachate observed coming through the Posi-Shell covered slopes. Also, there were seeps of leachate coming from the Closure Turf area that was not going down to the liner low point recover area. Some of the Posi-Shell had areas covered with soil to control the seeps.

7-15-25, Page 2 of 2

- The area connecting to the Old City South Landfill had some leachate and gas seeps in the newly lined western area. Once fully connected to the liquids and gas handling systems, this problem should be controlled. The leachate seeps are still an ongoing problem.
- The Terminal basin floor was covered with sediment that was in the process of being removed. Litter was covering the outlet risers.
- The western edge of the Closure Turf had decomposed trash that was uncovered at the base of the Closure Turf. Odors were localized to the due to the liner construction.
- The eastern drainage channel downstream of Basin B where the soil was washed away has been repaired. There was debris in the bottom of the channel at the start of the channel. The vegetation growing out of the concrete was removed and concrete repaired. The B basin was dry, and sediment was not removed.
- Basin A had dry sediment covering the whole basin. Sediment was in the process of being removed.
- The westside drainage channel out of Basin A had a minor amount of sediment.
- A minor amount of windblown litter was observed on the slopes of the Old City South landfill along the oil field road.
- Basin E was dry and had sediment.
- City sage mitigation decks B and C were observed. There was mustard weed growing in the sage mitigation and PM-10 Oak Tree areas. The dead PM-10 mitigation oak trees had not been replaced.
- County sage mitigation slopes were naturally doing well. There was no grading of the bare slopes or planting being done.
- The wastewater city sewer connection at the landfill entrance was observed. There were no odors detected, and no concerns observed.

Flare Operating Conditions:

- o Flare 1 1640 °F, 2443 SCFM, 40% volume CH4
- o Flare 3 Not Operating
- o Flare 9 1642°F, 2891 SCFM
- o Flare 10 1653°F, 2990 SCFM
- o Flare 11- Not Operating

The gas-to-energy plant was operating using 8227 SCFM of recovered gas, 43% volume of CH4. The total volume of recovered gas was 16,551 SCFM.

FURTHER REVIEW NEEDED
COMMENTS
 Signed:
Signed. Affairles

Monitor: Mike Lindsay	Page 1 of 2				
Discipline: Environmental Engineer	Date: 07-15-2025 Tuesday				
Site Conditions: Partly Cloudy, 57–80 °F, SSE 4–9 mph, 82% RH, 52 AQI Moderate					
SITELOC					

SITE LOG

- 1. No landfill odors are present in the adjacent neighborhood along Timber Ridge Street at 7:30 am.
- 2. Met with Jim Aidukas (UltraSystems), Phillip Chen and Christina Nguyen (LACDRP), Alex Fitchmun (LACPW) and Dave Thompson (LEA), following in separate vehicles to site locations.
- 3. The admin and LEA facility are in good order.
- 4. Observed Cell CC-5A from a bench road south of cell. Three tippers are operating at west end of cell, along with moving floor trucks. ADC is 70% covered with new trash at 8:30 am. No haul trucks are queued on the main haul road. Water trucks are applying water to disposal area. The closure turf continues to be peeled back as necessary for cell construction.
- 5. A small pond of leachate is present at the tie-in of Cell CC-5A liner.
- 6. Observed toppled drilling rig north of Cell CC-5A where operator fatality occurred. An investigation is ongoing.
- 7. The closure turf is in good order, with no odors present.
- 8. Misters are operating along haul road to Cell CC-5A.
- 9. Observed the overall landfill operations from the observation deck. The nearby windsock is vertical with no wind present.
- 10. Straw wattles and crushed asphalt have been stockpiled on Cell CC-4 Part 4/5.
- 11. Cells CC-4 Part 4 and 5 are in good order, with liter fencing collecting windblown trash.
- 12. Bird abatement is active.
- 13. County sage mitigation area is in good order.
- 14. Street sweepers are cleaning the haul roads.
- 15. Observed top deck area where Los Angeles fire debris is being placed. Soil is covering area from the day before. Water trucks are applying water to area. No odors are present.
- 16. Sediment basin A is dry, with soil piled for removal.
- 17. Soil and vegetation has dropped onto the basin A concrete spillway.
- 18. The westside drainage channel is in good order.
- 19. Water trucks are applying water throughout site to control dust.
- 20. Flare 9 is operating at 2924 scfm, 1658 °F. Gas sample measured at 43 % Vol. CH4, 0.3 % Vol. O2, 26 ppm CO, and 41 ppm H2S. Blowers 1, 2, 4, 5 and 6 are operating.
- 21. Flare 10 is operating at 2900 scfm, 1655 °F.
- 22. Flare 11 is offline.
- 23. New blower motors are staged on the flare pad.
- 24. Sunshine Gas Producers facility is operating at 8225 scfm, with no odors present.
- 25. Perimeter drainage channel at flare pad is in good order, with some sediment.
- 26. The County top deck is in good order.
- 27. Workers continue to take measurements at test plots that involve microorganisms that digest methane.
- 28. The terminal basin is mostly covered with sediment, with soil piled for drying. Some sediment has been removed. Trash is present throughout basin, especially at the riser drains.
- 29. The terminal basin outlet channel is in good order.

Page 2 of 2 07-15-2025

- 30. Vegetation is growing out of cracks in the concrete top wall at the north end of terminal basin.
- 31. Sediment basin B is still covered with a layer of sediment.
- 32. The eastside drainage channel is in good order. The section east of basin B has trash present at culvert.
- 33. Sediment basin A is in good order, with soil being removed.
- 34. The basin A spillway has soil and vegetation that partially blocks the channel.
- 35. The westside drainage channel is in good order.
- 36. Flare 1 is operating at 2443 scfm, 1640 °F. Gas sample measured 33 % Vol. CH4, 0 % Vol. O2, 0 ppm CO, and 73 ppm H2S. Gas inlet temperature is 132 °F.
- 37. A fallen dead tree is present on the perimeter fencing of flare 1 north end.
- 38. City deck B sage mitigation area is in good order. Some mustard weed is present.
- 39. City deck C sage mitigation area is in good order. Some mustard weed is present. Workers are present at deck C.
- 40. The south perimeter PM-10 berm has many dead oak trees present.
- 41. Flare 3 is offline.
- 42. Observed construction of a new waste cell east of Cell CC-5A, including scrapers and excavators.

FURTHER REVIEW NEEDED

- 1. Eliminate leachate from ponding at Cell CC-5A liner tie-in.
- 2. Remove vegetation growing in concrete cracks at basin B and terminal basin north top wall.
- 3. Remove trash at eastside drainage channel by sediment basin B.
- 4. Remove soil and vegetation on basin A spillway.
- 5. Remove fallen tree at flare 1 fencing.
- 6. Replace dead oak trees at PM-10 berm.

Signed: Michael W. Lindsay

August 2025

Monitor: James Aidukas	Page:	1	of	2	
Discipline: Project Manager	Date: 8-21-2025	5			
Site Conditions: 70-95°F, 0-10 mph					
	SITE LOG				

Drove the Granada Hills area near Woodley Avenue, the adjacent neighborhood, and school areas from 6:45 to 7:45 a.m. There was no landfill odors detected at Balboa Blvd and Woodley or in the adjacent neighborhood. Observed numerous junk cars parked on the roadway shoulder or Sierra Highway near the I-14 overpass. It appears that a car recycling business on Sierra Highway is using the shoulder for junk car storage. Met with Mike Lindsay (UltraSystems), Phillip Chen, and Christina Nguyen (LACDRP), and Dave Thompson (City LEA). We then proceeded to monitor the site and observed the following:

- There was an iron oxide seep observed on the Old City South slope when entering this new Administration access road. This seep could be an alluvial source.
- Along this new road above the Terminal Basin was a control panel labeled "Cap Well". The
 operating function of this control panel is not known. The operating date on the panel was
 6/03/2016. It appears that the system is in auto start control mode with a current liquid
 level of 2.77 feet. Ask Republic if this is for controlling cut off wall liquids.
- It was observed that lighting for the permanent scales had no lighting shields on the light fixture. The CUP conditions require downward facing shields.
- The Adler Tank leachate and condensate treatment system was operating. There were no odors detected coming from the south area of the tank farm. The hydrogen peroxide storage vessel had an emergency shutdown switch located near the vessel. There was no remote safety switch.
- Observed Cell CC-5A from the Deck A observation platform. Moving Floor and Tipper transfer trucks along with Packer trucks were placing waste in this area. The operations area was wider and longer since the last site visit. The area east of the active site was being prepared for liner to be installed to the east and terminate at the Final Toe Berm.
- The active area near the top deck of the bowl area that was accepting fire soil and ash debris was not actively accepting waste.
- The upper slopes of the prior filled CC-4 Parts 3, 4, and 5 areas were graded, and straw wattles were placed for erosion control. This area was also hydroseeded above that area. Posi Shell was placed on the slopes above the active fill area and above the Closure Turf.
- There were no seeps of leachate observed coming through the Posi-Shell covered slopes nor from the Closure Turf area.
- The area connecting to the Old City South Landfill and the current active area had the leachate liquids connected to the recovery piping that transported the liquids to the current final Toe Berm and handling systems. The allowed water level has been increased from 11" WC to 28" WC before the current Toe Berm pump is turned on. Why was this level increased?

8-21-25, Page 2 of 2

- The Terminal Basin floor had approximately 85% of the sediment removed. A soil berm
 was holding seepage water so that the underground drainage channel could be finished at
 the Terminal Basin. The outlet risers were not cleared of sediment and waste covering
 them.
- The sediment removed from the Terminal Basin was approximately 12 feet high at the end of the rainy season.
- The eastern drainage channel downstream of Basin B where the soil was washed away has been repaired. There was debris at the bottom of the channel at the start of the channel. The vegetation growing out of the concrete was removed and concrete repaired. The B basin was dry, and sediment was removed.
- Basin A was dry, and the sediment was removed.
- The westside drainage channel out of Basin A had a minor amount of sediment.
- A minor amount of windblown litter was observed on the slopes of the Old City South landfill along the road to Flare 3.
- Basin E was dry and had sediment.
- City sage mitigation decks B and C were observed. There was mustard weed growing in the sage mitigation and PM-10 Oak Tree areas. The dead PM-10 mitigation oak trees had not been replaced.
- County sage mitigation slopes were naturally doing well. There was no grading of the bare slopes or planting being done.
- The wastewater city sewer connection at the landfill entrance was observed. There were no odors detected, and no concerns observed.
- The County landfill area was graded and low point areas filled to eliminate future ponding.
 HDPE piping was moved and arranged to organize excess materials.

Flare Operating Conditions:

- o Flare 1 1636°F, 3181 SCFM, 40% volume CH4
- o Flare 3 Not Operating
- o Flare 9 Not Operating
- o Flare 10 1648°F, 2847 SCFM
- o Flare 11 1659°F, 3468 SCFM

The gas-to-energy plant was operating using 8533 SCFM of recovered gas, 43% volume of CH4. The total volume of recovered gas was 18,029 SCFM.

FURTHER REVIEW NEEDED
COMMENTS
Signed: Signed:

Monitor: Mike Lindsay	Page 1 of 2			
Discipline: Environmental Engineer	Date: 08-21-2025 Thursday			
Site Conditions: Clear, 72–100 °F, N 4–8 mph, 33% RH, 46 AQI Good				
SITELOG				

- 1. No landfill odors are present in the adjacent school or neighborhood along Timber Ridge Drive at 7:15 am. An AQMD vehicle is parked at the end of Constable Avenue. Republic odor patrol is active.
- 2. The admin and LEA facility are in good order.
- 3. Met with Jim Aidukas (UltraSystems), Phillip Chen and Christina Nguyen (LACDRP), and Dave Thompson (LEA), following in separate vehicles to site locations.
- 4. Met with Michael Maglione (Kate Downey's replacement at Republic) and discussed landfill operations and UltraSystems' mission.
- 5. Observed the overall landfill operations from the observation deck. The nearby windsock is vertical with no wind present. New informational placards are present along handrail.
- 6. Cells CC-4 Part 4 and 5 are in good order, with liter fencing collecting windblown trash.
- 7. Bird abatement is active.
- 8. Cell CC-5A is in good order, with three tippers operating at west end of cell, along with moving floor trucks. ADC is 80% covered with new trash at 8:45 am. No haul trucks are queued on the main haul road. Water trucks are applying water to disposal area.
- 9. Additional Posi-Shell cover has been applied to the north slopes of Cell CC-5A.
- 10. The closure turf is in good order, with no odors present.
- 11. Misters are operating along haul road to Cell CC-5A.
- 12. The terminal basin has been mostly cleared of sediment, with some soil piled for drying.
- 13. A soil berm has been created to contain the remaining water near the riser drains.
- 14. The terminal basin outlet channel is in good order.
- 15. Vegetation is growing out of cracks in the concrete top wall at the north end of terminal basin.
- 16. Observed new cell construction southeast of Cell CC-5A. Liner tie-in trenches have been made, with scrapers removing soil from bottom of cell.
- 17. Street sweepers are cleaning the haul roads.
- 18. Sediment basin B has been cleared of sediment, except some soil piles at back of basin and at riser drains.
- 19. The eastside drainage channel is in good order. The section east of basin B has trash present at culvert.
- 20. Flare 9 is offline.
- 21. Flare 10 is operating at 2955 scfm, 1653 °F. Gas sample measured at 43 % Vol. CH4, 0.6 % Vol. O2, 6 ppm CO, and 41 ppm H2S. Blowers 1, 2, 4, 5 and 6 are operating.
- 22. Blower number 3 has been uninstalled.
- 23. Flare 11 is operating at 3495 scfm, 1642 °F.
- 24. New blower motors are staged on the flare pad.
- 25. Sunshine Gas Producers facility is operating at 8570 scfm, with no odors present.
- 26. Perimeter drainage channel at flare pad has been cleared of sediment.
- 27. The County top deck is in good order.
- 28. County sage mitigation area is in good order.

- 29. The secondary access road is in good order, with no ruts present. The perimeter gate is propped open.
- 30. The Bee Canyon and Rice Canyon mitigation oak trees northwest of landfill perimeter are in good order.
- 31. The new air quality monitoring station at top of the secondary access road is in good order, with equipment operation waiting for power to be supplied.
- 32. The leachate collection low-point drainage pump station is in good order, with no odors present.
- 33. The leachate collection system Baker tanks are in good order, with no leaks or odors present.
- 34. Flare 1 is operating at 3172 scfm, 1630 °F. Gas sample measured 39 % Vol. CH4, 0.4 % Vol. O2, 0 ppm CO, and 57 ppm H2S. Gas inlet temperature is 153 °F.
- 35. A new blower motor is staged at the flare 1 pad.
- 36. A fallen dead tree is present on the perimeter fencing of flare 1 north end.
- 37. City deck B sage mitigation area is in good order. Some mustard weed is present.
- 38. City deck C sage mitigation area is in good order. Some mustard weed is present.
- 39. The south perimeter PM-10 berm has many dead oak trees present.
- 40. Flare 3 is offline.
- 41. Sediment basin A has been cleared of sediment, except for small piles of soil along perimeter.
- 42. The basin A spillway has soil and vegetation that partially blocks the channel.
- 43. The westside drainage channel is in good order.
- 44. Water trucks are applying water throughout site to control dust.
- 45. The westside drainage channel is in good order.
- 46. The scales are in good order, with no odors present.
- 47. Sediment basin E by scales is in good order, with some sediment present.

FURTHER REVIEW NEEDED

- 1. Remove vegetation growing in concrete cracks at terminal basin north top wall.
- 2. Remove trash at eastside drainage channel by sediment basin B.
- 3. Remove soil and vegetation on basin A spillway.
- 4. Remove fallen tree at flare 1 fencing.
- 5. Replace dead oak trees at PM-10 berm.

Signed: Michael W. Lindsay

September 2025

Monitor: Jan	nes Aidukas	Page:	1	of	2	
Discipline:	Project Manager	Date: 9-25-2025				
Site Condition	ons: 60- 80°F, 0-5 mph					
	Si ⁻	TE LOG				

Drove the Granada Hills area near Woodley Avenue, the adjacent neighborhood, and school areas from 6:40 to 7:40 a.m. There was no landfill odors detected at Balboa Blvd and Woodley or in the adjacent neighborhood. Observed numerous junk cars parked on the roadway shoulder of Sierra Highway near the I-14 overpass. It appears that a car recycling business on Sierra Highway is using the shoulder for junk car storage. There was also illegal dumping of trash in this area. Met with Mike Lindsay (UltraSystems), Phillip Chen, and Christina Nguyen (LACDRP), and Dave Thompson (City LEA). We then proceeded to monitor the site and observed the following:

- There was an iron oxide seep observed on the Old City South slope when entering this new Administration access road. This seep could be an alluvial groundwater source.
- Along this new road above the Terminal Basin was a control panel labeled "Cap Well". The
 operating function of this control panel is to control the pumping of alluvial water from a
 cutoff wall for controlling alluvial water from leaving the site. It appears that the system is
 in auto start control mode with a set current low liquid level of 2.77 feet.
- It was observed that lighting for the permanent scales had no lighting shields on the light fixture. The CUP conditions require downward facing shields.
- The Adler Tank leachate and condensate treatment system was operating. There were two new tanks placed in temporary fashion. There were no odors detected coming from the tank farm. The hydrogen peroxide storage vessel had an emergency shutdown switch located near the vessel. There was no remote safety switch.
- Observed Cell CC-5A from the Deck A observation platform. Moving Floor and Tipper transfer trucks along with Packer trucks were placing waste in this area. The operations area was wider and longer since the last site visit. The area east of the active site had HDPE liner being installed next to the location of the western area for the Final Toe. All leachate and condensate is collected in the active fill area and piped to a eastern area where the collection was priorly handled in CC-3A. This liquid is then pump to the Toe Berm just north of the administration facilities. This Toe Berm will be used until the Final Toe Berm construction is finished, HDPE liner and equipment installed and operational.
- The active area near the top deck of the bowl area that was accepting fire soil and ash debris from the fire locations. This area is now final filled buy this type of waste.
- The upper slopes of the prior filled CC-4 Parts 3, 4, and 5 areas were graded, and straw wattles were placed for erosion control. This area was also hydroseeded above that area. Posi Shell was placed on the slopes above the active fill area and above the Closure Turf. The areas where there are leachate and condensate seeps are covered with soil. The Closure Turf liner was covered with waste. How the waste covered Closure Turf will allow continuity is not known.

9-25-25, Page 2 of 2

- The area connecting to the Old City South Landfill and the current active area had the
 leachate liquids connected to the recovery piping that transported the liquids to the
 current final Toe Berm and handling systems. The allowed water level has been increased
 from 11" WC to 28" WC before the current Toe Berm pump is turned on to transfer liquids
 to the tank treatment facility. The reason and engineering for this level increased is not
 known.
- The Terminal Basin floor had all of the sediment removed. A soil berm was holding seepage water so that the underground drainage channel concrete structure could be finished. The outlet risers were not cleared of all sediment and litter covering them. There were alluvial seeps between the walls and floor of the basin.
- The sediment removed from the Terminal Basin was approximately 12 feet high at the end
 of the rainy season.
- The eastern drainage channel downstream of Basin B where the soil was washed away has been repaired. There was debris at the bottom of the channel at the start of the channel. The vegetation growing out of the concrete was removed and concrete repaired. The hillside concrete wall near the repaired soil erosion channel's was cracking. The B basin was dry, and sediment was removed.
- Basin A had a minor amount of rainwater. All of the sediment was removed.
- The westside drainage channel out of Basin A had a minor amount of sediment.
- A minor amount of windblown litter was observed on the slopes of the Old City South landfill along the road to Flare 3.
- · Basin E was dry and had sediment.
- City sage mitigation decks B and C were observed. There was mustard weed growing in the sage mitigation and PM-10 Oak Tree areas. The dead PM-10 mitigation oak trees had not been replaced.
- County sage mitigation slopes were naturally doing well. There was no grading of the bare slopes or planting being done.
- The wastewater city sewer connection at the landfill entrance was observed. There were no odors detected, and no concerns observed.
- The County landfill area was graded and low point areas filled to eliminate future ponding.
 HDPE piping was moved and arranged to organize excess materials.

Flare Operating Conditions:

- o Flare 1 1631 °F, 2966 SCFM, 31% volume CH4
- o Flare 3 Not Operating
- o Flare 9 1650°F, 2630 SCFM
- Flare 10 Not Operating
- o Flare 11 1641°F, 3258 SCFM

The gas-to-energy plant was operating using 8710 SCFM of recovered gas, 38% volume of CH4. The total volume of recovered gas was 17.564 SCFM.

The total volume of recovered gas was 17,504 SOTT.
FURTHER REVIEW NEEDED
COMMENTS
Signed: // Kioluless

Monitor: Mike Lindsay	Page 1 of 2			
Discipline: Environmental Engineer	Date: 09-25-2025 Thursday			
Site Conditions: Clear, 62–80 °F, SE 3–6 mph, 81% RH, 40 AQI Good				
SITE LOG				

- 1. No landfill odors are present in the adjacent school or neighborhood along Canyon Ridge Lane at 7:35 am. Republic odor patrol is active. An AQMD vehicle is parked at the end of Constable Avenue.
- 2. The admin and LEA facility are in good order.
- 3. Checked in with Ron Daerr (Republic Services).
- 4. Met with Jim Aidukas (UltraSystems), Phillip Chen and Christina Nguyen (LACDRP), Alex Fitchmun (LACPW), and Dave Thompson (LEA), following in separate vehicles to site locations.
- 5. Observed the overall landfill operations from the observation deck. The nearby windsock is nearly vertical with light winds present. Four tippers are active in Cell CC-5A, with traffic controllers and a water truck present. ADC is 90% covered with new trash at 8:40 am. No haul trucks are queued on the main haul road. Water trucks are applying water to disposal area.
- 6. The closure turf is in good order, with no odors present.
- 7. Misters are operating along haul road to Cell CC-5A.
- 8. A drilling rig is constructing a gas collection well on Cell CC-2A north of the Posi-Shell area.
- 9. Cells CC-4 Part 4 and 5 are in good order, with liter fencing collecting windblown trash.
- 10. Cushion soil is being stockpiled at west end of Cell CC-4 Part 4.
- 11. The County top deck is in good order, with soil stockpiled at northwest corner.
- 12. County sage mitigation area is in good order.
- 13. Bird abatement is active including noise rockets.
- 14. Soil has spilled into the westside drainage channel directly south of Cell CC-5A.
- 15. The terminal basin has been cleared of sediment. Some water is present at riser drains.
- 16. Trash odors are present at northwest corner of terminal basin where decomposing trash is lodged into the concrete wall corner.
- 17. Construction of the westside drainage channel tie-in to the terminal basin is ongoing.
- 18. New Cell CC-3 construction continues southeast of Cell CC-5A. Drainage trenches are being constructed at floor center.
- 19. Sub-liner liquids are present at northwest floor/ wall intersection. No odors are present.
- 20. Street sweepers are cleaning the haul roads.
- 21. Sediment basin B has been cleared of sediment, except some soil piles at back of basin and at riser drains. A deer is walking across the basin floor.
- 22. New concrete cracks are present at the sediment basin B spillway.
- 23. The eastside drainage channel is in good order.
- 24. The secondary access road is in good order, with no ruts present.
- 25. The new air quality monitoring station at top of the secondary access road is in good order, with equipment operation waiting for power to be supplied.
- 26. The westside drainage channel is in good order, cleared of sediment for the rain season.
- 27. Flare 9 is operating at 2721 scfm, 1653 °F. Gas sample measured at 38 % Vol. CH4, 1.7 % Vol. O2, 48 ppm CO, and 38 ppm H2S. Blowers 1, 2, 4, 5 and 6 are operating.
- 28. Flare 10 is offline.
- 29. Blower number 3 is still uninstalled.

Page 2 of 2 09-25-2025

- 30. Flare 11 is operating at 3251 scfm, 1664 °F.
- 31. New blower motors are staged on the flare pad.
- 32. Sunshine Gas Producers facility is operating at 8654 scfm, with no odors present.
- 33. Perimeter drainage channel at flare pad is cleared of sediment.
- 34. Sediment basin A has been cleared of sediment, except for small piles of soil along perimeter. Some water is present at riser drains.
- 35. The basin A spillway has soil and vegetation that partially blocks the channel.
- 36. Flare 1 is operating at 2917 scfm, 1639 °F. Gas sample measured 31 % Vol. CH4, 1.0 % Vol. O2, 24 ppm CO, and 56 ppm H2S. Gas inlet temperature is 153 °F.
- 37. A new blower motor is staged at the flare 1 pad.
- 38. A fallen dead tree is present on the perimeter fencing of flare 1 north end.
- 39. City deck B sage mitigation area is in good order. Some mustard weed is present.
- 40. City deck C sage mitigation area is in good order. Some mustard weed is present.
- 41. The south perimeter PM-10 berm has many dead oak trees present.
- 42. Water trucks are applying water throughout site to control dust.
- 43. Observed methane surface concentration data on computer in LEA office.

FURTHER REVIEW NEEDED

- 1. Remove spilled soil in the westside drainage channel directly south of Cell CC-5A.
- 2. Remove odorous trash at northwest corner of terminal basin.
- 3. Repair cracked concrete at sediment basin B spillway.
- 4. Remove soil and vegetation on basin A spillway.
- 5. Remove fallen tree at flare 1 fencing.
- 6. Replace dead oak trees at PM-10 berm.

Signed: Michael W. Lindsay