Sunshine Canyon Landfill Independent Monitor Quarterly Site Monitoring Status Report July 1, 2024 – September 30, 2024

Prepared For:

City of Los Angeles Department of City Planning

And

County of Los Angeles Department of Regional Planning



Prepared By:



16431 Scientific Way Irvine, California 92618

Prepared On:

February 7, 2025

CERTIFICATION STATEMENT

February 7, 2025

The attached Quarterly Site Monitoring Status Report for the Sunshine Canyon Landfill dated February 7, 2025 is the Third Quarterly Report for 2024, issued by UltraSystems. This report covers the monitoring period from July 1, 2024, through September 30, 2024 and is prepared for the City of Los Angeles Department of City Planning and the County of Los Angeles Department of Regional Planning.

I, James T. Aidukas, Project Manager for the Mitigation Monitoring Services of the Sunshine Canyon Landfill, certify that the statements in the Quarterly Report and the referenced monthly reports reflect the site conditions observed, and compliance status noted by me and other qualified experts during the stated site visits.

Signed,

James T. Aidukas

Project Manager

Contents

Quarterly Status Report	1
Site Visits During the Quarter	
Definition of Terms	
Status Summary	2
Compliant	2
Non-Compliant	2
Further Review Needed	3
Conclusions	17

Sunshine Canyon Landfill City Mitigation Monitoring Summary (see spreadsheet)

Sunshine Canyon Landfill County Mitigation Monitoring Summary (see spreadsheet)

Appendices

Appendix I Further Review Needed Comments: Reference I-g through I-i

Appendix II Photo Location Map and Relevant Site Photos

Appendix III Quarterly Site Visits

Attendees by Date and Mitigation Monitoring Site Reports

Quarterly Status Report

This Quarterly Status Report is a compilation of the period's monthly Site Monitoring. After each site visit, the UltraSystems monitors who went to the Sunshine Canyon Landfill site each wrote a Mitigation Monitoring Site Report. The Mitigation Monitoring Summary spreadsheets for the City and County of Los Angeles note any conditions and/or mitigation measures that need further review and document these areas in an appendix for that site visit date. Any issues that required immediate attention were reported to Republic Services (Republic) staff and the appropriate staff at the City of Los Angeles Planning Department, the County of Los Angeles Department of Regional Planning, the County of Los Angeles Public Works and the Sunshine Canyon Landfill Local Enforcement Agency (SCL–LEA).

The Sunshine Canyon Landfill City and County Mitigation Monitoring Summary spreadsheets record by date each site visit and frequency of monitoring of specific conditions and/or mitigation measures. When a condition and/or mitigation measure is monitored, a check mark is made under the date that it was monitored, and the status of being compliant with the conditions and/or mitigation measures' requirements observed during monitoring is recorded. Tasks with a yearly or non-ongoing monitoring frequency are denoted by a forward slash (/) in subsequent date columns. In the status column, the letter "C" is put next to the task if it is Compliant; the letters "NC" are noted if the task status is Non-Compliant; and the letters "FRN" are used if Further Review is Needed for meeting the requirements of the conditions and/or mitigation measures.

Under the Further Review Needed/ Comment column, observed conditions that have been noted as "FRN" in the status column refer to appendices which detail what was observed during the site monitoring. When the conditions and/or mitigation measures that were previously noted as "FRN" are fully compliant, an "R" is placed in the Resolved column and a "C" replaces the "FRN" in the status column. Also noted in the FRN–Comments column are those action items that would improve monitoring efficiency by having reports and documents readily available. These are summarized in the Mitigation Monitoring Summary spreadsheets and the Summary of Requested Documents section of the Quarterly Reports.

This Quarterly Report provides the City of Los Angeles Department of Planning and the County of Los Angeles Department of Regional Planning with a concise status of the Mitigation Measure Monitoring for the period of July 1, 2024, to September 30, 2024. It includes:

- 1. The City and County Mitigation Monitoring Summary spreadsheets for July 1, 2024, to September 30, 2024. These spreadsheets record the areas of monitoring completed and the status of being compliant during the third quarter of 2024;
- 2. A Status Summary of Non-Compliant, Further Review Needed and Compliant with the requirements of the conditions and/or mitigation measures;
- 3. Photo Location Map and Relevant Site Photos showing site conditions of key areas of the landfill during this quarter; and
- 4. Site visit attendees by date of site visit and the mitigation monitoring site report from each monitor.

Site Visits During the Quarter

Three site visits were performed by UltraSystems during the July 1 to September 30, 2024 quarter to observe operational site activities and determine compliance status with conditions and/or mitigation measures. They were performed on July 3, 2024; August 19, 2024; and September 24, 2024.

Definition of Terms

<u>Compliant</u> is defined as complying with the City and County conditions and/or mitigation measures.

Non-compliant is defined as not complying with the City and County conditions and/or mitigation measures.

<u>Further Review Needed</u> is defined as implementing plans (agency-approved, if required) to fully comply with a condition and/or mitigation measure. Some plans, especially vegetation, require an extended time frame, and immediate compliance is not possible.

<u>Resolved</u> is defined as action taken or activities completed to fully comply with conditions and/or mitigation measures.

Status Summary

This section summarizes the conditions and/or mitigation measures that were monitored during the quarterly reporting period and their respective statuses. The Sunshine Canyon Landfill Mitigation Monitoring Summary spreadsheets for the City and County show the conditions and/or mitigation measures monitored during the quarter. Also included in this report are relevant photos in Appendix II.

Compliant

Most of the conditions and/or mitigation measures monitored were observed to be compliant. There are City and County conditions which are compliant but are noted as having corresponding comments that refer to the appendices. The Compliant with Comments section of the monitoring report provides a summary of activities being done onsite to construct or maintain facilities, and a summary of documents, reports and drawings that should be readily available onsite for monitoring reference.

Non-Compliant

During UltraSystems' site visits, no Non-Compliant conditions and/or mitigation measures were noted. Also, it must be understood that any monitoring related to landfill gas and odors is not part of the UltraSystems Monitoring Program at this time. These issues are currently being handled by a multi-agency team, which is led by the South Coast Air Quality Management District (SCAQMD).

Further Review Needed

The following conditions and/or mitigation measures were found not to be fully compliant but were being worked on to obtain full compliance. This section summarizes the progress being made toward being fully compliant. When a condition and/or mitigation measure progresses from "FRN" to fully compliant, it is noted as Resolved in this section, and on the City and County Mitigation Monitoring Summary spreadsheets.

Q-B.2.c (City)

Ancillary Uses and Facilities. The subject property may only be used for the following uses and facilities. These ancillary uses and facilities described in the July 1997 Draft Subsequent EIR, pages 2-38 through 2-43, and may be located on the applicant's property generally in conformance with the diagram attached as Exhibit e-4, and during the life of the landfill, may be moved or relocated following commencement of landfilling operations as necessary to accommodate development of the ultimate landfill footprint.

Geology-1.07 (County)

All grading activities shall be in compliance with specific requirements provided in a comprehensive geotechnical report for the proposed Project, including provisions for excavation approved by the County Department of Public Works, the County Local Enforcement Agency (LEA) and other Responsible Agencies.

Geology-1.11 (County)

Grading allows for ancillary facilities outside of the landfill footprint.

Biota-4.29 (County)

San Diego Horned Lizard: Impact on the San Diego horned lizard can be mitigated to a level of less than significant by restoring coastal sage scrub habitat. This will create a temporal loss of the species, but the population should recover following restoration of this habitat. Topsoils should be selected that are friable to suit lizard habitat requirements.

Biota-4.30 (County)

California Gnatcatcher: Surveys shall be conducted for California gnatcatchers prior to Game Permit onsite grading to determine the status of this Game species within development areas.

Biota-4.33 (County)

Migratory Bird Treaty Act: To prevent the loss of an active migratory bird nest, vegetation shall not be cleared during the breeding season (i.e. March 15 to August 1).

Biota-4.34 (County)

Raptor nests: If habitat removal is proposed during the raptor breeding season (i.e. March to July), a survey shall be conducted for active nesting areas.

Current Status/Comment – There was no grading outside of the approved landfill development limits during the 3rd Quarter. The road realignment work was not within the Sunshine Canyon waste fill limits but is in the CUP-approved areas for ancillary use. Grading up the canyon from the terminal basin was occurring to construct the final toe berm which has a completion date of late 2025 or early 2026. The City/County CUP condition 1.18 requires that all alluvium soil be removed prior to filling with compacted soils. Alluvium removal is to be verified by a qualified geologist. Rain events in the 1st and 2nd Quarters caused significant erosion and mudflows. This resulted in an accumulation of sediment and standing water in the 3rd Quarter in the Terminal Basin and Basin A, and sediment in

Basins B and E. The Terminal Basin had major erosion at the inlet pipes from the landfill and damage to the inlet concrete wall. No City-approved drawings were available for review. Cells CC-4 Part 3, 4 and 5 were accepting waste during the 3rd Quarter. Most of the erosion in this area from the rain events was repaired. The road around Basin E was being graded wider to have three truck lanes and was paved. The road was striped, had speed bumps installed, and K-rail placed at the edge of the roadway. The new temporary access road to CC-4 Part 3, 4 and 5 was completed and paved.

Q-C.3.h (City)

The access roads extended to new fill areas shall be surfaced with recycled asphalt, aggregate materials, or soft stabilization products to minimize the length of untreated dirt.

<u>Current Status/Comments</u> – In the 3rd Quarter, localized dust clouds occurred on dirt roads to and on the County top deck when soil importation trucks were delivering soil. These temporary roads did not have rock nor recycled concrete surfacing or soil stabilizer to control dust generation. Dust was not observed leaving the site from this location. On windy and dry days, dust clouds were observed coming from the cut slopes near the future toe berm location. These dust clouds could have left the site.

Q-C.5 (City)

Graffiti removal and deterrence on building and structures in public view.

<u>Current Status/Comments</u> – In the 3rd Quarter, there was no graffiti observed at the landfill site.

Q-C.10.c (City)

The operator shall submit, as part of its annual report, an evaluation of the feasibility of beneficial uses of the landfill gas collected at the site such as landfill-gas-to-energy.

Odor/Landfill Gas - 7.07 (County)

The permittee will recover and sell as much gas as is technically and economically feasible to reduce total air quality emissions from the landfill operations. It is expected that the technical and economic feasibility of commercial recovery and sale of landfill gas as a renewable energy resource will occur at levels below 40 MMCFD. The gas collection system will be installed in increments to allow for maximum gas recovery.

Gas - 52 (County)

To the extent technically and economically feasible, the Permittee shall use Landfill gas for energy generation at the Facility or other beneficial uses, rather than flaring, and shall obtain all applicable local, state, and/or federal approvals for any such use. Notwithstanding the forgoing, the Per be exempt from this Condition No. 52 if, as a 'part of its annual report required by Part X of the IMP, the Permittee determines that any such activity or project is infeasible, which determination shall be subject to the review and approval of the Director of Public Works.

The Permittee shall also install and maintain a landfill gas collection system complying with SCAQMD requirements, which uses best available control technology to control the lateral migration of gases to the satisfaction of the Director of Public Works, County LEA, and SCAQMD. In addition to the other requirements of this Condition No. 52, Landfill gas flares shall be installed below the adjacent interior ridges of the site, unless otherwise required by the SCAQMD, and the flames shall be totally contained within the stacks. Flame arrestors shall be provided to the satisfaction of the County Forester and Fire Warden.

<u>Current Status/Comments</u> – During the 3rd Quarter, power outages and gas recovery system maintenance caused a fluctuation in gas recovery volumes recorded the monitoring visits.

T-4 (City)

Prepare a plot plan ["fire plan"] to the satisfaction of the Fire Department.

a. immediate access fire plan [now]

b. plot plan for the future facilities will be submitted when these are implemented

Fire Service - 12.03 (County)

The permittee shall maintain onsite fire response capabilities, construct access road, provide water tanks, water mains, fire hydrants and fire flows and perform brush clearance to the satisfaction of the County Forester and Fire Warden. The landfill will comply with all applicable County codes and ordinances which delineated the requirements for fire access, water mains, fire flows and fire hydrants, specifically defined by the County Fire Department. New construction water tanks, water mains and fire hydrants will be completed to meet the fire flow requirements of the Fire Department.

<u>Current Status/Comments</u> – An updated fire plan showing the locations of all facilities, and normal and emergency ingress and egress using the new temporary access road should be prepared and sent to the local City fire department station and City and County planning departments. The toe berm construction location, and Gas to Energy areas should be shown on the plan. Emergency egress should be posted for employees and customers.

M-4.1.1(2) (City)

Areas outside of and above the cut and fill as shown on the conceptual grading plan shall not be graded, except for the development of ancillary facilities or other related improvements. Additional grading may be necessary for slope stability or drainage purposes. Prior to undertaking any grading activities, the Department of Building and Safety shall be notified and approve any additional grading based on engineering studies (in accordance with CCR Title 27) provided by the project proponent and independently evaluated by the Department of Building and Safety.

M-4.1.1(4) (City)

Grading that allows for construction of ancillary facilities outside of the landfill footprint or that has the potential to impact property beyond the boundary of the landfill shall be approved by the Department of Building and Safety.

M-4.1.1(5) (City)

All grading activities shall be in compliance with specific requirements provided in a comprehensive geotechnical report prepared specifically for the proposed project, including provisions for excavation approved by the Department of Building and Safety, City Engineer, City LEA and other Responsible Agencies.

M-4.1.5(12) (City)

Geologic Hazards - Liquefaction

Alluvium in the canyon bottoms beneath the footprint of the waste containment system and beneath ancillary structures shall be excavated and, if necessary, replaced with compacted structural fill during construction. A qualified geologist shall be onsite during construction activities to observe removal and replacement of alluvium and verify that all alluvium within the landfill footprint has been removed prior to placement of any compacted fill or construction of any containment system elements.

M-4.14.1(155) (City)

Construction of the realigned access roadway shall not exceed 15 percent in grade. An access road shall be constructed and maintained around the working area of the landfill for emergency access for firefighting equipment.

Geology-1.07 (County)

All grading activities shall be in compliance with specific requirements provided in a comprehensive geotechnical report prepared specifically for the proposed Project, including provisions for excavation approved by the County Department of Public Works, the County Local Enforcement Agency (LEA) and other Responsible Agencies.

<u>Current Status/Comments</u> – There was no grading outside of the approved landfill development limits during the 3rd Quarter. Grading for the new main access road realignment in the small valley south of the current main access road was completed with road striping, speed bumps, and safety Krails. The access road and slopes around Basin E appeared to have uncontrolled rainwater impacts. Republic's final drainage design plans should include review of the current drainage impacts. The construction plans and supporting geotechnical reports were reviewed and approved by City Planning and the City Building Department. The City Building Department also approved brush and tree clearance and hillside grading. The technical reports and detailed plans were not available for review by the monitor. Compliance with County Geology – 1.07 documentation was not able to be verified by the monitor.

Access roads were being maintained around the working area for emergency access. The final perimeter access road construction on the westside was completed. Wet weather surfacing or paving was not done.

M-4.1.4(11) (City)

An operations checklist shall be used by a registered engineering geologist for surveys following all earthquake events measuring 5.0 on the Richter Scale or greater near the project site. A comparison of operating parameters and site conditions before and after major earthquake events shall be made to verify that systems are operational as designed. Final designs for major engineered structures shall be based on the results of the detailed stability analyses of potential seismic events.

Geology-1.16 (County)

An operations checklist will be used by a certified engineering geologist, registered civil engineer, or licensed surveyor for surveys following all earthquake events of 5.0 magnitude or greater.

<u>Current Status/Comments</u> – There were no earthquakes of 5.0 magnitude or greater in the area during the 3rd Quarter.

M-4.1.1(6) (City)

Revegetation and erosion control procedures on all exposed slopes shall be implemented. The erosion controls to be implemented at the site shall include soil stabilization measures and revegetation in accordance with the approved revegetation plan as approved by the City Building and Safety Department. Interceptor ditches shall be designed to divert storm runoff to a sedimentation basin.

M-4.2.11(23) (City)

Disturbed areas shall be revegetated with an interim ground cover as specified in the proposed revegetation program. Excavation will proceed in a manner to reduce the number of graded areas at any given time.

M-4.2.12 (28) (City)

Site Erosion

- c. A temporary vegetation cover shall be established on all slopes that are to remain inactive for a period longer than 180 days.
- d. An SCAQMD approved soil stabilization (sealant) product shall be used to retard soil erosion and enhance revegetation. Soil sealant shall be applied when necessary to selected working areas of the landfill. The sealant will also be used as a binder or tackifier to hold seen during revegetation mulch, and fertilizers in-place until grasses become establish and stabilize on the landfill surface.

Geology-1.13 (County)

Revegetation and erosion control of all exposed slopes will be an ongoing process. The erosion controls to be implemented at the site will include soil stabilization measures and revegetation in accordance with the approved Revegetation Program. The installation of interceptor ditches shall be designed for the diversion of storm runoff to sedimentation basins. Sediment traps will be used at points of runoff concentration along the perimeter of exposed slopes surfaces.

Condition: Approval of drainage plan. Retention of a consulting horticulturalist/Registered Professional Forester and an independent qualified biologist by the permittee for ongoing supervision of revegetation programs. Review and monitoring of planting programs by County Forester.

Geology-1.14 (County)

To prevent soil erosion on the face of the landfill, interim vegetation measures will be taken after placement of the temporary soil layer (even though the area may be disturbed by future filling operations). Vegetative cover will be placed as in the approved Revegetation Program.

Condition: Retention of a consulting horticulturalist/Registered Professional Forester and an independent qualified biologist by the permittee for ongoing supervision of revegetation programs. Review and monitoring of planting programs by County Forester.

Biota - 4.42 (County)

Areas inactive for 180 days or longer will be planted with interim vegetation as approved by County biologist. Records will be kept to track fill areas of the site which are transferred to an inactive status so that appropriate dust control and revegetation measures can be implemented.

Air Quality - 6.02 (County)

Dust Control will also be accomplished through the temporary revegetation of the landfill surface. A temporary revegetation of the landfill surface, and a temporary vegetation cover will be established on all slopes that are to remain inactive for a period longer than 180 days. Specifications of temporary revegetation measures will be provided in the Revegetation Plan submitted to the County biologist for approval, the Closure and Postclosure Maintenance Plans, the Condition Use Permit, and Conditions of Project Approval.

Visual-10.08 (County)

Cover/Revegetation Requirements

The permittee shall comply with the following cover and re-vegetation requirements at the Landfill:

(1). The permittee shall apply a temporary hydroseed vegetation cover on any slope or other Landfill area that is projected to be inactive for a period greater than 180 days, as set forth in the IMP. The

permittee shall promptly notify the County LEA and the Department of Public Works of any such slope or area;

Revegetation Requirements

- (5) Notwithstanding the foregoing, the permittee shall not be bound by the previous provisions of this Condition No. 44, but instead by the requirements of the County LEA, so long as the Limits of Fill are not exceeded, if in consultation with the Department of Public Works, the County LEA determines that a different re-vegetation design or plan:
- (1) would better protect public health and safety;
- (2) would enable revegetation of the final slopes at least as well as shown in Exhibit "B" described in subsection D, above; and/or experts, including an independent, qualified bio (3) would be required because the minimum standards adopted by the CIWMB have been amended;
- (6) the permittee shall employ an expert or biologist, to satisfy this Condition No. 44. Soil sampling and laboratory analysis shall be conducted in all areas that are required to be re-vegetated before any revegetation occurs to identify chemical or physical soil properties that may adversely affect plant growth or establishment. Soil amendments and fertilizer recommendations shall be applied and plant materials selected, based on the above referenced testing procedures and results. To the extent possible, plant types shall blend with species indigenous to the area, be drought tolerant, and be capable of rapid growth. The selected plants shall not include nonindigenous species that are likely to be invasive of adjacent natural areas.

Biota - Revegetation - 44.A (County)

A. The Permittee shall apply a temporary hydroseed vegetation cover on any slope or other Landfill area that is projected to be inactive for a period greater than 180 days, as set forth in the IMP. The Permittee shall promptly notify the SCL-LEA and the Department of Public Works of any such slope or area.

Revegetation - 44.F/44.F CUP (County)

F. The Permittee shall employ an expert or experts, including an independent, qualified biologist, to satisfy this Condition No. 44. Soil sampling and laboratory analysis shall be conducted in all areas that are required to be re-vegetated before any re-vegetation occurs to identify chemical or physical soil properties that may adversely affect plant growth or establishment. Soil amendments and fertilizer recommendations shall be applied and plant materials selected, based on the above-referenced testing procedures and results. To the extent possible, plant types shall blend with species indigenous to the area, be drought tolerant, and be capable of rapid growth. The selected plants shall not include non-indigenous species that are likely to be invasive of adjacent natural areas.

<u>Current Status/Comments</u> – During the 3rd Quarter, Closure Turf was being maintained, and gas and liquids recovery systems under the turf were performing well. This cover material was in lieu of vegetation on the south-facing slopes and controlled and eliminated dust and erosion while also recovering landfill gas and leachate. There was a significant erosion rill at the interface of Cell CC-2A cover soil and the western edge of the Closure Turf. Portions of the western Turf have been removed for the installation of the new liner system and the tie-in to the existing liner. There were old waste odors, gas emissions and odorous liquids that had to be handled until the new liner system was completed and operational.

M-4.1.1 (7) (City)

Prior to the initiation of grading activities, the project proponent shall undertake, if necessary, reabandonment procedures as required by the California Department of Conservation, Division of Oil, Gas, and Geothermal Resources.

<u>Current Status/Comments</u> – The old, abandoned oil well casing adjacent to the north secondary access road from the Flare 11 site was not reabandoned. An evaluation of the need to reabandon this well should be done. This well was not leaking oil or gas and did not pose a current hazard. It is well beyond the approved landfill limits but inside the ridgeline of Sunshine Canyon. An unabandoned well could be a future problem.

M-4.1.6 / 18 (City)

Survey monuments shall be installed around the perimeters of the outer fill areas at points where they would not be subject to disturbance by landfill development and marking the 500-foot setback from the more restrictive zone. The exact spacing, location, and characteristics of the survey monuments shall be submitted to and approved by the City Local Enforcement Agency (LEA).

<u>Current Status/Comments</u> – A significant number of the landfill perimeter boundary survey PVC marker pipes have been removed in areas where Edison pole grading took place, near the Flare 11 site pad grading and near the CC-4 Part 3 buttress. All PVC boundary markers need to be verified and replaced if missing. New markers should also be placed at the final south double-lined boundary.

M-4.2.13/29, 30, 32, 33, 34 (City)

The natural biological processes that generate odors in a landfill through anaerobic decomposition cannot be prevented or avoided. However, the LFGs shall be prevented from escaping to the atmosphere through the use of control measures. These measures include using daily and intermediate cover material over deposited wastes, filling any surface cracks with clean dirt as necessary, and extracting LFG through the use of an LFG collection and recovery system and destroying collected gases by combustion.

Operational techniques shall be utilized to control odor sources at the landfill. The size of the working face shall be limited so that the area of waste exposed to the atmosphere is kept to a minimum.

The LFG collection and recovery system shall be installed in phases as each portion of the landfill site is filled. The final system shall contain a network of gas extraction wells, collection system piping, and flaring facilities. Because the LFG generation begins at lower levels of volume and increases during the landfill site life, the gas will be flared initially until sufficient quantities are available for processing into electricity.

If an odor problem should develop, appropriate control measures shall be implemented. These measures include the application of additional dirt daily cover material or more frequent application of the cover material to seal the landfill surface, or adjustments to the wells, equipment, and operation of the LFG collection and recovery system.

To ensure that odors are kept to a minimum, the following odor/LFG monitoring program shall be implemented for the proposed landfill project. The monitoring program shall comply with the requirements of SCAQMD Rule 1150.1 and include:

- a. Sample Probe Installation: One monitoring probe per 1,000 feet or as identified by South Coast Air Quality Management District (SCAQMD) and/or Local Enforcement Agency (LEA) in the landfill expansion, and one probe per 650 feet or as identified by SCAQMD and/or LEA in the City Inactive landfill along the landfill perimeter, or whichever is more restrictive shall be installed to identify potential areas of subsurface landfill gas (LFG) migration. These probes shall be monitored to ensure that quantities of LFG beyond regulatory standards do not vent offsite through subsurface soils.
- b. Integrated Landfill Surface Sampling: The landfill surface shall be monitored to ensure that the average concentration of total organic compounds over the landfill surface does not exceed SCAQMD's standard of 25 ppm.
- c. Ambient Air Samples: 24-hour integrated gas samples and required meteorological data shall be taken to assess any impact the landfill is having on the ambient air quality at the landfill perimeter.

- d. Instantaneous Landfill Surface Monitoring: Spot checks on the landfill surface shall be made to determine the maximum concentration of total organic compounds measured as methane, measured at any one point on the surface of the landfill does not exceed the SCAQMD's standard of 500 ppm.
- e. Regular Monitoring and Annual Testing: LFG concentrations at perimeter probes, gas collection system headers, the landfill surface, and in ambient air downwind of the landfill shall be monitored once per month or less frequently (but no less than quarterly) as required by the SCAQMD. The LFG collection system shall be adjusted and improved based on quarterly monitoring data and annual stack testing results.

Odor/Landfill Gas - 7.06 (County)

If an odor problem should develop, appropriate control measures shall be implemented. These measures include the application of daily cover material or more frequent applicant of the cover material to seal the landfill surface, or adjustments to the wells, equipment, and operation of the LFG collection and recover system.

Amendment 45.N - 4.a, 4.c, 4.d (County)

Identify and provide status on the measures currently being implemented as required by the AQMD's Order for Abatement.

An odor patrol program, which would include the following at a minimum:

- Provide a trained technician to conduct odor patrols in the surrounding neighborhoods at a frequency of one patrol per hour from 6 a.m. to 10 a.m., Monday through Saturday, and during adverse wind conditions.
- If odor is detected, identify its potential and/or actual source, including those that may not be related to the Landfill's operation, such as an odorous trash dumpster or transfer trucks.
- If odor is determined to be related to the Landfill's operation, take immediate action to reduce the odor. Document the streets patrolled on a map, time of the patrol, potential source of odor, and immediate actions taken by the Landfill.
- A landfill gas mitigation plan in preparation for the next rainy season since landfill gas emissions from either the landfill surface or landfill gas control equipment is cited as a potential contributor in the AQMD's Order for Abatement. The plan should include the following at a minimum:
- Description of the site's current Gas Monitoring and Control Plan, including a map showing locations of gas monitoring probes, gas extraction wells, horizontal and vertical gas collection lines, etc.
- Compliance history of the site's landfill gas migration control program from January 1, 2009, to the present quarter as well as any corrective actions.
- Discuss the impacts of the most recent heavy rains on the landfill gas collection system, including identifying locations of damage due to soil erosion, as well as any corrective actions or mitigation measures.
- A work plan that includes preventive measures, such as identifying and filling any surface cracks and installing additional extraction wells, as well as contingency measures.
- An implementation schedule for the above work plan.

Amendment 45.N - 5 (County)

Include in the Quarterly Dust and Odor Reports, which are required by CUP Condition No. 45.N, the status and effectiveness of mitigation measures 1 through 3 above, and the Odor Mitigation Plan.

<u>Current Status/Comments</u> – Compliance with these mitigation measures, concerning landfill gas monitoring and odor control and detection, is being monitored by a multi-agency team led by the SCAQMD. Only obvious gas emission sources, odorous operations related to gas and/or gas and landfill liquids, lack of cover, or exposed trash resulting in odors detected during the monitoring visits are reported in the monitors' site report.

On our random days of site visits during the 3rd Quarter, there were no landfill odors detected in the adjacent neighborhoods.

The use of Closure Turf to seal inactive filled areas and function as intermediate cover also provided enhanced gas and liquids recovery and gas-related odor control. There were no gas or liquids odors detected coming from operational Closure Turf areas.

M-4.3.1(37) (City)

As development of the site proceeds, surface drainage systems shall be maintained so that surface runoff is diverted away from working slopes and isolated from landfilled refuse. Onsite drainage channels would be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, §2533(C), and County of Los Angeles Public Works Department, Flood Control Division requirements.

Surface Water - 2.03 (County)

As development of the site proceeds, surface drainage systems shall be maintained so that surface runoff is diverted away from working slopes and isolated from landfilled refuse. Onsite drainage channels would be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, §2546(C), which mandates the requirements for a capital storm event (100-year 24-hour precipitation).

M-4.3.1(38) (City)

Permanent bench drainage ditches shall be installed when final cover is placed on completed portions of the landfill. These ditches shall be lined. Temporary unlined drainage facilities consisting of diversion ditches (V-ditches) where necessary shall directly intercept natural surface runoff. Any intermittent channel flow in the existing canyon bottom shall be captured, channeled, and conveyed into a sedimentation basin. Diversion ditches shall convey surface runoff from the undisturbed areas to the permanent perimeter ditches for safe transport around the landfill footprint. Surface covers of various types, from mulches to vegetation, shall be used to retard erosion from areas of disturbance. In addition, areas of disturbance shall be kept at a minimum during active filling operations.

Surface Water - 2.12 (County)

Permanent bench drainage ditches shall be installed when final cover is placed on completed portions of the landfill. These ditches shall be lined. Temporary unlined drainage facilities consisting of diversion ditches (V-ditches) where necessary shall directly intercept natural surface runoff. Any intermittent channel flow in the existing canyon bottom shall be captured, channeled, and conveyed into a sedimentation basin. Diversion ditches shall convey surface runoff from the undisturbed areas to the permanent perimeter ditches for safe transport around the landfill footprint. Surface covers of various types, from mulches to vegetation, shall be used to retard erosion from areas of disturbance. In addition, areas of disturbance shall be kept at a minimum during active filling operations.

<u>Current Status/Comments</u> – It is assumed by UltraSystems that the permanent drainage V-ditches and channels are designed in accordance with the referenced regulations. The design drawings and engineering reports should be available for review and use.

Surface drainage systems were in-place to intercept or divert rainwater away from prior landfill cells and current filling operations. Most of these were temporary systems in active areas, and most conveyance V-ditches were unlined. The construction of the final toe berm and main access road realignment project is ongoing. This is a two-year project and includes a new basin, modification of the terminal basin, and the construction of new drainage channels, and possibly a new upstream basin from the terminal basin. The road realignment will entail the construction of a new main access

road, a 350,000-cubic-foot sedimentation basin, drainage improvements in the ravine south of the current entrance, and modifications to the terminal basin's size and inlet sources. The design plans, design details and engineering calculations were submitted to the City for permit approval. The design plans and engineering reports were not available for review by the monitor nor submitted to the LACPW for approval. Compliance with Surface Water – 2.03 could not be verified. An engineering evaluation of the total site's surface drainage system should be done, which reflects the current system's modifications. Onsite drainage channels should be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, Section 2533(C), and County of Los Angeles Public Works department, Flood Control requirements.

The rainwater control system for the new access road and slope around Basin E had uncontrolled rainwater impacts. Republic's final design and construction plans for the drainage system for this adjacent canyon development were not made available to be monitored. The Basin E water discharge pipe into the Terminal Basin was plugged with sediment in the 3rd Quarter. Drainage improvements, engineering calculations and plans for the whole landfill site were also not available to the monitor. Republic's engineering consultant should have drainage plans and engineering support calculations available for agencies' approval and monitors' review.

M-4.3.1(39) (City)

As filling operations progress upward in elevation and laterally across the canyon, both permanent and temporary drainage facilities shall be used to provide appropriate drainage protection. The lower elevation portions of the landfill working face shall be placed under final cover as soon as final grade is attained, and bench ditches shall be installed that will connect to adjacent, permanent perimeter ditches. These ditches shall connect directly to the temporary diversion drainage ditches that will protect the active landfill areas from natural surface runoff.

M-4.18 / 178 (City)

The maximum permitted elevations for the landfill shall not be allowed to be exceeded at any time during landfill development and shall be verified through survey control points.

<u>Current Status/Comments</u> – A site map showing areas that are at the final elevations, and which should have final cover should be available for review. A map showing other filled elevations should also be available onsite for review. The amount of stockpiled soil should also be indicated in recorded elevations.

M-4.3.1(40) (City)

In order to monitor the effectiveness of those measures designed to prevent pollution from entering the offsite stormwater system, the project proponent shall be required to apply for coverage under the SWRCB General Construction Activities Stormwater Permit Programs.

M-4.3.1(45) (City)

An erosion control plan would be implemented by the project proponent to prevent stormwater pollution from construction activity. Construction materials, equipment and vehicles would be stored or parked in areas protected from stormwater runoff. Construction material loading and unloading would be in designated areas to minimize any washout due to stormwater runoff. Pre-construction controls would be implemented to include the use of a sandbagging system, including sandbag check dams and sandbag desilting basins, which would be used to limit runoff velocities and minimize sediment in stormwater runoff.

Surface Water 2.14 (County)

An erosion control plan would be implemented by the project proponent to prevent stormwater pollution from construction activity. Construction materials, equipment and vehicles would be stored or parked in areas protected from stormwater runoff. Construction material loading and unloading would be in designated areas to minimize any washout due to stormwater runoff. Pre-construction controls would be implemented to include the use of a sandbagging system, including sandbag check dams and sandbag desilting basins, which would be used to limit runoff velocities and minimize sediment in stormwater runoff.

Current Status/Comments – Surface drainage systems were in-place to intercept or divert rainwater away from prior landfill cells and current filling operations. Most of these were temporary systems in active areas, and most conveyance V-ditches were unlined. The construction of the final toe berm and main access road realignment project is ongoing. This is a two-year project and includes a new basin, modification of the terminal basin, and the construction of new drainage channels, and possibly a new upstream basin from the terminal basin. The road realignment will entail the construction of a new main access road, a 350,000-cubic-foot sedimentation basin, drainage improvements in the ravine south of the current entrance, and modifications to the terminal basin's size and inlet sources. The design plans, design details and engineering calculations were submitted to the City for permit approval. The design plans and engineering reports were not available for review by the monitor nor submitted to the LACPW for approval. Compliance with Surface Water – 2.03 could not be verified. An engineering evaluation of the total site's surface drainage system should be done, which reflects the current system's modifications. Onsite drainage channels should be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, Section 2533(C), and County of Los Angeles Public Works department, Flood Control requirements.

M-4.3.1(41) (City)

The surface water collection system shall be designed to collect runoff and collect/retain suspended solids. Water leaving the sedimentation basins shall be monitored in accordance with NPDES requirements.

M-4.3.1(43) (City)

Sediment shall be cleaned out of the sedimentation basins after every significant storm.

Surface Water 2.10 (County)

The surface water collection system shall be designed to collect runoff and collect/retain suspended solids. Water leaving the sedimentation bans shall be monitored in accordance with NPDES requirements. Sediment shall be cleaned out of the sedimentation basins after every significant storm.

<u>Current Status/Comments</u> – In the 3rd Quarter, all the basins or channels were fully cleared of sediment. Standing water was observed in the Terminal Basin. Major modifications were made to the Terminal Basin and its inlet channels. No hydrology reports were available to the monitor or the County that would show future rainwater control improvements and capacities. The damaged terminal basin outlet riser was repaired. The inlet piping and western wall of the basin were damaged by high rainwater flows in the 1st Quarter. This damage was repaired. Sediment, small rocks and debris were still being discharged into the outlet channel to the County flood control system.

M-4.3.1(46) (City)

A preventive maintenance program would be implemented by the project proponent, including inspection of facility equipment, systems, and stormwater management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater. This program

applies to the onsite drainage ditches; rip-rap; berms and dikes; dust control; silt fences; diversion grading; and pavement surfaces. Each system and piece of stationary equipment would be inspected monthly. Procedures for inspection would vary, due to the piece of equipment or system. However, the major elements of the inspection program would include checking for cracks or structural failures, inspecting parts or pieces of equipment nonfunctioning, checking for the degradation or deterioration of operating units, and investigating the need for cleaning or emptying units. A summary report of these monitoring results and the corrective actions taken will be disseminated in each newsletter with a more detailed report on the website and in the annual report.

Surface Water 2.15 (County)

Surface Water Preventive Maintenance Program

A preventive maintenance program will be implemented by the permittee, including inspection of facility equipment, systems, and stormwater management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater. This program applies to the onsite drainage ditches, rip-rap, berms and dikes, dust control, silt fences, diversion grading, and pavement surfaces. Each system and piece of equipment will be inspected monthly.

Procedures for inspection would vary based on the piece of equipment or system. However, the major elements of the inspection program will include checking for cracks or structural failures, inspecting parts or pieces of equipment nonfunctioning, checking for the degradation or deterioration of operating units, and investigating the need for cleaning or emptying units.

<u>Current Status/Comments</u> – A preventative maintenance program with inspection of facility equipment, systems and storm water management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater should be performed monthly, with a summary report issued on a quarterly basis. These reports were not reviewed in the 3rd Quarter.

In the 3rd Quarter, it was observed that vegetation was growing out of numerous cracks in the water retention basins and drainage conveyance channels' concrete. There were areas of the channels and basins that needed the growing vegetation to be removed, and repair of the concrete and sealing of cracks. These clean-up and maintenance tasks are put on Republic's monthly preventative maintenance program work list. The concrete drainage channel's wall south of Basin B has the soil supporting the wall being washed away by rain. The concrete wall is compromised by not stopping water from flowing into the back of the wall. Areas of the wall are cracked and are moving. There was no progress in performing this maintenance.

M-4.3.2(50) (City)

The LCRS shall be installed at the base and side slopes of the landfill. This system shall be designed and installed to collect generated leachate for disposal consistent with LARWQCB requirements. The collection system shall consist of a filter rock blanket embedded with a system of collection pipes or a blanket embedded with a system of collection pipes or geosynthetic alternative that collects and transports the fluid to a holding tank. In accordance with RCRA, Subtitle D, 40 CFR, Part 258, the collection systems shall be designed to limit the hydraulic head on the liner to less than 12 inches. Collection pipes shall be sized and spaced to reduce the hydraulic head in the leachate collection system as specified in WDRs. Leachate shall be recovered and treated onsite. The treated leachate shall be sampled prior to discharge from the holding tank in accordance with the WDRs to determine suitability for reuse onsite per LAWRQCB requirements. Summary results of this sampling shall be disseminated in the newsletter with more detailed reporting on the website and in the Annual Report.

<u>Current Status/Comment</u> – The old City North top deck has a tank farm of 16 Adler storage tanks for processing recovered leachate and condensate, with a double-wall pipeline to the sewer connection at the entrance near San Fernando Road. This system operated with no odors detected at the tank farm nor the sewer connection during the 3rd Quarter. Tank farm liquids were being treated with 30% hydrogen peroxide at the tank farm prior to the connection of the City sewer connection. A remote shut-off system to close the hydrogen peroxide holding vessel's outlet valve was not installed.

M-4.4.1(60) (City)

Venturan Coastal Sage Scrub

A detailed conceptual mitigation plan shall be prepared by the project proponent and contain specific information on planting, maintenance, and monitoring. A revegetation plan that includes Coastal sage scrub restoration can feasibly occur onsite. The implementation of this plan will provide onsite mitigation greater than 1:1 to offset the loss of coastal sage scrub.

Biota - 4.27 (County)

Venturan Coastal Sage Scrub: A detailed conceptual mitigation plan shall be prepared by the permittee and shall contain specific information on planting, maintenance, and monitoring. A revegetation plan that includes coastal sage scrub restoration can feasibly occur onsite. The implementation of this plan will provide onsite mitigation greater than 1:1 to offset the loss of coastal sage scrub.

<u>Current Status/Comments</u> – During the 3rd Quarter, City sage mitigation area decks B and C were being maintained by the removal of non-native vegetation. Native vegetation was doing well. Bare spots are being filled-in from seeds and spreading of prior planted native plants. The condition of the PM-10 oak trees was still being evaluated by Republic's consulting biologists. Their yearly mitigation tree status report was being prepared. There was a substantial amount of dead PM-10 trees observed by the monitor. No schedule for tree replacement has been issued. There was no activity on the County sage mitigation area. Native plants were doing well in the County sage area, repopulating in the areas where they naturally came back. No mitigation revegetation planting activity was done for this area in the 3rd Quarter. Areas of City decks B and C were being graded for the new temporary waste hauling access road. There appears to be minimal impacts to the sage mitigation areas.

M-4.4.3/72 (City)

Native tree species shall be replaced at a 2:1 (replacement: removal) ratio, consisting of 15-gallon or 5:1 3-gallon container trees. Mitigation trees shall be planted prior to impacted trees being removed, thus allowing trees to grow to specimen size in the field. A specimen-size tree shall be defined as a 15-gallon tree with a minimum trunk caliper of 1-inch measured 1-foot above ground. All mitigation trees shall be specimen size within 1 year after tree removal.

Biota - 4.10 (County)

The permittee shall comply with all terms and Conditions of Oak Tree Permit No. 86-312-(5). The permittee is authorized to remove oak trees within the project areas as necessary to conduct landfill operations authorized by this grant and subject to the requirements of Part VII of the Implementation and Monitoring Program attached to Oak Tree Permit 86-312-(5). Prior to approving any excavation of more than five acres containing significant stands of oak and/or Douglas fir trees, the Director of Public Works shall confer with the Los Angeles County Forester and Fire Warden.

<u>Current Status/Comments</u> – In the 3rd Quarter, Republic's biologist consultant had not yet issued an updated mitigation tree report. The number and type of trees that will need to be replaced and schedule of planting will be addressed in this report.

M-4.4.2/69 (City)

Potential candidate mitigation sites have been identified by the project proponent in conjunction with resource agencies for consideration to compensate for impacts on riparian and wetland resources as a result of project development. These sites include Bull Creek, Bee Canyon and East Canyon, which are located proximate to the project site. Prior to the development of any detailed mitigation plans and drawings, the final selection will be determined cooperatively by the CDFW, Corps, SWRCB, and other regulatory agencies in conjunction with the City and project proponent.

<u>Current Status/Comments</u> – The status of providing offsite wetland and riparian mitigation has not changed in the 3rd Quarter. The City was proceeding with writing and adopting an ordinance to allow the wetlands and riparian mitigation to be created in the Chatsworth Reservoir. All environmental analysis has been completed. Republic stated that there has been no progress in finalizing and adopting the ordinance. The delay in the issuance of the City ordinance is delaying any progress in creating the required wetlands and riparian mitigation. Time extension letters from the US Corps of Engineers and the California Department of Fish and Wildlife were in-place for 2019. New extension letters have not obtained since then. The feasibility of the Chatsworth Dam mitigation site needs to be evaluated as still being a potential mitigation site.

M-4.9.3(110) (City)

Landfill employees shall watch for any illegal dumping activities on or around the project site. The landfill litter control crew shall provide cleanup services for areas within one mile of the project site. The phone number where this service will be requested will be provided in the quarterly newsletter and on the website.

<u>Current Status/Comments</u> – In the 3rd Quarter, there was no litter or illegal dumping observed in the adjacent neighborhood. There was illegal dumping on the shoulder of Sierra Highway near the I-14 overpass. Illegal dumping was also seen on San Fernando Road.

M-4.9.4(125) (City)

The landfill operator shall maintain perimeter fencing in and around the site in accordance with CCR, Title 14, § 17658 to discourage illegal entry to the landfill. Where existing topography conditions create an effective barrier, no perimeter fencing shall be installed. Entrance and access gates shall remain locked when the landfill facility is not in operation. All existing perimeter fencing shall be inspected on a routine basis by the landfill operator, and necessary repairs shall be made to ensure a continued deterrent for unauthorized entry to the project site. Additionally, the landfill operator shall maintain posted "no trespassing" signage at the exterior perimeter fencing nearest the project site entrance.

<u>Current Status/Comments</u> – During the 3rd Quarter, the north perimeter gate was observed to be not locked.

M-4.19.2(191) (City)

Prior to the commencement of initial earth excavation, specific sections of the City/County Landfill Project area shall be resurveyed as a precautionary measure to minimize potential loss of undiscovered paleontological resources. Specific sections of the project area to be resurveyed shall be as determined by the intended cut-and-fill areas proposed for landfill development. As new areas for excavation are

identified by the project proponent, an evaluation of those areas shall be made based on the prior survey results and consultation with appropriate technical specialists.

Ecological Significance 62 (County)

The Permittee shall develop and implement a program to identify and conserve all significant archaeological and paleontological materials found onsite pursuant to Part VII of the IMP. If the Permittee finds any evidence of aboriginal habitation or fossils during earthmoving activities, Landfill operations shall immediately cease in that immediate area, and the evidence and area shall be preserved until a qualified archaeologist or paleontologist, as appropriate, makes a determination as to the significance of the evidence. If the determination indicates that the archaeological or paleontological resources are significant, the resources shall be recovered to the extent practicable prior to resuming Landfill operations in that immediate area of the Landfill.

<u>Current Status/Comments</u> – During the 3rd Quarter, grading was performed in native undisturbed areas that required archeological and paleontological monitoring. Reports were not available for review.

Alternative Fuel Vehicles 77.A-H (County)

As part of its annual report to the TAC required by the IMP, the Permittee shall submit an ongoing evaluation of its compliance with each component of this Condition No. 77. The Permittee may appeal the requirements of this Condition No. 77 to the Director of the Department in accordance with the procedure described in Condition No. 11 for the appeal of a notice of Violation, but only on the bases of whether a particular alternative fuel is technologically or economically feasible.

<u>Current Status/Comments</u> – An annual report showing Compliance with each component of Condition 77 should be prepared and submitted to the TAC.

Conclusions

In this reporting period, UltraSystems has monitored the conditions and/or mitigation measures for the City and County, as shown on the Mitigation Monitoring Summary spreadsheets.

As shown by the Non-Compliant and Further Review Needed sections above, the landfill is actively working toward being fully compliant with conditions and/or mitigation measures. Only three noncompliant conditions were observed, M-4.1.6(18) survey monuments and M-4.3.1(46) preventive maintenance and M-4.4.2(69) offsite wetlands and riparian mitigation. Furthermore, monitoring of the tasks on these Mitigation Monitoring Summary spreadsheets track progress toward being fully compliant. Notwithstanding the above, air quality compliance status is not being actively monitored by UltraSystems. Review of design plans, specifications, engineering support documents, and Cityapproved plans were not provided for the monitor to verify compliance with all City and County CUP conditions. The CUP conditions have special and unique construction requirements that the landfill site location requires. Access to engineering data and plans being implemented, and Hydrologist and Geologist construction reports are necessary to verify compliance with City and County CUP conditions and important construction activity.

The 2024 3rd Quarter Mitigation Monitoring Summary spreadsheets track the progress and completion of tasks as they were accomplished during this quarterly period.

								Se	CO	nd Q	uarter	202	24							1	Γhir	d Qu	arter 2	2024	4			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
1	Project Manager																											
2																												
3																												
4	Q - A.3.		Definitions	info	/				/				/				/				/				/			
5	Q - A.6.		Submit Annual Reports	June yearly	/				/				/				/				/				/			
6	Q - A.10.		Provision of Fees	yearly	/				/				/				/				/				/			
7	Q - B.1.		Permitted/Prohibited Landfill Uses	yearly	/				/				/				/				/				/			
8	Q - B.2		Approval of Landfill	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
9	Q - B.2.c.		Ancillary Uses and Facilities	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
10			Ancillary Uses and Facilities																									
11	Q - B.2.d (3)		10 Year Phase Review	2015	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
12			10 Year Phase Review																									
13	Q - B.4.d.		Inert/Exempt Materials	info	/				/				/				/				/				/			
14	Q - B.5.a.		Prohibited Waste	info	/				/				/				/				/				/			
15	Q - B.6.		Waste Diversion	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
16	Q - C.3.g.		Paved Access Roads	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
17	Q - C.3.h.		Surfacing of Access Roads	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
18	Q - C.5.		Graffiti Removal and Deterrence	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
19	Q - C.10.c.		Evaluation of Beneficial Gas Usage	June yearly	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
20	Q - C.10.d. (1)		Alternative Fuel Vehicles	status																								
21	Q - C.10.d. (2)	IC Non	Alternative Fuel Refuse Collection Trucks Compliant, FRN = Further Review Needed, R	status																								

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

[/] = Yearly or non-ongoing monitoring frequency

								Sc	ecol	nd Q	uarter	202	24							1	Γhir	d Qu	arter 2	2024	4			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
22	Q - C.12.a.		Technical Advisory Committee	info	/				/				\				/				/				/			
23	Q - C.12.c.		Contract for Mitigation Monitoring	info	/				/				/				/				/				/			
24	Q - C.12.c.		Contract for Mitigation Monitoring-5 years	info	/				/				/				/				/				/			
25																												
26	T - 4		Fire Plan	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
27	T - 5.j.		Trip Diversion	status	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
28	T - 6		Satisfactory Street Lighting	status	/				/				\				/				/				/			
29																												
30	M - 4.1.1	7	Reabandonment Procedures	status	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
31	M - 4.1.4	11	Post-5.0 Earthquake Analysis	upon event	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
32	M - 4.2.12	27	Heavy Equipment Operations	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
33	M - 4.2.12		Heavy Equipment Operations	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
34	M - 4.2.12	28	Site Erosion-Cover	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
35	M - 4.2.12		Site Erosion-Cell Height	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
36	M - 4.2.12		Site Erosion-Sealant	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
37	M - 4.2.13	29	LFG Control Measures	ongoing	✓	NC	l-d		✓	NC	l-e		✓	FRN	I-f		✓	NC	l-g		✓	NC	l-h		✓	FRN	l-i	
38	M - 4.2.13	30	Operational Odor Control Techniques	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
39	M - 4.2.13	31	Solid Waste Compaction	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
40	M - 4.2.13	32	LFG Collection and Recovery System	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
41	M - 4.2.13	33	Odor Control Measures	ongoing	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

					Ī			Se	COI	nd Q	uarter	202	24							T	hir	d Qu	arter 2	2024	4			
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
42	M - 4.2.13	34	Odor/LFG Monitoring	ongoing	/		l-d		/		l-e		\		I-f		/		I-g		/		l-h		/		l-i	
43			Periodic LFG Monitoring		/		l-d		/		l-e		/		I-f		/		I-g		/		l-h		/		l-i	
44	M - 4.3.2	52	LFG Migration Mitigation	ongoing	✓	С	l-d		✓	С	l-e		>	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
45	M - 4.3.2	57	Dust Control Water	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
46	M - 4.4.2	69	Offsite Mitigation Sites	status	✓	NC	l-d		✓	NC	l-e		~	NC	I-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
47	M - 4.4.2	70	Purchasing Wetland Credit	status	✓	FRN	l-d		✓	FRN	l-e		~	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
48	M - 4.4.2	71	Funding-Invasive Species Eradication Program	status	/				/				/				/				/				/			
49	M - 4.6	85	Site Lighting	status	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	
50	M - 4.7.1	86	Open Space Buffer Area	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
51	M - 4.9.3	106	Litter Minimization	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
52	M - 4.9.3	107	Litter/Debris Containment	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
53	M - 4.9.3	108	Vehicle Tarping Requirements	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
54	M - 4.9.3	109	Periodic Offsite Litter Pickup	ongoing	✓	С	NONE		✓	С	NONE		>	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
55	M - 4.9.3	110	Illegal Dumping Activities	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
56	M - 4.9.3	111	Radio Dispatch Litter Control	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
57	M - 4.9.3	112	Litter Control	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
58	M - 4.9.5	127	Address Concerns of Citizens' Advisory Committee	ongoing	/				/				/				/				/				/			
59	M - 4.9.6	128	Landfill Gas/Collection System-Unsafe Methane Levels Monitoring	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		√	С	NONE	
60	M - 4.9.6	129	Landfill Gas/Collection System- Detection/Training	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
61	M - 4.9.6	130	Landfill Gas/Collection System-Risk Mitigation	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored / = Yearly or non-ongoing monitoring frequency

								Sc	eco	nd Q	uarter	202	24							7	Γhir	d Qu	arter 2	2024	4			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
62	M - 4.16.4	176	Reclaimed Water	status	/				/				/				/				/				/			
63 64	M - 4.16.4	177	Water Conservation	ongoing	✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		~	С	NONE	
	Civil & Geotechnical E	Engineer																										
66																												
68	M - 4.1.1	2	Grading Outside of Conceptual Grading Plan Area	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
69	M - 4.1.1	3	Unsuitable Material Removal/Buffer Zones	ongoing																								
70	M - 4.1.1	4	Grading Outside of Landfill Footprint	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	I-h		✓	FRN	l-i	
71	M - 4.1.1	5	Grading Activity Compliance	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
72	M - 4.1.2	8	Landslide Guidelines	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
73	M - 4.1.2	9	Soil Stabilization	ongoing																								
74	M - 4.1.4	10	Landfill Design	ongoing																								
75	M - 4.1.4	11	Earthquake Operations Checklist	upon event	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
76	M - 4.1.5	12	Geologic Hazards - Liquefaction	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
77	M - 4.1.5	13	Design/Construction-Liquefaction	ongoing																								
78	M - 4.1.5	14	Design/Construction-Containment Structures	ongoing																								
79	M - 4.1.6	15	Refuse Slope Gradients	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
80	M - 4.1.6	16	Cut and Fill Slope Gradients	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	Ш
81	M - 4.1.6	17	Final Slope Factors of Safety	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	Щ
82	M - 4.1.6	18	Survey Monuments	ongoing	✓	NC	l-d		✓	NC	l-e		✓	NC	l-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored / = Yearly or non-ongoing monitoring frequency

								Se	eco:	nd Q	uarter	202	24							1	[hir	d Qu	arter 2	2024	4			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
83	M - 4.3.2	47	Landfill Liner	ongoing																								
84	M - 4.3.2	48	Landfill Liner	ongoing																								
85	M - 4.3.2	54	Preliminary Closure/Postclosure Plan	status																								
86	M - 4.3.2	55	Landfill Design/Operation/Final Closure Monitoring	status																								
87	M - 4.3.2	56	Cover Application	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
88	M - 4.14.1	155	Access Roadway Grade	ongoing	~	FRN	l-d		✓	FRN	I-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
89	M - 4.18	178	Landfill Elevation Exceedance	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
90																												\vdash
91	Hydrologist		_																									
92																												
93																												
94	M - 4.1.4	11	Earthquake Operations Checklist	upon event	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
95	M - 4.3.1	36	Surface Water Infiltration Minimization	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
96	M - 4.3.1	37	Surface Drainage Systems	ongoing	✓	FRN	l-d		✓	FRN	I-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
97	M - 4.3.1	38	Permanent/Temporary Ditches	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
98	M - 4.3.1	39	Drainage Protection	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
99	M - 4.3.1	40	SWRCB Permit Coverage	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
100	M - 4.3.1	41	Surface Water Collection System	ongoing																								
101	M - 4.3.1	42	Surface Water Quality Monitoring	ongoing																								
102	M - 4.3.1	43	Sediment Basin Maintenance	ongoing	✓	NC	l-d		✓	NC	l-e		✓	NC	I-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
103	M - 4.3.1	44	Final Landfill Cover	ongoing																								
104	M - 4.3.1	45	Erosion Control Plan	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	ecoi	nd Q	uarter	202	24							1	Γhir	d Qu	arter 2	2024	4			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
105	M - 4.3.1	46	Preventive Maintenance Program	ongoing	~	NC	l-d		✓	NC	l-e		✓	NC	l-f		✓	NC	I-g		✓	NC	l-h		✓	NC	l-i	
106	M - 4.3.2	49	Interception of Groundwater Seepage	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	I-i	
107	M - 4.3.2	50	LCRS/Leachate Monitoring	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	
108	M - 4.3.2	51	LCRS Monitoring	ongoing																								Ш
109																												Н
	Biologist																											Ш
111																												
112																												
113	M - 4.1.1	6	Slope Erosion Control	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	Ш
114	M - 4.2.11	23	Revegetation/Excavation	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
115	M - 4.2.12		Temporary Vegetation Cover	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
116	M - 4.4.1	60	Coastal Sage Scrub Mitigation Plan	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
117	M - 4.4.1	61	Coastal Sage Scrub Seeding	ongoing																								Ш
118	M - 4.4.1	62	Mariposa Lily Mitigation Plan	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	l-i	Ш
119	M - 4.4.1	63	San Diego Horned Lizard Mitigation	ongoing	✓	С	l-d		✓	С	l-e		~	С	I-f		✓	С	I-g		✓	С	l-h		✓	С	I-i	
120	M - 4.4.1	64	California Gnatcatcher Surveys	ongoing	/				/				\				/				/				/			
121	M - 4.4.1	65	Least Bell's Vireo Surveys	ongoing	/				/				/				/				/				/			
122	M - 4.4.1	66	Western Burrowing Owl Surveys	ongoing	/				/				/				/				/				/			
123	M - 4.4.1	67	Migratory Bird Treaty Act	ongoing	/				/				/				/				/				/			
124	M - 4.4.1	68	Raptor Nests Habitat	ongoing	/				/				/				/				/				/			
125	M - 4.4.3	72	Native Tree Mitigation	ongoing	~	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
126	M - 4.4.3	73	Nonnative Tree Mitigation	status	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

				ongoing		COI	nd Q	uarter	202	24							_	Thir	d Qu	arter :	2024	4			\neg			
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
127	M - 4.4.3	74	Mitigation Tree Planting	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
128	M - 4.4.3	75	Tree Planting Mitigation Site Prep	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
129	M - 4.4.3	76	Poultry Wire Screen	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
130	M - 4.4.3	77	Backfill Material	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
131	M - 4.4.3	78	Tree Planting Procedure	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
132	M - 4.4.3	79	Tree Area Mulching	ongoing	✓	С	NONE		✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
133	M - 4.4.3	80	Tree Irrigation/Fertilization	ongoing	✓	С	NONE		✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
134	M - 4.4.3	81	Irrigation System	ongoing	✓	С	NONE		✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
135	M - 4.4.3	82	Annual Tree Monitoring Report	annual	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
136	M - 4.9.2	96	Vector Activity Monitoring	ongoing	✓	FRN	l-d		✓	FRN	l-e		~	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	I-i	
137	M - 4.9.2	97	Vector Elimination	ongoing	✓	С	NONE		✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
138	M - 4.9.2	98	Fly Control	ongoing																								
139	M - 4.9.2	99	Rodent Control	ongoing	✓	O	NONE		✓	С	NONE		>	С	NONE		✓	O	NONE		✓	O	NONE		✓	С	NONE	
140	M - 4.9.2	100	Operational Vector-Limiting Activity	ongoing																								
141	M - 4.9.2	101	Equipment Cleanliness/Maintenance	ongoing	✓	С	NONE		✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
142	M - 4.9.2	102	Storage of Vector-Attracting Items	ongoing																								
143	M - 4.9.2	103	Salvaged Material Storage-Vector Control	ongoing	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	
144	M - 4.9.2	104	Periodic Vector Inspections	ongoing																								
145	M - 4.9.2	105	Implementation of Vector Control Measures	ongoing																								
146																										Щ		Ш
147	Air Quality & Noise Sp	ecialist																										

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	COI	nd Q	uarter	202	24							7	Γhir	d Qu	arter 2	2024	4			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
148																												
149																												
150	M - 4.2.11	19	Emissions Mitigation Measures	ongoing	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	
151	M - 4.2.11	19	Construction Curtailing due to Pollution	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE	
152	M - 4.2.11	20	Dust Lofting Minimization	ongoing																								
153	M - 4.2.11	21	Wind Speed Monitoring	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
154	M - 4.2.11	22	Grading-Dust Reduction	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
155	M - 4.2.12	24	Construction Equipment Maintenance	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
156	M - 4.2.12		Construction Curtailing due to Pollution	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE	
157	M - 4.2.12	25	Refuse Trucks-Maintenance	ongoing																								
158	M - 4.2.12		Refuse Trucks-Engine	ongoing																								
159	M - 4.2.12		Refuse Trucks-Fee Schedule	ongoing																								
160	M - 4.2.12		Refuse Trucks-Fee Schedule Delivery Time	ongoing																								
161	M - 4.2.12		Refuse Trucks-Idling	ongoing																								
162	M - 4.2.12		Refuse Trucks-Emissions	ongoing																								
163	M - 4.2.12	26	Truck Travel and Fugitive Dust Emissions	ongoing	✓	NC	l-d		✓	NC	l-e		✓	NC	I-f		✓	NC	l-g		✓	NC	l-h		✓	NC	l-i	
164	M - 4.2.12		Truck Travel and Fugitive Dust Emissions	ongoing																								
165	M - 4.2.12		Truck Travel and Fugitive Dust Emissions	ongoing																								
166	M - 4.2.12		Truck Travel and Fugitive Dust Emissions	ongoing																								
167	M - 4.5.2	83	Landfill Hours	info	/				/				/				/				/				/			Ш
168	M - 4.5.2	84	Landfill Equipment-Noise Reduction	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

 $[\]label{Condition} Checkmark = Condition \ or \ mitigation \ was \ monitored$

^{/ =} Yearly or non-ongoing monitoring frequency

								Se	COI	nd Q	uarter	202	24							1	Γhir	d Qu	arter	202	4			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
169																											 	\vdash
170	Hydrology, Hazardous	Waste /	Risk of Upset																									
171																												
172																												
173	M - 4.3.2	53	Groundwater Monitoring Wells	ongoing																							<u> </u>	\sqcup
174	M - 4.3.2	58	Operation as Class III Landfill	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
175	M - 4.3.2	59	Underground Fuel Storage	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE	
176	M - 4.9.1	90	Refuse Inspection Program	ongoing																								
177	M - 4.9.1	91	Hazardous Waste Load-Checking	status																								
178	M - 4.9.1	93	Hazardous Waste Detection Training	status																								
179	M - 4.9.1	94	Spill Response Program	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
180	M - 4.9.4	115	Safety Inspections/Checklists	ongoing																								
181	M - 4.9.4	118	Accident/Injury reports, Inspections	status																								
182	M - 4.9.4	121	Fire Prevention Plan	ongoing	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	
183	M - 4.9.4	123	Personal Protective Equipment	ongoing																								
184	M - 4.9.4	125	Site Access/Fencing	ongoing	✓	С	NONE		✓	С	NONE		✓	FRN	I-f		✓	С	NONE		✓	С	NONE		✓	FRN	l-i	
185	M - 4.14.1	147	Fire Response Capabilities	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
186	M - 4.14.1	148	Hydrant Installation	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
187					\vdash																							\vdash
	Archaeologist																											
189																												
190	M 4404	400				ED.	, ,			FDM				ED.:	1.5			FDV				ED.				EDV	, .	
191	M - 4.19.1	183	Archaeological Resurvey	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

 $[\]label{Checkmark} \textbf{Checkmark} = \textbf{Condition or mitigation was monitored}$

^{/ =} Yearly or non-ongoing monitoring frequency

								Sc) COI	nd Q	uarter	202	24							-	Thir	d Qu	arter :	2024	,			\neg
Line #	Reference #	Mitigation #	City Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
192	M - 4.19.1	184	Onsite Archaeologist	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
193	M - 4.19.1	185	Archaeological Resources	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE	
194	M - 4.19.1	186	Archaeological Resources	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE	
195																												
196	Paleontologist																											
197																												
198																												
199	M - 4.19.2	187	Paleontological Resources Resurvey	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
200	M - 4.19.2	188	Paleontological Resources Excavation	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE	
201	M - 4.19.2	189	Paleontological Resources Training	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
202	M - 4.19.2	190	Paleontological Resources Recovery	ongoing																								
203	M - 4.19.2	191	Paleontological Resources Inspection	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

								Se	con	d Q	uarter	202	24							-	Third	1 Qu	arter 2	2024				\neg
Line #	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
1	Project Manager																											
2																												
3																												
4	Amendment 45.N - 1	45N	Daily Cover Materials	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
5	Amendment 45.N - 3	45N	Daily Cover Procedure	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
6	Amendment 45.N - 4.a	45N	Order for Abatement Status	ongoing	/		l-d		/		l-e		/		l-f		/		I-g		/		l-h		/		l-i	
7	Amendment 45.N - 4.c	45N	Odor Patrol Program	ongoing	/		l-d		/		l-e		/		l-f		/		I-g		/		l-h		/		l-i	
8	Amendment 45.N - 4.d	45N	Landfill Gas Mitigation Plan	ongoing	/		l-d		/		l-e		/		l-f		/		l-g		/		l-h		/		l-i	
9	Amendment 45.N - 5	45N	Dust and Odor Reports	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
10																												
11	Combined Site & Bridge Area -20.A	20.A	Joint Powers Authority	info	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
12	Combined Site & Bridge Area -20.F	20.F	Mitigation Reporting and Monitoring Program Amendment	status	/				/				/				/				/				/			
13	Landfill Capacity - 27	27	Tipping Fees for Partial Loads/Peak Hours	status																			<u> </u>					
14	Grading & Drainage-41.AD	41A-D	Water Conservation	status	~	FRN	l-d		✓	FRN	l-e		>	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
15	Revegetation - 44.F	44.F	Revegetation	status	~	FRN	l-d		✓	FRN	l-e		>	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
16	Fugitive Dust - 45.B	45.B	Working Face Areas	ongoing	~	FRN	l-d		✓	FRN	l-e		>	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
17	Fugitive Dust - 45.F	45.F	Inactive Areas Monitoring	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
18	Fugitive Dust - 45.I	45.I	Cleaning of Roads	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
19	Litter Control - 46.AD	46A-D	Litter Control Program	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
20	Gas - 52	52	Landfill Gas Collection System	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
21	Traffic - 57	57	Traffic Improvements	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
22	Traffic - 60	60	Street Light Installation	status	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
23	Traffic - 61	61	Traffic Minimization	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
24	Permittee Fees - 64 - 72	64-72	Permittee Fees	info	/				/				/				/				/		L		/			

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

 $^{*\} C = Compliant, NC = Non-Compliant, FRN = Further\ Review\ Needed,\ R = Resolved$

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

			County Mitigation Measures and Conditions Monitored by Discipline					Sı	econ	ıd Q	uarter	202	24							-	Thire	d Qu	arter 2	2024				\neg
Line #	keference #	Mitigation #		Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
48	Groundwater - 3.14		Groundwater-Monitoring Wells	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
49	BIOTA – 4.05		Annual Fee Submission for SEA Studies	status	/				/				/				/				/				/			
50	BIOTA – 4.06		Buffer Zone Maintenance as Nature Preserve	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
51	BIOTA – 4.07		Buffer Zone Maintenance-Vegetation	ongoing	~	FRN	l-d		✓	FRN	l-e		~	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
52	BIOTA – 4.08		Ridgeline Maintenance-Remain Undisturbed	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
53	BIOTA – 4.47		Cleaning of Equipment	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
54	BIOTA – 4.48		Monitoring of Vector-Attracting Items	ongoing																								
55	BIOTA – 4.49		Salvaged Material Storage-Vector Control	ongoing	✓	FRN	l-d		✓	FRN	l-e		~	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
56	BIOTA – 4.50		Vector Activity Monitoring	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
57	Air Quality - 6.03		Dust Emission Minimization	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
58	Air Quality - 6.04		Usage of Cut Material for Cover	ongoing	✓	С	NONE		<	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
59	Air Quality - 6.05		Operations in Accordance with SCAQMD/DOPW Requirements	info	/				/				/				/				/				/			
60	Air Quality - 6.06		Landfill Gas Control/Extraction System/Monitoring	ongoing	/				/				/				/				/				/			
61	Air Quality - 6.07		Flaring Systems	info	/				/				/				/				/				/			
62	Air Quality - 6.08		Management of Truck Arrivals	ongoing																								
63	Air Quality - 6.10		Refuse Truck Mitigation	status																								
64	Air Quality - 6.11		Light Duty Alternative Fuel Vehicles	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
65	Air Quality - 6.11		Alternative Fuel Refuse Collection/Transfer Trucks	status																								
66	Air Quality - 6.11		Alternative Fuel Vehicle Report Submission	status																								
67	Air Quality - 6.11		Heavy-duty, Alternative Fuel Off-Road Equipment Pilot Program	status																								
68	Air Quality - 6.11		Non-Diesel, Alternative Fuel Vehicles- Transfer/Collection Trucks	status																								
69	Air Quality - 6.11		Non-Diesel, Alternative Fuel Vehicles Truck Trips	status																								
70	Air Quality - 6.11		Clean Fuel Demonstration Program	status																								

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	econ	ıd Q	uarter	202	24							-	Thire	l Qu	arter 2	2024	1			\neg
Line #	keference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
71	Air Quality - 6.11		Compliance Evaluation	status																								
72	Odor/Landfill Gas – 7.01		Landfill Gas Escape Prevention	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
73	Odor/Landfill Gas – 7.02		Landfill Gas Collection System	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
74	Odor/Landfill Gas – 7.04		Gas Collection/Flare System Risk Mitigation	ongoing																								
75	Odor/Landfill Gas – 7.05		Wellhead Awareness	status	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
76	Odor/Landfill Gas – 7.06		Odor Control Measures	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
77	Odor/Landfill Gas – 7.07		Gas Recovery and Sale	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
78	Traffic/Circulation – 8.03		Street Light Installation	status	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
79	Traffic/Circulation – 8.04		Truck Traffic Minimization	status																								
80	Traffic/Circulation – 8.08		Tipping Fees for Partial Loads/Peak Hours	status																								
81	Traffic/Circulation – 8.10		Nighttime Landfill Operations Feasibility	status	/				/				/				/				/		ı		/			
82	Traffic/Circulation – 8.11		Parking Management along San Fernando Road	status	/				/				/				/				/				/			
83	Traffic/Circulation – 8.13		Adequate Queuing	status																								
84	Visual – 10.03		Landfill Flare Locations	status	/				/				/				/				/				/			
85	Visual – 10.04		Confinement of Excavation Cover Material	status																								
86	Visual – 10.05		Lighting Requirements	status																								
87	Visual – 10.11		Litter Control Program	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
88	Visual – 10.11		Solid Waste Load Procedures-Improperly Covered/Contained	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
89	Visual – 10.11		Debris Removal at Entrance	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
90	Visual – 10.11		Litter Control-Fencing	ongoing	~	FRN	С		✓	FRN	l-e		~	FRN	l-f		✓	FRN	С		✓	FRN	l-h		✓	FRN	l-i	
91	Visual – 10.11		Periodic Litter Pickup	ongoing	✓	С	l-d		✓	С	l-e		✓	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
92	Visual – 10.11		Litter Control-Additional Measures	ongoing	✓	FRN	l-d		✓	FRN	l-e		~	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
93	Visual – 10.12		Discharge Control/Litter Recovery	status																								

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

					Second Quarter 2024											Third Quarter 2024												
Line #	Aeference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
94	Water Conserv 11.01		Water Conservation	ongoing	>	FRN	l-d		✓	FRN	l-e		>	FRN	l-f		>	FRN	l-g		✓	FRN	l-h		~	FRN	l-i	
95	Recycling - 14.01		On-site Waste Diversion/Recycling	ongoing	~	С	NONE		✓	С	NONE		~	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE	
96	Recycling - 14.03		Tonnage Disposal Determination	info	/				/				/				/				/				/			
97	Recycling - 14.04		Recycling-Various Tasks	info	/				/				/				/				/				/			
98			Clean Dirt Procedures																									
99	Site - 15.11		Reclaimed Water Utilization	status	/				/				/				/				/				/			
100	Site - 15.12		Water Conservation Measures	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		<	FRN	l-i	
101	Admin Rpts/Pgms - 17.4		Operation Compliance	info	/				/				/				/				/				/			
102	Admin Rpts/Pgms -17.10		Fill Sequencing Plans	status																								
103	Admin Rpts/Pgms-17.15		Quarterly Newsletter	status	✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE		✓	FRN	NONE	
	Landfill Operation - 18.7		Graffiti Removal/Deterrent Plan	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
122	0: "0 0 1 1 1 1 5 1																									\dashv		
	Civil & Geotechnical Engineer																											
124																												
	Revegetation - 44.C	44.C	Cut Slope Requirements	ongoing	√	FRN	l-d		✓	FRN	l-e		√	FRN	l-f		√	FRN	l-g		✓	FRN	l-h		√	FRN	l-i	
127			Sat Grapo recipionionio																									
128	Geology - 1.01		Survey Monument Locations	ongoing	√	NC	l-d		✓	NC	l-e		√	NC	l-f		√	NC	l-g		✓	NC	l-h		✓	NC	l-i	
129	Geology - 1.02		Seismic Design	ongoing																								
130	Geology - 1.03		Maximum Refuse Slope Gradients	ongoing	✓	FRN	l-d		✓	FRN	l-e		√	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
131	Geology - 1.04		Maximum Refuse Slope Gradients	ongoing	√	FRN	l-d		✓	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
132	Geology - 1.05		Unsuitable Material Procedures	ongoing																								
133	Geology - 1.06		Grading Activities Procedures	ongoing	✓	FRN	l-d		✓	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
134	Geology - 1.07		Grading Activities Procedures	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		~	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
135	Geology - 1.09		Outer Perimeter Ridgeline Requirements	info	✓	FRN	l-d		✓	FRN	l-e		√	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

					Second Quarter 2024						Third Quarter 2024																	
Line #	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
185	BIOTA – 4.13		Oak Tree Mitigation Counting	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
186	BIOTA – 4.20		Poultry Wire Screen	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
187	BIOTA – 4.24		Drip Irrigation	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
188	BIOTA – 4.27		Coastal Sage Scrub Mitigation Plan	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
189	BIOTA – 4.28		Coastal Sage Scrub Seeding	ongoing																						Ш		
190	BIOTA – 4.29		San Diego Horned Lizard Mitigation	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
191	BIOTA – 4.30		California Gnatcatcher Surveys	ongoing	✓	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
192	BIOTA – 4.31		Least Bell's Vireo Surveys	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
193	BIOTA – 4.32		Western Burrowing Owl Surveys	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
194	BIOTA – 4.33		Migratory Bird Treaty Act	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
195	BIOTA – 4.34		Raptor Nests Habitat	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
196	BIOTA – 4.36		Personnel Retention for Monitoring Revegetation Plan	ongoing																								
197	BIOTA – 4.37		Personnel Retention for Monitoring Revegetation Plan, Onsite Plants	status																								
198	BIOTA – 4.38		Green Waste Material	ongoing																						Ш		
199	BIOTA – 4.39		Revegetation of Slopes/Fill Areas	ongoing																								
200	BIOTA – 4.41		Revegetation Plan-Replacement Cover	ongoing																								
201	BIOTA – 4.42		Interim Vegetation	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
202	BIOTA – 4.43		Replacement Riparian Habitat	status	✓	FRN	l-d		~	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
203	Air Quality - 6.02		Dust Control	ongoing	✓	С	l-d		>	С	l-e		>	С	I-f		✓	С	l-g		✓	С	l-h		✓	С	l-i	
204	Visual – 10.06		Upper Ridge Planting/Revegetation	ongoing																								
205	Visual – 10.07		Tree Planting Around Perimeter	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
206	Visual – 10.08		Cover/Revegetation Requirements	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	
207	Visual – 10.08		Solid Waste Disposal Procedures	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
208	Visual – 10.08		Final Cut Slope Steepness	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	l-f		✓	FRN	l-g		✓	FRN	l-h		✓	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

					Second Quarter 2024						Third Quarter 2024																	
Line #	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
233	Air Quality – 6.01		Dust Generation-Dumping	ongoing	~	С	NONE		~	С	NONE		~	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
234	Air Quality – 6.01		Water Tanks/Piping Maintenance	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
235	Air Quality – 6.01		Wind Speed Monitoring	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
236	Air Quality – 6.01		Report Submission-Dust/Odor	every quarter	/				/				/				/				/				/			
237	Odor/Landfill Gas – 7.03		Odor/Landfill Gas Monitoring Program	ongoing	/				/				/				/				/				/			
238	Odor/Landfill Gas – 7.03		Landfill Surface Sampling	ongoing	/				/				/				/				/				/			
239	Odor/Landfill Gas – 7.03		Landfill Perimeter Air Samples	ongoing	/				/				/				/				/				/			
240	Odor/Landfill Gas – 7.03		Landfill Surface Monitoring	ongoing	/				/				/				/				/				/			
241	Odor/Landfill Gas – 7.03		LFG Collection System Monitoring	ongoing	/				/				/				/				/				/			
242	Noise – 9.01		Landfill Access/Operation	info	/				/				/				/				/				/			
243	Noise – 9.03		Landfill Equipment-Mufflers/Silencers	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
	Admin Rpts/ Pgms-17.16		Air Quality Monitoring-Corrective Action Plan	ongoing	/				/				/				/				/				/			
246	Hydrology, Hazardous Waste / Risk	of Upset																										
248		•																										
249																												
250	IMP - Part IV.E	IMP4	Load Inspection-Random Manual	ongoing																								
251																												
252	Groundwater - 3.05		Leachate Collection and Removal System	ongoing																								
253	Groundwater - 3.15		Underground Diesel Fuel Storage Tanks	ongoing	/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE		/	NA	NONE	
254	Fire Service - 12.02		On-site Fire Response Capabilities- Operating Equipment	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
255	Fire Service - 12.03		On-site Fire Response Capabilities- Roads/Water	ongoing	✓	FRN	l-d		✓	FRN	l-e		✓	FRN	I-f		✓	FRN	I-g		✓	FRN	l-h		✓	FRN	l-i	
256	Fire Service - 12.04		On-site Fuel Storage Tanks-Permit Issuance	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	
257	Fire Service - 12.05		Building Limits	ongoing	✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE		✓	С	NONE	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved

^{**} See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

^{/ =} Yearly or non-ongoing monitoring frequency

								S	econ	ıd Qı	uarter	202	24								Γhire	d Qu	arter 2	:024				
Line #	Reference #	Mitigation #	County Mitigation Measures and Conditions Monitored by Discipline	Monitoring Frequency	4/16/2024	Status*	Further Review Needed/Comments**	Resolved*	5/21/2024	Status*	Further Review Needed/Comments**	Resolved*	6/11/2024	Status*	Further Review Needed/Comments**	Resolved*	7/3/2024	Status*	Further Review Needed/Comments**	Resolved*	8/19/2024	Status*	Further Review Needed/Comments**	Resolved*	9/24/2024	Status*	Further Review Needed/Comments**	Resolved*
282																												
283	Paleontologist																											
284																												
285																												
286	Ecological Significance - 62	62	identification/Odriser validit	ongoing	√	FRN	l-d		1	FRN	l-e		✓	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		~	FRN	Ţ	
287	IMP - Part VII.B	IMP7	Archaeological/Paleontological-Report Submission	ongoing	~	FRN	l-d		✓	FRN	l-e		~	FRN	I-f		✓	FRN	l-g		✓	FRN	l-h		~	FRN	l-i	

^{*} C = Compliant, NC = Non-Compliant, FRN = Further Review Needed, R = Resolved ** See Appendix I for Comments

Checkmark = Condition or mitigation was monitored

Appendix I

Further Review Needed Comments: Reference I-g through I-i Third Quarter 2024 Site Visits

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Project Manager	Q – B.2.c		City Planning	I-g through I-i: There was no grading outside of the approved landfill development limits during the 3rd Quarter. The road realignment work was not within the Sunshine Canyon waste fill limits, but is in the CUP-approved areas for ancillary uses. Grading up the canyon from the terminal basin was occurring while constructing the final toe berm with a completion date in late 2025 or early 2026. Rain events in the 1st and 2nd quarters caused significant erosion and mudflows. This resulted in an accumulation of sediment and standing water in the Terminal Basin and Basin A, and sediment in Basins B and E. Most of the erosion has been repaired. Cells CC-4 Part 3, 4 and 5 were accepting waste during the 3rd Quarter. The western edge of the Closure Turf was being removed and prepared for the next cell. This will be adjacent to the Southern Old City Landfill slopes. Tying into the existing landfill liner system caused exposure to old waste and liquids. The road around Basin E was graded wider to have three truck lanes and was paved. The road was striped, speed bumps installed, and K-rails placed at the edge of the roadway. The new temporary access road to CC-4 Part 3, 4 and 5 was paved.
		Geology - 1.07	County DPW EPD/SCL-LEA	I-g through I-i: See Q – B.2.c above.
		Geology - 1.12	County DPW EPD/SCL-LEA	I-g through I-i: See Q – B.2.c above.
	Q - C.3.h		City Planning	I-g through I-i: In the 3rd Quarter, localized dust clouds occurred on dirt roads to and on the County top deck when soil importation trucks were delivering soil. These temporary roads did not have rock nor recycled concrete surfacing or soil stabilizer to control dust generation. The dust was not observed leaving the site from this location. On windy and dry days, dust clouds were observed coming from the cut slopes near the future toe berm location.
	Q - C.10.c		City Planning	I-g through I-i: During the 3rd Quarter, site power outages and gas recovery system maintenance caused fluctuation in gas recovery volumes recorded during monitoring.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Project Manager		Odor/Landfill Gas - 7.07	County Planning/SCAQMD SCL-LEA	I-g through I-i See Q - C.10.c above.
		Gas - 52	County DPW EPD/SCL-LEA County Forester Fire Warden	I-g through I-i: See Q - C.10.c above.
	T-4		City Planning, City Fire Department	I-g through I-i: An updated fire plan showing the locations of all facilities, and normal and emergency ingress and egress using the new temporary access road should be prepared and sent to the local City fire department station and City and County planning departments. The toe berm construction location, and Gas to Energy areas should be shown on the plan. Emergency egress should be posted for employees and customers.
		Fire Service - 12.03	County DPW EPD/SCL-LEA County Forester Fire Warden	I-g through I-i: See T-4 above.
	M - 4.1.1 / 4	M - Earth Resources	City Department of Building and Safety	I-g through I-i: The rainwater control system for the new access road and slope around Basin E had uncontrolled rainwater impacts. Republic's final design and construction plans for the drainage system for this adjacent canyon development were not made available to be monitored. The Basin E water discharge pipe into the Terminal Basin was plugged with sediment in the 3rd Quarter. Drainage improvements, engineering calculations and plans for the whole landfill site were also not available to the monitor. Republic's engineering consultant should have drainage plans and engineering support calculations available for agencies' approval and monitors' review.
	M - 4.1.1 / 7		City Planning, DOGGR	I-g through I-i: The old abandoned oil well casing adjacent to the north secondary access road from the Flare 11 site was not reabandoned. An evaluation of the need to reabandon this well should be done. This well was not leaking oil or gas, and did not pose a current hazard. It is well beyond the approved landfill limits but inside the ridgeline of Sunshine Canyon. An unabandoned well could be a future problem.
		Re-abandonment Procedures	County Planning, County DPW EPD/SCL-LEA, DOGGR	I-g through I-i: See M - 4.1.1 / 7 above.
	M - 4.1.4 / 11	Post-5.0 Earthquake Analysis	City Planning	I-g through I-i: There were no earthquakes of 5.0 or greater during this monitoring period.
	M - 4.2.12 / 26 and 28		City Planning/SCAQMD	I-g through I-i: During the 3rd Quarter, Closure Turf was being maintained, and gas and liquids recovery systems under the turf were performing well. There was a significant erosion rill at the interface of Cell CC-2A cover soil and the western edge of the Closure Turf. The future western portion of the Closure Turf was removed for the tie-in to the existing landfill liner systems to the Old City South slopes. This was an odorous construction effort due to the leachate on top of the bottom liner and excavation into old waste.
		Fugitive Dust - 45.F	County DPH/County LEA County DPW-EPD County Biologist	I-g through I-i: See M - 4.2.12 / 28 above.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Project Manager	M -4.2.13/ 29, 30, 32, 33, and 34		City Planning/SCL-LEA/SCAQMD	I-g through I-i: Compliance with these mitigation measures, concerning landfill gas monitoring and odor control and detection, is being monitored by a multi-agency team led by the SCAQMD. Only obvious gas emission sources, odorous operations related to gas and/or gas and landfill liquids, lack of cover, or exposed trash resulting in odor observed during the monitoring visit are reported.
		Amendment 45.N-4.a, 4.c, 4.d	County DPW-EPD	I-g through I-i: See M -4.2.13/ 29, 30, 32, 34 above.
		Amendment 45.N-5	County DPW-EPD	I-g through I-i: See M -4.2.13/29, 30, 32, 34 above.
	M - 4.2.13 / 33		City Planning/SCAQMD	I-g through I-i: On our random days of site visits during the 3rd Quarter, there were no landfill odors detected in the adjacent neighborhoods.
	M - 4.2.13 / 34		City Planning/SCAQMD	I-g through I-i: See M-4.2.13/29, 30, and 32 above.
		Odor/Landfill Gas - 7.06	County DPW-EPD/SCL- LEA/SCAQMD	I-g through I-i: See M-4.2.13/33 above.
		Amendment 45.N - 4.a, 4.c, 4.d	County DPW-EPD	I-g through I-i: See M-4.2.13/29, 30, 32, and 34 above.
		Amendment 45.N - 5	County DPW-EPD	I-g through I-i See M-4.2.13/29, 30, 32, and 34 above.
		Surface Water - 2.15	County DPW EPD/ LARWQCB, SCL- LEA	I-g through I-i: A preventative maintenance program with inspection of facility equipment, systems and storm water management devices to detect conditions that may cause breakdowns or failures resulting in discharge of materials into stormwater should be performed on a monthly basis, with a summary report issued on a quarterly basis. These reports were not reviewed in the 3rd Quarter. In the 3rd Quarter, it was observed that the majority of vegetation that was growing out of numerous cracks in the water retention basins and drainage conveyance channels' concrete was removed. The concrete drainage
				channel's wall south of Basin B has the soil supporting the wall being washed away by rain. The concrete wall is compromised by not stopping water from flowing into the back of the wall. Areas of the wall are cracked and are moving. There was no progress in performing this maintenance.
	M - 4.4.2/ 69		City Planning	I-g through I-i: The status on providing offsite wetland and riparian mitigation has not changed in the 3rd Quarter. The City was proceeding with writing and adopting an ordinance to allow the wetlands and riparian mitigation to be created in the Chatsworth Reservoir. All environmental analysis has been completed. Republic stated that there has been no progress in finalizing and adopting the ordinance. The delay in the issuance of the City ordinance is delaying any progress in creating the required wetlands and riparian mitigation. Time extension letters from the US Corps of Engineers and the California Department of Fish and Wildlife were in place for 2019. New extension letters were not obtained since then. The feasibility of the Chatsworth Dam mitigation site needs to be evaluated as still being a potential mitigation site.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Civil and Geotechnical		Biota - 4.4.3	CDFW	I-g through I-i: See M - 4.4.2 / 69 above.
Engineer	M - 4.9.3 / 110		City Planning/City LEA	I-g through I-i: In the 3rd Quarter, there was no litter or illegal dumping observed in the adjacent neighborhood. There was illegal dumping on the shoulder of Sierra Highway near the I-14 overpass. Illegal dumping was seen along the entrance wall on San Fernando Road.
	M - 4.1.1 / 2		City Building and Safety City Planning	I-g through I-i: See M - 4.1.1 / 5 below.
	M - 4.1.1 / 4		City Planning/LARWQCB Cal Recycle	I-g through I-i: See M - 4.1.1 / 5 below.
	M - 4.1.1 / 5		City Planning/ LARWQCB Cal Recycle	I-g through I-i: There was no grading outside of the approved landfill development limits during the 3rd Quarter. There was grading around the new main access road in the small valley south of the landfill entrance. The road was paved, striped, speed bumps installed, and K-rails placed. The construction plans and supporting geotechnical reports were reviewed and approved by City Planning and the City Building Department. The City also approved brush and tree clearance and hillside grading. The new temporary access road from the scales to the Cell CC-4 Part 3, 4 and 5 active areas was paved.
		Geology - 1.07	County DPW EPD/ County LEA	I-g through I-i: See M - 4.1.1 / 5 above.
	M - 4.1.5 / 12		City Planning/LARWQCB Cal Recycle	I-g through I-i: See M - 4.1.1 / 5 above.
	M - 4.1.6 / 18			I-g through I-i: A significant number of the landfill perimeter boundary survey PVC marker pipes have been removed in areas where Edison pole grading took place, near the Flare 11 site pad grading and near the CC-4 Part 3 buttress. All PVC boundary markers need to be verified and replaced if missing. New markers should be also placed at the final south double-lined boundary.
	M - 4.14.1 / 155		City Planning/Cal Recycle PW-B0E LADBS City LEA	I-g through I-i: Access roads were being maintained around the working area for emergency access. The final perimeter access road construction on the westside was completed. Wet weather surfacing or paving was not done.
	M - 4.18 / 178		City Planning/City LEA	I-g through I-i: A site map showing areas that are at the final elevations and which should have final cover should be available for review. A map showing other filled elevations should also be available onsite for review. The amount of stockpiled soil should also be indicated in recorded elevations.
		Visual - 10.01 Visual - 10.02	County DPW EPD/ LARWQCB SCL-LEA	I-g through I-i: See M - 4.18 / 178 above.


Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Civil and Geotechnical Engineer	M - 4.3.1/ 37, 38		City Planning/ LARWQCB CalRecycle SCL-LEA PW-BOE	I-g through I-i: Surface drainage systems were in-place to intercept or divert rainwater away from prior landfill cells and current filling operations. Most of these were temporary systems in active areas, and most conveyance V-ditches were unlined. The construction of the final toe berm and main access road realignment project is ongoing. This is a two-year project and includes a new basin, modification of the terminal basin, and the construction of new drainage channels, and possibly a new upstream basin from the terminal basin. The road realignment will entail the construction of a new main access road, a 350,000-cubic-foot sedimentation basin, drainage improvements in the ravine south of the current entrance, and modifications to the terminal basin's size and inlet sources. The design plans, design details and engineering calculations were submitted to the City for permit approval. The design plans and engineering reports were not available for review by the monitor nor submitted to the LACPW for approval. Compliance with Surface Water - 2.03 could not be verified. An engineering evaluation of the total site's surface drainage system should be done which reflects the current system's modifications. Onsite drainage channels should be designed per CCR, Title 23, Division 3, Chapter 15, Article 3, Section 2533(C), and County of Los Angeles Public Works Department, Flood Control requirements.
Hydrologist		Surface Water - 2.03 Surface Water - 2.12	County DPW EPD/ LARWQCB SCL-LEA	I-g through I-i: See M - 4.3.1/37, 38 above.
	M - 4.3.1 / 39		City Planning/LARWQCB Cal Recycle	I-g through I-i: See M - 4.3.1/ 37, 38 above.
	M - 4.3.1 / 40		City Planning/ LARWQCB CalRecycle SCL-LEA PW-BOE LADBS	I-g through I-i: See M - 4.3.1/ 37, 38 above.
	M - 4.3.1 / 43		City Planning/ LARWQCB CalRecycle SCL-LEA PW-BOE LADBS	I-g through I-i: In the 3rd Quarter, all of the basins or channels were fully cleared of sediment. Standing water was observed in the Terminal Basin. Major modifications were made to the Terminal Basin and its inlet channels. No hydrology reports were available to the monitor or the County that would show future rainwater control improvements and capacities.
		Surface Water - 2.10	LARWQCB / County DPW EPD	I-g through I-i: See M - 4.3.1/ 37, 38 and 43 above.
		Surface Water - 2.14	LARWQCB / County DPW EPD	I-g through I-i: See M - 4.3.1/ 37, 38 and 43 above.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Hydrologist	M - 4.3.1/ 46		City Planning/ LARWQCB CalRecycle PW-B0E	I-g through I-i: See 2.15 above.
	M - 4.3.2 / 50		City Planning/ LARWQCB CalRecycle SCL-LEA	I-g through I-i: The old City North top deck has a tank farm of 16 Adler storage tanks for processing recovered leachate and condensate, with a double-wall pipeline to the sewer connection at the entrance near San Fernando Road. This system operated with no odors detected at the tank farm nor the sewer connection during the 3rd Quarter. Tank farm liquids were being treated with 30% hydrogen peroxide at the tank farm and at the sewer connection. A remote shut-off system to close the holding vessel's valves was not installed.
Biologist	M - 4.1.1 / 6		City Planning/ LARWQCB CalRecycle SCL-LEA LADBS	I-g through I-i: See M - 4.2.12 / 28 above.
		Geology - 1.14	LARWQCB/ County Forester	I-g through I-i: See M - 4.2.12 / 28 above.
	M - 4.2.11 / 23		City Planning	I-g through I-i: See M - 4.2.12 / 28 above.
		Geology - 1.13	County DPW EPD/ County Forester LARWQCB	I-g through I-i: See M - 4.2.12 / 28 above.
	M - 4.2.12		SCL-LEA/ City Planning	I-g through I-i: See M - 4.2.12 / 28 above.
		Revegetation - 44.A	SCL-LEA/ County DPW EPD Regional Planning County Biologist	I-g through I-i: See M - 4.2.12 / 28 above.
		Revegetation - 44.F	SCL-LEA/ County DPW EPD Regional Planning County Biologist	I-g through I-i: See M - 4.2.12 / 28 above.
		Biota - 4.42	SCL-LEA	I-g through I-f: See M - 4.2.12 / 28 above.
		Air Quality - 6.02	SCAQMD/ SCL-LEA	I-g through I-i: See M - 4.2.12 / 28 above.

Discipline	City Condition Reference # / Mitigation #	County Condition Reference #/ Mitigation #	Responsible Agency	Further Review Needed - Comments
Biologist		Visual - 10.08	County Forester	I-g through I-i: See M - 4.2.12 / 28 above.
	M - 4.4.1 / 60		City Planning	I-g through I-i: During the 3rd Quarter, City sage mitigation area decks B and C were being maintained by the removal of non-native vegetation. Native vegetation was doing well. Bare spots are being filled-in from seeds and spreading of prior planted native plants. The condition of the PM-10 oak trees was still being evaluated by Republic's consulting biologists. Their yearly mitigation tree status report was being prepared. There was a substantial amount of dead PM-10 trees observed by the monitor. No schedule for replacement has been issued. There was no activity on the County sage mitigation area. Native plants were doing well in the County sage area, repopulating in the areas where they naturally came back. No mitigation revegetation activity was done for this area in the 3rd Quarter. Areas of City Decks B and C were being graded for the new temporary waste hauling access road. There appears to be minimal impacts to the sage mitigation areas.
		Biota - 4.27	County LEA/CDFW	I-g through I-i: See M - 4.4.1 / 60 above.
		Biota - 4.10	County LEA/CDFW	I-g through I-i: Republic's biologist consultant has not yet issued an updated mitigation tree report. The number and type of trees that will need to be replaced and schedule of planting will be addressed in this report.
	M - 4.4.3 / 72		City Planning	I-g through I-i: See Biota - 4.10 above.
	M - 4.9.4 / 121		City Planning/Cal Recycle Cal OSHA LAFD City LEA	I-g through I-i: See T-4 above.
	M-4.9.4/ 125		City Planning/ CalRecycle Cal OSHA SCL-LEA	I-g through I-i: During the 3rd Quarter, the north perimeter gate was observed not to be locked.
Paleontologist	M-4.19.2/191		City Planning	I-g through I-i: During the 3rd Quarter, grading was performed in native undisturbed areas that required archeological and paleontological monitoring. Reports were not available for review.
		Ecological Significance 62	County Planning	I-g through I-i: See M-4.19.2/ 191 above.

Appendix II

Relevant Site Photos

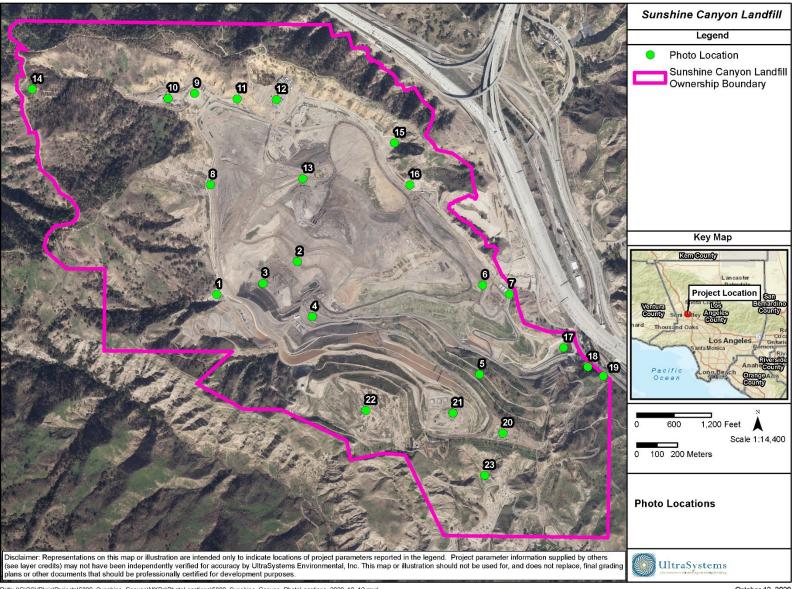

Path: \(\text{IIGISSVR\gis\Projects\5800}\) \(\text{Sunshine}\) \(\text{Canyon\IMXDs\PhotoLocations\5800}\) \(\text{Sunshine}\) \(\text{Canyon\Implies}\) \(\text{Projects\5800}\) \(\text{Sunshine}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\text{Canyon\Implies}\) \(\text{Months\frac{1}{2}}\) \(\tex

October 12, 2020

Photo Location Map Key

Map Location	Title	Photo Number
1	Basin A	1 - 18
2	Working Area, CC4 Part 1/2	19 - 64
3	Working Area, CC-4 Part 3	65 – 100
4	Working Area, CC-4 Part 4/5	101 - 115
5	Closure Turf	116 - 123
6	Office and Scales Location	124 - 128
7	Alder Tank Liquids Treatment System	_
8	County Sage Mitigation Area and Westside Drainage Channels	129 - 140
9	Basin D	-
10	Basin D Material Storage Area	-
11	Basin D Outlet Channel	-
12	Flares 9, 10, 11 and Gas-to-Energy Facility	141 - 174
13	County Top Deck	175 - 190
14	North Access Road	_
15	Basin B	191 – 205
16	Eastside Drainage Channel	206 - 212
17	Terminal Basin	213 - 280
18	Greywater Sewer Connection	_
19	Retaining Wall at San Fernando Road	_
20	Sage Mitigation, Deck C	281 – 284
21	Sage Mitigation, Deck B	285 - 294
22	Sage Mitigation, Deck A	_
23	Southern Ownership Buffer	295 – 296
-	General Site	297 - 494



Photo 1: Basin A: July 3, 2024



Photo 3: Basin A: July 3, 2024



Photo 2: Basin A: July 3, 2024



Photo 4: Basin A: July 3, 2024



Photo 5: Basin A: July 3, 2024



Photo 7: Basin A: July 3, 2024



Photo 6: Basin A: July 3, 2024



Photo 8: Basin A: August 19, 2024



Photo 9: Basin A: August 19, 2024



Photo 11: Basin A: August 19, 2024



Photo 10: Basin A: August 19, 2024



Photo 12: Basin A: August 19, 2024



Photo 13: Basin A: August 19, 2024



Photo 15: Basin A: August 19, 2024



Photo 14: Basin A: August 19, 2024



Photo 16: Basin A: September 24, 2024



Photo 17: Basin A: September 24, 2024



Photo 19: Working Area, CC4 Part 1/2: August 19, 2024



Photo 18: Basin A: September 24, 2024



Photo 20: Working Area, CC4 Part 1/2: August 19, 2024



Photo 21: Working Area, CC4 Part 1/2: August 19, 2024



Photo 23: Working Area, CC4 Part 1/2: August 19, 2024



Photo 22: Working Area, CC4 Part 1/2: August 19, 2024



Photo 24: Working Area, CC4 Part 1/2: August 19, 2024



Photo 25: Working Area, CC4 Part 1/2: August 19, 2024



Photo 27: Working Area, CC4 Part 1/2: August 19, 2024



Photo 26: Working Area, CC4 Part 1/2: August 19, 2024



Photo 28: Working Area, CC4 Part 1/2: August 19, 2024



Photo 29: Working Area, CC4 Part 1/2: August 19, 2024



Photo 31: Working Area, CC4 Part 1/2: August 19, 2024



Photo 30: Working Area, CC4 Part 1/2: August 19, 2024



Photo 32: Working Area, CC4 Part 1/2: August 19, 2024



Photo 33: Working Area, CC4 Part 1/2: August 19, 2024



Photo 35: Working Area, CC4 Part 1/2: August 19, 2024



Photo 34: Working Area, CC4 Part 1/2: August 19, 2024



Photo 36: Working Area, CC4 Part 1/2: August 19, 2024



Photo 37: Working Area, CC4 Part 1/2: August 19, 2024



Photo 39: Working Area, CC4 Part 1/2: August 19, 2024



Photo 38: Working Area, CC4 Part 1/2: August 19, 2024



Photo 40: Working Area, CC4 Part 1/2: August 19, 2024



Photo 41: Working Area, CC4 Part 1/2: August 19, 2024



Photo 43: Working Area, CC4 Part 1/2: August 19, 2024



Photo 42: Working Area, CC4 Part 1/2: August 19, 2024



Photo 44: Working Area, CC4 Part 1/2: August 19, 2024



Photo 45: Working Area, CC4 Part 1/2: August 19, 2024



Photo 47: Working Area, CC4 Part 1/2: August 19, 2024



Photo 46: Working Area, CC4 Part 1/2: August 19, 2024



Photo 48: Working Area, CC4 Part 1/2: August 19, 2024



Photo 49: Working Area, CC4 Part 1/2: August 19, 2024



Photo 51: Working Area, CC4 Part 1/2: August 19, 2024



Photo 50: Working Area, CC4 Part 1/2: August 19, 2024



Photo 52: Working Area, CC4 Part 1/2: August 19, 2024



Photo 53: Working Area, CC4 Part 1/2: August 19, 2024



Photo 55: Working Area, CC4 Part 1/2: September 24, 2024



Photo 54: Working Area, CC4 Part 1/2: September 24, 2024



Photo 56: Working Area, CC4 Part 1/2: September 24, 2024



Photo 57: Working Area, CC4 Part 1/2: September 24, 2024



Photo 59: Working Area, CC4 Part 1/2: September 24, 2024



Photo 58: Working Area, CC4 Part 1/2: September 24, 2024



Photo 60: Working Area, CC4 Part 1/2: September 24, 2024



Photo 61: Working Area, CC4 Part 1/2: September 24, 2024



Photo 63: Working Area, CC4 Part 1/2: September 24, 2024



Photo 62: Working Area, CC4 Part 1/2: September 24, 2024



Photo 64: Working Area, CC4 Part 1/2: September 24, 2024

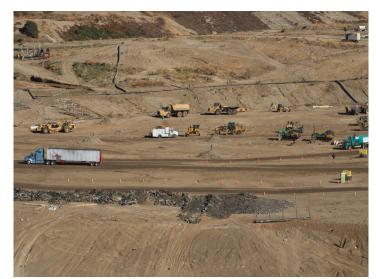


Photo 65: Working Area, CC-4 Part 3: August 19, 2024



Photo 67: Working Area, CC-4 Part 3: August 19, 2024



Photo 66: Working Area, CC-4 Part 3: August 19, 2024



Photo 68: Working Area, CC-4 Part 3: August 19, 2024



Photo 69: Working Area, CC-4 Part 3: August 19, 2024



Photo 71: Working Area, CC-4 Part 3: August 19, 2024



Photo 70: Working Area, CC-4 Part 3: August 19, 2024



Photo 72: Working Area, CC-4 Part 3: August 19, 2024



Photo 73: Working Area, CC-4 Part 3: August 19, 2024



Photo 75: Working Area, CC-4 Part 3: August 19, 2024



Photo 74: Working Area, CC-4 Part 3: August 19, 2024



Photo 76: Working Area, CC-4 Part 3: August 19, 2024



Photo 77: Working Area, CC-4 Part 3: August 19, 2024



Photo 79: Working Area, CC-4 Part 3: September 24, 2024



Photo 78: Working Area, CC-4 Part 3: September 24, 2024



Photo 80: Working Area, CC-4 Part 3: September 24, 2024



Photo 81: Working Area, CC-4 Part 3: September 24, 2024



Photo 83: Working Area, CC-4 Part 3: September 24, 2024



Photo 82: Working Area, CC-4 Part 3: September 24, 2024



Photo 84: Working Area, CC-4 Part 3: September 24, 2024



Photo 85: Working Area, CC-4 Part 3: September 24, 2024



Photo 87: Working Area, CC-4 Part 3: September 24, 2024



Photo 86: Working Area, CC-4 Part 3: September 24, 2024



Photo 88: Working Area, CC-4 Part 3: September 24, 2024



Photo 89: Working Area, CC-4 Part 3: September 24, 2024



Photo 91: Working Area, CC-4 Part 3: September 24, 2024



Photo 90: Working Area, CC-4 Part 3: September 24, 2024



Photo 92: Working Area, CC-4 Part 3: September 24, 2024



Photo 93: Working Area, CC-4 Part 3: September 24, 2024



Photo 95: Working Area, CC-4 Part 3: September 24, 2024



Photo 94: Working Area, CC-4 Part 3: September 24, 2024



Photo 96: Working Area, CC-4 Part 3: September 24, 2024



Photo 97 Working Area, CC-4 Part 3: September 24, 2024



Photo 99: Working Area, CC-4 Part 3: September 24, 2024



Photo 98: Working Area, CC-4 Part 3: September 24, 2024



Photo 100: Working Area, CC-4 Part 3: September 24, 2024



Photo 101: Working Area, CC-4 Part 4/5: July 3, 2024



Photo 103: Working Area, CC-4 Part 4/5: July 3, 2024



Photo 102: Working Area, CC-4 Part 4/5: July 3, 2024



Photo 104: Working Area, CC-4 Part 4/5: July 3, 2024



Photo 105: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 107: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 106: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 108: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 109: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 111: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 110: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 112: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 113: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 115: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 114: Working Area, CC-4 Part 4/5: August 19, 2024



Photo 116: Closure Turf: July 3, 2024



Photo 117: Closure Turf: July 3, 2024



Photo 119: Closure Turf: August 19, 2024



Photo 118: Closure Turf: August 19, 2024



Photo 120: Closure Turf: August 19, 2024



Photo 121: Closure Turf: September 24, 2024



Photo 123: Closure Turf: September 24, 2024



Photo 122: Closure Turf: September 24, 2024



Photo 124: Office and Scales Location: July 3, 2024



Photo 125: Office and Scales Location: August 19, 2024



Photo 127: Office and Scales Location: August 19, 2024



Photo 126: Office and Scales Location: August 19, 2024



Photo 128: Office and Scales Location: August 19, 2024



Photo 129: County Sage Mitigation Area and Westside Drainage Channels : July 3, 2024



Photo 131: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 130: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 132: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 133: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 135: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 134: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 136: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 137: County Sage Mitigation Area and Westside Drainage Channels : August 19, 2024



Photo 139: County Sage Mitigation Area and Westside Drainage Channels: September 24, 2024



Photo 138: County Sage Mitigation Area and Westside Drainage Channels: September 24, 2024



Photo 140: County Sage Mitigation Area and Westside Drainage Channels: September 24, 2024

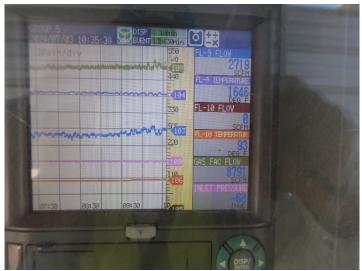


Photo 141: Flares 9, 10, 11 and Gas-to-Energy Facility: July 3, 2024



Photo 143: Flares 9, 10, 11 and Gas-to-Energy Facility: July 3, 2024



Photo 142: Flares 9, 10, 11 and Gas-to-Energy Facility: July 3, 2024



Photo 144: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 145: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 147: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 146: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 148: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 149: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 151: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 150: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 152: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 153: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 155: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 154: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024

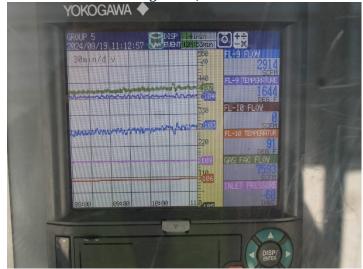


Photo 156: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 157: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 159: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 158: Flares 9, 10, 11 and Gas-to-Energy Facility: August 19, 2024



Photo 160: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 161: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024

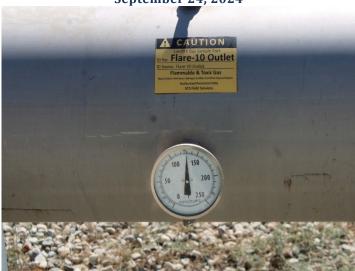


Photo 163: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 162: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 164: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 165: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 167: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 166: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 168: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 169: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 171: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 170: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 172: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 173: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 175: County Top Deck: July 3, 2024



Photo 174: Flares 9, 10, 11 and Gas-to-Energy Facility: September 24, 2024



Photo 176: County Top Deck: July 3, 2024



Photo 177: County Top Deck: July 3, 2024



Photo 179: County Top Deck: August 19, 2024



Photo 178: County Top Deck: August 19, 2024



Photo 180: County Top Deck: August 19, 2024



Photo 181: County Top Deck: August 19, 2024



Photo 183: County Top Deck: August 19, 2024



Photo 182: County Top Deck: August 19, 2024



Photo 184: County Top Deck: August 19, 2024



Photo 185: County Top Deck: August 19, 2024



Photo 187: County Top Deck: September 24, 2024



Photo 186: County Top Deck: August 19, 2024



Photo 188: County Top Deck: September 24, 2024



Photo 189: County Top Deck: September 24, 2024



Photo 191: Basin B: July 3, 2024



Photo 190: County Top Deck: September 24, 2024



Photo 192: Basin B: July 3, 2024



Photo 193: Basin B: July 3, 2024



Photo 195: Basin B: July 3, 2024



Photo 194: Basin B: July 3, 2024



Photo 196: Basin B: August 19, 2024



Photo 197: Basin B: August 19, 2024



Photo 199: Basin B: August 19, 2024



Photo 198: Basin B: August 19, 2024



Photo 200: Basin B: August 19, 2024



Photo 201: Basin B: August 19, 2024



Photo 203: Basin B: August 19, 2024



Photo 202: Basin B: August 19, 2024



Photo 204: Basin B: August 19, 2024



Photo 205: Basin B: August 19, 2024



Photo 207: Eastside Drainage Channel: August 19, 2024



Photo 206: Eastside Drainage Channel: August 19, 2024



Photo 208: Eastside Drainage Channel: August 19, 2024



Photo 209: Eastside Drainage Channel: August 19, 2024



Photo 211: Eastside Drainage Channel: September 24, 2024



Photo 210: Eastside Drainage Channel: September 24, 2024



Photo 212: Eastside Drainage Channel: September 24, 2024



Photo 213: Terminal Basin: July 3, 2024



Photo 215: Terminal Basin: July 3, 2024



Photo 214: Terminal Basin: July 3, 2024



Photo 216: Terminal Basin: July 3, 2024



Photo 217: Terminal Basin: July 3, 2024



Photo 219: Terminal Basin: July 3, 2024



Photo 218: Terminal Basin: July 3, 2024



Photo 220: Terminal Basin: August 18, 2024



Photo 221: Terminal Basin: August 18, 2024



Photo 223: Terminal Basin: August 18, 2024



Photo 222: Terminal Basin: August 18, 2024



Photo 224: Terminal Basin: August 18, 2024



Photo 225: Terminal Basin: August 18, 2024



Photo 227: Terminal Basin: August 18, 2024



Photo 226: Terminal Basin: August 18, 2024



Photo 228: Terminal Basin: August 18, 2024



Photo 229: Terminal Basin: August 18, 2024



Photo 231: Terminal Basin: August 18, 2024



Photo 230: Terminal Basin: August 18, 2024



Photo 232: Terminal Basin: August 18, 2024





Photo 235: Terminal Basin: August 18, 2024



Photo 234: Terminal Basin: August 18, 2024



Photo 236: Terminal Basin: August 18, 2024



Photo 237: Terminal Basin: August 18, 2024



Photo 239: Terminal Basin: August 18, 2024



Photo 238: Terminal Basin: August 18, 2024



Photo 240: Terminal Basin: August 18, 2024



Photo 241: Terminal Basin: August 18, 2024



Photo 243: Terminal Basin: August 18, 2024



Photo 242: Terminal Basin: August 18, 2024



Photo 244: Terminal Basin: August 18, 2024



Photo 245: Terminal Basin: August 18, 2024



Photo 247: Terminal Basin: August 18, 2024



Photo 246: Terminal Basin: August 18, 2024



Photo 248: Terminal Basin: August 18, 2024



Photo 249: Terminal Basin: August 18, 2024

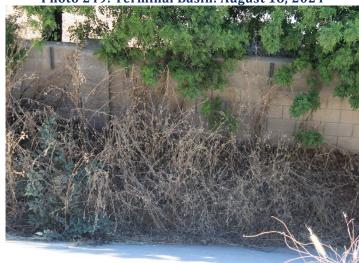


Photo 251: Terminal Basin: August 18, 2024



Photo 250: Terminal Basin: August 18, 2024



Photo 252: Terminal Basin: August 18, 2024



Photo 253: Terminal Basin: August 18, 2024



Photo 255: Terminal Basin: August 18, 2024



Photo 254: Terminal Basin: August 18, 2024



Photo 256: Terminal Basin: September 24, 2024



Photo 257: Terminal Basin: September 24, 2024



Photo 259: Terminal Basin: September 24, 2024



Photo 258: Terminal Basin: September 24, 2024



Photo 260: Terminal Basin: September 24, 2024



Photo 261: Terminal Basin: September 24, 2024



Photo 263: Terminal Basin: September 24, 2024



Photo 262: Terminal Basin: September 24, 2024



Photo 264: Terminal Basin: September 24, 2024



Photo 265: Terminal Basin: September 24, 2024



Photo 267: Terminal Basin: September 24, 2024



Photo 266: Terminal Basin: September 24, 2024



Photo 268: Terminal Basin: September 24, 2024



Photo 269: Terminal Basin: September 24, 2024



Photo 271: Terminal Basin: September 24, 2024



Photo 270: Terminal Basin: September 24, 2024



Photo 272: Terminal Basin: September 24, 2024



Photo 273: Terminal Basin: September 24, 2024



Photo 275: Terminal Basin: September 24, 2024



Photo 274: Terminal Basin: September 24, 2024



Photo 276: Terminal Basin: September 24, 2024



Photo 277: Terminal Basin: September 24, 2024



Photo 279: Terminal Basin: September 24, 2024



Photo 278: Terminal Basin: September 24, 2024



Photo 280: Terminal Basin: September 24, 2024



Photo 281: Sage Mitigation, Deck C: July 3, 2024



Photo 283: Sage Mitigation, Deck C: July 3, 2024



Photo 282: Sage Mitigation, Deck C: July 3, 2024



Photo 284: Sage Mitigation, Deck C: July 3, 2024



Photo 285: Sage Mitigation, Deck B: July 3, 2024



Photo 287: Sage Mitigation, Deck B: July 3, 2024



Photo 286: Sage Mitigation, Deck B: July 3, 2024



Photo 288: Sage Mitigation, Deck B: August 19, 2024



Photo 289: Sage Mitigation, Deck B: August 19, 2024



Photo 291: Sage Mitigation, Deck B: August 19, 2024



Photo 290: Sage Mitigation, Deck B: August 19, 2024



Photo 292: Sage Mitigation, Deck B: September 24, 2024



Photo 293: Sage Mitigation, Deck B: September 24, 2024



Photo 295: Southern Ownership Buffer: July 3, 2024



Photo 294: Sage Mitigation, Deck B: September 24, 2024



Photo 296: Southern Ownership Buffer: July 3, 2024



Photo 297: General Site: July 3, 2024



Photo 299: General Site: July 3, 2024



Photo 298: General Site: July 3, 2024



Photo 300: General Site: July 3, 2024



Photo 301: General Site: July 3, 2024



Photo 303: General Site: July 3, 2024



Photo 302: General Site: July 3, 2024



Photo 304: General Site: July 3, 2024



Photo 305: General Site: July 3, 2024



Photo 307: General Site: July 3, 2024



Photo 306: General Site: July 3, 2024



Photo 308: General Site: July 3, 2024



Photo 309: General Site: July 3, 2024



Photo 311: General Site: July 3, 2024



Photo 310: General Site: July 3, 2024



Photo 312: General Site: July 3, 2024



Photo 313: General Site: July 3, 2024



Photo 315: General Site: July 3, 2024



Photo 314: General Site: July 3, 2024



Photo 316: General Site: July 3, 2024



Photo 317: General Site: July 3, 2024



Photo 319: General Site: July 3, 2024



Photo 318: General Site: July 3, 2024



Photo 320: General Site: July 3, 2024



Photo 321: General Site: July 3, 2024



Photo 323: General Site: July 3, 2024



Photo 322: General Site: July 3, 2024



Photo 324: General Site: July 3, 2024



Photo 325: General Site: July 3, 2024



Photo 327: General Site: July 3, 2024



Photo 326: General Site: July 3, 2024



Photo 328: General Site: July 3, 2024



Photo 329: General Site: July 3, 2024



Photo 331: General Site: July 3, 2024



Photo 330: General Site: July 3, 2024



Photo 332: General Site: July 3, 2024



Photo 333: General Site: July 3, 2024



Photo 335: General Site: July 3, 2024



Photo 334: General Site: July 3, 2024



Photo 336: General Site: July 3, 2024



Photo 337: General Site: July 3, 2024



Photo 339: General Site: July 3, 2024



Photo 338: General Site: July 3, 2024



Photo 340: General Site: July 3, 2024



Photo 341: General Site: July 3, 2024



Photo 343: General Site: July 3, 2024



Photo 342: General Site: July 3, 2024



Photo 344: General Site: July 3, 2024



Photo 345: General Site: July 3, 2024



Photo 347: General Site: July 3, 2024



Photo 346: General Site: July 3, 2024



Photo 348: General Site: July 3, 2024



Photo 349: General Site: July 3, 2024



Photo 351: General Site: August 19, 2024



Photo 350: General Site: August 19, 2024



Photo 352: General Site: August 19, 2024



Photo 353: General Site: August 19, 2024



Photo 355: General Site: August 19, 2024



Photo 354: General Site: August 19, 2024



Photo 356: General Site: August 19, 2024



Photo 357: General Site: August 19, 2024



Photo 359: General Site: August 19, 2024



Photo 358: General Site: August 19, 2024



Photo 360: General Site: August 19, 2024



Photo 361: General Site: August 19, 2024



Photo 363: General Site: August 19, 2024



Photo 362: General Site: August 19, 2024



Photo 364: General Site: August 19, 2024



Photo 365: General Site: August 19, 2024



Photo 367: General Site: August 19, 2024



Photo 366: General Site: August 19, 2024



Photo 368: General Site: August 19, 2024



Photo 369: General Site: August 19, 2024



Photo 371: General Site: August 19, 2024



Photo 370: General Site: August 19, 2024

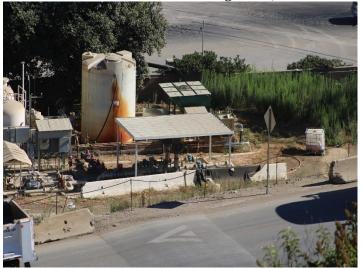


Photo 372: General Site: August 19, 2024



Photo 373: General Site: August 19, 2024



Photo 375: General Site: August 19, 2024



Photo 374: General Site: August 19, 2024



Photo 376: General Site: August 19, 2024



Photo 377: General Site: August 19, 2024



Photo 379: General Site: August 19, 2024





Photo 380: General Site: August 19, 2024



Photo 381: General Site: August 19, 2024



Photo 383: General Site: August 19, 2024



Photo 382: General Site: August 19, 2024



Photo 384: General Site: August 19, 2024



Photo 385: General Site: August 19, 2024



Photo 387: General Site: August 19, 2024



Photo 386: General Site: August 19, 2024



Photo 388: General Site: August 19, 2024



Photo 389: General Site: August 19, 2024



fPhoto 391: General Site: August 19, 2024



Photo 390: General Site: August 19, 2024



Photo 392: General Site: August 19, 2024



Photo 393: General Site: August 19, 2024



Photo 395: General Site: August 19, 2024



Photo 394: General Site: August 19, 2024



Photo 396: General Site: August 19, 2024



Photo 397: General Site: August 19, 2024



Photo 399: General Site: August 19, 2024



Photo 398: General Site: August 19, 2024



Photo 400: General Site: August 19, 2024



Photo 401: General Site: August 19, 2024



Photo 403: General Site: August 19, 2024



Photo 402: General Site: August 19, 2024



Photo 404: General Site: August 19, 2024



Photo 405: General Site: August 19, 2024



Photo 407: General Site: August 19, 2024



Photo 406: General Site: August 19, 2024



Photo 408: General Site: August 19, 2024



Photo 409: General Site: August 19, 2024



Photo 411: General Site: August 19, 2024



Photo 410: General Site: August 19, 2024



Photo 412: General Site: August 19, 2024



Photo 413: General Site: August 19, 2024



Photo 415: General Site: August 19, 2024



Photo 414: General Site: August 19, 2024



Photo 416: General Site: August 19, 2024



Photo 417: General Site: August 19, 2024



Photo 419: General Site: August 19, 2024



Photo 418: General Site: August 19, 2024



Photo 420: General Site: August 19, 2024



Photo 421: General Site: August 19, 2024



Photo 423: General Site: August 19, 2024



Photo 422: General Site: August 19, 2024



Photo 424: General Site: August 19, 2024



Photo 425: General Site: August 19, 2024



Photo 427: General Site: August 19, 2024

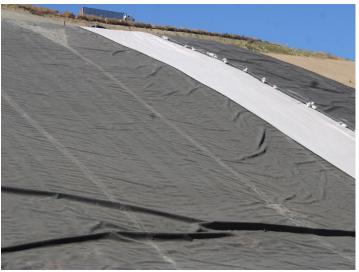


Photo 426: General Site: August 19, 2024



Photo 428: General Site: August 19, 2024



Photo 429: General Site: August 19, 2024



Photo 431: General Site: August 19, 2024



Photo 430: General Site: August 19, 2024



Photo 432: General Site: August 19, 2024



Photo 433: General Site: August 19, 2024



Photo 435: General Site: August 19, 2024



Photo 434: General Site: August 19, 2024



Photo 436: General Site: August 19, 2024



Photo 437: General Site: August 19, 2024



Photo 439: General Site: August 19, 2024



Photo 438: General Site: August 19, 2024



Photo 440: General Site: August 19, 2024



Photo 441: General Site: August 19, 2024



Photo 443: General Site: August 19, 2024



Photo 442: General Site: August 19, 2024



Photo 444: General Site: August 19, 2024



Photo 445: General Site: August 19, 2024



Photo 447: General Site: September 24, 2024



Photo 446: General Site: September 24, 2024



Photo 448: General Site: September 24, 2024



Photo 449: General Site: September 24, 2024



Photo 451: General Site: September 24, 2024



Photo 450: General Site: September 24, 2024



Photo 452: General Site: September 24, 2024



Photo 453: General Site: September 24, 2024



Photo 455: General Site: September 24, 2024



Photo 454: General Site: September 24, 2024



Photo 456: General Site: September 24, 2024



Photo 457: General Site: September 24, 2024



Photo 459: General Site: September 24, 2024



Photo 458: General Site: September 24, 2024



Photo 460: General Site: September 24, 2024



Photo 461: General Site: September 24, 2024



Photo 463: General Site: September 24, 2024



Photo 462: General Site: September 24, 2024



Photo 464: General Site: September 24, 2024



Photo 465: General Site: September 24, 2024



Photo 467: General Site: September 24, 2024



Photo 466: General Site: September 24, 2024



Photo 468: General Site: September 24, 2024



Photo 469: General Site: September 24, 2024



Photo 471: General Site: September 24, 2024



Photo 470: General Site: September 24, 2024



Photo 472: General Site: September 24, 2024



Photo 473: General Site: September 24, 2024



Photo 475: General Site: September 24, 2024



Photo 474: General Site: September 24, 2024



Photo 476: General Site: September 24, 2024



Photo 477: General Site: September 24, 2024



Photo 479: General Site: September 24, 2024



Photo 478: General Site: September 24, 2024



Photo 480: General Site: September 24, 2024



Photo 481: General Site: September 24, 2024



Photo 483: General Site: September 24, 2024



Photo 482: General Site: September 24, 2024



Photo 484: General Site: September 24, 2024



Photo 485: General Site: September 24, 2024



Photo 487: General Site: September 24, 2024



Photo 486: General Site: September 24, 2024



Photo 488: General Site: September 24, 2024



Photo 489: General Site: September 24, 2024



Photo 491: General Site: September 24, 2024



Photo 490: General Site: September 24, 2024



Photo 492: General Site: September 24, 2024



Photo 493: General Site: September 24, 2024



Photo 494: General Site: September 24, 2024

Appendix III

Quarterly Site Visits: Site Visit Attendees by Date of Site Visit/ Mitigation Monitoring Site Reports

July 2024

Monitor: James Aidukas	Page:	1	of	2
Discipline: Project Manager	Date: 7/3/24			
Site Conditions: 60-90°F				*
SITE	LOG			

Drove the Granada Hills area near Woodley Avenue, the adjacent neighborhood, and school areas from 6:15 to 7:20 a.m. There were no landfill odors detected at the school or the adjacent areas. The deep ruts in the left turning and the adjacent northbound lanes on San Fernando Road at the landfill entrance have not been repaired. This road condition could be a hazard for passenger cars, small pickup trucks, and motorcycles. The retaining wall south of the entrance, the walkway in front of the wall and the acceleration lane had been cleared of soil and rock. The area is ready for fall rain events. Met with Steven Jareb, Edgar De La Torre, and Diana Gonzalez (LACDRP), Alex Fitchmun (LACDPW), Dave Thompson (LEA) and Kate Downey (Republic Services- for a portion of the monitoring). We then proceeded to monitor the site and observed the following:

- The Administration area facilities were in good condition. There were no improvements made to the parking lot area's surface condition.
- The Adler Tank leachate and condensate treatment system was operating, and no odors were detected. The hydrogen peroxide storage vessel had an emergency shutdown switch located near the vessel. There was no remote safety switch.
- The excavated and soil filled slopes above and below the new scales had the slopes compacted and these and other slopes were final graded.
- The terminal basin had the inlet corrugated HDPE pipes and the western concrete wall of the basin removed. The basin had ponds of standing water. There was a significant amount of sediment in the whole basin, approximately eight feet in depth in some areas. The water removal well outside of the western wall of the basin had iron oxide in it and was draining out of the well casing down into the basin. An excavator was moving soil into piles to promote sediment drying. The outlet risers were covered with debris around and on top of them. A large (approximately 72" diameter) galvanized corrugated drainage pipe was being buried under where the final toe berm will be constructed.
- The new access road from the scales to Cell CC-5 is paved. The road around Basin E has been striped and K-rails have been placed at the edge of the roadway for truck safety. These roads are functioning well. All the slopes that had erosion from prior rain events were not repaired. Permanent rainwater downcomer piping and temporary liner downcomers were installed.
- Basin E had some dry sediment in it. Most of the basin's sediment was removed.
- Soil was being imported and placed in the active disposal area.
- The site operations were viewed from the Deck A observation area. The active waste disposal areas were in Cell CC-5. There were localized fresh waste odors at the landfill perimeter access road near Basin A. Odors were not leaving the site.

7/3/24 Page 2 of 2

- The western edge of the Closure Turf was being removed and prepared for the next Cell development moving east. There were buried gas collection pipes that were uncovered and removed in this area. Decomposed trash was uncovered at the base of the Closure Turf. Concrete pieces of the old Gentille Road were uncovered by a backhoe. Alluvial water was draining out of the Old City South landfill.
- The bowl area had soil cover placed on the top eastern slopes, most likely for gas or liquids odor control.
- The eastern drainage channel downstream of Basin B where the soil was washed away from the back of the concrete channel's slope wall had not yet been repaired, Portions of the concrete wall are showing cracks and movement. Vegetation is growing in the concrete channel.
- Basin B had all the sediment removed. Vegetation growing in the concrete cracks was not removed.
- Basin A was dry, and all the sediment was removed.
- The westside drainage channel out of Basin A was cleared of the windblown litter.
- City sage mitigation Decks B and C were observed. There was mustard weed growing in the sage mitigation and PM-10 Oak Tree areas. The dead PM-10 mitigation Oak trees had not been replaced.
- County sage mitigation slopes were naturally doing well. There was no grading of the bare slopes or planting being done.

Flare Operating Conditions:

- o Flare 1 1634°F, 2486 SCFM
- o Flare 3 Not Operating
- Flare 9 1646° F, 2719 SCFM
 Flare 10 Not Operating
- o Flare 11 1626°F, 3622 SCFM

The gas-to-energy plant was using 8791 SCFM of recovered gas. The total volume of recovered gas was 17,618 SCFM.

FURTHER REVIEW NEEDED
COMMENTS
Signed:

August 2024

Monitor: James Aidukas	Page:	1	of	2	
Discipline: Project Manager	Date: 8/19/24				
Site Conditions: 60-95°F, 0-15 mph	2 2	<i>y</i>			
SIT	ELOG				

Drove the Granada Hills area near Woodley Avenue, the adjacent neighborhood, and school areas from 6:30 to 7:30 a.m. There were no landfill odors detected at the school or the adjacent areas. The deep ruts in the left turning and the adjacent northbound lanes on San Fernando Road at the landfill entrance have not been repaired. This road condition could be a hazard for passenger cars, small pickup trucks, and motorcycles. Met with Mike Lindsay (UltraSystem), Edgar De La Torre, and Diana Gonzalez (LACDRP), and Michael Harmon, and Alex Fitchman (LACDPW). We then proceeded to monitor the site and observed the following:

- The Administration area facilities were in good condition. There were no improvements made to the parking lot area's surface condition.
- The Adler Tank leachate and condensate treatment system was operating, and no odors were detected. The hydrogen peroxide storage vessel had an emergency shutdown switch located near the vessel. There was no remote safety switch.
- Observed the whole landfill from the Deck A viewing platform. The Northeastern area of Cell CC-4 Part 4 was actively accepting waste. Approximately 90% of the ADC was covered with waste at 8:30am. The erosion at the western edge of the Closure Turf has not been repaired.
- Basin E was dry and cleared of sediment. New concrete V-ditches were installed around the basin.
- The new scales were operating with no concerns noted.
- The terminal basin had the inlet corrugated HDPE pipes removed and the northern portion of the western concrete wall. New corrugated galvanized pipes (approximately 72" and smaller) were installed. There was a significant amount of sediment in the whole basin, approximately eight feet or more in depth in some areas. Water entering the basin flowed to the outlet risers in a sediment dirt channel. The outlet risers were covered with debris around and on top of them. The outlet channel had sediment and rocks in it from rain events.
- The new access road from the scales to Cell CC-4 Part-5 is paved and in use. The road around Basin E has been striped and K-rails have been placed at the edge of the roadway for truck safety. These roads are functioning well.
- Large galvanized pipe (up to 72"in diameter) was being installed up stream of the terminal basin to handle Old City South surface water.
- Soil was being imported and placed in the active disposal area.
- There was a localized fresh waste odor at the landfill perimeter access road near Basin A. This was where the trucks were entering and leaving the active disposal area. Odors were not leaving the site.

Page 2 of 2 08-19-2024

- 32. The County sage mitigation slopes are in good order.
- 33. Sediment basin A has been cleared of sediment.
- 34. The westside drainage channel is in good order; cleared of sediment.
- 35. Flare 3 is offline.
- 36. Flare 1 is operating at 2560 scfm, 1640 °F. Gas sample measured at 35 % Vol. CH4, 2.0 % Vol. O2, 16 ppm CO, and 3 ppm H2S. Gas inlet temperature is 141 °F
- 37. City deck B sage mitigation area is in good order.

FURTHER REVIEW NEEDED

1. Remove dumped mattresses along Sepulveda Boulevard.

Signed: Michael W. Lindsay

Monitor: Mike Lindsay	Page 1 of 2	
Discipline: Environmental Engineer	Date: 08-19-2024 Monday	
Site Conditions: Clear, 63–96 °F, NW 2–16 mph, 81% RH, 44 AQI Good		
SITE LOG		

- 1. No landfill odors are present in the adjacent neighborhood or school at 7:25 am. Trash bins are out for Monday pickup.
- 2. Two mattresses have been illegally dumped along Sepulveda Boulevard just southeast of Balboa Boulevard, one-half mile from landfill entrance.
- 3. The admin and LEA facility are in good order.
- 4. The Alder tank farm is in good order, with no odors present.
- 5. Street sweepers are cleaning the haul roads.
- 6. Met with Jim Aidukas (UltraSystems), Edgar De La Torre and Diana Gonzalez (LACDRP), and Mike Harmon and Alex Fitchman (LACPW), following in separate vehicles to site locations.
- 7. Observed the overall landfill operations from the observation deck.
- 8. Working area at Cell CC-4/5 is active with tippers, moving floor trucks and packer trucks.
- 9. ADC is 95% covered with new trash at 8:45 am.
- 10. Basin E is in good order, with sediment removed ahead of the rainy season. New drainage V-ditches have been constructed at perimeter of basin. K-rails have been placed along access road.
- 11. Observed new scalehouse in operation.
- 12. The terminal basin is being cleared of sediment. Vegetation has grown at northeast end of basin.
- 13. The outlet drainpipe for the new sediment basin E, which terminates near the gabion wall, is not visible (covered with sediment).
- 14. The gabion wall is covered with sediment (the wall is about nine feet high).
- 15. The terminal basin outlet channel is in good order.
- 16. Large drainage pipes are being laid that come down from old City south slopes towards the terminal basin.
- 17. Jute netting is being installed on the slopes below the new haul road for soil stabilization.
- 18. Observed closure turf where bottom portion has been excavated for new cell construction. No odors are present.
- 19. Liner material is being placed on side slopes opposite to the closure turf area.
- 20. Sediment basin B has been cleared of sediment.
- 21. Fans are in-place above the active working area to mitigate odors.
- 22. Flare 9 is operating at 2914 scfm, 1644 °F. Gas sample measured at 43 % Vol. CH4, 0.3 % Vol. O2, 13 ppm CO, and 48 ppm H2S. Blowers 2, 3, 4, 5 and 6 are operating. Gas inlet temperature is 140 °F.
- 23. Blower number 1 has been removed.
- 24. Flare 10 is offline.
- 25. Flare 11 is operating at 3093 scfm, 1660 °F. Gas inlet temperature is 142 °F.
- 26. Sunshine Gas Producers facility is operating at 7593 scfm, with no odors present.
- 27. Perimeter drainage channel at flare pad is in good order, with sediment mostly clear.
- 28. A drainage channel below (southwest) of the flare pad is still blocked with soil and a large tree.
- 29. No odors are present at the bowl area by sediment basin B.
- 30. A large storage/ work structure is being constructed adjacent to the gas to energy facility.
- 31. The County top deck is in good order, with stockpiled soil being used for cover material.

Page 2 of 2 08-19-2024

- 32. The County sage mitigation slopes are in good order.
- 33. Sediment basin A has been cleared of sediment.
- 34. The westside drainage channel is in good order; cleared of sediment.
- 35. Flare 3 is offline.
- 36. Flare 1 is operating at 2560 scfm, 1640 °F. Gas sample measured at 35 % Vol. CH4, 2.0 % Vol. O2, 16 ppm CO, and 3 ppm H2S. Gas inlet temperature is 141 °F
- 37. City deck B sage mitigation area is in good order.

FURTHER REVIEW NEEDED

1. Remove dumped mattresses along Sepulveda Boulevard.

Signed: Michael W. Lindsay

September 2024

Monitor: James Aidukas	Page:	1	of	2	
Discipline: Project Manager	Date: 9/24/24				
Site Conditions: 60-95°F, 0-10 mph					
	SITE LOG				

Drove the Granada Hills area near Woodley Avenue, the adjacent neighborhood, and school areas from 6:45 to 7:30 a.m. There were no landfill odors detected at the school or the adjacent areas. The deep ruts in the left turning and the adjacent northbound lanes on San Fernando Road at the landfill entrance have not been repaired. This road condition could be a hazard for passenger cars, small pickup trucks, and motorcycles. Met with Mike Lindsay (UltraSystems), Edgar De La Torre, and Diana Gonzalez (LACDRP), Alex Castro (LACDPW), and Dave Thompson (City LEA). We then proceeded to monitor the site and observed the following:

- The Administration area facilities were in good condition.
- The Adler Tank leachate and condensate treatment system was operating, and no odors were detected. The hydrogen peroxide storage vessel had an emergency shutdown switch located near the vessel. There was no remote safety switch.
- Observed the whole landfill from the Deck A viewing platform. The Northeastern area of Cell CC-4 Part 4 was actively accepting waste. Approximately 80% of the ADC was covered with waste at 9:00am. The erosion at the western edge of the Closure Turf has not been repaired. A deep hole was observed at the bottom of the HDPE drainage downcomer. Access was limited due to construction.
- The top deck of the prior active area near the top deck of the bowl area was idle. The area was covered with ADC.
- The prior filled CC-4 Parts 3, 4, and 5 were graded and straw wattles were placed for erosion control
- Soil was being brought in by dump trucks and placed near the active area. Double dump trucks brought in soil that was placed on the County top deck.
- Sediment was removed from the terminal basin. Seep water was entering from the western wall.
- The western edge of the Closure Turf was being removed and prepared for the next cell development moving east. Decomposed trash was uncovered at the base of the Closure Turf. Odors were localized to the construction when it was observed.
- The eastern drainage channel downstream of Basin B where the soil was washed away from the back of the concrete channels slope wall had not yet been repaired. Portions of the concrete wall were showing cracks and movement. Vegetation growing in the concrete channel has been removed.
- Basin A was dry and cleared of sediment.
- The westside drainage channel out of Basin A has not been cleared of sediment and windblown litter.

9/24/24 Page 2 of 2

- City sage mitigation decks B and C were observed. There was mustard weed growing in the sage mitigation and PM-10 Oak Tree areas. The dead PM-10 mitigation oak trees had not been replaced.
- County sage mitigation slopes were naturally doing well. There was no grading of the bare slopes or planting being done.
- The wastewater city sewer connection at the landfill entrance was observed. There were no odors detected, and no concerns observed.

Flare Operating Conditions:

- o Flare 1 1631°F, 2410 SCFM
- o Flare 3 Not Operating
- Flare 9 Not Operating
 Flare 10 1651°F, 3272 SCFM
- o Flare 11 1651°F, 3388 SCFM

FURTHER REVIEW NEEDED

COMMENTS

Signed:

Monitor: Mike	Lindsay	Page 1 c	of 2	
Discipline: Env	ironmental Engineer	Date:	09-24-2024	Tuesday
Site Conditions: Clear, 60–90 °F, E 3–8 mph, 46% RH, 54 AQI Moderate				
SITELOG				

- 1. No landfill odors are present in the adjacent neighborhood or school at 7:40 am. Republic odor patrol is active.
- 2. The Alder tank farm is in good order, with no odors present.
- 3. Street sweepers are cleaning the haul roads.
- 4. Met with Jim Aidukas (UltraSystems), Edgar De La Torre and Diana Gonzalez (LACDRP), Alex Castro (LACPW), and Dave Thompson (LEA), following in separate vehicles to site locations.
- 5. The admin and LEA facility are in good order.
- 6. The observation deck has had new flooring installed.
- 7. Observed the overall landfill operations from the observation deck.
- 8. Rolls of new straw wattle has been staged near Cell CC-4 Part 4/5.
- 9. Working area at Cell CC-4 is active with tippers, moving floor trucks and packer trucks.
- 10. ADC at Cell CC-4 is 70% covered with new trash at 8:50 am.
- 11. The Cell CC-3 working area is not active at 8:50 am, and is completely covered with ADC. Additional rolls of straw wattle are staged at east end of cell.
- 12. Double bottom dump trucks are bringing soil onto site and stockpiling it on the County top deck.
- 13. Odor dome fan trailers are in-place at Cell CC-3 above the active working area to mitigate odors.
- 14. The large storage/ maintenance structure constructed adjacent to the gas to energy facility has had the outside cover material installed. The structure is anchored onto perimeter 40-yard containers.
- 15. Observed closure turf where west perimeter has been repaired for erosion. No odors are present.
- 16. The perimeter oilfield gate is closed and locked.
- 17. The terminal basin has been cleared of sediment.
- 18. The outlet drainpipe for the new sediment basin E, which terminates near the gabion wall, is now visible.
- 19. The gabion wall has been removed from the terminal basin.
- 20. The south-end terminal basin wall has been repoured with new concrete.
- 21. The eastside drainage channel is in good order.
- 22. The terminal basin outlet channel is in good order.
- 23. Progress has been made installing large drainage pipes that come down from old City south slopes towards the terminal basin.
- 24. Workers are installing liner material on slopes adjacent to the closure turf.
- 25. The gas-to-energy plant is in good order, with no odors present.
- 26. Flare 9 is offline.
- 27. Blower number 1 has not been reconnected.
- 28. Flare 10 is operating at 3263 scfm, 1651 °F. Gas sample measured at 41 % Vol. CH4, 1.0 % Vol. O2, 10 ppm CO, and 43 ppm H2S. Blowers 2, 3, 4, 5 and 6 are operating. Gas inlet temperature is 130 °F.
- 29. Flare 11 is operating at 3388 scfm, 1651 °F. Gas inlet temperature is 140 °F.
- 30. Sunshine Gas Producers facility is operating at 8146 scfm, with no odors present.
- 31. Perimeter drainage channel at flare pad is in good order, with sediment mostly clear.
- 32. A drainage channel below (southwest) of the flare pad is still blocked with soil and a large tree.

Page 2 of 2 09-24-2024

- 33. No odors are present at the bowl area by sediment basin B.
- 34. The County top deck is in good order, with stockpiled soil being used for cover material.
- 35. The County sage mitigation slopes are in good order.
- 36. Sediment basin A is clear of sediment.
- 37. The westside drainage channel is in good order; cleared of sediment.
- 38. Flare 3 is offline.
- 39. Flare 1 is operating at 2392 scfm, 1631 °F. Gas sample measured at 34 % Vol. CH4, 1.9 % Vol. O2, 22 ppm CO, and 91 ppm H2S. Gas inlet temperature is 138 °F
- 40. City deck B sage mitigation area is in good order.
- 41. The south perimeter odor neutralizing piping is operating properly.

	FURTHER REVIEW NEEDED
1.	None.
Signe	ed: Michael W. Lindsay