

Town & Country Retail 6310-6360 W. Third Street Los Angeles, California 90036

May 26, 2017

Town & Country Retail 6310-6360 W. Third Street Los Angeles, California 90036

Holley

Janet Holtz

Principal Environmental Scientist

Prepared for:

Regency Centers Corporation

One Independent Drive, Suite 114

Jacksonville, FL 32202

Prepared by:

Arcadis U.S., Inc.

320 Commerce

Suite 200

Irvine

California 92602

Tel 714 730 9052

Fax 714 730 9345

Our Ref.:

CM011944.0000

Date:

May 26, 2017

This document is intended only for the use of the individual or entity for which it was prepared and may contain information that is privileged, confidential and exempt from disclosure under applicable law. Any dissemination, distribution or copying of this document is strictly prohibited.

CONTENTS

Ac	ronyn	ns and Abbreviations	V
Ex	ecutiv	ve Summary	1
1	Intro	oduction	1
	1.1	Purpose	1
	1.2	Detailed Scope of Services	1
	1.3	Significant Assumptions	2
	1.4	Limitations and Exceptions	2
	1.5	Special Terms and Conditions	3
	1.6	Reliance	3
	1.7	Deviations	3
	1.8	Additional Services	3
2	Site	Location / Land Use	4
	2.1	Site Location	4
	2.2	Site and Vicinity Characteristics	4
	2.3	Current Use of the Property	4
	2.4	Description of Structures, Roads, and Other Improvements on the Site	4
	2.5	Current Uses of the Adjoining Properties	5
3	Use	r-Provided Information	6
	3.1	Environmental Liens	6
	3.2	Activity and Use Limitations	6
	3.3	Specialized Knowledge	6
	3.4	Valuation Reduction for Environmental Issues	6
	3.5	Commonly Known or Reasonably Ascertainable Information	6
	3.6	Obvious Contamination Presence or Likely Presence	6
	3.7	Owner, Property Manager, and Occupant Information	6
	3.8	Reason for Performing Phase I ESA	6
4	Site	History	7
	4.1	Previous Environmental Investigations	8
5	Rec	ords Review	.12

	5.1	Regul	atory Database Research	12
		5.1.1	Site	13
		5.1.2	Off-Site Properties	14
	5.2	Agend	cy Research	15
6	En	vironme	ntal Setting	17
	6.1	Topog	graphy	17
	6.2	Geolo	gy	17
	6.3	Surfac	ce Water	17
	6.4	Hydro	geology	17
	6.5	Flood	Zones	17
7	Site	e Recon	naissance	18
	7.1	Metho	odology and Limiting Conditions	18
	7.2	Gene	ral Site Conditions	18
		7.2.1	Site Observations	18
		7.2.2	Hazardous Substances and Petroleum Products in Connection with Identified Uses	20
		7.2.3	Storage Tanks	20
		7.2.4	Odors	20
		7.2.5	Pools of Liquid	20
		7.2.6	Drums	20
		7.2.7 Conne	Hazardous Substances and Petroleum Product Containers (Not Necessarily in ction with Identified Uses)	20
		7.2.8	Unidentified Substance Containers	20
		7.2.9	PCBs	20
		7.2.10	Pits, Ponds, or Lagoons	21
		7.2.11	Stained Soil or Pavement	21
		7.2.12	Stressed Vegetation	21
		7.2.13	Solid Waste	21
		7.2.14	Wastewater	21
		7.2.15	Wells	21
		7.2.16	Septic Systems	21
		7 2 17	Heating / Cooling	21

		7.2.18 Stains or (Corrosion	22
		7.2.19 Drains or	Sumps	22
8	Inter	views		23
	8.1	Interview with Site	e Contacts	23
9	Find	ings and Conclusi	ons	24
	9.1	Recognized Envi	ronmental Conditions	24
	9.2	Controlled Recog	nized Environmental Conditions	24
	9.3	Historical Recogn	nized Environmental Conditions	24
	9.4	De Minimis Cond	itions	24
	9.5	Conclusions		25
10	Data	Gaps		26
11	Envi	ronmental Profess	sionals Statement	27
12	Refe	rences		28
T/	ABI	ES (EMBE	EDDED IN TEXT)	
Tab	ole 1	Historical Info	mation Reviewed	7
Tab	ole 2	Regulatory Ag	ency Databases/Lists Reviewed	12

FIGURES

Figure 1 Site Location Map

Figure 2 Site Plan

APPENDICES

- A Site Photographs
- B Historical Research Documentation
- C Prior Report
- D EDR Radius Map Report
- E Supporting Documentation

arcadis.com iv

ACRONYMS AND ABBREVIATIONS

Arcadis U.S., Inc.

AST aboveground storage tank

ASTM ASTM International

bgs below ground surface

CFR Code of Federal Regulations

CRECs controlled recognized environmental conditions

EDR Environmental Data Resources, Inc.

ESA Environmental Site Assessment

HRECs historical recognized environmental conditions

LAFD Los Angeles Fire Department

LUST Leaking underground storage tank

PCBs polychlorinated biphenyls

PCE perchloroethylene

RECs recognized environmental conditions

RWQCB Regional Water Quality Control Board

U.S. EPA United States Environmental Protection Agency

UST underground storage tank

EXECUTIVE SUMMARY

Arcadis U.S., Inc. (Arcadis) was retained by Regency Centers Corporation (Regency) to conduct a Phase I Environmental Site Assessment (ESA) of Town & Country Retail located at 6310-6360 W. Third Street in Los Angeles, Los Angeles County, California (the Site). The Site is an existing retail center proposed for redevelopment.

As directed by Regency, the Phase I ESA was performed in accordance with the ASTM International (ASTM) Standard E1527-13, Standard Practice for Environmental Site Assessments: *Phase I Environmental Site Assessment Process*. The goal of the Phase I ESA was to identify recognized environmental conditions (RECs), controlled recognized environmental conditions (CRECs), and historical recognized environmental conditions (HRECs) associated with the property in conformance with ASTM E1527-13.

The Phase I ESA included a visual inspection of the property completed on May 17, 2017; observation of adjacent properties; reviews of environmental regulatory agency records, historical documents, and facility records that were available on site; and interviews with personnel represented to be familiar with the Site as indicated elsewhere in the report.

The findings identified by Arcadis are summarized below and discussed in greater detail in the body of the report.

Historical Findings

The Site is located in the former Salt Lake Oil Field and north of the La Brea Tar and Fossil Pits. Two oil wells were drilled onsite circa 1906 and associated features included sumps and crude oil storage tanks. The wells were abandoned circa 1930. In the 1940s, the Site was developed with the Town & Country Market in the central portion of the Site. The Site was developed in its present-day retail configuration in the early 1960s.

The Site is located in a high potential methane zone as defined by the Los Angeles Public Works

Department and is currently monitored for methane and is subject to methane ordinances established by
the Los Angeles Fire Department and the Los Angeles Building Department.

Based on the Site's historical use for oil field activities, a previous consultant conducted soil testing onsite. Results of soil testing identified crude oil impacted soil in the former oil well locations and in two suspected former oil sump locations. The highest concentrations of contaminants were primarily less than 10 feet below ground surface (bgs); however, in one location contaminants were identified to greater than 20 feet bgs. Low level impacts were also encountered in drainage channel locations but did not extend beyond 3 feet bgs. No impacts were found in former suspected aboveground tank locations. The highest total petroleum hydrocarbon (TPH) concentration detected was 14,000 parts per million (ppm). Concentrations of other contaminants of concern were trace to non-detect, or in the case of metals, consistent with background concentrations. The previous consultant stated that based on the current development of the site, the lack of pathways for human exposure to the contaminated soil limited the human health risk. They also stated the TPH impacts at the Site did not present a significant risk to groundwater beneath the Site. However, they did state that the Regional Water Quality Control Board

(RWQCB) might require remedial activities were the site to be redeveloped. They estimated the cost for excavation of 6,000 cubic yards (9,000 tons) of impacted soil, transport, treatment, and import of clean soil at \$324,000 (1998 dollars). They also stated that a methane monitoring and maintenance plan should be developed for the Site and that the estimated cost of annual testing was \$25,000 (1998 dollars).

On-Site Findings

The approximate 7.5-acre, irregular-shaped site consists of a retail center and a paved parking lot. Tenants of note include the following:

Kmart

Kmart occupies the east shopping center building. The Kmart building is a two-story building with a basement. The basement and first floors are used for retail sales. The second story consists of retail goods storage areas, former offices, a staff lounge, restrooms, a hazardous materials storage room, and air handler rooms for the building.

Three elevators and a series of escalators provide access to the floors of the building. Two of the elevators are traction-type. A service elevator is hydraulic. An inspection of the elevator equipment rooms did not reveal evidence of spills or releases of hydraulic fluid or unusual odors. The equipment appeared to be in aged condition.

Used automotive batteries are stored in a hazardous materials room located on the second floor of the building. The batteries were observed to be stored on wooden pallets. Poly drums of hazardous materials are also stored in the room. The hazardous materials consist of damaged aerosols such as hair spray, soaps and cleaners, waxes and polishes, makeup, etc. The poly drums are labeled stating their contents. No evidence of releases or staining was observed in the hazardous materials room.

Whole Foods Market

Whole Foods Market occupies the western portion of the shopping center buildings. A refrigeration equipment room, hazardous materials center and offices are located in the rear, southern portion of the building.

The refrigeration equipment room contains approximately 16 compressors and large cooling equipment. The equipment and piping is labeled as containing R-404A refrigerant and Polyol Ester Lubricant. The equipment appeared to be aged but in good operating order. Dark staining was observed on and around the compressors but the staining appeared to be due to small releases over a long period of time and not from a malfunction release.

A hydraulic box compressor is present near the loading dock. The compressor appeared to be in good operating order and no evidence of releases or significant staining was observed on the compactor or in the surrounding area.

A hazardous materials center is located next to the box compressor. The area contained two poly 55-gallon drums and approximately seven poly bins. The containers were labeled as to their contents. The hazardous materials consist of damaged general waste. No evidence of staining or releases was observed on the containers or in the surrounding area.

A truck loading dock is located at the south side of the building. Forklift propane tanks are stored in locked steel cages on the loading dock. Additionally, four steel plates are present in the floor of the loading dock, evidence of a possible clarifier. The Site contact was unaware of a clarifier at the Site.

CVS Pharmacy

The CVS Pharmacy building occupies the western end of the retail buildings. The building is a single-story structure with a basement. The basement is used for retail goods storage.

A hydraulic box compressor is present near the loading dock at the south side of the building. The compressor appeared to be in good operating order and no evidence of releases or significant staining was observed on the compactor or in the surrounding area.

Citibank

Citibank occupies a building located on the northwest corner of the Site. Access to the interior of the bank was not granted for this assessment.

Regulatory Findings

An environmental database report prepared by Environmental Data Resources, Inc. (EDR) was reviewed for local, state, and federal listings for the Site and properties within the site vicinity. Regulatory database lists were reviewed for cases pertaining to leaking underground storage tanks (USTs) and aboveground storage tanks (ASTs), hazardous waste sites, and abandoned sites within the specified radii of standards established by ASTM guidelines. The Site address 6310 W. Third Street is listed under the name Kmart in the HAZNET database. Kmart is listed as generating hazardous waste under manifest from 1995 through 2015. There are over 60 records listed. Typical waste streams included waste oil and mixed oil, unspecified solvent mixture, off-specification, aged or surplus organics, asbestos-containing waste, alkaline solution without metals, latex waste, and acidic liquids. This listing indicates the proper offsite disposal under manifest of hazardous waste and does not in itself indicate an environmental concern for the Site. The Site address 6360 W. Third Street is listed under the name CVS Pharmacy No. 9661 in the RCRA-LQG and ECHO databases. The RCRA database provides a variety of waste codes for wastes generated at the site and indicates there were no violations. The same information is provided in the EPA's ECHO database. The remaining site addresses were not listed in any of the databases searched.

According to EDR's report, numerous properties are listed within the ASTM-search radius due to the Site's location in a dense urban area. However, based on their listing for tracking purposes only, distance from the Site, hydraulic location with respect to groundwater flow, and/or case closure, these off-site properties are unlikely to represent a concern of environmental impairment or a vapor encroachment condition to the Site. However, the following offsite property warrants discussion:

Kings Cleaners, 349 S. Fairfax Avenue, located adjacent to the west of the Site across S. Fairfax Avenue, is listed in the RCRA-SQG, ECHO, CA HAZNET, and CA Drycleaners databases. This address is currently an operating cleaner named Fair Dry Cleaners. It is listed as a generator of hazardous waste from 1995 to 2000; the waste stream is listed as halogenated solvents which includes the dry cleaning solvent perchloroethylene (PCE). No violations are reported. This facility currently uses a non-toxic dry cleaning compound according to signage on the facility. However, the historical long-term use of PCE and

the propensity for dry cleaners to release PCE to the environment represents a potential concern for the Site due to this facility's proximity to the Site. There are no agency records of a release from this facility; however, this can simply mean that no subsurface testing has been conducted. Arcadis observed two monitoring wells near this property, one north and one west of it. However, these wells are associated with a release south of the cleaners and the plume from that release is confined to the west side of S. Fairfax Avenue according to the most recent information from the RWQCB.

It is noted that the EDR database report does not identify any regional groundwater plumes underlying the Site; however, this does not rule out that groundwater beneath the Site and in the surrounding area is not impacted with contaminants of concern due to the fairly shallow depth, reported to be less than 30 feet bgs, and the long-term development of the surrounding area for oil field and commercial uses. The shallow aquifer is not considered a potable water source.

Conclusions

Arcadis has performed a Phase I ESA of the Site in conformance with the scope and limitations of ASTM Practice E1527-13 for Phase I ESAs. This assessment has revealed no evidence of RECs in connection with the Site, with the following exceptions:

- A previous subsurface investigation conducted onsite in 1998 identified soil impacted with
 petroleum hydrocarbons. The depth of impact was mainly confined to less than 10 feet bgs;
 however, one location had elevated concentrations of contaminants to greater than 20 feet bgs.
 The origin of the contamination is attributed to former oil field activities onsite including oil wells
 and oil sumps.
- The former oil wells onsite do not appear to have been abandoned to current standards and a
 previous consultant suspected the well in the northeast portion of the Site was leaking and
 contributing to high methane gas levels in that area.
- The presence of current and historical dry cleaners adjacent west of the Site represents a suspect REC for the Site. If releases of PCE from the dry cleaners impacted soil vapor and groundwater, a vapor intrusion concern may exist for the Site.

No CRECs were identified in connection with the Site, with the following exception:

The Site's location within a defined methane zone and the detected presence of methane gas
onsite represents an environmental concern for the Site and the health and safety of site
occupants. However, as long as methane continues to be monitored and vented in accordance
with Fire Department requirements, it is considered a CREC for the Site.

The following de minimis conditions were identified in connection with the Site:

It is a possible a clarifier is present at the south end of the Site. Based on the types of current
and historical tenant uses it is not anticipated that hazardous materials were routed through the
clarifier. It is likely that the clarifier was used for waste cooking grease from onsite restaurants.
However, evaluation of the clarifier is warranted if the Site is redeveloped.

• Aging equipment onsite, such as elevators and compressors, indicate the potential for oily releases to the subsurface.

In order to more fully understand the ownership liability of the RECs, Arcadis recommends further investigation and/or discussion with legal counsel.

1 INTRODUCTION

Arcadis U.S., Inc. (Arcadis) was retained by Regency Centers Corporation (Regency) to conduct a Phase I Environmental Site Assessment (ESA) of Town & Country Retail located at 6310-6360 W. Third Street in Los Angeles, Los Angeles County, California (the Site). The Site is an existing retail center proposed for redevelopment.

1.1 Purpose

Arcadis understands that the purpose for conducting this Phase I ESA is to assess and document the current status of environmental conditions at the Site.

1.2 Detailed Scope of Services

As directed by Regency, the Phase I ESA was conducted in accordance with the ASTM International (ASTM) E1527-13 Standard Practice for Site Assessments: Phase I Environmental Site Assessment Process. The goal of the Phase I ESA was to identify recognized environmental conditions (RECs), controlled recognized environmental conditions (CRECs), and historical recognized environmental conditions (HRECs) associated with the property in conformance with ASTM E1527-13.

A REC is defined as the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: 1) due to release to the environment; 2) under conditions indicative of a release to the environment; or 3) under conditions that pose a material threat of a future release to the environment. *De minimis* conditions are not RECs.

A CREC is defined as a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority and that subjects the property to activity and/or use limitations.

A HREC is defined as a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed in a manner accepted by the applicable regulatory authority (for example, as evidenced by the issuance of a no further action letter or equivalent), without subjecting the property to any activity and use limitations.

The ASTM practice requires environmental professionals to identify data gaps following reasonable inquiry of site and Regency personnel and Arcadis' search for "reasonably ascertainable" resources. ASTM E1527-13 defines a data gap as "a lack of or inability to obtain information required by this practice despite good faith efforts by the environmental professional to gather such information."

Arcadis' scope of work included:

- On-site inspection of the Site to identify environmental conditions issues as defined above;
- Review of available environmental documents for the Site, including previous site assessments and investigations;
- Interviews with persons represented to be familiar with the operation and history of the Site;

- Review of property history through interviews, aerial photographs, on-line planning portals, and historical mapping (as available);
- Observation of adjacent properties and the local area to evaluate the potential for adverse environmental impact to the Site; and
- Contracting of Environmental Data Resources, Inc. (EDR) to identify sites of concern as required in the regulatory records review section of the ASTM practice for a Phase I ESA.

The Phase I ESA did not include the collection or analysis of soil, air, water, groundwater, transformer/ electrical fluids, hazardous building materials, or other samples, nor did it include a title search or search for environmental liens. This ESA did not include an assessment of the environmental (or health and safety) compliance status of the site operations.

1.3 Significant Assumptions

Arcadis has assumed that the information sources used for this assessment provided accurate information. Evaluations presented in this report are based exclusively on information provided by Regency and site personnel and observations made during the site visit. No invasive field activities were conducted and no laboratory analyses were performed.

The boundaries of the Site were described in documents provided by Regency and by interviews with Regency and site personnel. Arcadis assumed this information was accurate.

1.4 Limitations and Exceptions

The services performed and any opinions expressed by Arcadis in this report are based upon the limits of the assessment described herein. Arcadis has relied upon the accuracy of documents, information, data, and other materials provided or made available by Regency and others. Arcadis has not independently verified such information and assumes no liability for the accuracy or completeness of such information. Arcadis makes no guarantee that site conditions do not exist, or will not exist in the future, that were undetected or that could lead to liability in connection with the Site. Similarly, past and present activities on the Site indicating the potential for the existence of environmental concerns may not have been discovered by Arcadis. Such activities may include those that would indicate the potential for regulated hazardous substances at the Site. Likewise, site conditions or site activities that were outside the scope of the services described above, or changes to site conditions or regulatory requirements may lead to liabilities in connection with the Site that are not identified in this report. Arcadis has reviewed the information obtained in connection with the performance of the services described above, in keeping with existing applicable environmental consulting standards and enforcement practices, but cannot predict what actions any given agency may take or what standards and practices may apply in the future.

Where access to portions of the Site or to structures on the Site was unavailable or limited, Arcadis renders no opinion and accepts no responsibility for assessment of the condition of these portions of the Site, including specifically, but not limited to, the presence of hazardous substances or petroleum products at these locations. In addition, Arcadis renders no opinion concerning the presence or absence of hazardous substances or petroleum products where direct observation of any part of the Site, or structure on the Site, is limited by physical obstructions.

The conclusions and observations are based upon limited data and professional opinions, and the assessment is performed on a particular date. Site conditions and activities may change after that date. Therefore, the risk of undiscovered environmental impairment of the Site cannot be ruled out. Arcadis does not make any representations or warranties regarding the condition or value of the Site, regardless of the results of the assessment presented in this report.

Arcadis makes no guarantees, certifications, warranties, or representations of any kind whatsoever, whether expressed or implied, regarding this Phase I ESA, the condition of the Site, or the liabilities associated with the Site.

1.5 Special Terms and Conditions

No special terms and conditions were imposed on this Phase I ESA.

1.6 Reliance

It is understood that this report will be prepared for the sole use of Regency, and the contents thereof may not be used or relied upon by any other person without the express written consent and authorization of Arcadis. Use of this report by any other party shall be at such party's sole risk and liability.

1.7 Deviations

No deviations from the referenced ASTM Standard occurred.

1.8 Additional Services

No additional services beyond those outlined in ASTM E1527-13 were conducted as part of the assessment.

2 SITE LOCATION / LAND USE

2.1 Site Location

The irregular-shaped, approximate 7.5-acre site is located at the southeast corner of the intersection of W. Third Street and S. Fairfax Avenue in Los Angeles, California. The Site is located approximately 2.5-miles north of the 10 Freeway. The Site Location Map and Site Plan are presented as **Figures 1 and 2**.

2.2 Site and Vicinity Characteristics

The Site is a retail shopping center constructed in the 1960s. An asphalt-paved parking lot, a small locksmith shop, and stand-alone bank building cover the north end of the Site, and approximately 252,645 square feet of retail-use buildings cover the south end of the Site. An alleyway for store deliveries is present along the south boundary of the Site. The site vicinity is comprised of commercial, retail and residential uses. Photographs of the Site and surrounding areas were taken to document current conditions and are included in **Appendix A**.

2.3 Current Use of the Property

The current use of the site is a retail shopping center. The shopping center is anchored by Kmart located on the east and Whole Foods Market and CVS Pharmacy on the west. The remaining retail stores consist of Payless Shoes, Little Caesars Pizza, Image Clothing, Kmart Shoes, Wigs Today, News Stand, and Andres Restaurant. A small locksmith shop and a small tobacco shop are located in the parking lot. See **Appendix E** for a list of the current onsite tenants.

A stand-alone building occupied by Citibank is located in the northwest corner of the Site. Access to the interior of the Citibank building was not granted by Citibank for this assessment.

2.4 Description of Structures, Roads, and Other Improvements on the Site

The Site is improved with a retail shopping center constructed in the early 1960s. The retail buildings are located on the south side of the Site. The north portion of the Site is occupied by an asphalt-paved parking lot, a bank building, and a small locksmith shop.

Kmart occupies the east portion of the retail buildings. The Kmart building is a two-story building with a basement. The basement and first floors are used for retail sales. The second story contains retail goods storage areas, former offices, a staff lounge, restrooms, a hazardous materials storage room, and air handler rooms for the building.

Single-story retail stores and a restaurant occupy the central portion of the shopping center buildings.

Whole Foods Market and CVS Pharmacy occupy the western portion of the shopping center buildings. These buildings are of single-story construction; however, the CVS Pharmacy building contains a belowgrade basement for retail goods storage.

The buildings are of wood, steel, and concrete construction, with some brick support walls. Interior building materials consist of ceramic floor tiles, wood laminate flooring, vinyl floor tiles, carpeting, drywall, plaster, suspended ceiling tiles, and glue-on ceiling tiles. The building materials were observed to be in conditions varying from good to significantly damaged. Most of the building materials are in aged condition. Suspect asbestos-containing materials (ACMs) were observed in the Kmart building and include 12"x12" and 9"x9" vinyl floor tiles, black mastic, carpet mastic, pipe insulation, and glue-on ceiling tiles. There were some identifying labels on the doors indicating a prior ACM inspection. Other onsite buildings may also contain ACMs.

A small access alley provides delivery access to the buildings and is located along the southern boundary of the Site. Customer access to the Site is via Fairfax Avenue to the west, West 3rd Street to the north, and Ogden Drive to the east.

2.5 Current Uses of the Adjoining Properties

Land uses surrounding the Site predominately consist of commercial and residential properties. The adjoining properties and land uses include:

- North: W. Third Street followed by the Los Angeles Farmers Market.
- East: S. Ogden Drive followed by a Ross retail store
- South: Hancock Park elementary school.
- West: S. Fairfax Avenue followed by commercial uses including a dry cleaner.

Based on visual observations, current activities at the adjacent properties do not appear to be of environmental concern to the Site.

3 USER-PROVIDED INFORMATION

Arcadis was not provided with an ASTM User Questionnaire.

3.1 Environmental Liens

Arcadis' review of regulatory records did not identify environmental liens recorded for the Site.

3.2 Activity and Use Limitations

Arcadis' review of regulatory records did not identify activity and use limitations, such as engineering controls, land use restrictions or institutional controls, that are in place at the Site and/or have been filed or recorded in a registry.

3.3 Specialized Knowledge

Regency does not have specialized knowledge or experience related to the property other than as provided in a prior report (see Section 4.1).

3.4 Valuation Reduction for Environmental Issues

Regency did not comment on whether the purchase price reasonably reflects the fair market value of the property.

3.5 Commonly Known or Reasonably Ascertainable Information

Regency does not have commonly known or reasonably ascertainable information other than as provided in a prior report.

3.6 Obvious Contamination Presence or Likely Presence

Regency stated that the Site is monitored for methane gas due to its location within a defined methane zone.

3.7 Owner, Property Manager, and Occupant Information

The Site is owned by Third & Fairfax, LLC and managed by The ARBA Group. According to a prior report, the Site is identified as Assessor's Parcel Numbers 5509-018-003, -004, -005, -009, -010, -012, and -013. Site occupants were identified in Section 2.3.

3.8 Reason for Performing Phase I ESA

The reason for performing the Phase I ESA was to evaluate current environmental conditions at the Site.

4 SITE HISTORY

Historical information obtained by Arcadis from EDR during this Phase I ESA is summarized in **Table 1**.

Table 1 Historical Information Reviewed

Source	Date	Information Obtained
Sanborn® Fire Insurance Maps (copies provided in Appendix B)	1950, 1969	The 1950 map depicts the Site improved with the Town & Country Market, identified as "numerous stores and booths." The stores and booths are all clustered in the center of the Site. Along the southeast property line there are two small storage structures, a service yard and an incinerator. To the north is the farmers market and to the northwest of the stalls there is a small structure labelled gas & oil. The northwest corner of the intersection of W. Third Street and S. Fairfax Avenue, diagonal to the Site, is also identified as "gas & oils." Commercial buildings are depicted to the west, Hancock Park School to the south, and undeveloped land to the east. The 1969 map depicts the Site in its current configuration with buildings in the southern half of the site, a parking lot in the northern half, and a small structure in the northwest corner. The surrounding area is fairly similar to the 1950 map; however, a grocery warehouse is now depicted east of the Site across Ogden Drive. No obvious concerns to the Site were depicted on the maps reviewed.
Topographic Maps (copies provided in Appendix B)	1894, 1896, 1898, 1900, 1902, 1920, 1921, 1924, 1926, 1950/53, 1966, 1972, 1981, 1991/94, and 2012	The 1894 through 1902 maps depict the Site as undeveloped land south of the present-day W. Third Street and in between the branches of two blue-line streams. The surrounding area is depicted as mostly undeveloped land other than several roads and scattered residences. The 1920 and 1921 maps depict the Site at the southeast corner of the present-day W. Third Street and S. Fairfax Avenue. What appears to be a small road is present in the northwest corner of the Site. The Site is located within the Salt Lake Oil Fields and oil wells are shown onsite and in the surrounding area. On the 1924 and 1926 maps, the small road onsite is no longer shown; however, oil wells are still depicted onsite. The surrounding oil field is now identified as the La Brea Oil Field. The area outside of the oil field is depicted with city streets. Fossil pits are identified southeast of the Site north of Wilshire Boulevard. The 1950/53 map shows what the Sanborn map from the same time period described as the Town & Country Market in the center of the Site. A school is shown south of the Site and what is likely the Farmers Market north of the Site. The majority of the surrounding area is shaded red indicating a developed urban area. The 1966 through 1991/94 maps depict the Site in its current configuration. The surrounding area is a well-developed urban area. The 2012 map does not depict features onsite or in the surrounding area. No features were depicted on or off the Site on the maps reviewed that would indicate an environmental concern for the Site except for historic oil field uses, which are discussed later in this report.

Source	Date	Information Obtained
Aerial Photographs (copies provided in Appendix B)	1923, 1928, 1938, 1948, 1952, 1964, 1972, 1977, 1983, 1989, 1990, 1994, 2002, 2005, 2009, 2010, and 2012. Also Google Earth 2016.	In the 1923 photograph, the Site is covered with oil field related features including access roads, small structures, storage tanks, and possible oil wells (unclear due to the scale of the photograph). The surrounding area is an oil field with many oil field related features. In the 1928 photograph, the site and a portion of the surrounding area remain an oil field; however, residential neighborhoods are now visible in the surrounding area as well. In the 1938 photograph, oil field related activities onsite and in the surrounding area appear to have ceased or to have been significantly reduced in scope. There does appear to be at least one storage tank onsite in the northeast corner and a possible sump in the southwest corner. More urban development is visible in the surrounding area. The 1948 and 1952 photograph show the center of the Site developed with the Town & Country Market. The market is surrounded by a paved parking area. North of the Site is the L.A. farmers market, northeast is a drive-in movie theatre, east is undeveloped land, south is a school, and west is commercial and residential. The 1964 through the 2012 photographs show the Site developed in its general present-day configuration. The surrounding area also remains pretty stable over this time period. Land to the east is first developed with a commercial use on the 1964 photograph, and the drive-in movie theatre is gone by 2002 and has been replaced with commercial buildings. The 2016 aerial image shows the Site and surrounding area in their present-day configurations.
		No features were depicted on or off the Site on the photographs reviewed that would indicate an environmental concern for the Site except for historical oil field uses which are discussed later in this report.
City Directory Abstract (copy provided in Appendix B)	1920 - 2014	The EDR City Directory Abstract Report covers the years from 1920 to 2014 in approximately 5-year intervals. 6310 W. Third is first listed in 1933 as a private individual's name identified as an oil worker. From 1967 to 1976 it is listed as Britts Department Store, and from 1981 to 2014 as K Mart. 6320 W. Third is listed from 1967 to 1990 as several different shoe stores. 6330 W. Third is listed from 1967 to 2006 as a jewelry, handbag and shoe store, and in 2010 as a shoe store and wireless phone store. 6340 W. Third is listed in 1967 and 1971 as a jewelry and handbag store, in 1976 to 1981 as a travel agent, in 1986 and 1990 as Leeds Imports, and in 2006 as Annas Linens. 6350 W. Third is listed as a grocery store from 1976 to 1990 and from 2006 to 2014 as Whole Foods Market. 6360 W. Third is listed as a drug store from 1967 to 2014 (CVS Pharmacy in 2014).
		Prior and current tenant types do no indicate an obvious concern for the Site. There were no listings for dry cleaners or gas stations in the city directory listings.

4.1 Previous Environmental Investigations

Arcadis was provided with the following environmental report for the Site:

EBI Consulting. 2004. Phase I Environmental Site Assessment Report, Town & Country Retail, 6310-6360 W. Third Street, Los Angeles, CA. August 13.

According to EBI, the Site is multi-tenant retail center consisting of three, one-, two- and three-story buildings totaling 228,390 square feet and constructed in 1961. At the time of EBI's inspection, they noted that the stand-alone bank building and the buildings occupied by Savon and Kmart had basements. No chemical storage was observed onsite other than photo processing chemicals in Savon and Kmart and typical janitorial compounds. Waste cooking grease from several restaurants was observed to be stored in exterior bins. EBI stated that the current use of the site did not represent an environmental concern for the Site. However, based on the date(s) of building construction they noted the potential for asbestoscontaining materials (ACMs) to be present onsite.

EBI stated that the Site is located in the Salt Lake Oil Field and north of the La Brea Tar and Fossil Pits, which are sources of methane gas. Reportedly, accumulation of methane gas caused an explosion at the east adjacent Ross retail store in 1985. As a result of the explosion, the Los Angeles City Fire Department (LAFD) issued a methane ordinance requiring methane monitoring and mitigation measures in the "high potential methane zone" centered on the Salt Lake Oil Field. As the Site is located within this zone, a methane mitigation and monitoring system was implemented on the Site and has been in effect since 1990. EBI stated that the onsite methane gas monitoring system includes 12 street probes, seven gas vents and 10 parking lot gas vents, six wells, and three onsite gas probes. EBI stated that the site, in accordance with LAFD requirements, conducts semi-weekly methane gas monitoring and gas pressure monitoring and reporting. EBI reviewed a gas monitoring report for the Site dated June 2004 and methane gas concentrations ranged from non-detect to 88% of the lower explosive limit (LEL). The highest gas concentrations were reported to be in the eastern portion of the parking lot. EBI contacted a representative of the LAFD Environmental Unit, which has local agency oversight of methane compliance. The LAFD representative stated that the "current concentrations of methane gas reported in the semi-weekly methane monitoring reports are not a concern to the Fire Department at this time."

EBI also contacted a representative of Lofy Engineering, the firm that conducted the semi-weekly onsite methane monitoring. The representative stated that two gas venting mitigation wells were installed onsite in 1991/1992 after "mud geysers and gas buildup occurred at the subject property and in the local vicinity." In 1997, the wells were abandoned at the direction of the property management firm due to cost; however, the representative stated that the Site did not violate any local oversight agency requirements and that the Site was still in compliance with local, state and federal regulations as long as the twice-weekly monitoring and onsite monitoring alarm systems were maintained.

EBI stated that two former oil wells were located on site, one in the northwest portion of the Site and one in the northeast portion of the Site. They stated the wells were abandoned in the 1930s. EBI referenced a prior geophysical survey conducted at the Site that apparently located one well but not the second one. EBI discussed the wells with a representative of the Division of Oil, Gas & Geothermal Resources (DOGGR) who stated that a "construction site review for the reported abandoned wells by DOGGR would be required if the subject property proposed further development."

EBI was provided with prior reports for the Site including a Phase I and II report prepared by California Environmental (CE) in 1998. Based on the site's prior use for oil field related activities and its location within a methane zone, CE conducted a Phase II investigation which consisted of a geophysical survey to locate the two former onsite oil wells and advancing six soil borings to depths of 8- and 20-feet bgs. 18

soil samples were collected from the borings and analyzed for total petroleum hydrocarbons (TPH), volatile organic compounds (VOCs), semi-VOCs (SVOCs), and metals. The geophysical survey identified an anomaly in the northwest corner of the Site that was interpreted to be oil well #102. No anomalies suspected of being a well were detected in the northeast corner of the Site where oil well #99 was reported to be located. CE stated that the highest rate of methane gas venting was in the northeast portion of the Site. They stated "It is the opinion of CE that the methane gas problem in this area is at least partially due to a leaking well. If the well can be located and re-abandoned the methane problem will probably be reduced or eliminated."

Results of soil testing identified crude oil impacted soil in the former oil well locations and in two suspected former oil sump locations. The highest concentrations of contaminants were primarily less than 10 feet below ground surface (bgs); however, in one location contaminants were identified to greater than 20 feet bgs. Low level impacts were also encountered in drainage channel locations but did not extend beyond 3 feet bgs. No impacts were found in former suspected aboveground tank locations. The highest TPH concentration detected was 14,000 parts per million (ppm). Concentrations of VOCs and SVOCs were trace to non-detect. Detections of metals were consistent with background concentrations. CE stated that based on the current development of the site, the lack of pathways for human exposure to the contaminated soil limited the human health risk. They also stated the petroleum impacts at the Site did not present a significant risk to groundwater beneath the Site. However, they did state that the Regional Water Quality Control Board (RWQCB) might require remedial activities were the site to be redeveloped. They estimated the cost for excavation of 6,000 cubic yards (9,000 tons) of impacted soil, transport, treatment, and import of clean soil at \$324,000 (1998 dollars). CE also stated that a methane monitoring and maintenance plan should be developed for the Site and that the estimated cost of annual testing is \$25,000 (1998 dollars).

The EBI report also reviewed an asbestos inspection report for the Whole Foods Market and an asbestos abatement report for that space.

EBI also reviewed weekly methane monitoring reports prepared by Lofy Engineering in 2004. The reports summarize probe testing of detectable levels of methane in 11 out of 12 probes at the Site. Monitoring of exterior gas vents was also performed, and the reports note that there are gas detection alarm systems in place at the Site. The reports noted that at one time, there were two onsite vent wells identified as Kerbrat #2 and Fukuda #3. The wells had been a pathway for venting the methane gas in the area and reducing ambient pressure in the soil. The wells had served as key gas relief wells, which had prevented any gas building up in the Kmart basement since their activation in 1992. The discharge water from the wells was directed to a 5,000-gallon onsite aboveground storage tank located near Kerbrat #2. During its existence, the tank had been drained to the storm sewer system seven times prior to the tank's removal in 1997. The well venting system was discontinued and the relief wells were abandoned by the property management company in 1997 as the system was too expensive to operate. The Lofy reports also noted the continuous pumping of an offsite well (Anthony #2) between Ogden Drive and the Ross store east of the Site. The reports noted a new concrete subterranean clarifier next to this well.

Based on the information contained in the prior reports discussed in the EBI report, Arcadis concludes that the presence of TPH-impacted soil at the Site is a REC for the Site. Additionally, the presence of methane gas onsite is CREC for the Site as long as methane venting and regular monitoring are conducted. Any change in site use would likely require a re-evaluation of onsite methane mitigation.

According to EBI's review of an EDR regulatory records database report, no offsite properties with the potential to impact the Site were identified. EBI stated that no adverse environmental records were identified for the Site at local agencies contacted such as the Building Department, Fire Department, and Public Works Department.

EBI concluded their report as follows: "Although EBI recommends no further actions at this time, EBI is of the opinion that the potential exists for significant Subject Property ownership liability for costs associated with any future requirement for further actions related to the following environmental concerns: reabandonment of the two former oil wells reportedly abandoned on the Subject Property in the 1930s; subsurface assessment and remediation of potentially contaminated surface and subsurface soils; and further actions required to address any future methane gas pressure and/or methane gas concentrations."

Arcadis concurs with EBI's conclusion with regard to future ownership liability related to historical uses of the Site and the Site's location within a defined high potential methane zone. Although EBI did not identify further action at the time, it is Arcadis' opinion that more refined cost estimates for future ownership liability could be obtained from a current subsurface site investigation. See **Appendix C** for a copy of the prior report.

5 RECORDS REVIEW

As part of this assessment, Arcadis reviewed regulatory databases and available agency files and records for the Site. Information from these sources is discussed in the following sections.

5.1 Regulatory Database Research

An environmental database report prepared by EDR was reviewed for local, state, and federal listings for properties within the site area. Included in EDR's report are regulatory databases reviewed by EDR for cases pertaining to leaking underground storage tanks (USTs) and aboveground storage tanks (ASTs), hazardous waste sites, and abandoned sites within the ASTM-specified radii (Table 2). EDR also reviewed selected databases generated by the United States Environmental Protection Agency (U.S. EPA). Explanations of the regulatory agency databases reviewed are presented in EDR's report, which is included as **Appendix D**.

It should be noted that the computerized geocoding technology used in the database search is based on available census data and is only accurate to approximately ±300 feet. Also, elevations were determined from the U.S. Geological Survey Digital Elevation Model and are relative (not absolute). Sites with an elevation equal to or higher than the target property have been differentiated from sites with an elevation lower than the target property.

Sites identified within the study radii were evaluated to determine if they are likely to have adversely impacted the Site. The criteria used to evaluate the potential for adverse impact to the Site include:

- Distance from the Site;
- Expected depth and direction of groundwater and surface water flow;
- · Expected storm water flow direction; and
- Presence/absence of documented contaminant releases at the identified sites not identified as remediated.

Table 2 Regulatory Agency Databases / Lists Reviewed

Search Radius	Agency	Database	Type of Records in Database
1 mile	U.S. EPA	NPL	Sites designated for Superfund cleanup by the U.S. EPA
	U.S. EPA	CORRACTS	RCRA facilities undergoing "corrective actions"
	U.S. EPA	CERCLIS	Sites under review by the U.S. EPA
0.5 mile	U.S. EPA	TSD	Facilities that treat, store, and/or dispose of hazardous waste
	RWQCB	LUST	Sites with LUSTs

Search Radius	Agency	Database	Type of Records in Database
	SWRCB	SWLF/SWAT	Sites permitted as solid waste landfills, incinerators, or transfer stations
	IWMB	WMUDS/SWAT	Tracking and inventory of waste management units
	U.S. EPA	CERCLIS-NFRAP	CERCLIS sites with no further remedial actions planned.
Site or	U.S. EPA	RCRA Generator	Sites that generate large or small quantities of hazardous waste
Adjacent Properties	U.S. EPA	ERNS	Sites with reported accidental releases of oil and hazardous substances
	RWQCB	UST	Sites with registered USTs

Notes:

BEP = Bond Expenditure Plan

CERCLIS = Comprehensive Environmental Response

Compensation and Liability Information System

CORRACTS = Corrective Action Report

ERNS = Emergency Response Notification System

DHS = Department of Public Health

IWMB = Integrated Waste Management Board

LUST = Leaking Underground Storage Tank

NFRAP = No Further Remedial Action Planned

NPL= National Priorities List

OES = Office of Emergency Services

SWAT = Solid Waste Assessment Test

SWLF = Solid Waste Landfills

TSD = Transfer, Storage and Disposal

WMUDS = Waste Management Unit Database

5.1.1 Site

According to EDR's report, the Site address 6310 W. Third Street is listed under the name Kmart in the HAZNET database. Kmart is listed as generating hazardous waste under manifest from 1995 through 2015. There are over 60 records listed. Typical waste streams included waste oil and mixed oil, unspecified solvent mixture, off-specification, aged or surplus organics, asbestos-containing waste, alkaline solution without metals, latex waste, and acidic liquids. This listing indicates the proper offsite disposal under manifest of hazardous waste and does not in itself indicate an environmental concern for the Site.

The Site address 6360 W. Third Street is listed under the name CVS Pharmacy No. 9661 in the RCRA-LQG and ECHO databases. The RCRA database provides a variety of waste codes for wastes generated at the site and indicates there were no violations. The same information is provided in the EPA's ECHO database.

The remaining site addresses were not listed in any of the databases searched.

5.1.2 Off-Site Properties

According to EDR's report, numerous properties are listed within the ASTM-search radius due to the Site's location within a densely developed urban area. However, based on their listing for tracking purposes only, distance from the Site, type of release, groundwater flow pattern, inactivity and no active regulatory involvement, and/or successful remediation with case closure granted by the regulatory oversight agency, none of the off-site properties listed in the EDR database report are likely to represent an obvious concern of environmental impairment or a vapor encroachment condition to the Site. However, the following adjacent properties are of note:

Hancock Park Elementary School, 408 S. Fairfax Avenue, is located adjacent south of the Site. It is listed in the Envirostor, RCRA-SQG, ECHO, and UST databases. It is listed on the DTSC's Envirostor website as "inactive – needs evaluation as of 11/22/2005." The only information provided is as follows: *The site is currently a school that has been in operation since 1953. The school is within an area designated by the city of Los Angeles as "high potential methane district." An abandoned oil well is in the middle of the school. The school has methane sensors underneath some buildings with high levels of alarms at 25 % of LEL. Manual measurements taken daily. 160 PPM methane detected (max).*

The Grove at Farmer's Market, 6301 W. Third Street, is located diagonal to the Site to the northeast. It is listed in the SLIC database. According to the RWQCB's Geotracker website, the case is listed as "open-verification monitoring as of 1/21/2000." Summary information is as follows: The Grove is a 16-acre commercial development site, has been historically related to oil production operations. Soil, soil gas, and groundwater beneath the property are impacted by petroleum hydrocarbons. No free product is present at the site. No municipal supply well is located within three miles from the site. Shallow aquifer is at 5 to 25 feet below grade. Several phases of environmental assessments including health risk assessment and remediation were conducted through 2000. Site soil gas mitigation system under residential land use including vapor barrier and venting system for indoor air exposure pathway was permitted and installed. The complete site improvements satisfied human health protection requirements. The site has been redeveloped as commercial land-use prevents additional excavation.

Mas Auto Service, 371 S. Fairfax Avenue, was located adjacent to the west of the Site across S. Fairfax Avenue. Mas Auto Service (also known as Mas Texaco Service) is listed in the LUST, UST and Historic Auto databases. According to the RWQCB's Geotracker website, the current status is "open - remediation as of 9/16/2005." The contaminant is listed as gasoline. The most recent (1st quarter 2017) groundwater monitoring report on Geotracker depicts the plume generated from the release at this facility to flow north and to remain on the west side of S. Fairfax Avenue. Therefore, based on active characterization of this site, ongoing remediation, and oversight by the RWQCB, this release does not appear to represent a current environmental concern for the Site. In addition, the sources of the releases, which were USTs, have been removed and the property is currently a vacant lot.

Kings Cleaners, 349 S. Fairfax Avenue, is located adjacent to the west of the Site across S. Fairfax Avenue. This address is also listed as Fair Fine Dry Cleaners and Fair Cleaners and is a currently an operating cleaner named Fair Dry Cleaners. It is listed in the RCRA-SQG, ECHO, CA HAZNET, and CA Drycleaners databases. It is listed as a generator of hazardous waste from 1995 to 2000; the waste stream is listed as halogenated solvents which includes the dry cleaning solvent perchloroethylene (PCE). No violations are reported. This facility currently uses a non-toxic dry cleaning compound

according to signage on the facility. However, the historical long-term use of PCE and the propensity for dry cleaners to release PCE to the environment represents a potential concern for the Site due to this facility's proximity to the Site. There are no agency records of a release from this facility; however, this can simply mean that no subsurface testing has been conducted. Arcadis observed two monitoring wells near this property, one north and one west of it. However, these wells are associated with the Mas Auto Service release south of the cleaners and the plume from that release is confined to the west side of S. Fairfax Avenue according to the most recent information from the RWQCB.

Thrifty Tailor & Dry Cleaners, 410 S. Fairfax Avenue, was located adjacent to the southwest of the Site across S. Fairfax Avenue and is listed as an Historical Cleaner in 2005 and 2006. No other information is provided. However, taken in context with an active dry cleaner approximately 300 feet north of this former dry cleaner, the potential remains for historical releases of dry cleaning solvents to have impacted the Site.

Several other historical cleaners and auto stations are listed within a 1/8-mile radius of the Site dating back to 1924; however, without further information, they are not anticipated to represent a current environmental concern to the Site. It is also noted that the EDR database report does not identify any regional groundwater plumes underlying the Site; however, this does not rule out that groundwater beneath the Site and in the surrounding area is not impacted with contaminants of concern due to the fairly shallow depth, reported to be less than 30 feet bgs, and the long-term development of the surrounding area for oil field and commercial uses. The shallow aquifer is not considered a potable water source.

Two properties are listed in EDR's Orphan Summary; however, neither appear to represent a current environmental concern to the Site.

5.2 Agency Research

Files and records available at the agencies listed in **Table 3** were reviewed for information on the Site.

Table 3 Local Agency Files

Source	Date	Information Obtained
California Regional Water Quality Control Board (RWQCB)	May 2017	Available information maintained by the RWQCB at http://geotracker.waterboards.ca.gov was reviewed for records concerning hazardous spills, USTs, and LUSTs at the Site. There were no records for the Site addresses.
Department of Toxic Substances Control (DTSC)	May 2017	A review of the DTSC website (http://www.envirostor.dtsc.ca.gov/public/) did not identify any records for the Site addresses.
Los Angeles City Fire Department (LAFD)	May 2017	Arcadis requested records for the site addresses from the LAFD. A response is pending at this time.
Los Angeles County Department of Public Works Environmental Programs Division	May 2017	A review of the agency's website (http://ladpw.org/epd/CleanLA/OpenFileReview.aspx)_did not identify any records for the Site addresses.

Source	Date	Information Obtained
Division of Oil, Gas & Geothermal Resources (DOGGR)	May 2017	According to DOGGR's Well Finder database, two oil wells were located onsite, one north of the CVS along the western site boundary near S. Fairfax Avenue (API 03715230), and one located north of the Kmart near the northeast corner of the Site (API 03715229). See below for further details on the wells. Numerous wells are depicted in the surrounding area including one on the property north of the Site and one on the property south of the Site.
Los Angeles City Department of Public Works, Bureau of Engineering	March 31, 2004	Methane and Methane Buffer Zones Map. According to the map, the Site is located within a Methane Zone, which then indicates it is subject to various codes such as those enforced by the LAFD and the Los Angeles Building Department. See Appendix E for a copy of the map.

Onsite well detail -

Well ID	Well Number	Operator	Status
API 03715230	No. 102	Chevron U.S.A., Inc.	Plugged and abandoned in 1930/31 as reported in a prior report. No records on DOGGR website to confirm.
API 03715229	No. 99	Chevron U.S.A., Inc.	Plugged and abandoned in 1930/31 as reported in a prior report. No records on DOGGR website to confirm.

6 ENVIRONMENTAL SETTING

6.1 Topography

According to information obtained from the U.S. Geological Survey 7.5-Minute Series Topographic Map of the Hollywood quadrangle, dated 2012, topography at the Site is approximately 180 feet above mean sea level. The Site and surrounding area are relatively level. The general topographic gradient of the surrounding area exhibits a slight downward slope to the southwest.

6.2 Geology

The general geology summary provided by EDR specifies that the sediments beneath the Site have been identified as part of the Quaternary Series of the Quaternary System of the Cenozoic Era. According to the United States Department of Agriculture Soil Conservation Service, the Site is underlain by the Urban Land soil component, which indicates near surface soil has been reworked to the extent that native soil characteristics are no longer identifiable.

6.3 Surface Water

Arcadis did not observe surface water features onsite or adjacent to the Site.

6.4 Hydrogeology

According to a report on Geotracker for a property located adjacent west of the Site across S. Fairfax Avenue (371 S. Fairfax Avenue), depth to groundwater ranges from approximately 14 to 31 feet bgs. The groundwater gradient is reported to be to the north/northwest.

6.5 Flood Zones

According to the EDR report, the eastern, western and northern boundaries of the Site are within a 500-year flood zone.

7 SITE RECONNAISSANCE

On May 17, 2017, Mr. Blake Hunter, a representative of Arcadis, performed a reconnaissance-level assessment of the Site to observe general site conditions and indications of the possible release(s) of chemicals to the subsurface. A walk-over site reconnaissance was conducted to identify visible evidence of RECs. Mr. Hunter was accompanied by Mr. Osmar Flores, Maintenance Supervisor with The ARBA Group, the property manager, and Mr. Bob Voakes, Building Engineer with Kmart, during the site reconnaissance. Photographs taken during the site reconnaissance are included in **Appendix A**.

7.1 Methodology and Limiting Conditions

Arcadis' representative was granted full access to the Site. The methodology for the site visit included walking and observing the entire site except for the Citibank building. There were no other limiting conditions.

7.2 General Site Conditions

7.2.1 Site Observations

The approximate 7.5-acre, irregular-shaped site consists of a retail shopping center. The retail buildings are located on the south side of the Site. The north portion of the Site is occupied by an asphalt-paved parking lot, a bank building, and a small locksmith shop.

Kmart

Kmart occupies the east shopping center building. The Kmart building is a two-story building with a basement. The basement and first floors are used for retail sales. The second story consists of retail goods storage areas, former offices, a staff lounge, restrooms, a hazardous materials storage room, and air handler rooms for the building.

Three elevators and a series of escalators provide access to the floors of the building. Two of the elevators are traction-type. A service elevator is hydraulic. An inspection of the elevator equipment rooms did not reveal evidence of spills or releases of hydraulic fluid or unusual odors. The equipment appeared to be in aged condition.

Two hydraulic box compactors are located on the first floor of the building. According to Mr. Voakes, one of the compactors is not in operating order and is not used. No evidence of releases or significant staining was observed on the compactors or in the surrounding area. Mr. Voakes was unaware of any releases from the compactors.

New automotive batteries and automotive maintenance and cleaning chemicals are stored on retail shelves in the basement of the building and in a small storage room. The containers appeared to be in new condition and no evidence of releases or staining was observed.

Used automotive batteries are stored in a hazardous materials room located on the second floor of the building. The batteries were observed to be stored on wooden pallets. Poly drums of hazardous materials

are also stored in the room. The hazardous materials consist of damaged aerosols such as hair spray, soaps and cleaners, waxes and polishes, makeup, etc. The poly drums are labeled stating their contents and are sealed. No evidence of releases or staining was observed in the hazardous materials room. According to Mr. Voakes, the hazardous materials and batteries are removed on a regular basis by regional Kmart personnel.

Whole Foods Market

Whole Foods Market occupies the western portion of the shopping center buildings. The building is single-story and of concrete, wood, and steel beam construction. Stockrooms, a refrigeration equipment room, hazardous materials center, and offices are located in the rear, southern portion of the building.

The refrigeration equipment room contains approximately 16 compressors and large cooling equipment. The equipment and piping is labeled as containing R-404A refrigerant and Polyol Ester Lubricant. The equipment appeared to be aged but in good operating order. Dark staining was observed on and around the compressors but the staining appeared to be due to small releases over a long period of time and not from a malfunction release.

A hydraulic box compressor is present near the loading dock. The compressor appeared to be in good operating order and no evidence of releases or significant staining was observed on the compactor or in the surrounding area.

A hazardous materials center is located next to the box compressor. The area contained two poly 55-gallon drums and approximately seven poly bins. The containers were labeled as to their contents. The hazardous materials consist of damaged cleaners, bleach, liquids, small batteries, make up, and aerosols. No evidence of staining or releases was observed on the containers or in the surrounding area.

A truck loading dock is located at the south side of the building. Forklift propane tanks are stored in locked steel cages on the loading dock. Additionally, four steel plates are present in the floor of the loading dock, evidence of a possible clarifier. Mr. Flores was unaware of a clarifier at the Site. Mr. Flores did state that the floor drain in the loading dock was connected to a sump pump.

CVS Pharmacy

The CVS Pharmacy building occupies the western end of the retail buildings. The building is a singlestory structure with a basement. The basement is used for retail goods storage and utilizes a conveyer system to transport the goods to the first floor.

A hydraulic box compressor is present near the loading dock at the south side of the building. The compressor appeared to be in good operating order and no evidence of releases or significant staining was observed on the compactor or in the surrounding area.

Citibank

Citibank occupies the building located in the northwest corner of the Site. Access to the interior of the bank was not granted for this assessment. There is reportedly a basement in this building.

7.2.2 Hazardous Substances and Petroleum Products in Connection with Identified Uses

No hazardous substances or petroleum products were observed onsite other than as described above.

7.2.3 Storage Tanks

Arcadis did not observe ASTs at the Site. No evidence of USTs, such as dispensers, pipes, or vent lines, was observed on the Site.

7.2.4 Odors

No odors that would indicate an environmental concern were noted on the Site.

7.2.5 Pools of Liquid

No readily visible standing surface water, pools, or sumps containing liquids likely to be hazardous substances or petroleum products were identified during this assessment.

7.2.6 Drums

Poly drums containing hazardous waste are stored in the Kmart and Whole Food Market facilities. The drums contain general waste such damaged cleaners, make up, and aerosols. No other drums were observed on site.

7.2.7 Hazardous Substances and Petroleum Product Containers (Not Necessarily in Connection with Identified Uses)

No hazardous substances or petroleum products were observed onsite not in connection with identified uses.

7.2.8 Unidentified Substance Containers

No unidentified substance containers were observed onsite.

7.2.9 PCBs

No electrical or hydraulic equipment known to contain polychlorinated biphenyls (PCBs) or likely to contain PCBs was identified onsite during this assessment. An electrical transmission line with pole - mounted transformers was observed along the eastern site boundary. The transformers appeared to be in good condition and no evidence of seepage or releases was observed. The transformers are owned by the Los Angeles Department of Water & Power (DWP) and any concerns with the transformers would be the responsibility of DWP.

7.2.10 Pits, Ponds, or Lagoons

During the site visit, Arcadis' representative looked for pits, ponds, or lagoons on the Site. Arcadis' representative also looked for pits, ponds, and lagoons on adjoining properties to the extent that such features could be visually and/ or physically observed from the Site or identified in the interviews or records review. No such features were identified on or near the Site.

7.2.11 Stained Soil or Pavement

During the site visit, Arcadis' representative did not observe areas of stained soil or significantly stained pavement.

7.2.12 Stressed Vegetation

During the site visit, Arcadis' representative looked for areas of stressed vegetation (from other than insufficient water). No areas of stressed vegetation were observed during this assessment.

7.2.13 Solid Waste

During the site visit, Arcadis looked for areas that were apparently filled or graded by non-natural causes (or filled with material of unknown origin) that suggest the presence of trash construction debris, demolition debris, or other solid waste disposal, or mounds or depressions suggesting trash or other solid waste disposal. No such areas were observed.

7.2.14 Wastewater

During the site visit, Arcadis looked for wastewater or other liquids (including storm water) or discharges into a drain, ditch, underground injection system, or stream on or adjacent to the Site. There is no process wastewater discharged on site.

7.2.15 Wells

During the site visit, Arcadis looked for wells, including dry wells, irrigation wells, injection wells, monitoring wells, water wells, abandoned wells, oil wells, or other wells. No wells were observed onsite. Former oil wells onsite are discussed elsewhere in this report.

7.2.16 Septic Systems

During the site visit, Arcadis looked for indications of on-site septic systems or cesspools. No septic systems or cesspools were observed. The Site is connected to the municipal sewer system.

7.2.17 Heating / Cooling

Heating and cooling systems were not evaluated for this assessment.

7.2.18 Stains or Corrosion

Arcadis did not observe areas of significant staining or corrosion during this site assessment.

7.2.19 Drains or Sumps

Floor drains were observed in the air handler and refrigeration rooms onsite. The drains appeared to direct condensation to the sewer system.

A steel-grated drain was observed in the truck loading dock of the Whole Foods Market building. According to Mr. Flores, the drain is connected to a sump pump. Mr. Flores was unaware of the further discharge of the drain.

8 INTERVIEWS

8.1 Interview with Site Contacts

Arcadis interviewed Mr. Osmar Flores, Maintenance Supervisor for The ARBA Group, the property management company. Mr. Flores was aware of the methane monitoring system onsite; however, he was unaware of the system being activated since managing the property for the past two years. Additional relevant information from Mr. Flores is included within this report.

Arcadis interviewed Mr. Bob Voakes with Kmart. Mr. Voakes stated he has been associated with the Site's Kmart facility for 35 years. Mr. Voakes was aware of the methane monitoring system onsite and stated he was unaware of the system being activated since installed after an east adjacent facility explosion. Additional relevant information from Mr. Voakes is included within this report.

9 FINDINGS AND CONCLUSIONS

Arcadis has performed a Phase I ESA in accordance with the ASTM International E1527-13 Standard Practice for Site Assessments: Phase I Environmental Site Assessment Process. Limitations or deviations from this practice are described in Section 1.4 of this report. The findings identified by Arcadis are summarized below and discussed in greater detail in the body of the report.

9.1 Recognized Environmental Conditions

No RECs were identified in connection with the Site, with the following exceptions:

- A previous subsurface investigation conducted onsite in 1998 identified soil impacted with petroleum hydrocarbons. The depth of impact was mainly confined to less than 10 feet bgs; however, one location had elevated concentrations of contaminants to greater than 20 feet bgs. The origin of the contamination is attributed to former oil field activities onsite including oil wells and oil sumps.
- The former oil wells onsite do not appear to have been abandoned to current DOGGR standards and a previous consultant suspected the well in the northeast portion of the Site was leaking and contributing to high methane gas levels in this area.
- The presence of current and historical dry cleaners adjacent west of the Site represents a suspect REC for the Site. If releases of PCE from the dry cleaners impacted soil vapor and groundwater, a vapor intrusion concern may exist for the Site.

9.2 Controlled Recognized Environmental Conditions

No CRECs were identified in connection with the Site, with the following exception:

The Site's location within a defined methane zone and the detected presence of methane gas
onsite represents an environmental concern for the Site and the health and safety of site
occupants. However, as long as methane continues to be monitored and vented in accordance
with Fire Department requirements, it is considered a CREC for the Site.

9.3 Historical Recognized Environmental Conditions

No HRECs were identified in connection with the Site.

9.4 De Minimis Conditions

The following de minimis conditions were identified in connection with the Site:

• It is a possible a clarifier is present at the south end of the Site. Based on the types of current and historical tenant uses it is not anticipated that hazardous materials were routed through the

clarifier. It is likely that the clarifier was used for waste cooking grease from onsite restaurants. However, evaluation of the clarifier is warranted if the Site is redeveloped.

 Aging equipment onsite, such as elevators and compressors, indicate the potential for oily releases to the subsurface.

9.5 Conclusions

Arcadis has performed a Phase I ESA of the Site in conformance with the scope and limitations of ASTM Practice E1527-13 for Phase I ESAs. This assessment has revealed no evidence of RECs in connection with the Site other than as identified in Section 9.1 above. In order to more fully understand the ownership liability of the RECs, Arcadis recommends further investigation and/or discussion with legal counsel.

No Phase I ESA can wholly eliminate uncertainty regarding the potential for RECs in connection with a property. This evaluation was intended to reduce, but not eliminate uncertainty in RECs.

10 DATA GAPS

Previous reports prepared for the Site indicated that the Site is monitored for methane gas. However, Arcadis was not provided with current information regarding onsite methane monitoring and site contacts indicated the methane monitoring system onsite is currently inactive. The lack of information provided on the current status of onsite methane monitoring and the Site's compliance with Fire and Building Department ordinances represents a data gap for the Site. An in-depth evaluation is recommended.

No other significant data gaps were identified during this assessment. Pertinent data, if any, obtained by Regency following the issuance of this report should be reviewed by an environmental professional and an addendum should be prepared to present an evaluation of the data and any changes to the conclusions of this report, as warranted by the data.

arcadis.com 26

11 ENVIRONMENTAL PROFESSIONALS STATEMENT

The environmental assessment described herein was conducted by the undersigned employee of Arcadis. Arcadis' assessment consisted solely of the activities described in the Introduction of this Report, and in accordance with the ASTM E1527-13 guidelines for Phase I Environmental Site Assessments signed prior to initiation of the assessment, as applicable.

I declare that, to the best of my professional knowledge and belief, I meet the definition of environmental professional as defined in §312.10 of 40 Code of Federal Regulations (CFR) 312, and I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the Subject Property. I have developed and performed all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312. *

Report Prepared By:

May 26, 2017

Janet Holtz Date

Principal Environmental Scientist

arcadis.com 27

^{*}A professional geologist's or environmental professional's certification of conditions comprises a declaration of his or her professional judgment. It does not constitute a warranty or guarantee, expressed or implied, nor does it relieve any other party of its responsibility to abide by contract documents, applicable codes, standards, regulations, and ordinances.

12 REFERENCES


- ASTM International. 2013. Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process, Designation E1527-13.
- EBI Consulting. 2004. Phase I Environmental Site Assessment Report, Town & Country Retail, 6310-6360 W. Third Street, Los Angeles, CA. August 13.
- Environmental Data Resources, Inc. (EDR). 2017. Radius Map Report with GeoCheck. Inquiry #4930273.2s. May 8.
- EDR. 2017. Aerial Photo Decade Package. May 9.
- EDR. 2017. Historical Topographic Map Report. May 8.
- EDR. 2017. Certified Sanborn Map Report. May 8.
- EDR. 2017. Historical City Directory Abstract. May 9.

arcadis.com 28

FIGURES



MAP SOURCE: Google Earth Pro ÉAN »€ CEI È I Ä⊃ ÉAFFÌ »CFCHÌ ÈHÎ ÄV

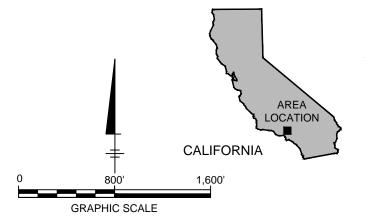

TOWN AND COUNTRY RETAIL 6310-6360 WEST 3rd STREET LOS ANGELES, CALIFORNIA

SITE LOCATION MAP





APPENDIX A

Site Photographs



<u>Description of Photograph:</u> View of the Site towards southeast.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #2

<u>Description of Photograph:</u>
View of the Site towards southeast.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter

Date of Photograph:

May 17, 2017



<u>Description of Photograph:</u> View of the bank building at northwest corner of the Site.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #4

Description of Photograph:

View of the Locksmith at the northeast corner of the Site and east adjacent properties.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By: Blake Hunter



<u>Description of Photograph:</u> View of the first floor of the Kmart building.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #6

<u>Description of Photograph:</u>
Typical storage on second floor of Kmart building.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



<u>Description of Photograph:</u> View of potential asbestos insulation in air handling room.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #8

<u>Description of Photograph</u>: View of the paint and lubricating oil in air handling room.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



Description of Photograph:

View of the used batteries stored in the hazardous materials storage room in the Kmart building.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

Date of Photograph:

May 17, 2017



Photograph #10

Description of Photograph:

View of hazardous materials storage room in the Kmart building.

<u>Site Location:</u> 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



<u>Description of Photograph:</u> View of the box compactor in the Kmart building.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By: Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #12

<u>Description of Photograph:</u> View of the hydraulic service elevator equipment room.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



<u>Description of Photograph:</u> View of new batteries in the Kmart building.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By: Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #14

Description of Photograph:

View of the new automotive chemicals in the Kmart building.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

Date of Photograph:

May 17, 2017



<u>Description of Photograph:</u> View of the Little Ceasar's kitchen

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #16

<u>Description of Photograph:</u> View of the methane monitoring control panel for the Site.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



<u>Description of Photograph</u>: View of a typical methane monitor at the Site.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #18

<u>Description of Photograph:</u> View of the Whole Food Market interior.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



<u>Description of Photograph</u>: View of the refrigerant compressors in the Whole Foods Market.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #20

<u>Description of Photograph</u>: View of the refrigerant and lubricant used in the Whole Foods Market refrigeration system.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter



<u>Description of Photograph:</u> View of the box compactor in the Whole Foods Market.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

Date of Photograph: May 17, 2017



Photograph #22

<u>Description of Photograph</u>: View of the Hazardous Materials Center in the Whole Foods Market.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

Date of Photograph:

May 17, 2017



<u>Description of Photograph</u>: View of the loading dock at Whole Foods Market. Note possible clarifier.

Site Location:


6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

Date of Photograph:

May 17, 2017

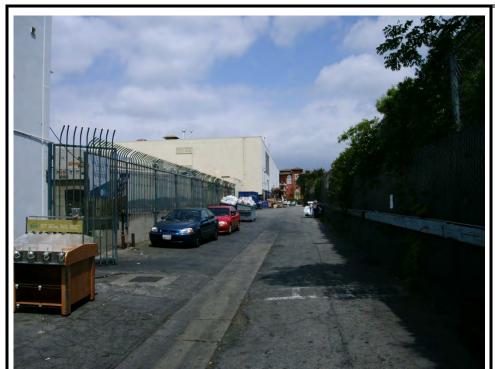

Photograph #24

<u>Description of Photograph:</u> View of the south access alley at the Site.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

Date of Photograph:

May 17, 2017



<u>Description of Photograph</u>: View of the CVS Pharmacy

interior.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

<u>Photograph Taken By:</u> Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #26

<u>Description of Photograph:</u> View of the box compactor at the CVS Pharmacy facility.

Site Location:

6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



<u>Description of Photograph:</u> View of the north adjacent

properties.

Site Location: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By: Blake Hunter

<u>Date of Photograph:</u> May 17, 2017



Photograph #28

<u>Description of Photograph:</u> View of the west adjacent former gasoline station.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter



<u>Description of Photograph</u>: View of the west adjacent properties. Note dry cleaners facility.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

Date of Photograph:

May 17, 2017



Photograph #30

<u>Description of Photograph</u>: View of the south adjacent property.

<u>Site Location</u>: 6310-6360 West 3rd Street, Los Angeles, CA

Photograph Taken By:

Blake Hunter

APPENDIX B Historical Research Documentation

Town & Country Retail 6310 W. Third Street Los Angeles, CA 90036

Inquiry Number: 4930273.3

May 08, 2017

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor Shelton, CT 06484 Toll Free: 800.352.0050 www.edrnet.com

Certified Sanborn® Map Report

05/08/17

Site Name:

Client Name:

Town & Country Retail 6310 W. Third Street Los Angeles, CA 90036 EDR Inquiry # 4930273.3 ARCADIS U.S., Inc. 320 Commerce Suite 200 Irvine, CA 92602-0000 Contact: Janet Holtz



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by ARCADIS U.S., Inc. were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # 0A51-4B96-9FB7

PO# NA

Project Regency L.A.

Maps Provided:

1969

1950



Sanborn® Library search results
Certification #: 0A51-4B96-9FB7

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

Library of Congress

University Publications of America

▼ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

ARCADIS U.S., Inc. (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property.

Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1969 Source Sheets



Volume 22, Sheet 2224 1969



Volume 22, Sheet 2243 1969



Volume 22, Sheet 2245 1969


1950 Source Sheets



Volume 22, Sheet 2224 1950




Volume 22, Sheet 2243 1950

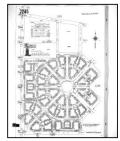

Volume 22, Sheet 2245 1950





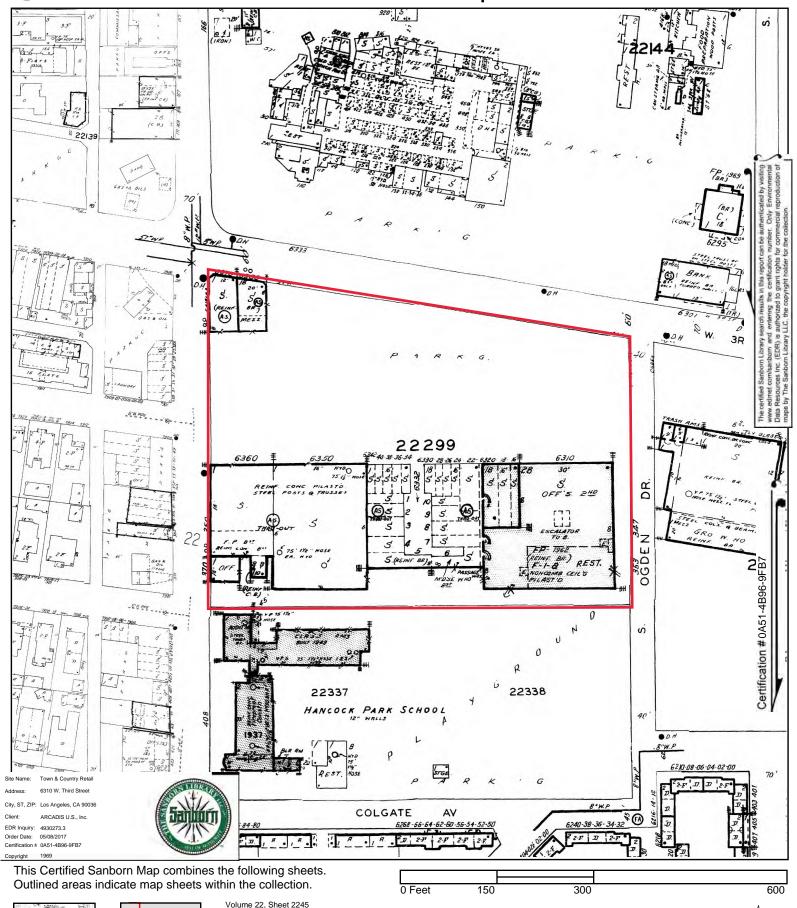






Volume 22, Sheet 2245 Volume 22, Sheet 2243 Volume 22, Sheet 2224







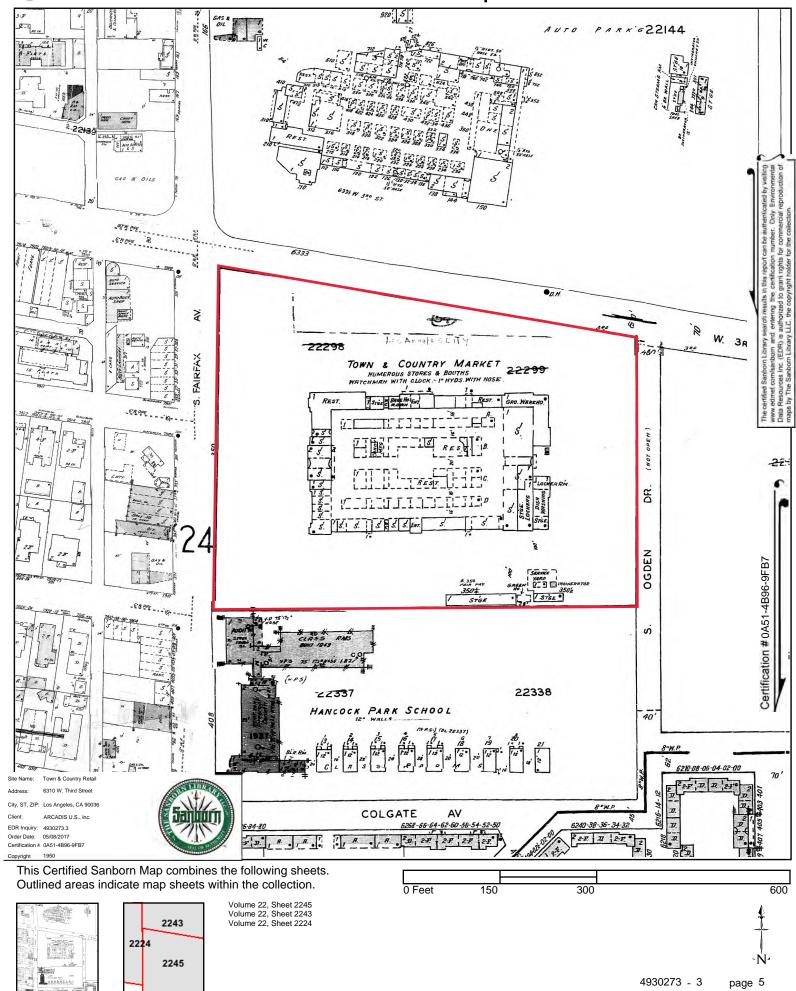

Town & Country Retail 6310 W. Third Street Los Angeles, CA 90036

Inquiry Number: 4930273.9

May 09, 2017

The EDR Aerial Photo Decade Package



6 Armstrong Road, 4th floor Shelton, CT 06484 Toll Free: 800.352.0050 www.edrnet.com

EDR Aerial Photo Decade Package

05/09/17

Site Name: Client Name:

Town & Country Retail 6310 W. Third Street Los Angeles, CA 90036 EDR Inquiry # 4930273.9 ARCADIS U.S., Inc. 320 Commerce Suite 200 Irvine, CA 92602-0000 Contact: Janet Holtz



Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

Search Results:

<u>Year</u>	<u>Scale</u>	<u>Details</u>	Source
2012	1"=500'	Flight Year: 2012	USDA/NAIP
2010	1"=500'	Flight Year: 2010	USDA/NAIP
2009	1"=500'	Flight Year: 2009	USDA/NAIP
2005	1"=500'	Flight Year: 2005	USDA/NAIP
2002	1"=500'	Flight Date: June 10, 2002	USDA
1994	1"=500'	Acquisition Date: May 31, 1994	USGS/DOQQ
1989	1"=500'	Flight Date: August 22, 1989	USDA
1983	1"=500'	Flight Date: November 19, 1983	EDR Proprietary Brewster Pacific
1977	1"=500'	Flight Date: April 25, 1977	EDR Proprietary Brewster Pacific
1972	1"=500'	Flight Date: November 21, 1972	EDR Proprietary Brewster Pacific
1964	1"=500'	Flight Date: July 28, 1964	USGS
1952	1"=500'	Flight Date: August 02, 1952	USGS
1948	1"=500'	Flight Date: July 10, 1948	USGS
1938	1"=500'	Flight Date: May 22, 1938	USDA
1928	1"=500'	Flight Date: January 01, 1928	USGS
1923	1"=500'	Flight Date: January 01, 1923	FAIR

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.


Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.


Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.



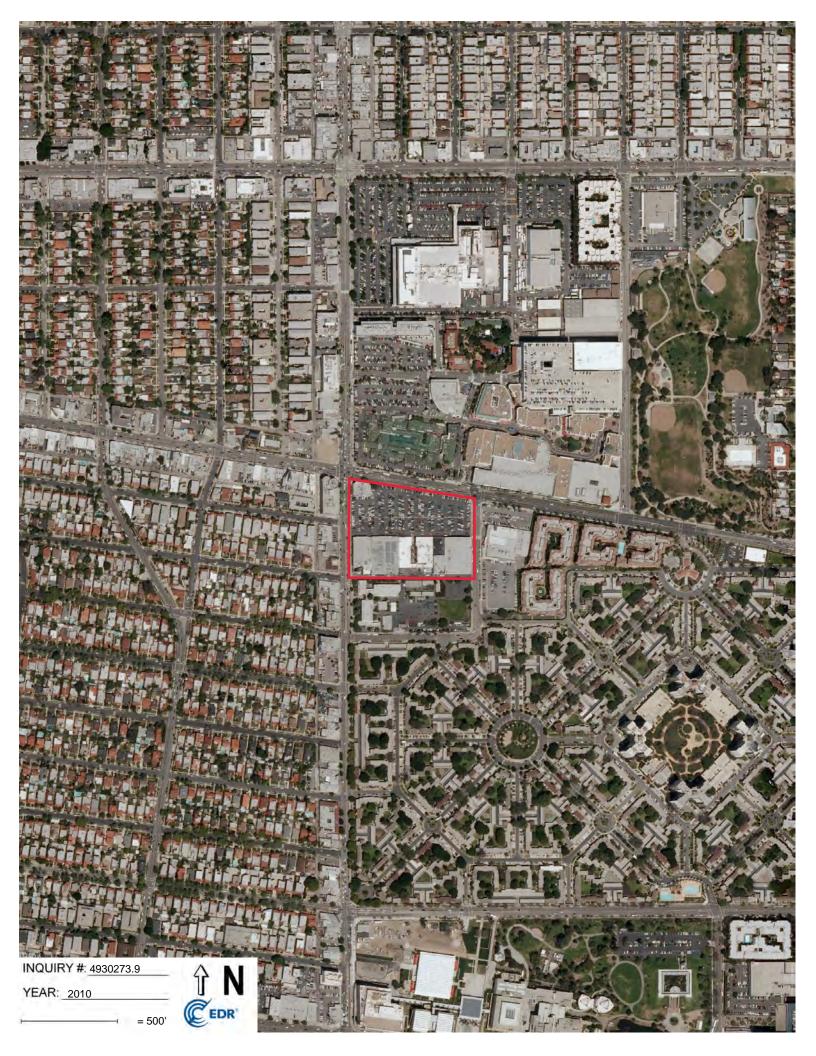




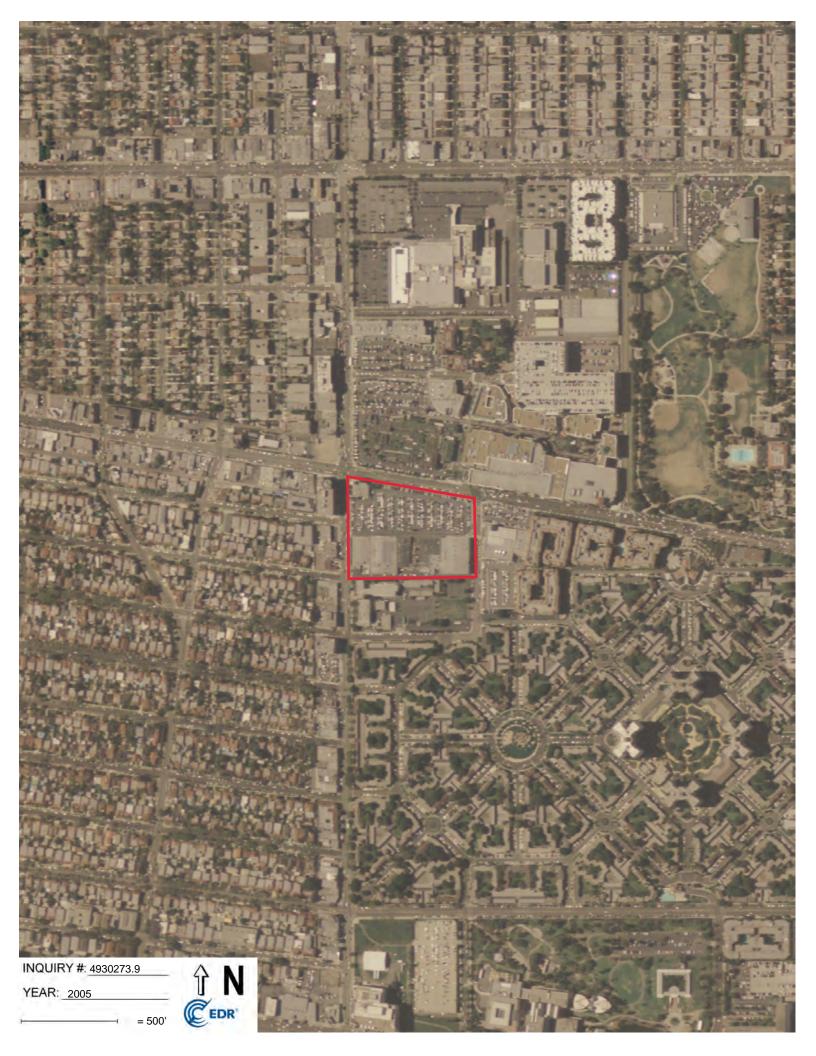









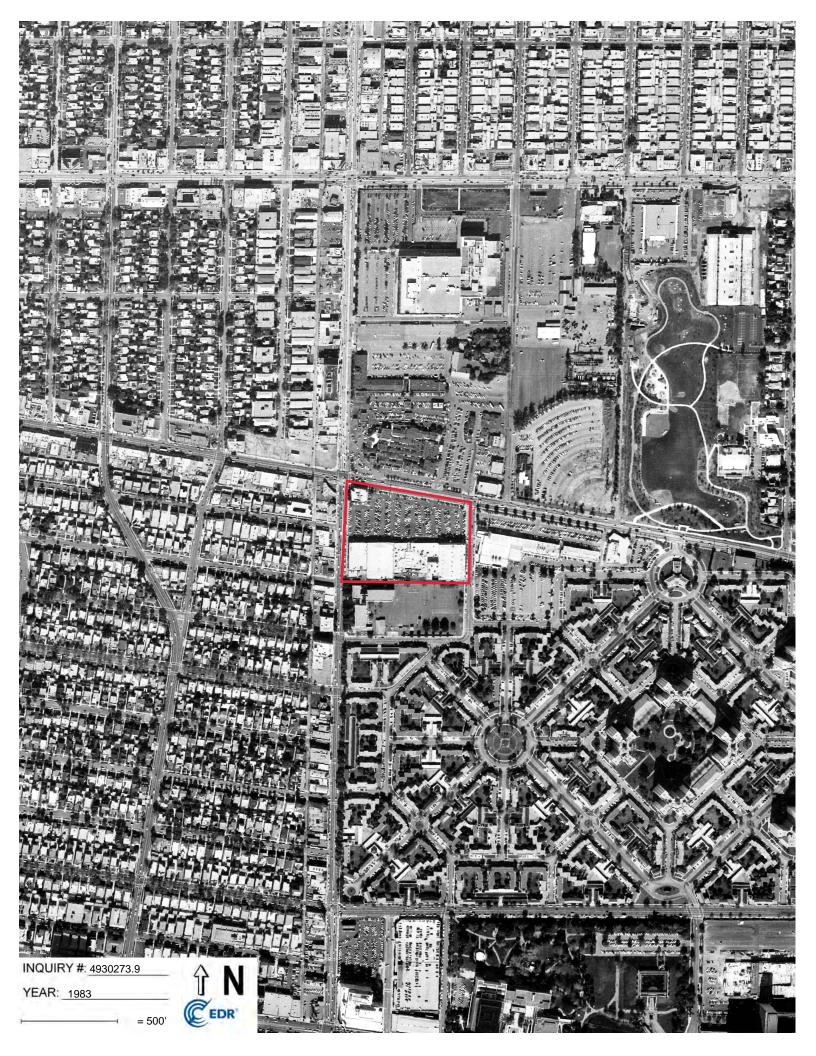

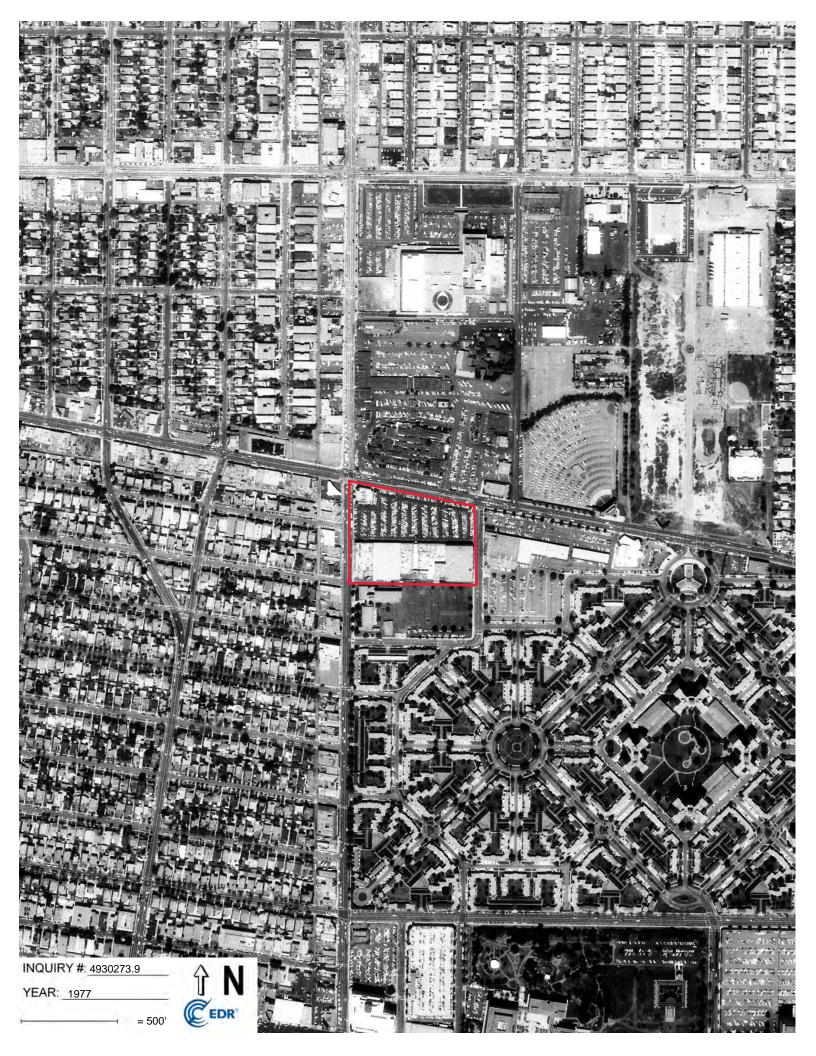







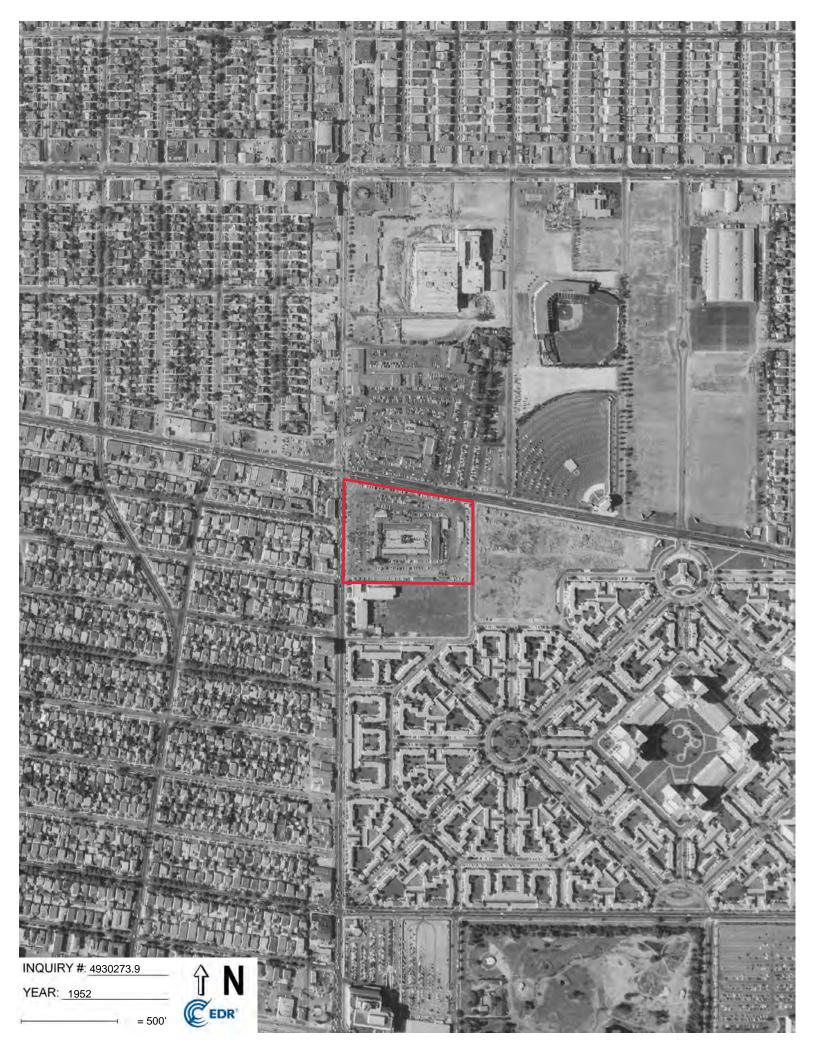



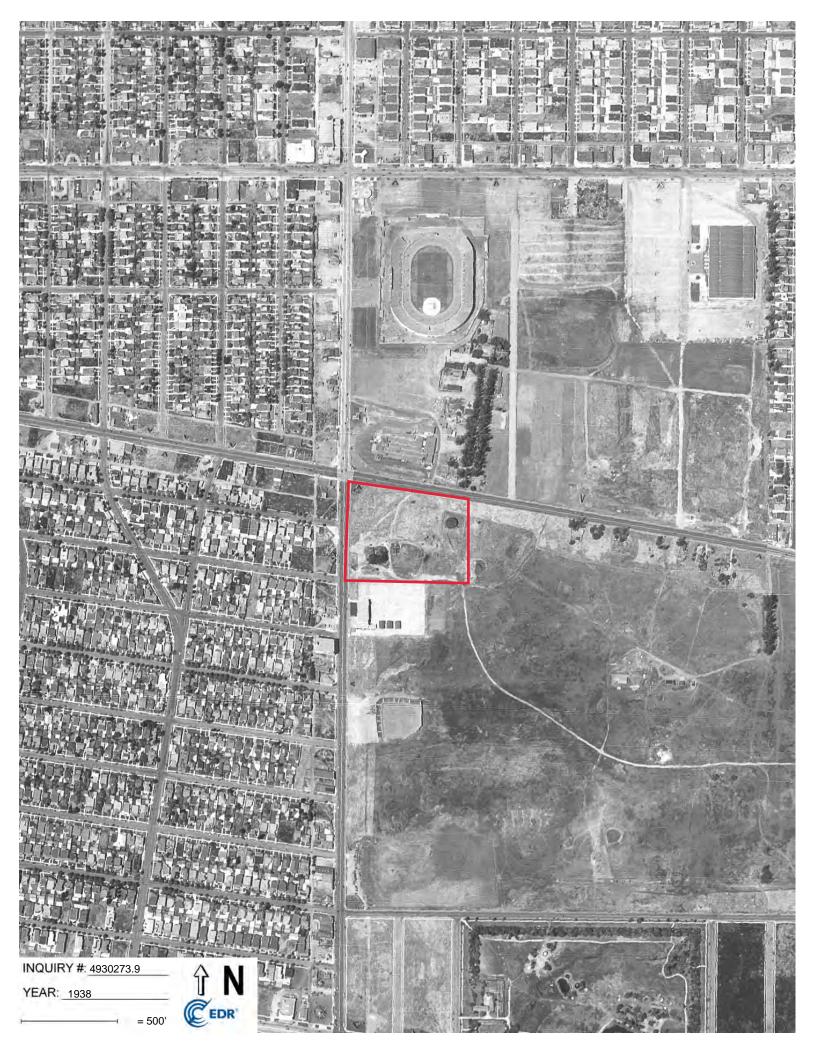



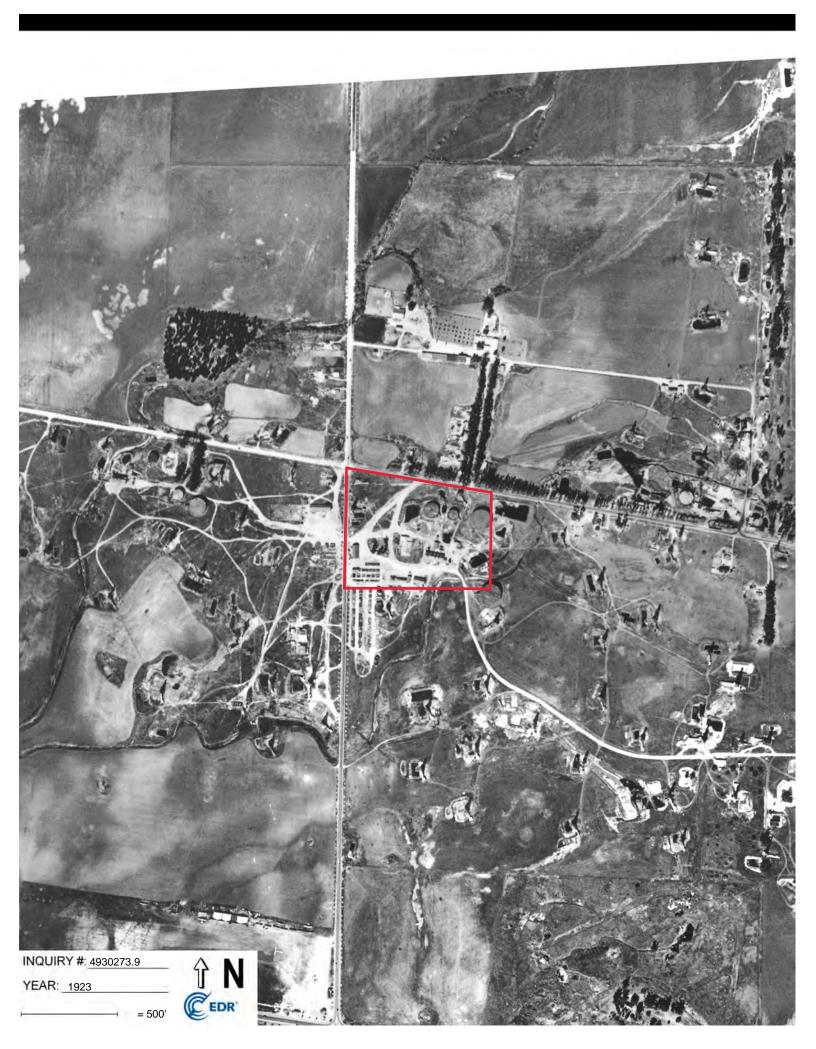

Town & Country Retail 6310 W. Third Street Los Angeles, CA 90036

Inquiry Number: 4930273.4

May 08, 2017

EDR Historical Topo Map Report

with QuadMatch™



EDR Historical Topo Map Report

05/08/17

Site Name: Client Name:

Town & Country Retail 6310 W. Third Street Los Angeles, CA 90036 EDR Inquiry # 4930273.4 ARCADIS U.S., Inc. 320 Commerce Suite 200 Irvine, CA 92602-0000 Contact: Janet Holtz



EDR Topographic Map Library has been searched by EDR and maps covering the target property location as provided by ARCADIS U.S., Inc. were identified for the years listed below. EDR's Historical Topo Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topo Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the late 1800s.

Search Results:		Coordinates:			
P.O.#	NA	Latitude:	34.070699 34° 4' 15" North		
Project:	Regency L.A.	Longitude:	-118.360324 -118° 21' 37" West		
-	,	UTM Zone:	Zone 11 North		
		UTM X Meters:	374476.77		
		UTM Y Meters:	3770829.86		
		Elevation:	180.50' above sea level		
Mane Provid	dod:				

Maps Provided:

2012	1921
1991, 1994	1920
1981	1902
1972	1900
1966	1898
1950, 1953	1896
1926	1894
1924	

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

2012 Source Sheets



Hollywood 2012 7.5-minute, 24000



Beverly Hills 2012 7.5-minute, 24000

1991, 1994 Source Sheets



Hollywood 1991 7.5-minute, 24000 Aerial Photo Revised 1978



Beverly Hills 1994 7.5-minute, 24000 Aerial Photo Revised 1978

1981 Source Sheets



Beverly Hills 1981 7.5-minute, 24000 Aerial Photo Revised 1978



Hollywood 1981 7.5-minute, 24000 Aerial Photo Revised 1978



Hollywood 1972 7.5-minute, 24000 Aerial Photo Revised 1972



Beverly Hills 1972 7.5-minute, 24000 Aerial Photo Revised 1972

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1966 Source Sheets



Beverly Hills 1966 7.5-minute, 24000 Aerial Photo Revised 1964



Hollywood 1966 7.5-minute, 24000 Aerial Photo Revised 1964

1950, 1953 Source Sheets



Beverly Hills 1950 7.5-minute, 24000 Aerial Photo Revised 1947



Hollywood 1953 7.5-minute, 24000 Aerial Photo Revised 1952

1926 Source Sheets



Hollywood 1926 7.5-minute, 24000



Hollywood 1924 7.5-minute, 24000

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1921 Source Sheets



Santa Monica 1921 15-minute, 62500

1920 Source Sheets



SANTA MONICA 1920 15-minute, 62500

1902 Source Sheets



Santa Monica 1902 15-minute, 62500



Los Angeles 1900 15-minute, 62500

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1898 Source Sheets



Santa Monica 1898 15-minute, 62500


1896 Source Sheets



Santa Monica 1896 15-minute, 62500




Los Angeles 1894 15-minute, 62500

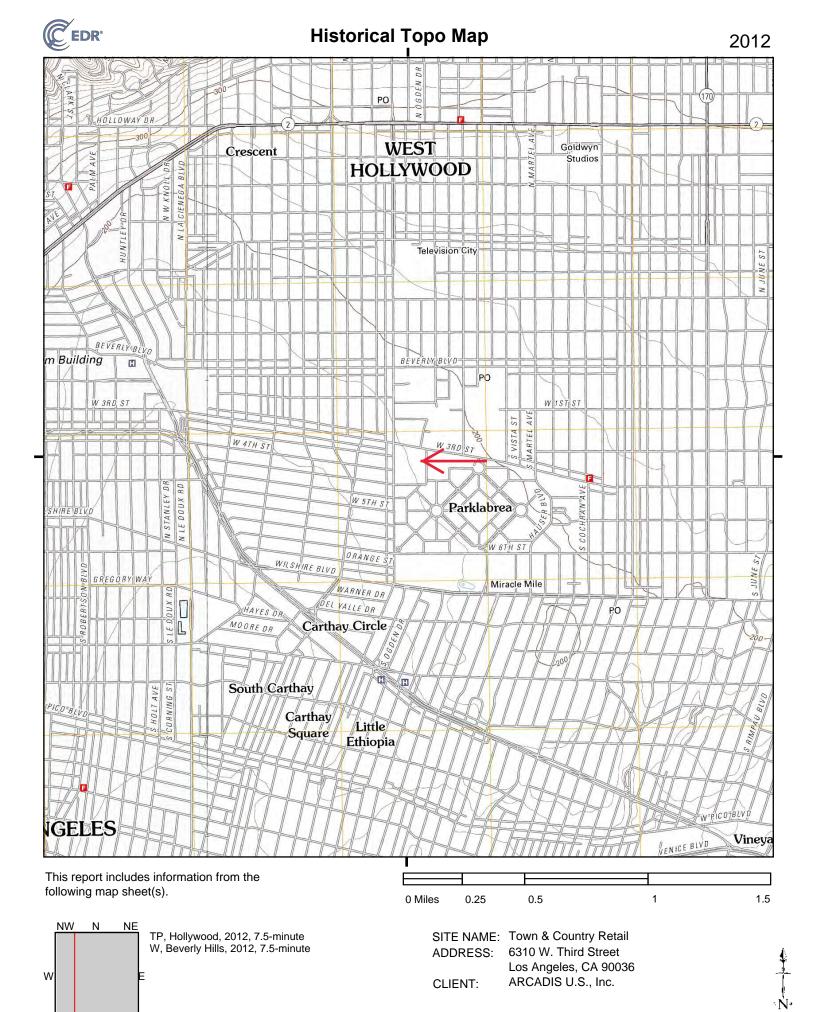

S

SE

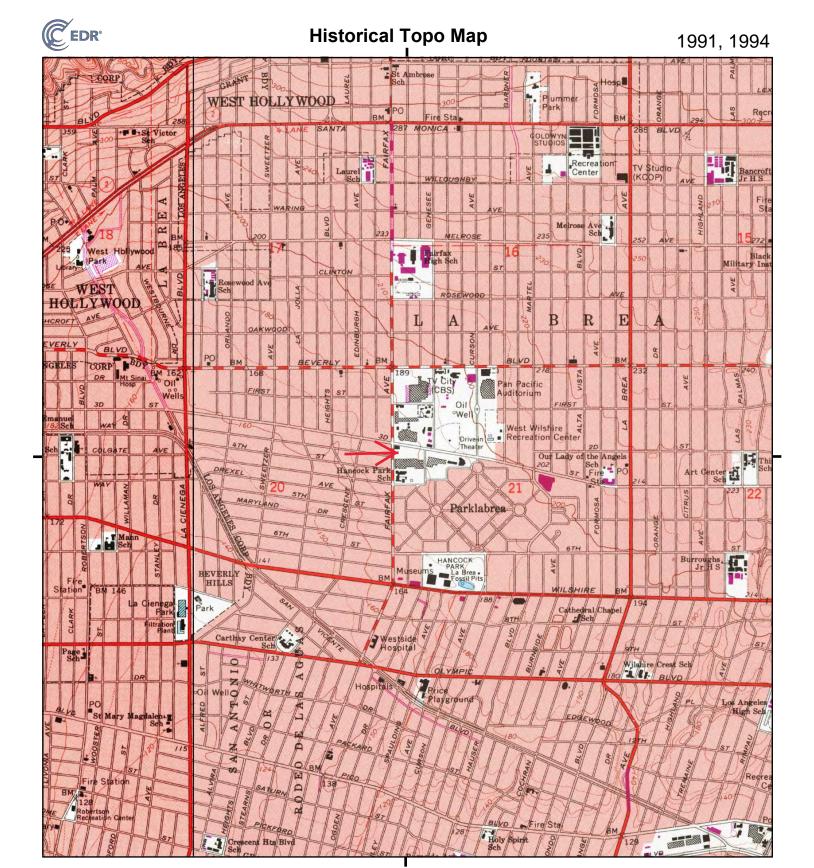

This report includes information from the following map sheet(s).

NW N NE
TP, Hollywood, 1991, 7.5-minute
W, Beverly Hills, 1994, 7.5-minute
SW S SE


0 Miles 0.25 0.5 1 1.5

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street

CLIENT:

Los Angeles, CA 90036 ARCADIS U.S., Inc.

This report includes information from the following map sheet(s).

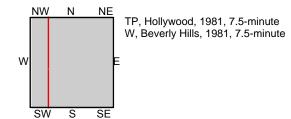

Crescent Hts Blvd


1 0 Miles 0.25 0.5 1.5

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street


CLIENT:

Los Angeles, CA 90036 ARCADIS U.S., Inc.



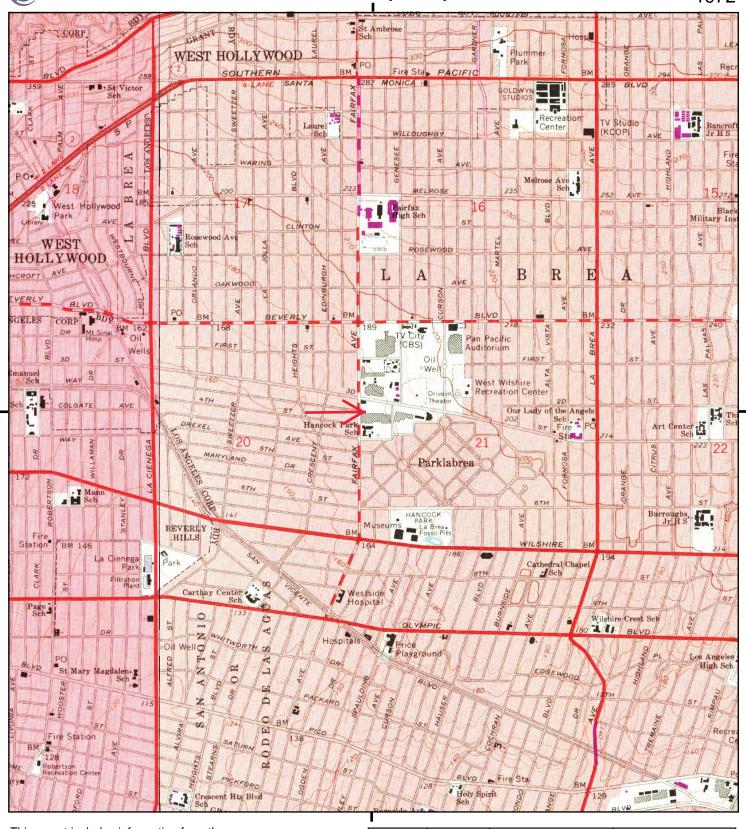

This report includes information from the following map sheet(s).

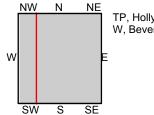


TP, Hollywood, 1972, 7.5-minute W, Beverly Hills, 1972, 7.5-minute

0 Miles 0.25 0.5 1

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street

Los Angeles, CA 90036


CLIENT: ARCADIS U.S., Inc.

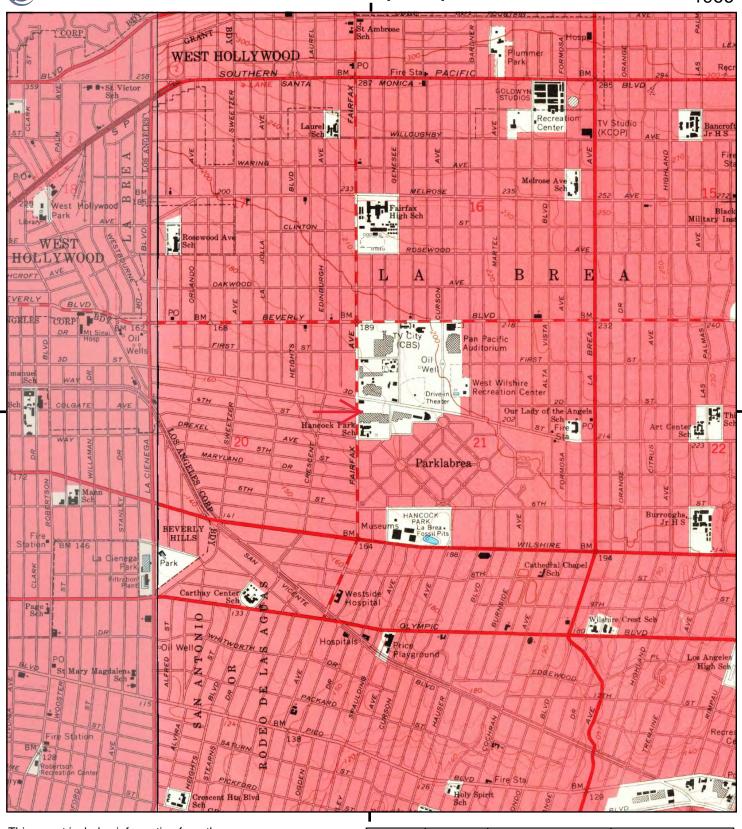

0 Miles

0.25

This report includes information from the following map sheet(s).

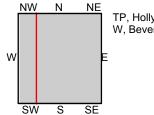

TP, Hollywood, 1966, 7.5-minute W, Beverly Hills, 1966, 7.5-minute

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street


0.5

Los Angeles, CA 90036

CLIENT: ARCADIS U.S., Inc.




1

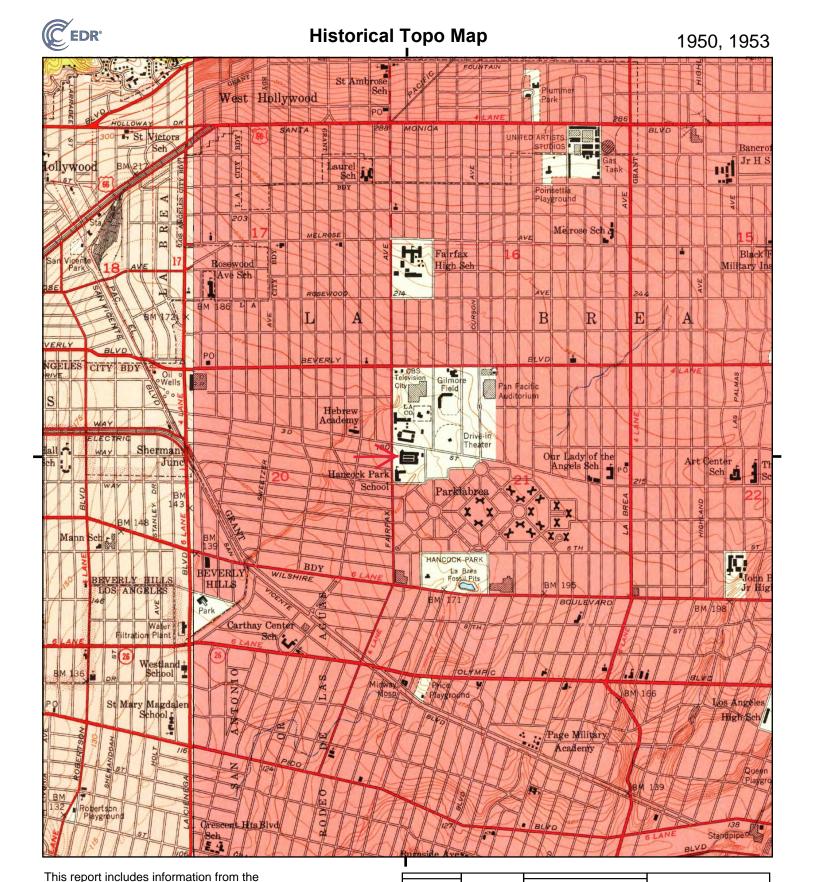

0 Miles

0.25

following map sheet(s).

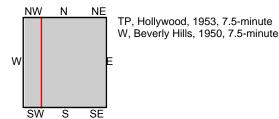


SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street

0.5

Los Angeles, CA 90036

CLIENT: ARCADIS U.S., Inc.


1

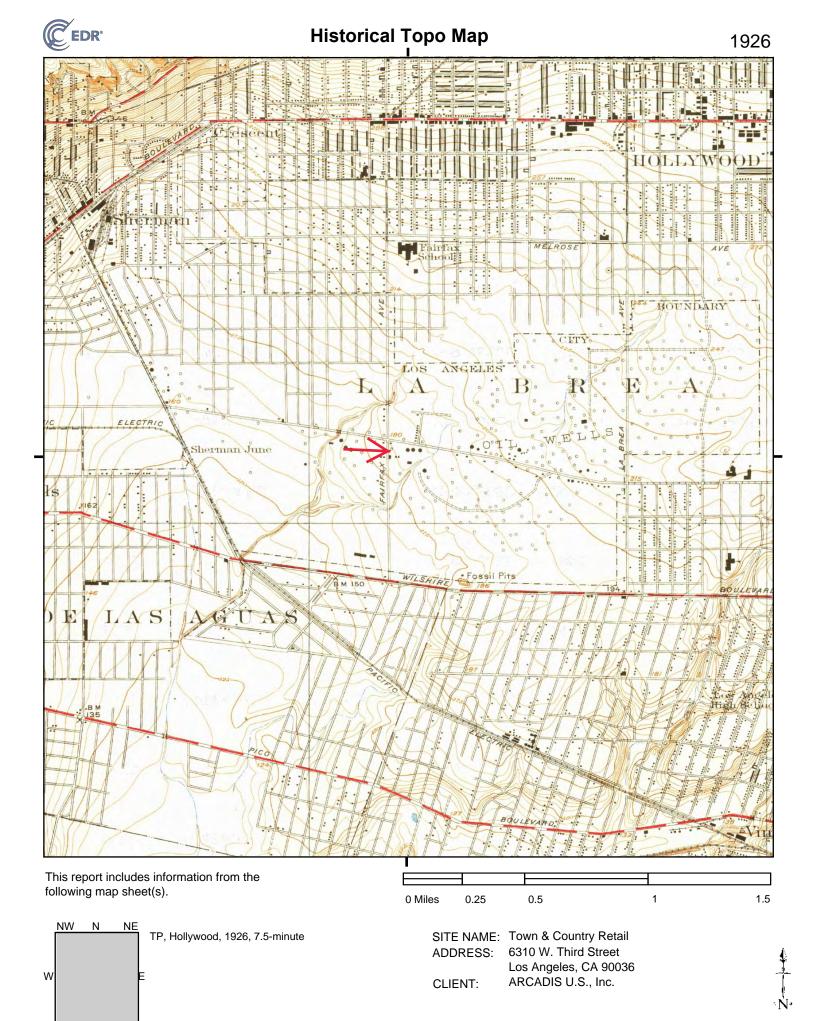

SW

S

SE

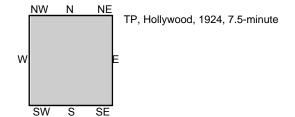


SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street

6310 W. Third Street Los Angeles, CA 90036

CLIENT: ARCADIS U.S., Inc.



This report includes information from the following map sheet(s).

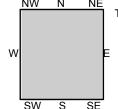

TP, Santa Monica, 1921, 15-minute


0 Miles 0.25 0.5 1.5

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street

Los Angeles, CA 90036

ARCADIS U.S., Inc. CLIENT:




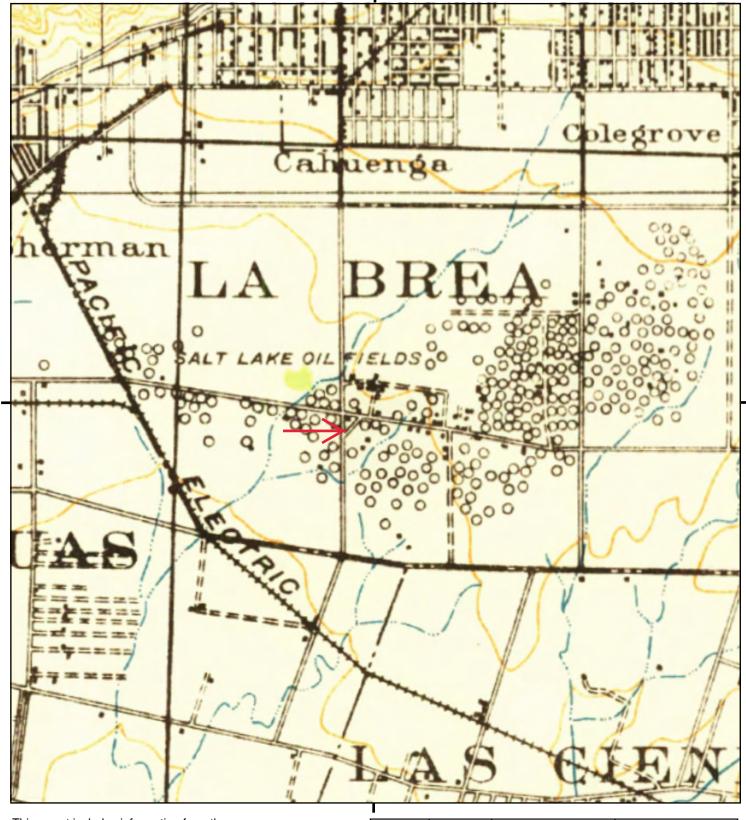

0 Miles

0.25

This report includes information from the following map sheet(s).

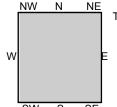


TP, SANTA MONICA, 1920, 15-minute


SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street


0.5


S: 6310 W. Third Street Los Angeles, CA 90036

CLIENT: ARCADIS U.S., Inc.

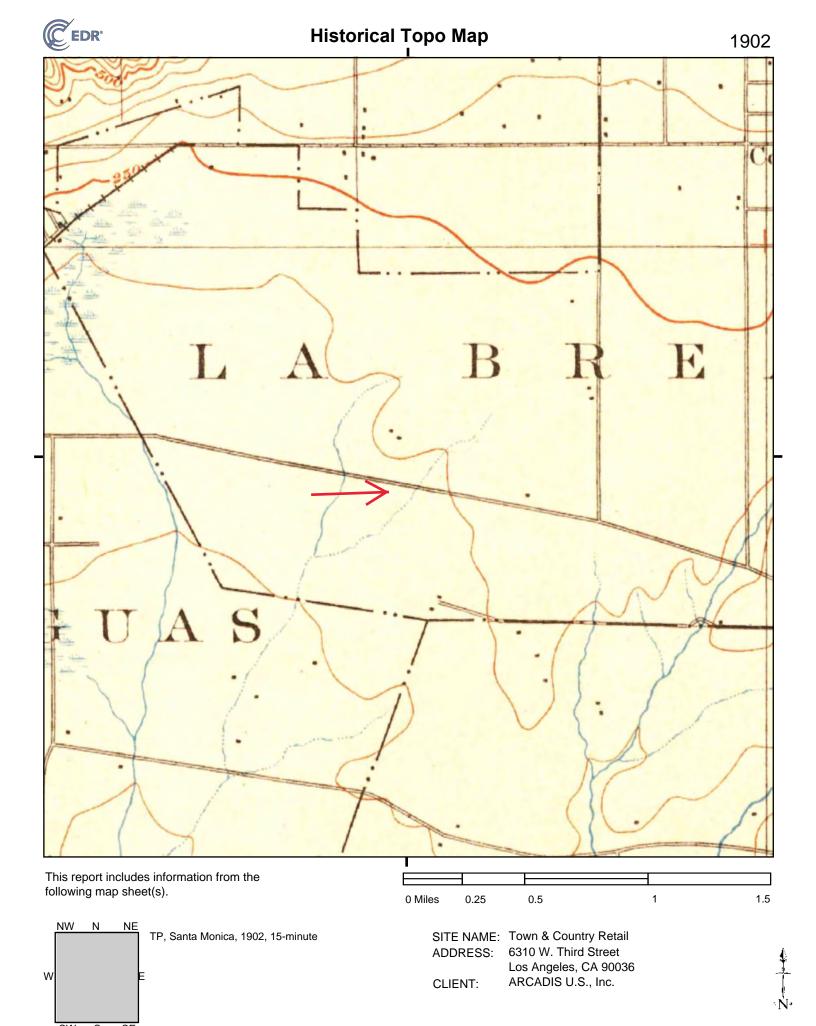

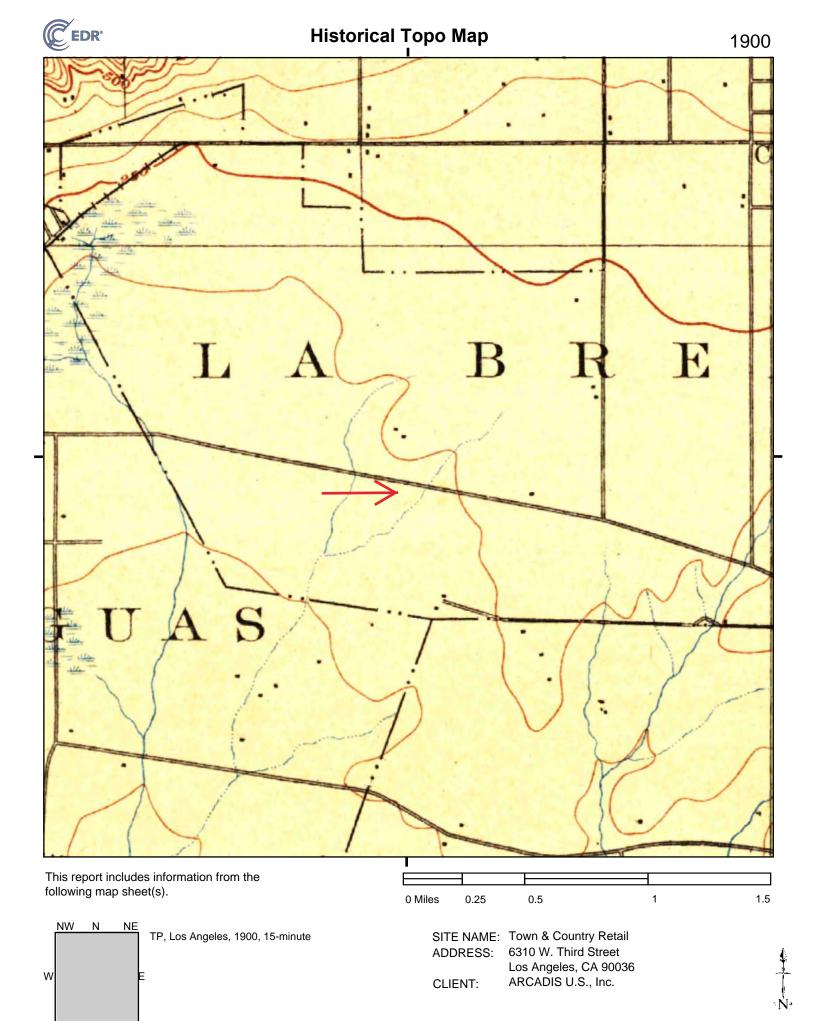

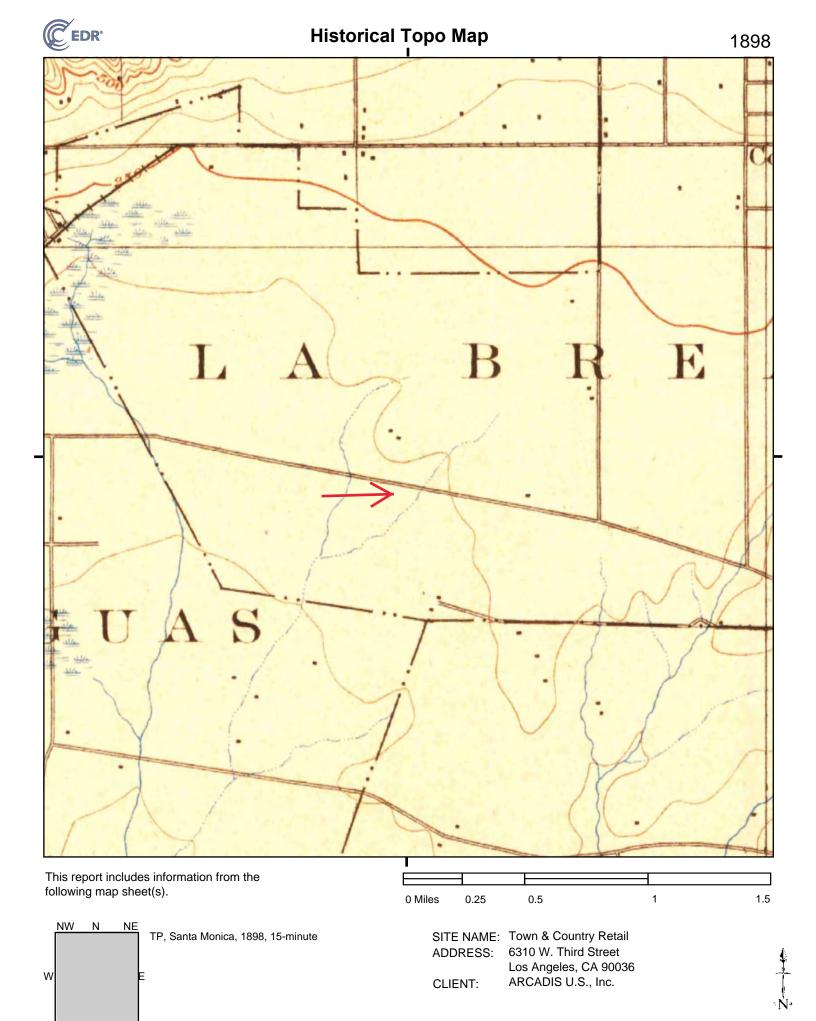

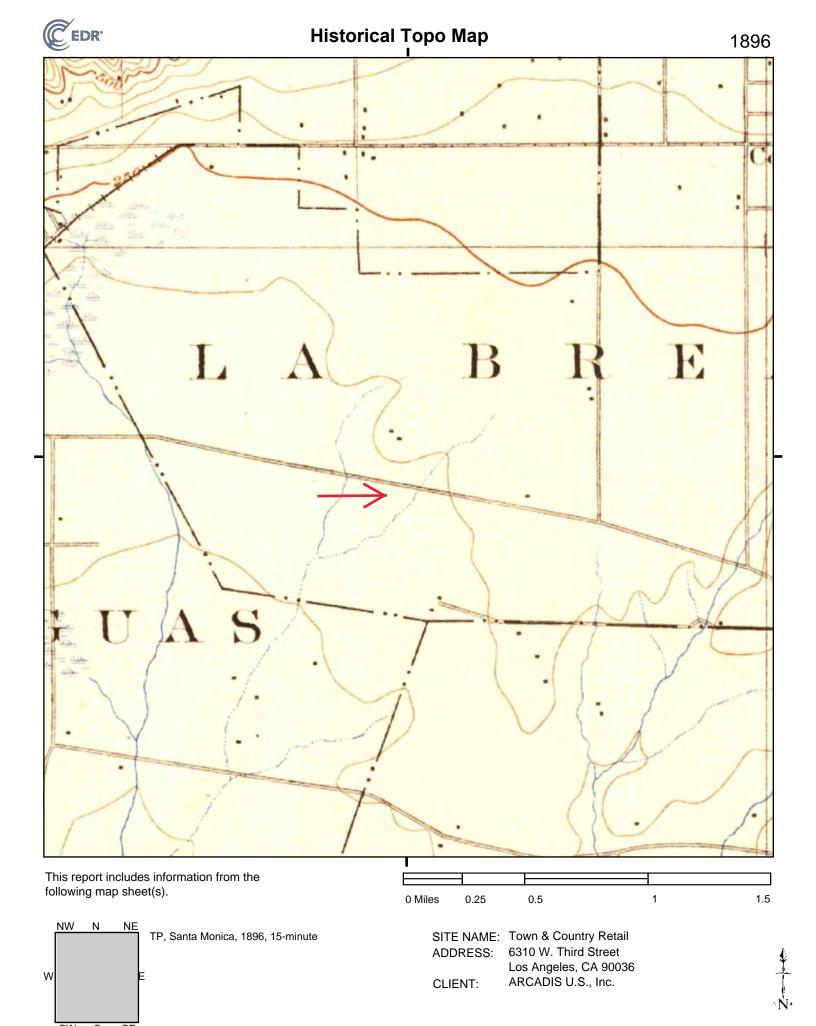



Town & Country Retail

6310 W. Third Street Los Angeles, CA 90036

Inquiry Number: 4930273.5

May 09, 2017

The EDR-City Directory Abstract



TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING. WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1920 through 2014. This report compiles information gathered in this review by geocoding the latitude and longitude of properties identified and gathering information about properties within 332 feet of the target property.

A summary of the information obtained is provided in the text of this report.

RECORD SOURCES

EDR's Digital Archive combines historical directory listings from sources such as Cole Information and Dun & Bradstreet. These standard sources of property information complement and enhance each other to provide a more comprehensive report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.



RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

<u>Year</u>	Source	<u>TP</u>	<u>Adjoining</u>	Text Abstract	Source Image
2014	EDR Digital Archive	-	Χ	X	-
	EDR Digital Archive	Χ	X	X	-
2010	EDR Digital Archive	-	X	X	-
	EDR Digital Archive	Χ	X	X	-
2006	Haines Company, Inc.	-	X	X	-
	Haines Company, Inc.	Χ	X	X	-
2004	Haines Company	-	-	-	-
2003	Haines & Company	-	-	-	-
2001	Haines Company, Inc.	-	-	-	-
2000	Haines & Company	-	X	X	-
1999	Haines Company	-	-	-	-
1996	GTE	-	-	-	-

EXECUTIVE SUMMARY

<u>Year</u>	Source	<u>TP</u>	<u>Adjoining</u>	Text Abstract	Source Image
1995	Pacific Bell	-	Χ	X	-
1992	PACIFIC BELL WHITE PAGES	-	-	-	-
1991	Pacific Bell	-	X	X	-
1990	Pacific Bell	-	X	X	-
	Pacific Bell	Χ	X	Χ	-
1986	Pacific Bell	-	X	Χ	-
	Pacific Bell	Χ	X	X	-
1985	Pacific Bell	-	X	Χ	-
1981	Pacific Telephone	-	X	Χ	-
	Pacific Telephone	Χ	X	Χ	-
1980	Pacific Telephone	-	X	X	-
	Pacific Telephone	Χ	X	X	-
1976	Pacific Telephone	-	X	Χ	-
	Pacific Telephone	Χ	X	X	-
1975	Pacific Telephone	-	X	X	-
1972	R. L. Polk & Co.	-	-	-	-
1971	Pacific Telephone	-	X	X	-
	Pacific Telephone	Χ	X	X	-
1970	Pacific Telephone	-	X	X	-
1969	Pacific Telephone	-	-	-	-
1967	Pacific Telephone	-	X	X	-
	Pacific Telephone	Χ	X	X	-
1966	Pacific Telephone	-	X	X	-
1965	Pacific Telephone	-	X	X	-
1964	Pacific Telephone	-	-	-	-
1963	Pacific Telephone	-	-	-	-
1962	Pacific Telephone	-	X	X	-
1961	R. L. Polk & Co.	-	-	-	-
1960	Pacific Telephone	-	X	X	-
1958	Pacific Telephone	-	X	X	-
1957	Pacific Telephone	-	X	X	-
1956	Pacific Telephone	-	X	X	-
1955	R. L. Polk & Co.	-	-	-	-
1954	R. L. Polk & Co.	-	X	Χ	-
1952	Los Angeles Directory Co.	-	-	-	-
1951	Pacific Telephone & Telegraph Co.	-	X	Χ	-
1950	Pacific Telephone	-	-	-	-
1949	Los Angeles Directory Co.	-	-	-	-
1948	Associated Telephone Company, Ltd.	-	-	-	-
1947	Pacific Directory Co.	-	-	-	-
1946	Southern California Telephone Co	-	-	-	-
1945	R. L. Polk & Co.	-	-	-	-

EXECUTIVE SUMMARY

<u>Year</u>	Source	<u>TP</u>	<u>Adjoining</u>	Text Abstract	Source Image
1944	R. L. Polk & Co.	-	-	-	-
1942	Los Angeles Directory Co.	-	X	X	-
1940	Los Angeles Directory Co.	-	-	-	-
1939	Los Angeles Directory Co.	-	-	-	-
1938	Los Angeles Directory Company Publishers	-	-	-	-
1937	Los Angeles Directory Co.	-	X	X	-
1936	Los Angeles Directory Co.	-	-	-	-
1935	Los Angeles Directory Co.	-	-	-	-
1934	Los Angeles Directory Co.	-	-	-	-
1933	Los Angeles Directory Co.	-	X	X	-
	Los Angeles Directory Co.	Χ	X	X	-
1932	Los Angeles Directory Co.	-	-	-	-
1931	TRIBUNE-NEWS PUBLISHING CO.	-	-	-	-
1930	Los Angeles Directory Co.	-	-	-	-
1929	Los Angeles Directory Co.	-	X	X	-
1928	Los Angeles Directory Co.	-	-	-	-
1927	Los Angeles Directory Co.	-	-	-	-
1926	Los Angeles Directory Co.	-	-	-	-
1925	Los Angeles Directory Co.	-	-	-	-
1924	Los Angeles Directory Co.	-	-	-	-
1923	Los Angeles Directory Co.	-	-	-	-
1921	Los Angeles Directory Co.	-	-	-	-
1920	Los Angeles Directory Co.	-	-	-	-

EXECUTIVE SUMMARY

SELECTED ADDRESSES

The following addresses were selected by the client, for EDR to research. An "X" indicates where information was identified.

<u>Address</u>	<u>Type</u>	<u>Findings</u>
6320 W. Third Street	Client Entered	X
6330 W. Third Street	Client Entered	X
6340 W. Third Strret	Client Entered	X
6350 W. Third Street	Client Entered	X
6360 W. Third Street	Client Entered	X

TARGET PROPERTY INFORMATION

ADDRESS

6310 W. Third Street Los Angeles, CA 90036

FINDINGS DETAIL

Target Property research detail.

<u>W 3RD</u>

6310 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	K MART DISCOUNT STORES STORE NO 7225	Pacific Bell
1986	K MART DISCOUNT STORES LOS ANGELES STORE NO 4007	Pacific Bell
1981	K MART DISCOUNT STORES LOS ANGELES STORE NO 7225	Pacific Telephone
1971	Britts Department Store	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
1933	MORGAN Jas P clk	Los Angeles Directory Co.
	MORGAN Saml S Abbie B oilwkr	Los Angeles Directory Co.

6320 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	PAYLESS SHOE SOURCE	Pacific Bell
1986	VOLUME SHOES	Pacific Bell
1981	SHOE STOP	Pacific Telephone
1971	Karls Shoe Stores	Pacific Telephone
	KARLS SHOE STORES LTD Los Angeles & Orange County Stores	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6330 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	STEWART S JEWELRY & HANDBAGS	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell

6340 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	LEEDS IMPORTS	Pacific Bell

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	LEEDS IMPORTS	Pacific Bell
1981	TOWER TRAVEL & TOURS	Pacific Telephone
1971	Stewarts Jewelry & Handbags	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6350 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	RALPHS GROCERY COMPANY STORES LOS ANGELES APPETITE SHOP	Pacific Bell
1981	SAFEWAY STORES INC	Pacific Telephone

6360 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	TOWN & COUNTRY CENTER STORES	Pacific Bell
1986	SAV-ON-DRUGSS INC	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
1981	SAV ON DRUGS INC	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1971	Sav On Drugs	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

W 3RD APPETITE SHOP

6350 W 3RD APPETITE SHOP

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	RALPHS GROCERY COMPANY STORES LOS ANGELES	Pacific Bell

W 3rd St

6310 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	KMART CORPORATION	EDR Digital Archive
	KMART STORES	EDR Digital Archive
	LITTLE CAESARS PIZZA	EDR Digital Archive
2010	ELECTRONIC FUNDS	EDR Digital Archive
	KMART CORPORATION	EDR Digital Archive
	KMART STORES	EDR Digital Archive

W 3RD ST

6310 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	CAESARS PIZZA	Haines Company, Inc.
	ELECTRNC FUNDS	Haines Company, Inc.
	KMART	Haines Company, Inc.
	KMART LTTL	Haines Company, Inc.
1976	Britts Department Store	Pacific Telephone
	PARK PLAZA BEAUTY SALON	Pacific Telephone
	Storez Britts Depertment Store	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1967	Britts Dept Store	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6320 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	KARLS SHOE STORES LTD	Pacific Telephone
	Los Angeles Stores	Pacific Telephone
	Storez Karls Shoe Stores	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1967	Karls Shoe Stores	Pacific Telephone
	KARLS SHOE STORES Los Angeles Stores	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

W 3rd St

6330 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2010	SHOE CONNECTION	EDR Digital Archive
	UNITED MOBILE PHONES	EDR Digital Archive
	WIRELESS PHONES	EDR Digital Archive

W 3RD ST

6330 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	PHONES	Haines Company, Inc.
	SHOE CONNECTION	Haines Company, Inc.
	UNITD MOBILE	Haines Company, Inc.
1976	Stewarts Jewelry & Handbags	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Storez Stewarts Jewelry & Handbags	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1967	Continental Shoe Salon	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6340 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	ANNAS LINENS	Haines Company, Inc.
1980	Tower Travel & Tours	Pacific Telephone
1976	Tower Travel & Tours	Pacific Telephone
1967	Stewarts Jewelry & Handbags	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

W 3rd St

6350 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	WHOLE FOODS MARKET CAL INC	EDR Digital Archive
2010	WHOLE FOODS MARKET CAL INC	EDR Digital Archive

W 3RD ST

6350 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	WHOLE FOODS	Haines Company, Inc.
1976	Safeway Stores Inc Customer Service For The Following Areas Los Angeles	Pacific Telephone

W 3rd St

6360 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	CVS PHARMACY INC	EDR Digital Archive
2010	CVS PHARMACY INC	EDR Digital Archive
	SAV-ON-DRUGS INC	EDR Digital Archive

W 3RD ST

6360 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	SAV ON DRUGS	Haines Company, Inc.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	SAV ON DRUGS INC Los Angeles	Pacific Telephone
	Storez Sav On Drugs Inc	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1967	Sav On Drugs	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

W 3RD STORE

6350 W 3RD STORE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	RALPHS GROCERY COMPANY STORES LOS ANGELES	Pacific Bell

W. Third Street

6320 W. Third Street

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	PAYLESS SHOE SOURCE	Pacific Bell
1986	VOLUME SHOES	Pacific Bell
1981	SHOE STOP	Pacific Telephone
1976	KARLS SHOE STORES LTD	Pacific Telephone
	Los Angeles Stores	Pacific Telephone
	Storez Karls Shoe Stores	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1971	Karls Shoe Stores	Pacific Telephone
	KARLS SHOE STORES LTD Los Angeles & Orange County Stores	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
1967	Karls Shoe Stores	Pacific Telephone
	KARLS SHOE STORES Los Angeles Stores	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6330 W. Third Street

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	PHONES	Haines Company, Inc.
	SHOE CONNECTION	Haines Company, Inc.
	UNITD MOBILE	Haines Company, Inc.
1990	STEWART S JEWELRY & HANDBAGS	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
1976	Stewarts Jewelry & Handbags	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Storez Stewarts Jewelry & Handbags	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1967	Continental Shoe Salon	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6350 W. Third Street

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	WHOLE FOODS	Haines Company, Inc.
1990	RALPHS GROCERY COMPANY STORES LOS ANGELES	Pacific Bell
1986	RALPHS GROCERY COMPANY STORES LOS ANGELES APPETITE SHOP	Pacific Bell
1981	SAFEWAY STORES INC	Pacific Telephone
1976	Safeway Stores Inc Customer Service For The Following Areas Los Angeles	Pacific Telephone

6360 W. Third Street

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	SAV ON DRUGS	Haines Company, Inc.
1990	TOWN & COUNTRY CENTER STORES	Pacific Bell
1986	SAV-ON-DRUGSS INC	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
1981	SAV ON DRUGS INC	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1976	SAV ON DRUGS INC Los Angeles	Pacific Telephone
	Storez Sav On Drugs Inc	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1971	Sav On Drugs	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
1967	Sav On Drugs	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

W. Third Strret

6340 W. Third Strret

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	ANNAS LINENS	Haines Company, Inc.
1990	LEEDS IMPORTS	Pacific Bell
1986	LEEDS IMPORTS	Pacific Bell
1981	TOWER TRAVEL & TOURS	Pacific Telephone
1980	Tower Travel & Tours	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Tower Travel & Tours	Pacific Telephone
1971	Stewarts Jewelry & Handbags	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
1967	Stewarts Jewelry & Handbags	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

Source

Pacific Telephone & Telegraph Co.

3RD ST W

<u>Year</u>

1951

6306 3RD ST W

<u>Uses</u>

W 3rd Town & Country Mkt Auto Wash

6333 3RD ST W		
<u>Year</u>	<u>Uses</u>	<u>Source</u>
1951	W 3rd Gills Old Fashioned Ice Cream	Pacific Telephone & Telegraph Co.
	W 3rd Johnnie Silveiras Ice Cream	Pacific Telephone & Telegraph Co.
	W 3rd Pelwhite Co fish	Pacific Telephone & Telegraph Co.
	W 3rd Toneys Earl Bakery	Pacific Telephone & Telegraph Co.
	W 3rd Yank Al citrus	Pacific Telephone & Telegraph Co.
	W 3rd	Pacific Telephone & Telegraph Co.
	Cotton Corner The	Pacific Telephone & Telegraph Co.
	Farmers Mkt Hall John & Billie vegetbls	Pacific Telephone & Telegraph Co.
	Farmers Market Ocean Foods Fish Stall	Pacific Telephone & Telegraph Co.
	N Farmers Mkt Vernons Coffee Bar	Pacific Telephone & Telegraph Co.
	Greyhound Bus Lines	Pacific Telephone & Telegraph Co.
	Little Mending Shop The reweaving	Pacific Telephone & Telegraph Co.
	Farmers Mkt Glenns Egg Stall	Pacific Telephone & Telegraph Co.
	Farmers Mkt Puritan Poultry	Pacific Telephone & Telegraph Co.
	Puritan Poultry	Pacific Telephone & Telegraph Co.
	Farmers Mkt Snedecors Gift Shop	Pacific Telephone & Telegraph Co.
	Farmers Market Louis Cuisine restrnt	Pacific Telephone & Telegraph Co.
	Louis Cuisine restrnt	Pacific Telephone & Telegraph Co.
	Farmers Mkt W 3rd & Fairfax Av Fish & Chips Old London	Pacific Telephone & Telegraph Co.
	Old London Fish & Chips	Pacific Telephone & Telegraph Co.
	Castillos Spanish Kitchen	Pacific Telephone & Telegraph Co.
	Boris Juice & Salad Bar	Pacific Telephone & Telegraph Co.
	Farmers Market Boris Juice & Salad Bar	Pacific Telephone & Telegraph Co.
	Farmers Mkt Gadget Nook	Pacific Telephone & Telegraph Co.
	Farmers Mkt Tusquellas John E meat mkt	Pacific Telephone & Telegraph Co.
	Gill Old Fashioned Ice Cream	Pacific Telephone & Telegraph Co.

<u>Year</u>	<u>Uses</u>	Source
1951	Farmers Mkt Beesons Coffee Shop	Pacific Telephone & Telegraph Co.
	Matlafs Poultry & Egg Ranch	Pacific Telephone & Telegraph Co.
	Michaels Cheesecake	Pacific Telephone & Telegraph Co.
	Farmers Mkt Yank Albert citrus prodc	Pacific Telephone & Telegraph Co.
	Farmers Market Magic Nut Shop	Pacific Telephone & Telegraph Co.
	Magic Nut Shop	Pacific Telephone & Telegraph Co.
	Farmers Mkt The Jelly Jar	Pacific Telephone & Telegraph Co.
	Farmers Mkt Desert Date Shop	Pacific Telephone & Telegraph Co.
	Reordan Margaret D Desert Date Shop	Pacific Telephone & Telegraph Co.
	Farmers Market Chinese Kitchen	Pacific Telephone & Telegraph Co.
	Farmers Mkt Floyds	Pacific Telephone & Telegraph Co.
	Farmers Mkt Morgans Garden Shop	Pacific Telephone & Telegraph Co.
	Morgans Garden Shop	Pacific Telephone & Telegraph Co.
	Farmers Market Variety	Pacific Telephone & Telegraph Co.
	B Farmers Mkt Magliano Paul jwlr	Pacific Telephone & Telegraph Co.
	B Magliano Paul jwlr	Pacific Telephone & Telegraph Co.
	Dodge Mary Korn Krib	Pacific Telephone & Telegraph Co.
	Farmers Mkt Dodge Mary Korn Krib	Pacific Telephone & Telegraph Co.
	Farmers Mkt Patsy Wrapping Serv	Pacific Telephone & Telegraph Co.
	Patsy Wrapping Serv	Pacific Telephone & Telegraph Co.
	Wrapping Service Patsy Farmers Market	Pacific Telephone & Telegraph Co.
	Farmers Market Feed Rite Pet Shop	Pacific Telephone & Telegraph Co.
	Feed Rite Pet Shop	Pacific Telephone & Telegraph Co.
	Weis Jack Feed Rite Pet Shop	Pacific Telephone & Telegraph Co.
	Farmers Mkt Wayne Gail accesrs	Pacific Telephone & Telegraph Co.
	Wayne Gail accesrs	Pacific Telephone & Telegraph Co.
	Farmers Mkt Taxco Gift Shop	Pacific Telephone & Telegraph Co.
	Taxco Gift Shop	Pacific Telephone & Telegraph Co.
	W 3rd Arnolds Coffee Bar	Pacific Telephone & Telegraph Co.
	W 3rd Bob White Productions	Pacific Telephone & Telegraph Co.
	W 3rd Brocks Candies	Pacific Telephone & Telegraph Co.
	W 3rd Bryans Pit Barbecue	Pacific Telephone & Telegraph Co.
	W 3rd Curl R B Curls Fine Foods	Pacific Telephone & Telegraph Co.
	W 3rd Curls Fine Foods	Pacific Telephone & Telegraph Co.
	W 3rd Danas	Pacific Telephone & Telegraph Co.
	W 3rd Davidson Meats	Pacific Telephone & Telegraph Co.
	W 3rd Farmerette Beauty Shop	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt fish & oyster bar	Pacific Telephone & Telegraph Co.

<u>Year</u>	<u>Uses</u>	Source
1951	W 3rd Farmers Mkt Alexanders Grocery	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Market Arnolds Coffee Bar	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt Brocks Candies	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt Bryans Pit Barbecue	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt Burbank Stall Vegetables	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt Danas	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt Farmerette Beauty Shop The	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Market Johnnie Silveiras Ice Cream	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Market Michaels Cheesecake	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt Taylor Sausage Co	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Market Toneys Earl Bakery	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt W 3rd & Fairfx Bell Henry F fountn lunch	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Market W 3rd & Fairfax Av Colonial Kitchens Exch	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt W 3rd & Fairfax Av Curls Fine Food	Pacific Telephone & Telegraph Co.
	W 3rd Farmers Mkt W 3rd & Fairfx Av Ocean Foods Fish Stall	Pacific Telephone & Telegraph Co.

FAIRFAX AVE S

327 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1951	S Fairfx Cali Cuba Cigar Co	Pacific Telephone & Telegraph Co.

329 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	XXXX	Haines & Company
1951	S Fairfx La Nel ladies apprl	Pacific Telephone & Telegraph Co.

331 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1951	S Fairfx Fashion Mart of Calif The	Pacific Telephone & Telegraph Co.
335 FAIRFAX AVE S		

Year Uses Source

1951 S Fairfx Knit Nook Pacific Telephone & Telegraph Co.

349 FAIRFAX AVE S

<u>Year</u> <u>Uses</u> <u>Source</u>

2000 KINGS CLE Haines & Company

350 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	Source
2000	XXXX	Haines & Company
1951	S Fairfx	Pacific Telephone & Telegraph Co.
	Hammond Ollie Steak House town & country br	Pacific Telephone & Telegraph Co.
	Hammonds Ollie Steak House town & country br	Pacific Telephone & Telegraph Co.
	Ollie Hammonds Town & Country Steak House	Pacific Telephone & Telegraph Co.
	Town & Country Market Inc Ollie Hammonds Steak House	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Baskin Robbins Ice Cream Co	Pacific Telephone & Telegraph Co.
	Saunders Poultry Mkt	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Saunders Poultry Mkt	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Farm Fresh Produce	Pacific Telephone & Telegraph Co.
	Colony House The restrnt	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Colony House The	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc smoke shop	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Tavern Shop houseware	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc La Paloma Spanish foods	Pacific Telephone & Telegraph Co.
	Margo of Calif	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Stone Ruth accesrs	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc juice bar	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Finkle & Mandelbaum groceries	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Town & Country Delicatessen	Pacific Telephone & Telegraph Co.
	Seafood Mart	Pacific Telephone & Telegraph Co.
	Town & Country Market Inc seafood mart	Pacific Telephone & Telegraph Co.
	Elite Gift Studio	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Elite Gift Studio	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Fishers Hamburgers	Pacific Telephone & Telegraph Co.

<u>Year</u>	<u>Uses</u>	Source
1951	Neill Florence Candies	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Florence Neill Candies	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Star of India	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc pharmacy	Pacific Telephone & Telegraph Co.
	Town & Country Pharmacy	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Jade Garden	Pacific Telephone & Telegraph Co.
	Town and Country Market Inc Cordells French Cuisine	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Mandels Jewlry	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Pastry Shop	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Yolandas Restaurant	Pacific Telephone & Telegraph Co.
	Yolandas Restaurant	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Meyers Barbecue	Pacific Telephone & Telegraph Co.
	Hawaiian Candies & Nuts Ltd	Pacific Telephone & Telegraph Co.
	Sawtelle Robt P Hawaiian Candies & Nuts Ltd	Pacific Telephone & Telegraph Co.
	Kips Toyland	Pacific Telephone & Telegraph Co.
	Mei Wings	Pacific Telephone & Telegraph Co.
	Alexandre Antiques	Pacific Telephone & Telegraph Co.
	Popoff Alexandre Alexandre Antiques	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Kips Toyland	Pacific Telephone & Telegraph Co.
	Town & Country Gifts	Pacific Telephone & Telegraph Co.
	Fink Henry Barber Shop	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Town & Country Sport Shop	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Bird House & Pet Supplies The	Pacific Telephone & Telegraph Co.
	Town and Country Market Inc Maxon	Pacific Telephone & Telegraph Co.
	Patio Knit Shop	Pacific Telephone & Telegraph Co.
	Ross Ranch Fruits & Vegetables	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc C & S Fruit & Produce Mkt	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc music & appliance shop	Pacific Telephone & Telegraph Co.
	Friedman Louis coins & stamps	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Cleaners	Pacific Telephone & Telegraph Co.
	Town & Country Flowers	Pacific Telephone & Telegraph Co.
	Town & Country Flowers	Pacific Telephone & Telegraph Co.

<u>Year</u>	<u>Uses</u>	Source
1951	Town & Country Mkt Inc flowers	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc flowers	Pacific Telephone & Telegraph Co.
	Town & Country Mkt Inc Chuck Jordans lapidaries	Pacific Telephone & Telegraph Co.
	S Fairfx Av Don Rito Renard Cosmetics	Pacific Telephone & Telegraph Co.
	S Fairfx Markys Meats	Pacific Telephone & Telegraph Co.
	S Fairfx Av Renard Don Rito Cosmetics	Pacific Telephone & Telegraph Co.
	S Fairfx Town & Country Mkt	Pacific Telephone & Telegraph Co.
	S Fairfx Town & Country Mkt Inc administration office	Pacific Telephone & Telegraph Co.
	S Fairfx Av Town & Country Mkt Inc beauty salon	Pacific Telephone & Telegraph Co.
	S Fairfx Town & Country Market Inc European Sausage Kitchen	Pacific Telephone & Telegraph Co.
	S Fairfx Town & Country Mkt Inc Seegers Quality Meats	Pacific Telephone & Telegraph Co.

351 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	KARABEL DAMCEWEAR UNLIMITED	Haines & Company
	CARABEL DANCEWEAR 323+99 S	Haines & Company
1951	S Fairfx Av Chief Drive In Clning Plant	Pacific Telephone & Telegraph Co.

353 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	KARABEL DANCEWEAR	Haines & Company
	CARABEL DANCE WEAR	Haines & Company
1951	S Fairfx Davis John C rl est div	Pacific Telephone & Telegraph Co.
	S Fairfx Davis John C rl est	Pacific Telephone & Telegraph Co.

355 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	LARTISAN	Haines & Company

357 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	HOLLYWD FLOWERS WHOLESALE CO 234 S	Haines & Company

359 FAIRFAX AVE S

<u> year</u>	<u>Uses</u>	<u>Source</u>
2000	LONDGREN Kristin	Haines & Company

<u>Year</u>	<u>Uses</u>	<u>Source</u>

1951 S Fairfx Juniorville chldrns apprl Pacific Telephone & Telegraph Co.

361 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	XXXX	Haines & Company
1951	S Fairfx Av Tony Sloan Beauty Salon	Pacific Telephone & Telegraph Co.
	S Fairfx Av Tony Sloan Beauty Salon	Pacific Telephone & Telegraph Co.

363 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	POSTAL UNLIMITED	Haines & Company
	AHKEVA SALES MARKETING FIRM	Haines & Company
	EL BURRITO JUNIOR	Haines & Company
	V N C MEDICAL SUPPLIES	Haines & Company
1951	S Fairfx Bronz Cake Shop	Pacific Telephone & Telegraph Co.

365 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	PIZZA WORLD	Haines & Company
1951	S Fairfx Av Lurie Wm Frankfort Co Inc rltrs	Pacific Telephone & Telegraph Co.
	S Fairfx Av Katz Jack J pub acct	Pacific Telephone & Telegraph Co.
	S Fairfx Frankfort Norman B Frankfort Co Inc ritrs	Pacific Telephone & Telegraph Co.
	S Fairfx Frankfort & Klein See Frankfort Co Inc rltrs	Pacific Telephone & Telegraph Co.
	S Fairfx Frankfort Co Inc rltrs	Pacific Telephone & Telegraph Co.

370 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	C A BREATH CLINIC	Haines & Company

371 FAIRFAX AVE S

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2000	MAS AUTO SERVICE	Haines & Company
1951	S Fairfx Texaco Service Station Dealers 4th & Fairfx Stn	Pacific Telephone & Telegraph Co.

S Fairfax Ave

300 S Fairfax Ave

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	TOYOTA PARTS SOLUTIONS INC	EDR Digital Archive
	CITI PWM	EDR Digital Archive
	THIRD FAIRFAX LLC	EDR Digital Archive
	CITIBANK N A	EDR Digital Archive
	TOYOTA PARTS SOLUTIONS INC	EDR Digital Archive
	CITI PWM	EDR Digital Archive
	CITIBANK N A	EDR Digital Archive
	THIRD FAIRFAX LLC	EDR Digital Archive
2010	THIRD FAIRFAX LLC	EDR Digital Archive
	CITIBANK NA	EDR Digital Archive
	GATES A AA GARAGE DOORS AND	EDR Digital Archive
	CITIBANK NA	EDR Digital Archive
	THIRD FAIRFAX LLC	EDR Digital Archive
	GATES A AA GARAGE DOORS AND	EDR Digital Archive

S FAIRFAX AVE

300 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	NEIGHBORS OF WATTS	Pacific Bell
	CALIFORNIA FEDERAL SAVINGS OFFICES LOS ANGELES	Pacific Bell
1986	NEIGHBORS OF WATTS	Pacific Bell
	CALIFORNIA FEDERAL LOS ANGELES AREA OFFICES LOS ANGELES	Pacific Bell
	BRENTWOOD SAVING & LOAN ASSN	Pacific Bell
1929	NELSON John A lab	Los Angeles Directory Co.

301 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1991	COLUMBIA SAVINGS AND LOAN ASSOCIATION	Pacific Bell
1986	UNITED AUTO REPAIR & SERVICE	Pacific Bell
1985	AIR CAR RENTAL INC	Pacific Bell
1981	UNION OIL DLRS SERVICE STNS	Pacific Telephone
	GARO S UNION	Pacific Telephone
1971	Parviz Union Oil Service	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1958	Union Oil Serv Stns Contiuned Los Angeles Continued	Pacific Telephone
	Golden Eagle Serv Stn	Pacific Telephone
1942	Standard Stations Inc gas stas	Los Angeles Directory Co.
1929	Bunch Guy M Bessie real est	Los Angeles Directory Co.

310 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1933	REAVIS Norris A Daris K oilwkr	Los Angeles Directory Co.
	HAMELL Edw B Louise oilwkr	Los Angeles Directory Co.

325 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	COMFORT SPORTS SHOES	Pacific Bell
1981	EXPRESS FOTOLAB INC	Pacific Telephone
1976	Excell Photo Fairfax	Pacific Telephone
1971	Exotic Snack De Lite	Pacific Telephone
1958	Langermann Furrier	Pacific Telephone

327 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	FAIRFAX LOCK & KEY SERVICE	Pacific Bell
1985	FAIRFAX LOCK & KEY SERVICE	Pacific Bell
1981	FAIRFAX LOCK & KEY SERVICE	Pacific Telephone
1980	Fairfax Lock & Key Service	Pacific Telephone
1976	Trank Harry Icksmth	Pacific Telephone
	FAIRFAX LOCK & KEY SERVICE	Pacific Telephone
1975	FAIRFAX LOCK & KEY SERVICE	Pacific Telephone
1958	Cali Cuba Cigar Co	Pacific Telephone

329 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	ZINA	Pacific Bell
1981	MANNYS BARBER SHOP	Pacific Telephone
1976	Mannys Barber Shop	Pacific Telephone
1971	Mannys Barber Shop	Pacific Telephone
1958	Reiss Morris G pub acct	Pacific Telephone
	Beverly Wilshire Detectives	Pacific Telephone
	Blauvelt Fred R tax counsilr	Pacific Telephone
	Reiss & Blauvelt	Pacific Telephone

331 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	SAM S CUSTOM TAILOR SHOP	Pacific Bell
1981	SAMS TAILOR SHOP	Pacific Telephone
1976	Maxs Tailor Shop	Pacific Telephone
1971	Maxs Tailor Shop	Pacific Telephone
1958	Scharfeld J tlrs	Pacific Telephone

333 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1981	FORUM MIWA BEAUTY SALON	Pacific Telephone
1971	Riera Bob Beauty Salon	Pacific Telephone
	Bobs Beauty Salon	Pacific Telephone
1962	GALE HAUI DESIGN	Pacific Telephone
1958	Salon No Two	Pacific Telephone
	Talk of the Town Coiffeur Inc	Pacific Telephone

335 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	FAIRFAX BARGAIN GENERAL MERCHANDISE	Pacific Bell
1971	Henning Eugene L	Pacific Telephone

337 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Sperber Murray S OD	Pacific Telephone
	Leonard L V OD	Pacific Telephone
1958	Tamms Barber Shop	Pacific Telephone

339 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	BEAUTIFUL NAIL	Pacific Bell
1981	OPTI CAL VISION CENTER	Pacific Telephone
1976	Opti Cal	Pacific Telephone
1971	M & M Rare Coin Co	Pacific Telephone
	Bronson Jan coin dlr	Pacific Telephone

348 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	CLEANERS	Haines Company, Inc.
	FAIR DRY	Haines Company, Inc.

349 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	KINGS CLEANERS	Pacific Bell
1986	KINGS CLEANERS	Pacific Bell
1981	KINGS CLEANERS	Pacific Telephone
1976	Kings Cleaners	Pacific Telephone
1971	Kings Cleaners	Pacific Telephone

350 S FAIRFAX AVE

350 S FAIRFAX AVE		
<u>Year</u>	<u>Uses</u>	<u>Source</u>
1971	ALEXANDERS GROCERY	Pacific Telephone
1960	MATERNITY MOTHERHOOD SHOPS	Pacific Telephone
1958	MATERNITY MOTHERHOOD SHOPS	Pacific Telephone
	Achilles Ortho Pediatric Shoe Repair	Pacific Telephone
	Aldrichs of California Gift Shop	Pacific Telephone
	Arpegio Fashions	Pacific Telephone
	Betty Wales Fashions womens apprl	Pacific Telephone
	Cards & Cups	Pacific Telephone
	Camera Exch	Pacific Telephone
	BRETON HOUSE	Pacific Telephone
	Charles Lewis Casuals	Pacific Telephone
	Charmaine Imports	Pacific Telephone
	Continental Shoe Salon	Pacific Telephone
	Coral Sea Restaurant	Pacific Telephone
	Fishers restrnt	Pacific Telephone
	Forbes Don Record Shop	Pacific Telephone
	Guy Mr mens haberdashery	Pacific Telephone
	Hersheways A Thousand & One Nights	Pacific Telephone
	Hickory Pit Bar B Q	Pacific Telephone
	Hollywood Shoppe The	Pacific Telephone
	India Imports	Pacific Telephone
	Jeb Shirts n Skirts	Pacific Telephone
	KFMU Radio Stn	Pacific Telephone
	Lannis Lingerie Shop	Pacific Telephone
	Lilyans Corsets & Lingerie Shoppe	Pacific Telephone
	Maternity Motherhood Shops	Pacific Telephone
	Mc Coys Antiques & Lamps	Pacific Telephone
	Mei Wings Oriental Gift Shop	Pacific Telephone
	Mexican Kitchen The	Pacific Telephone
	Mr Guy mens haberdashery	Pacific Telephone

<u>Uses</u>	<u>Source</u>
MOTHERHOOD MATERNITY SHOPS	Pacific Telephone
Neill Florence Candies	Pacific Telephone
Ninas Ladies Fashions	Pacific Telephone
Pan American Broadcasting Co	Pacific Telephone
Playmates	Pacific Telephone
Port of Asia	Pacific Telephone
Radio Stn KFMU	Pacific Telephone
Really Yours spotswr & acces	Pacific Telephone
Reiter Ruth & Helen ladies apprl	Pacific Telephone
Relax It Health & Massage Equipt	Pacific Telephone
Richards Ice Cream Shop	Pacific Telephone
Stewarts Jewelry & Handbags	Pacific Telephone
TOWN & COUNTRY VILLAGE	Pacific Telephone
Village Beauty Bar	Pacific Telephone
Village Pie Pan	Pacific Telephone
Village Shoe Fashions	Pacific Telephone
Village Swedish Shop The	Pacific Telephone
Wales Betty womens apprl	Pacific Telephone
Yolandas Restaurant	Pacific Telephone
MATERNITY MOTHERHOOD SHOPS	Pacific Telephone
MATERNITY MOTHERHOOD SHOPS	Pacific Telephone
MATERNITY MOTHERHOOD SHOPS	R. L. Polk & Co.
	MOTHERHOOD MATERNITY SHOPS Neill Florence Candies Ninas Ladies Fashions Pan American Broadcasting Co Playmates Port of Asia Radio Stn KFMU Really Yours spotswr & acces Reiter Ruth & Helen ladies apprl Relax It Health & Massage Equipt Richards Ice Cream Shop Stewarts Jewelry & Handbags TOWN & COUNTRY VILLAGE Village Beauty Bar Village Pie Pan Village Shoe Fashions Village Swedish Shop The Wales Betty womens apprl Yolandas Restaurant MATERNITY MOTHERHOOD SHOPS MATERNITY MOTHERHOOD SHOPS

351 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	GRACE SKIN & NAIL	Haines Company, Inc.
1990	CARABEL DANCEWEAR UNLIMITED	Pacific Bell
	KARABEL DANCEWEAR UNLIMITED	Pacific Bell
1986	CARABEL DANCEWEAR UNLIMITED	Pacific Bell
	KARABEL DANCEWEAR UNLIMITED	Pacific Bell
1981	CARABEL DANCEWEAR UNLIMITED	Pacific Telephone
	KARABEL DANCEWEAR UNLIMITED	Pacific Telephone
1976	Carabel Dancewear Unlimited	Pacific Telephone
	Karabel Dancewear Unlimited	Pacific Telephone
1971	R C R Coin Laundry	Pacific Telephone
1958	Welans Custom Cleaners & Tailors	Pacific Telephone
1942	Kornblum Abr H Mae clo clnr	Los Angeles Directory Co.
1937	Bunch Guy M Bessie real est	Los Angeles Directory Co.
	Kilpatrick Robt T real est	Los Angeles Directory Co.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	WHITE M Alice notary	Los Angeles Directory Co.
	MAYER Justin G reel est	Los Angeles Directory Co.
1933	BUNCH Guy M Bessie R real est	Los Angeles Directory Co.

353 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	SIGNTIST INC	Haines Company, Inc.
1995	Carabel Dance Wear	Pacific Bell
	Karabel Dance Wear	Pacific Bell
1991	Carabet L	Pacific Bell
	Carabet David	Pacific Bell
	Carabet Armie	Pacific Bell
	Carabeo R S Fer	Pacific Bell
	Carabelli Paula	Pacific Bell
	Carabelli Paul M Sepulveda	Pacific Bell
	Carabelli PA	Pacific Bell
	Carabel Dance Wear	Pacific Bell
1990	KARABEL DANCE WEAR	Pacific Bell
	CARABEL DANCE WEAR	Pacific Bell
1986	CARABEL DANCE WEAR	Pacific Bell
	KARABEL DANCE WEAR	Pacific Bell
1985	Carabel Dance Wear	Pacific Bell
	Karabel Dance Wear	Pacific Bell
1981	CARABEL DANCE WEAR	Pacific Telephone
	KARABEL DANCE WEAR	Pacific Telephone
1976	Carabel Dance Wear	Pacific Telephone
	Karabel Dance Wear	Pacific Telephone
1971	Imperial Wig Imports	Pacific Telephone
1958	Johnnys Shoe Repair	Pacific Telephone

355 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	LARTISAH	Haines Company, Inc.
1990	L ARTISAN	Pacific Bell
1986	L ARTISAN	Pacific Bell
1981	L ARTISAN	Pacific Telephone
1976	LARTISAN	Pacific Telephone
1971	LArtisan	Pacific Telephone

357 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	Source
2006	HOLYO	Haines Company, Inc.
	FLOWERS	Haines Company, Inc.
	WHOLESALE CO	Haines Company, Inc.
1990	FAIRFAX COINS	Pacific Bell
	MANDEL ROBT B COINS & STAMPS	Pacific Bell
	SADOVNICK BRETT TRADES	Pacific Bell
	TRADES	Pacific Bell
1986	MANDEL ROBT B COINS & STAMPS	Pacific Bell
	MANDEL ROBT B STAMPS & COINS	Pacific Bell
1981	MANDEL ROBT B COINS & STAMPS	Pacific Telephone
	MANDEL ROBT B STAMPS & COINS	Pacific Telephone
1976	Arnolds Stamps & Coins	Pacific Telephone
	Harolds Coins & Stamps	Pacific Telephone
	Harolds Stamps & Coins	Pacific Telephone
1971	Arnolds Stamps	Pacific Telephone

359 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	WEST COAST IMPORT EXPORT	Pacific Bell
1986	WEST COAST IMPORT EXPORT	Pacific Bell
1981	STOP N SAVE	Pacific Telephone
1976	Hawaii Independent Travel	Pacific Telephone
	INDEPENDENT TRAVEL SERVICE INC	Pacific Telephone
	Israel Independent Travel	Pacific Telephone
1971	Hawaii Independent Travel	Pacific Telephone
	INDEPENDENT TRAVEL SERVICE INC	Pacific Telephone
	Israel Independent Travel	Pacific Telephone
1965	M J DELSON CO MTGES	Pacific Telephone
1958	Delson M J Co rl est loans	Pacific Telephone
	ACME MORTGAGE CO	Pacific Telephone
	Acme Mortgage Co	Pacific Telephone
	DELSON M J CO mtges	Pacific Telephone
	Pioneer Mortgage Co See Pioneer Trust Deed Co	Pacific Telephone

361 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	DECORDOVA	Haines Company, Inc.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	BODEGA	Haines Company, Inc.
1990	MOMS GOURMET KITCHEN	Pacific Bell
1981	JOSEF S BEAUTY SALON	Pacific Telephone
1976	Maynards Hair Fashions	Pacific Telephone
	Pik A Book Co	Pacific Telephone
1971	LEE GILL WORK SHOP	Pacific Telephone
	Maynards Hair Fashions	Pacific Telephone
1958	Fabiano Beauty Salon	Pacific Telephone
	Fabiano Beauty Salon	Pacific Telephone
	Gill Lee Workshop	Pacific Telephone
	Lee Gill Workshop	Pacific Telephone

363 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	WESTSIDE	Haines Company, Inc.
	OPTICIANS	Haines Company, Inc.
	FRANKSOILER	Haines Company, Inc.
	OPCHARBOIS E	Haines Company, Inc.
1990	PEKING TAM	Pacific Bell
1986	KOSHER EXPRESS	Pacific Bell
1981	KOZO ICE CREAM FAIRFAX BRANCH	Pacific Telephone
1958	Bronz Cake Shop	Pacific Telephone

365 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	PIZZAWORLDINC	Haines Company, Inc.
1990	NOSTRA KOSHER	Pacific Bell
	KOSHER NOSTRA	Pacific Bell
1986	NOSTRA KOSHER	Pacific Bell
	KOSHER NOSTRA	Pacific Bell
1981	NOSTRA KOSHER	Pacific Telephone
	KOSHER NOSTRA	Pacific Telephone
1976	Decorators Quilting Co	Pacific Telephone
1958	ASTA-AMERICAN SLEEP TEACHING ASSN	Pacific Telephone
	Natl Labor Bureau	Pacific Telephone
	Melnikow H P Natl Labor Bureau	Pacific Telephone
	Asta American Sleep Teaching Assn	Pacific Telephone
	American Sleep Teaching Assn	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1957	ASTA-AMERICAN SLEEP TEACHING	Pacific Telephone

ASSN

370 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	LEVETT E R	Pacific Bell
	KINCAID HARRISON R	Pacific Bell
	SELDITZ HARRY A	Pacific Bell
	FINK HERMAN N & ASSOCIATES	Pacific Bell
	GEST MORRIS	Pacific Bell
1981	BEAUMAN STEVEN K	Pacific Telephone
	FINK HERMAN N & ASSOCIATES	Pacific Telephone
	GEST MORRIS	Pacific Telephone
	KINCAID HARRISON R	Pacific Telephone
	LEVETT E R	Pacific Telephone
	SELDITZ HARRY A	Pacific Telephone
1976	LEVETT E R	Pacific Telephone
	FINK HERMAN N & ASSOCIATES	Pacific Telephone
	Foster Glen B	Pacific Telephone
	KINCAID HARRISON R	Pacific Telephone
	SELDITZ HARRY A	Pacific Telephone
1971	FINK HERMAN N & ASSOCIATES	Pacific Telephone
	FOSTER GLEN B	Pacific Telephone
	KINCAID HARRISON R	Pacific Telephone
	LEVETT E R	Pacific Telephone
	SELDITZ HARRY A	Pacific Telephone
	Stoddard Raymond H	Pacific Telephone

361 1/2 S FAIRFAX AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	OPTIMART	Pacific Bell
	MARER LESLIE	Pacific Bell

<u>W 3RD</u>

6296 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	VALU RITE DRUGS	Pacific Bell
	SAV-RX DRUGS	Pacific Bell
	DISCO DRUG PHARMACY	Pacific Bell

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	VALU-RITE DRUGS	Pacific Bell
	SAV-RX DRUGS	Pacific Bell
	DISCO DRUG PHARMACY	Pacific Bell
1981	VALU-RITE DRUGS	Pacific Telephone
	SAV-RX DRUGS	Pacific Telephone
	DISCO DRUG PHARMACY	Pacific Telephone
1971	Tower Drug Co	Pacific Telephone
	Rexall Drug Park La Brea	Pacific Telephone
	Park La Brea The Owl Drug Co	Pacific Telephone
	OWL DRUG COMPANY ARKLa Brea	Pacific Telephone
1962	Tower Drug Co	Pacific Telephone
	Park La Brea The Owl Drug Co	Pacific Telephone
	Park La Brea Owl Rexall Drug Store	Pacific Telephone
	OWL DRUG COMPANY PARKLa Brea	Pacific Telephone

6298 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	ROSS STORES	Pacific Bell
	ROSS DRESS FOR LESS JEWELRY	Pacific Bell
1986	ROSS STORES	Pacific Bell
1962	Market Basket Park La Brea	Pacific Telephone
	VAN de KAMPS HOLLAND DUTCH BAKERS Los Angeles Bakery Stores	Pacific Telephone
	Market Basket	Pacific Telephone

6301 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	JUNIOR LEAGUE OF L A	Pacific Bell
	BROWN JOHN H	Pacific Bell
	GILMORE A F CO	Pacific Bell
	JLLA CITY WINDOW	Pacific Bell
	JUNIOR LEAGUE OF L A	Pacific Bell
1986	GILMORE A F CO	Pacific Bell
	BROWN JOHN H	Pacific Bell
1981	GILMORE A F CO	Pacific Telephone
	GILMORE A F CO	Pacific Telephone
1962	Gilmore E B	Pacific Telephone

6302 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1991	Hollywood Locksmith	Pacific Bell
	Jims Lock & Key Service	Pacific Bell
	Jims Maintenance CULVER CITY 3976681	Pacific Bell
	Jims Lock & Key Service	Pacific Bell
	HOLLYWOOD LOCKSMITH	Pacific Bell
1990	HOLLYWOOD LOCKSMITH	Pacific Bell
	JIM S LOCK & KEY SERVICE	Pacific Bell
1986	HOLLYWOOD LOCKSMITH	Pacific Bell
	JIM S LOCK & KEY SERVICE	Pacific Bell

6316 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	SINGER SEWING COMPANY APPROVED DEALERS	Pacific Bell
	WEST LOS ANGELES SEWING CENTER	Pacific Bell

6318 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	FOX PHOTO 1 HOUR LABS	Pacific Bell
	FOX 50 MINUTE COLOR PRINTS	Pacific Bell
1986	FOX 50 MINUTE COLOR PRINTS	Pacific Bell
	FOX PHOTO 1 HOUR LABS	Pacific Bell
1985	Town & Country Shpng Ctr	Pacific Bell
1981	BETTY WALES FASHIONS	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1971	Betty Wales Fashions	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Betty Wales Fashions	Pacific Telephone

6322 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	IDA S FASHIONS	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
1986	IDAS FASHIONS	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
1981	NINA S FASHIONS	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1971	Ninas Fashions	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Ninas Fashions	Pacific Telephone

6324 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	OPTICAL SHOPPE THE	Pacific Bell
1986	OPTICAL SHOPPE THE	Pacific Bell
1981	OPTICAL SHOPPE	Pacific Telephone
1971	Lannis	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Lannis	Pacific Telephone

6326 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	TOWN & COUNTRY CENTER STORES	Pacific Bell
	A LA CARD	Pacific Bell
	A L A CARD	Pacific Bell
	ALA CARD	Pacific Bell
1986	A LA CARD	Pacific Bell
	ALA CARD	Pacific Bell
	ALA CARD	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
1981	ALA CARD	Pacific Telephone
	ALA CARD	Pacific Telephone
	A LA CARD	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1971	A La Card	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	A La Card	Pacific Telephone

6328 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	CLAUDETTE JEWELRY	Pacific Bell
1986	CLAUDETTE JEWELRY	Pacific Bell
1981	CLAUDETTE JEWELRY	Pacific Telephone
1971	M Ladye Half Size Fashions	Pacific Telephone
	MLadye Half Size Fashions	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6331 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	FARMERS MKT ARTS & ANTIQUE GALLERY	Pacific Bell

6332 W 3RD

		0
<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	ANDRE S OF TOWN & COUNTRY	Pacific Bell
	CLEOPATRA S FISHERS HAMBURGERS	Pacific Bell
	CLIFTOWN JR	Pacific Bell
	MAJESTIC JEWELRY	Pacific Bell
	PEKING PALACE CHINESE RESTAURANT	Pacific Bell
	TOWN & COUNTRY CENTER PATIO SHOPS	Pacific Bell
1986	SUNNYS COFFEE SHOP	Pacific Bell
	MOONGATE ORIENTAL RESTAURANT	Pacific Bell
	MR FOOD	Pacific Bell
	TOWN & COUNTRY CENTER PATIO SHOPS ANDRE S OF TOWN & COUNTRY	Pacific Bell
	ANDRE S OF TOWN & COUNTRY	Pacific Bell
	CLEOPATRA S FISHERS HAMBURGERS	Pacific Bell
	LAURIES FLOWERS	Pacific Bell
	MAJESTIC JEWELRY	Pacific Bell
	MIKE S GREEK CUISINE	Pacific Bell
1981	ADELE S EMBROIDERED IMPORTS & HANDICRAFTS	Pacific Telephone
	ANDRE S OF TOWN & COUNTRY	Pacific Telephone
	ASAHI JAPANESE RESTAURANT	Pacific Telephone
	AVO S RESTAURANT	Pacific Telephone
	CLEOPATRA RESTAURAT	Pacific Telephone
	OF THE WORLD RESTAURANT & DELICATESSEN	Pacific Telephone
	KABAB HOUSE RESTAURANT	Pacific Telephone
	MAJESTIC JEWELRY	Pacific Telephone
	PEPE S MEXICAN CAFETERIA	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1971	Andres Of Town & Country	Pacific Telephone
	California Donuts And Pie Shop	Pacific Telephone
	Fishers Hamburgers	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1971	Jerrys Dog Pound food stand	Pacific Telephone
	Majestic Jewelry	Pacific Telephone
	Patio Gallery The	Pacific Telephone
	Scandinavian Inn	Pacific Telephone
	Scandinavian Inn	Pacific Telephone
	Town & Country Barber Shop	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Jerrys Dog Pound	Pacific Telephone
	TOWN & COUNTRY CENTER Patio Shops	Pacific Telephone
	Andres Of Town & Country	Pacific Telephone
	TOWN & COUNTRY CENTER Patio Shops	Pacific Telephone
	California Donuts And Pie Shop	Pacific Telephone
	Fishers Hamburgers	Pacific Telephone
	TOWN & COUNTRY CENTER Patio Shops	Pacific Telephone
	Town & Country Barber Shop	Pacific Telephone
	Town & Country Barber Shop	Pacific Telephone
	Yonkles Town & Country Bar B Q	Pacific Telephone
	Yonkles Town & Country Bar B Q	Pacific Telephone
1962	Upright Drapery Studio	Pacific Telephone

6333 W 3RD

<u>Year</u>	<u>Uses</u>	Source
1991	B DALTON BOOKSELLER	Pacific Bell
	Los Angeles Farmers Market	Pacific Bell
1990	ALEXANDER S GROCERY	Pacific Bell
	AMERICA U S A	Pacific Bell
	B DALTON BOOKSELLER BEVERLY HILLS BH	Pacific Bell
	BETTY S CARDTOWNE	Pacific Bell
	CASTILLO S SPANISH KITCHEN	Pacific Bell
	CHARLIE S LOPEZ PRODUCE INC	Pacific Bell
	CHINESE KITCHEN FARMERS MKT	Pacific Bell
	CRYSTAL EMPORIUM THE	Pacific Bell
	DIANES FLOWERS	Pacific Bell
	DREW S CANDLE SHOP CANDLES BY DREW	Pacific Bell
	FARMER FRESH PRODUCE	Pacific Bell
	FARMERS FRESH FLOWER MARKET	Pacific Bell

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	FARMERS MARKET NEWSTAND	Pacific Bell
	FARMERS MARKET-NEWSTAND	Pacific Bell
	FARMERS MARKET PEWTER-TIFFANY CREATIONS	Pacific Bell
	GILL OLD FASHIONED ICE CREAM	Pacific Bell
	GILL S OLD FASHIONED ICE CREAM	Pacific Bell
	GUMBO POT THE	Pacific Bell
	HILARY S FROZEN YOGURT	Pacific Bell
	HUNTINGTON MEATS	Pacific Bell
	JUNGLE BOB S	Pacific Bell
	KIDDYLAND	Pacific Bell
	KOKOMO CAFE	Pacific Bell
	KORNGUT MARVIN S	Pacific Bell
	LACE & GLITZ	Pacific Bell
	LANGSTON S SAUSAGE	Pacific Bell
	LITTLE JOHN S ENGLISH TOFFEE HOUSE	Pacific Bell
	MAGEE S MKTS	Pacific Bell
	MARIE S FRENCH & ITALIAN CUISINE	Pacific Bell
	MRS FIELDS COOKIES	Pacific Bell
	PERSON TO PERSON-PERSONALIZED GIFTS	Pacific Bell
	PEWTER PARK-TIFFANY CREATIONS	Pacific Bell
	PHIL S DELI	Pacific Bell
	PHIL S ROUNDUP	Pacific Bell
	RALPH S KEY SHOP	Pacific Bell
	SCRIPT CRAFT PERSONALIZED JWLRY	Pacific Bell
	SHELTAMS	Pacific Bell
	TESQUELLA S FISH & OYSTER BAR	Pacific Bell
	THEES CONTINENTAL PASTRIES	Pacific Bell
	326 BEER & WINE	Pacific Bell
	TIFFANY CREATIONS PEWTER	Pacific Bell
	TOKYO HOUSE	Pacific Bell
	TONY S PIZZA SPAGHETTI	Pacific Bell
	VIASPORT	Pacific Bell
	WALDER S WINES & SPIRITS	Pacific Bell
	WALDER S WINES & SPIRITS	Pacific Bell
1986	ADVERTISING COMMITEE	Pacific Bell
	ALEXANDER S GROERY	Pacific Bell

<u>Year</u>	<u>Uses</u>	Source
1986	BARCHI FOOD	Pacific Bell
	BETTY S CARDTOWNE	Pacific Bell
	BUNCHES OF FLOWERS	Pacific Bell
	CASTILLO S SPANISH KITCHMN	Pacific Bell
	CHINESE KITCHEN FARMER S MKT	Pacific Bell
	CIRCUS VARGAS	Pacific Bell
	CRYSTAL EMPORIUM THE	Pacific Bell
	DE LA CHESNAYE NORMAN	Pacific Bell
	FARMER FRESH PRODUCE	Pacific Bell
	FARMERS MKT	Pacific Bell
	FARMERS MKT FRUIT & PRODUCE	Pacific Bell
	FARMERS MARKET NEWSSTAND	Pacific Bell
	FARMERS MARKET NEWSTAND SEE SHELTAMS	Pacific Bell
	FARMERS MARKET PEWTER-TIFFANY CREATIONS	Pacific Bell
	FARMERS MKT STATIONERY N CARDS	Pacific Bell
	FARMERS MKT WINE & SPIRITS	Pacific Bell
	GILL OLD FASHINED ICE CREAM	Pacific Bell
	GILL S OLD FASHIONED ICE CREAM	Pacific Bell
	GRAY LINE SIGHTSEEING TOURS FARMERS MARKET	Pacific Bell
	GRAY LINE TOURS FARMERS MARKET	Pacific Bell
	GRAY LINE TOURS CHARTER SERVICE FARMERS MARKET	Pacific Bell
	GUMBO POT THE	Pacific Bell
	HANSON GALLERIES	Pacific Bell
	JOE S NURSERY	Pacific Bell
	JOE S NURSERY	Pacific Bell
	JUNIOR LEAGUE OF L A	Pacific Bell
	KORNGUT MARVIN S	Pacific Bell
	LANGSTON S SAUSAGE	Pacific Bell
	MRS FIELDS COOKIES	Pacific Bell
	NON STUFFY STATIONERY	Pacific Bell
	PEWTER PARK TIFFANY CREATIONS	Pacific Bell
	PHIL S DELI	Pacific Bell
	PHIL S ROUNDUP	Pacific Bell
	QUICHE LORI BKRY	Pacific Bell
	RALPHS KEY SHOP	Pacific Bell

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	RICKER-BARTLETT PEWTER-TIFFANY CREATION	Pacific Bell
	SHELTAMS	Pacific Bell
	STEVE S OASIS	Pacific Bell
	SUNRISE PIES & DESSERTS	Pacific Bell
	TESQUELLA S FISH & OYSTER BAR	Pacific Bell
	THEES CONTINENTAL PASTRIES	Pacific Bell
	TIFFANY CREATIONS PEWTER	Pacific Bell
	TOKYO HOUSE	Pacific Bell
	TONY S PIZZA-SPAGHETTI	Pacific Bell
	TUSQUELLAS MEAT MARKET	Pacific Bell
	VIASPORT	Pacific Bell
	WALDER S WINES & SPIRITS	Pacific Bell
	WINE GARDEN CAFE	Pacific Bell
1981	ACAPULCO PRODUCE	Pacific Telephone
	ALEXANDER S GROCERY	Pacific Telephone
	ALTABET S FLOWER SHOP	Pacific Telephone
	LOS ANGELES FARMERS MARTKET	Pacific Telephone
	BETTY S CARDLOWNE-FARMERS MARKET	Pacific Telephone
	BILL DANIELS QUALITY POULTRY	Pacific Telephone
	CASTILLO S SPANISH KITCHEN	Pacific Telephone
	CHINESE KITCHEN FARMER S MKT	Pacific Telephone
	DIANAS GLASS ART	Pacific Telephone
	FARMER S MARKET BOOK & NEWS	Pacific Telephone
	FARMER S MKT FRUIT & PRODUCE	Pacific Telephone
	FARMERS MARKET MAGIC & FUN SHOP	Pacific Telephone
	FARMER S MKT NEWS STAND	Pacific Telephone
	ICE CREAM	Pacific Telephone
	GILLS OLD FASHIONED ICE CREAM	Pacific Telephone
	GILL OLD FASHIONED ICE CREAM	Pacific Telephone
	GILL S OLD FASHIONED ICE CREAM	Pacific Telephone
	HANSON GALLERIES	Pacific Telephone
	JOE S NURSERY	Pacific Telephone
	JUNIOR LEAGUE OF L A	Pacific Telephone
	LA FRIEDA MEATS	Pacific Telephone
	MICHAEL S GOURMET PASTRY	Pacific Telephone
	PHIL S ROUNDUP	Pacific Telephone
	QUICHE LORI BKRY	Pacific Telephone

<u>Year</u>	<u>Uses</u>	Source
1981	RALPH S KEY SHOP	Pacific Telephone
	ROGERS WHOLESALE POULTRY	Pacific Telephone
	ROY S SHOE SHINE STAND	Pacific Telephone
	SHELTAM BOOKS	Pacific Telephone
	SMITH S OLYMPIC SPORTS	Pacific Telephone
	STEVE S OASIS	Pacific Telephone
	THEES CONTINENTAL PASTRIES	Pacific Telephone
	TONY S PIZZA-SPAGHETTI	Pacific Telephone
	ULTIMATE NUT CO INC THE	Pacific Telephone
	WORLDWIDE FASHIONS	Pacific Telephone
	YOUNG HOONG CORP	Pacific Telephone
1971	Accessory Shop The	Pacific Telephone
	Altabets Flower Shop	Pacific Telephone
	Blind Information Center	Pacific Telephone
	Callies Jack Restaurant	Pacific Telephone
	CASTILLOS SPANISH KITCHEN	Pacific Telephone
	Country Kitchen	Pacific Telephone
	Farmers Market	Pacific Telephone
	Dorothe Maternity Fashions	Pacific Telephone
	Farmers Mkt	Pacific Telephone
	Du Pars Restaurants & Bakeries Encino	Pacific Telephone
	Egg Basket	Pacific Telephone
	FARMERS MKT FRUIT & PRODUCE	Pacific Telephone
	Information Center For The Blind	Pacific Telephone
	Jack Callies Restaurant	Pacific Telephone
	Junior League Of L A	Pacific Telephone
	Mens Miscellaneous	Pacific Telephone
	Meshulams Inc	Pacific Telephone
	Our Disposable World	Pacific Telephone
	PITTS THOS D NURSERY	Pacific Telephone
	Ralphs Key Shop	Pacific Telephone
1962	BLIND INFORMATION CENTER FOR THE JUNIOR LEAGUE OF L A	Pacific Telephone
	Castllos Spanish Kitchen	Pacific Telephone
	FARMERS MKT FRUIT & PRODUCE	Pacific Telephone
	Fish Retail Ocean Foods	Pacific Telephone
	Horner John M pub acct	Pacific Telephone
	Information Center fot the Blind Junior League of L A	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1962	Junior League of L A Information Center for the Blind	Pacific Telephone
	Ocean Foods Fish Stall	Pacific Telephone
	Pelwhite Co fish	Pacific Telephone
	STONES PRODUCE	Pacific Telephone

6334 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1991	Allen Will	Pacific Bell
	At I Wertz Candies	Pacific Bell
1990	TOWN & COUNTRY CENTER STORES	Pacific Bell
	WERTZ ALLEN CANDIES	Pacific Bell
	ALLEN WERTZ CANDIES MAIN OFC & STORE	Pacific Bell
1986	ALLEN WERTZ CANDIES	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
	WERTZ ALLEN CANDIES MAIN OFC & STORE	Pacific Bell
1981	ALLEN WERTZ CANDIES	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	WERTZ ALLEN CANDIES	Pacific Telephone
1971	Neill Florence Candles	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Neill Florence Candies	Pacific Telephone

6336 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	ESKIMO S GOURMET FROZEN YOGURT INC	Pacific Bell
1986	TOWN & COUNTRY CENTER STORES	Pacific Bell
	CHARMAINE	Pacific Bell
1981	TOWN & COUNTRY CENTER	Pacific Telephone
	CHARMAINE	Pacific Telephone
1971	Charmaine	Pacific Telephone
	Charmaine	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6338 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1981	TOWN & COUNTRY CENTER	Pacific Telephone
	MR LOU S BEAUTY SUPPLIES & WIGS	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1971	Lous Beauty Supplies	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Lous Beauty Supplies	Pacific Telephone

6342 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	TOWN & COUNTRY CENTER STORES	Pacific Bell
	EVA S BAKERY	Pacific Bell
1986	EVAS BAKERY	Pacific Bell
	TOWN & COUNTRY CENTER STORES	Pacific Bell
1981	TOWN & COUNTRY CENTER	Pacific Telephone
	EVA S BAKERY	Pacific Telephone
1971	Evas Bakery	Pacific Telephone

6332 1/2 W 3RD

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	TOWN & COUNTRY NEWSTAND	Pacific Bell

W 3RD 9318894

6333 W 3RD 9318894

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1990	RICKER BARTLETT PEWTER TIFFANY CREATION	Pacific Bell

W 3RD ST

6296 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Tower Drug Co	Pacific Telephone
	Rexall Drug Parklabrea	Pacific Telephone
	Park La Brea The Owl Drug Co	Pacific Telephone
	OWL DRUG COMPANY PARKLABREA	Pacific Telephone
	Disco Drug & Discount Center	Pacific Telephone
1967	Tower Drug Co	Pacific Telephone
	Rexall Drug Park La Brea	Pacific Telephone
	Park La Brea The Owl Drug Co	Pacific Telephone
	OWL DRUG COMPANY PARKLa Brea	Pacific Telephone
1958	Parklabrea	Pacific Telephone

W 3rd St

6298 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	ROSS STORES INC	EDR Digital Archive
	ROSS STORES INC	EDR Digital Archive
2010	ROSS STORES INC	EDR Digital Archive
	ROSS STORES INC	EDR Digital Archive

W 3RD ST

6298 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	ROSS STORES	Haines Company, Inc.
1976	Market Basket Stores	Pacific Telephone
1967	Market Basket Stores	Pacific Telephone
1958	Market Basket Parklabrea	Pacific Telephone
	Van de Kamps Holland Dutch Bakers Los Angeles Bakery Stores	Pacific Telephone

6301 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	BUILDING	Haines Company, Inc.
	ABERCROMBIE	Haines Company, Inc.
	FITCH COMPANY	Haines Company, Inc.
	ANTHROPOLOGIE	Haines Company, Inc.
	BANANA REPUBLIC	Haines Company, Inc.
	GROVE	Haines Company, Inc.
	BARNES NOBLE	Haines Company, Inc.
	BOOKSELLERS	Haines Company, Inc.
	CELL FACTORY INC	Haines Company, Inc.
	CHICOS	Haines Company, Inc.
	COACH STORE AT	Haines Company, Inc.
	FARMERS MARKET	Haines Company, Inc.
	GAPTHE	Haines Company, Inc.
	GILMORE A F CO	Haines Company, Inc.
	GILMORE A F CO	Haines Company, Inc.
	ICE ACCESSORIES	Haines Company, Inc.
	LAPIAZZA	Haines Company, Inc.
	LUCKY BRAND	Haines Company, Inc.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	JEANS	Haines Company, Inc.
	NIKE GODDESS AT	Haines Company, Inc.
	THE GROVE	Haines Company, Inc.
	PACSUNWEAR	Haines Company, Inc.
	THE WHISPER LNG	Haines Company, Inc.
	EXEC OFC	Haines Company, Inc.
	T MOBILE	Haines Company, Inc.
1976	Gilmore Earl Mrs	Pacific Telephone
	Weygandt Harold W Sr	Pacific Telephone
1967	Gilmore Earl Mrs	Pacific Telephone
1958	Brown Henry	Pacific Telephone
	Gilmore E B	Pacific Telephone

W 3rd St

6302 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	A-1 KEYS	EDR Digital Archive
	A-1 KEYS	EDR Digital Archive
2010	A-1 KEYS	EDR Digital Archive
	A-1 KEYS	EDR Digital Archive

W 3RD ST

6302 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1985	HOLLYWOOD LOCKSMITH	Pacific Bell

6306 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>

1958 Town & Country Auto Wash Pacific Telephone

6314 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Store Operating Co Office	Pacific Telephone
	Mc Crory Stores	Pacific Telephone
	Mc Coroy Stores	Pacific Telephone

6316 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	TOWN & COUNTRY CENTER	Pacific Telephone
	Storez Town & Country Sewing Center	Pacific Telephone

6318 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Storez Betty Wales Fashions	Pacific Telephone
	Betty Wales Fashions	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1967	Betty Wales Fashions	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Betty Wales Fashions	Pacific Telephone

W 3rd St

6322 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	BUZA	EDR Digital Archive
	BUZA	EDR Digital Archive
2010	SHOE STUDIO	EDR Digital Archive
	A ROBERTA CORP	EDR Digital Archive
	A ROBERTA CORP	EDR Digital Archive
	SHOE STUDIO	EDR Digital Archive

W 3RD ST

6322 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Ninas Fashions	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	Storez Ninas Fashions	Pacific Telephone
1967	Ninas Fashions	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Ninas Fashions	Pacific Telephone

W 3rd St

6324 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	PAYLESS SHOESOURCE INC	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	PAYLESS SHOESOURCE INC	EDR Digital Archive
2010	COLLECTIVE BRANDS INC	EDR Digital Archive
	COLLECTIVE BRANDS INC	EDR Digital Archive

W 3RD ST

6324 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	PAYLESS SHOE	Haines Company, Inc.
	SOURCE	Haines Company, Inc.
1967	Lannis	Pacific Telephone
	Lannis	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone

6326 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Storez A La Card	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	Ala Card	Pacific Telephone
	ALA Card	Pacific Telephone
	A Los Angeles CARD	Pacific Telephone
1967	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	A La Card	Pacific Telephone
	A La Card	Pacific Telephone

W 3rd St

6328 W 3rd St

<u>Year</u>	<u>Uses</u>	Source
2014	WIGS TODAY	EDR Digital Archive
	JUNE & F INC	EDR Digital Archive
	JUNE & F INC	EDR Digital Archive
	WIGS TODAY	EDR Digital Archive
2010	WIGS TODAY	EDR Digital Archive
	JUNE & F INC	EDR Digital Archive
	JUNE & F INC	EDR Digital Archive
	WIGS TODAY	EDR Digital Archive

W 3RD ST

6328 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	ROBERTA CORP INC	Haines Company, Inc.
1976	Pinkn Blue Childrens Boutique	Pacific Telephone
1967	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Upright Drapery Studio	Pacific Telephone
	Upright Drapery Studio	Pacific Telephone

W 3rd St

6332 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	MR ANDRE	EDR Digital Archive
	ANDRES ITALIAN RESTAURANT	EDR Digital Archive
	MR ANDRE	EDR Digital Archive
	ANDRES ITALIAN RESTAURANT	EDR Digital Archive
2010	MR ANDRE	EDR Digital Archive
	ANDRES ITALIAN RESTAURANT	EDR Digital Archive
	MR ANDRE	EDR Digital Archive
	ANDRES ITALIAN RESTAURANT	EDR Digital Archive

W 3RD ST

6332 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	ANDRES	Haines Company, Inc.
	RESTAURANT	Haines Company, Inc.
	THAI PATIO	Haines Company, Inc.
1976	Andres Of Town & Country	Pacific Telephone
	Carmel Deli Restaurant	Pacific Telephone
	China Boy Restaurant	Pacific Telephone
	Fishers Hamburgers	Pacific Telephone
	Majestic Jewelry	Pacific Telephone
	Patio Gallery The	Pacific Telephone
	Thin World The restrnt	Pacific Telephone
	Patio Shops Andres Of Town & Country	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	Patio Shops Calif Donnts	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	TOWN & COUNTRY CENTER	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	Patio Shops Fishers Hanburgers	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	Patio Shops Patio Artesia Gallery	Pacific Telephone
1967	Anderson Soft Pretzels	Pacific Telephone
	Andres of Town & Country	Pacific Telephone
	Dog Pound restrnt	Pacific Telephone
	Dundee Donuts & Juice Bar	Pacific Telephone
	Fishers Hamburgers	Pacific Telephone
	Hardy Muriel Village Pie Pan	Pacific Telephone
	Majestic Jewelry	Pacific Telephone
	Pie Pan	Pacific Telephone
	Pretzels Inc	Pacific Telephone
	Scandinavia Inn	Pacific Telephone
	Scandinavian Inn	Pacific Telephone
	Town & Country Barber Shop	Pacific Telephone
	TOWN & COUNTRY CENTER Patio Shops	Pacific Telephone
	Andres of Town & Country	Pacific Telephone
	TOWN & COUNTRY CENTER Patio Shops	Pacific Telephone
	Dundee Donuts & Juice Bar	Pacific Telephone
	Fishers Hamburgers	Pacific Telephone
	TOWN & COUNTRY CENTER Patio Shops	Pacific Telephone
	Scandinavian Inn	Pacific Telephone
	TOWN & COUNTRY CENTER Patio Shops	Pacific Telephone
	Town & Country Barber Shop	Pacific Telephone
	Town & Country Barber Shop	Pacific Telephone
	Village Pie Pan	Pacific Telephone
	Yonkles Town & Country Bar B Q	Pacific Telephone
	Town & Country Barber Shop	Pacific Telephone
	VILLAGE PIE PAN	Pacific Telephone
	YONKLES TOWN & COUNTRY BAR B Q	Pacific Telephone

W 3rd St

6333 W 3rd St

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	GUMBO POT	EDR Digital Archive
	GLOBAL EYE LASER CNTR MED GRP	EDR Digital Archive
	MARKET OPTMTRIX DCTORS OPTMTRY	EDR Digital Archive
	MAGIC NUT LLC	EDR Digital Archive
	VANCE-WLLIVER HUNTINGTON MEATS	EDR Digital Archive
	PAMPAS GRILL	EDR Digital Archive
	SUR LA TABLE INC	EDR Digital Archive
	SHINE GALLERY	EDR Digital Archive
	GILLS ICE CREAM CALIFORNIA	EDR Digital Archive
	GIFT & GADGET NOOKS INC	EDR Digital Archive
	FRENCH CREPE CO	EDR Digital Archive
	CHINA DEPOT	EDR Digital Archive
	SUSHI A GOGO	EDR Digital Archive
	FARMERS MARKET SHOE REPAIR	EDR Digital Archive
	T& Y BAKERY	EDR Digital Archive
	PURITAN POULTRY	EDR Digital Archive
	MONSIEUR MARCEL GOURMET MARKET	EDR Digital Archive
	STROUK GROUP INC	EDR Digital Archive
	AROYAN MOSES	EDR Digital Archive
	MOISHES	EDR Digital Archive
	MONSTER TALENT MANAGEMENT INC	EDR Digital Archive
	SHELTAM BOOKS	EDR Digital Archive
	ZIA VALENTINA LLC	EDR Digital Archive
	ZARA USA INC	EDR Digital Archive
	DIVAS WEAR	EDR Digital Archive
	FARM FRESH PRODUCE	EDR Digital Archive
	FARM BOY	EDR Digital Archive
	STARBUCKS CORPORATION	EDR Digital Archive
	GAZAL ISAAC	EDR Digital Archive
	MARMALADE LLC	EDR Digital Archive
	SHORT ORDER	EDR Digital Archive
	RALPHS KEY SHOP	EDR Digital Archive
	COST PLUS INC	EDR Digital Archive
	PATSY DAMORE ITALIAN FOOD	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	DEANOS PIZZA	EDR Digital Archive
	LAPGENIUS INC	EDR Digital Archive
	MARKS JASON TALENT MANAGEMENT	EDR Digital Archive
	BARBERSHOP CLUB	EDR Digital Archive
	LITTLEJOHNS CANDY	EDR Digital Archive
	FARMERS MARKET	EDR Digital Archive
	WOODLAND EMBROIDERY	EDR Digital Archive
	PEKING KITCHEN	EDR Digital Archive
	LOTERIA GRILL HOLLYWOOD	EDR Digital Archive
	URBAN TRIBES	EDR Digital Archive
	KIPS TOYLAND	EDR Digital Archive
	AKT HOLDINGS LLC	EDR Digital Archive
	PAPPARDELLES PASTA	EDR Digital Archive
	ULYSSES VOYAGE GREEK REST	EDR Digital Archive
	HUTCHCO	EDR Digital Archive
	TOKYO HOUSE	EDR Digital Archive
	FRITZI DOG MANAGEMENT CO LLC	EDR Digital Archive
	CHANG MINNIE	EDR Digital Archive
	GRASS BURGER LLC	EDR Digital Archive
	SHELTAM BOOKS	EDR Digital Archive
	POWERCELL	EDR Digital Archive
	ESSENCE OF NATURE	EDR Digital Archive
	MARCONDAS MEATS INC	EDR Digital Archive
	CAMPER ATLANTIC CORP	EDR Digital Archive
	DU PARS REST & BAKERIES CORP	EDR Digital Archive
	TBILISI & YEREVAN BAKERY	EDR Digital Archive
	MAGIC NUT LLC	EDR Digital Archive
	VANCE-WLLIVER HUNTINGTON MEATS	EDR Digital Archive
	MAJESTIC JEWELRY	EDR Digital Archive
	LEON WEISS SYSTEM WATCH & JWLY	EDR Digital Archive
	WEISS JEWELRY	EDR Digital Archive
	GLOBAL EYE LASER CNTR MED GRP	EDR Digital Archive
	MARKET OPTMTRIX DCTORS OPTMTRY	EDR Digital Archive
	326 BEER & WINE	EDR Digital Archive
	326 LLC	EDR Digital Archive
	PAMPAS GRILL	EDR Digital Archive
	LITTLE SPAIN	EDR Digital Archive
	LIGHT MY FIRE	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2014	MAGEES FARMER MARKET INC	EDR Digital Archive
	S B GIFT	EDR Digital Archive
	DRAGUNARA SPICE BAZAAR	EDR Digital Archive
	CKK GROUP LLC	EDR Digital Archive
	ICONIC ACCESSORIES	EDR Digital Archive
	PHILS ROUND UP AND GRILL INC	EDR Digital Archive
	EL HIJO DE GRANJERO	EDR Digital Archive
	TUSQUELLAS SEA FOODS	EDR Digital Archive
	BOBS COFFEE & DONUT SHOP INC	EDR Digital Archive
	SPORT FASHIONS	EDR Digital Archive
	STICKER PLANET	EDR Digital Archive
	COFFEE BEAN & TEA LEAF	EDR Digital Archive
	PLANET DAILIES (LA) LLC	EDR Digital Archive
	SALAD BAR	EDR Digital Archive
	MONSIEUR MARCEL GOURMET MARKET	EDR Digital Archive
	STROUK GROUP INC	EDR Digital Archive
	AROYAN MOSES	EDR Digital Archive
	MOISHES	EDR Digital Archive
	MAJESTIC JEWELRY	EDR Digital Archive
	WEISS JEWELRY	EDR Digital Archive
	LEON WEISS SYSTEM WATCH & JWLY	EDR Digital Archive
	326 BEER & WINE	EDR Digital Archive
	326 LLC	EDR Digital Archive
	LITTLE SPAIN	EDR Digital Archive
	LIGHT MY FIRE	EDR Digital Archive
	MAGEES FARMER MARKET INC	EDR Digital Archive
	DRAGUNARA SPICE BAZAAR	EDR Digital Archive
	CKK GROUP LLC	EDR Digital Archive
	ICONIC ACCESSORIES	EDR Digital Archive
	S B GIFT	EDR Digital Archive
	PHILS ROUND UP AND GRILL INC	EDR Digital Archive
	EL HIJO DE GRANJERO	EDR Digital Archive
	SPORT FASHIONS	EDR Digital Archive
	TUSQUELLAS SEA FOODS	EDR Digital Archive
	BOBS COFFEE & DONUT SHOP INC	EDR Digital Archive
	STICKER PLANET	EDR Digital Archive
	ZIA VALENTINA LLC	EDR Digital Archive
	ZARA USA INC	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	Source
2014	COFFEE BEAN & TEA LEAF	EDR Digital Archive
	PLANET DAILIES (LA) LLC	EDR Digital Archive
	SALAD BAR	EDR Digital Archive
	DIVAS WEAR	EDR Digital Archive
	FARM BOY	EDR Digital Archive
	FARM FRESH PRODUCE	EDR Digital Archive
	STARBUCKS CORPORATION	EDR Digital Archive
	GAZAL ISAAC	EDR Digital Archive
	MARMALADE LLC	EDR Digital Archive
	SHORT ORDER	EDR Digital Archive
	RALPHS KEY SHOP	EDR Digital Archive
	PATSY DAMORE ITALIAN FOOD	EDR Digital Archive
	LAPGENIUS INC	EDR Digital Archive
	DEANOS PIZZA	EDR Digital Archive
	COST PLUS INC	EDR Digital Archive
	MARKS JASON TALENT MANAGEMENT	EDR Digital Archive
	BARBERSHOP CLUB	EDR Digital Archive
	LITTLEJOHNS CANDY	EDR Digital Archive
	FARMERS MARKET	EDR Digital Archive
	WOODLAND EMBROIDERY	EDR Digital Archive
	PEKING KITCHEN	EDR Digital Archive
	SUR LA TABLE INC	EDR Digital Archive
	AKT HOLDINGS LLC	EDR Digital Archive
	PAPPARDELLES PASTA	EDR Digital Archive
	ULYSSES VOYAGE GREEK REST	EDR Digital Archive
	HUTCHCO	EDR Digital Archive
	FRITZI DOG MANAGEMENT CO LLC	EDR Digital Archive
	CHANG MINNIE	EDR Digital Archive
	TOKYO HOUSE	EDR Digital Archive
	GRASS BURGER LLC	EDR Digital Archive
	ESSENCE OF NATURE	EDR Digital Archive
	MARCONDAS MEATS INC	EDR Digital Archive
	CAMPER ATLANTIC CORP	EDR Digital Archive
	DU PARS REST & BAKERIES CORP	EDR Digital Archive
	TBILISI & YEREVAN BAKERY	EDR Digital Archive
	SHELTAM BOOKS	EDR Digital Archive
	POWERCELL	EDR Digital Archive
	LOTERIA GRILL HOLLYWOOD	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	Source
2014	URBAN TRIBES	EDR Digital Archive
	KIPS TOYLAND	EDR Digital Archive
	SHINE GALLERY	EDR Digital Archive
	GILLS ICE CREAM CALIFORNIA	EDR Digital Archive
	GIFT & GADGET NOOKS INC	EDR Digital Archive
	FRENCH CREPE CO	EDR Digital Archive
	CHINA DEPOT	EDR Digital Archive
	SUSHI A GOGO	EDR Digital Archive
	FARMERS MARKET SHOE REPAIR	EDR Digital Archive
	T& Y BAKERY	EDR Digital Archive
	PURITAN POULTRY	EDR Digital Archive
	GUMBO POT	EDR Digital Archive
	MONSTER TALENT MANAGEMENT INC	EDR Digital Archive
	SHELTAM BOOKS	EDR Digital Archive
2010	SHELTAM BOOKS	EDR Digital Archive
	DESIGNER DETAILS INC	EDR Digital Archive
	BUTTERFLY SUNSHADE	EDR Digital Archive
	E PLE	EDR Digital Archive
	GARDEN DISTRICT	EDR Digital Archive
	BATH & BODY WORKS INC	EDR Digital Archive
	ROYAL SILVER	EDR Digital Archive
	PA ACQUISITION CORP	EDR Digital Archive
	ITS A BLOOMING BUSINESS	EDR Digital Archive
	GUMBO POT	EDR Digital Archive
	PURITAN POULTRY	EDR Digital Archive
	BRIEF TRANSIT INC	EDR Digital Archive
	THEES CONTINENTAL PASTRIES	EDR Digital Archive
	FARMERS MARKET SHOE REPAIR	EDR Digital Archive
	SUSHI A GOGO	EDR Digital Archive
	CHINA DEPOT	EDR Digital Archive
	FRENCH CREPE CO	EDR Digital Archive
	STROUK GROUP INC	EDR Digital Archive
	GIFT & GADGET NOOKS INC	EDR Digital Archive
	GILLS ICE CREAM CALIFORNIA	EDR Digital Archive
	SHINE GALLERY	EDR Digital Archive
	KIPS TOYLAND	EDR Digital Archive
	SHELTAM BOOKS	EDR Digital Archive
	FLOWER POWER	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2010	CART PLANET INC	EDR Digital Archive
	MONROEGIFTS CO	EDR Digital Archive
	BALLOONS BALLOONS	EDR Digital Archive
	DU PARS REST & BAKERIES CORP	EDR Digital Archive
	TBILISI & YEREVAN BAKERY	EDR Digital Archive
	WALDERS WINE & SPIRITS	EDR Digital Archive
	BREADWORKS BAKERY	EDR Digital Archive
	ERINSANDERS	EDR Digital Archive
	LITTLE SPAIN	EDR Digital Archive
	REFRESHER	EDR Digital Archive
	MARCONDAS MEATS INC	EDR Digital Archive
	ESSENCE OF NATURE	EDR Digital Archive
	ALEXANDER GINA INC	EDR Digital Archive
	INDIAN DREAM ACCESSORIES	EDR Digital Archive
	TOKYO HOUSE	EDR Digital Archive
	LOTERIA GRILL AT FARMERS MKT	EDR Digital Archive
	JASON MARKS TALENT MANAGEMENT	EDR Digital Archive
	CREATIVE EDGE	EDR Digital Archive
	HUTCHCO	EDR Digital Archive
	BARBERSHOP CLUB	EDR Digital Archive
	IMEDIA MARKETING	EDR Digital Archive
	ULYSSES VOYAGE GREEK REST	EDR Digital Archive
	WOMENS APPAREL	EDR Digital Archive
	AKT HOLDINGS LLC	EDR Digital Archive
	PEAZN AND LOVE	EDR Digital Archive
	SUR LA TABLE INC	EDR Digital Archive
	LADOCA INC	EDR Digital Archive
	PEKING KITCHEN	EDR Digital Archive
	WOODLAND EMBROIDERY	EDR Digital Archive
	LITTLEJOHNS CANDY	EDR Digital Archive
	PRIMESTAR TOURS & CHARTER	EDR Digital Archive
	COST PLUS INC	EDR Digital Archive
	DEANOS PIZZA	EDR Digital Archive
	RALPHS KEY SHOP	EDR Digital Archive
	MARMALADE LLC	EDR Digital Archive
	GAZAL ISAAC	EDR Digital Archive
	STARBUCKS CORPORATION	EDR Digital Archive
	FARM BOY	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2010	DIVAS WEAR	EDR Digital Archive
	SALAD BAR	EDR Digital Archive
	ZARA	EDR Digital Archive
	STICKER PLANET	EDR Digital Archive
	BOBS COFFEE & DONUT SHOP INC	EDR Digital Archive
	TUSQUELLAS SEA FOODS	EDR Digital Archive
	SPORT FASHIONS	EDR Digital Archive
	EL HIJO DE GRANJERO	EDR Digital Archive
	PHILS ROUND UP AND GRILL INC	EDR Digital Archive
	S B GIFT	EDR Digital Archive
	ICONIC ACCESSORIES	EDR Digital Archive
	CKK GROUP LLC	EDR Digital Archive
	MAGEES FARMER MARKET INC	EDR Digital Archive
	LIGHT MY FIRE	EDR Digital Archive
	326 LLC	EDR Digital Archive
	326 BEER & WINE	EDR Digital Archive
	LEON WEISS SYSTEM WATCH & JWLY	EDR Digital Archive
	WEISS JEWELRY	EDR Digital Archive
	MOISHES	EDR Digital Archive
	AROYAN MOSES	EDR Digital Archive
	SALAD BAR	EDR Digital Archive
	STICKER PLANET	EDR Digital Archive
	SPORT FASHIONS	EDR Digital Archive
	BOBS COFFEE & DONUT SHOP INC	EDR Digital Archive
	TUSQUELLAS SEA FOODS	EDR Digital Archive
	EL HIJO DE GRANJERO	EDR Digital Archive
	PHILS ROUND UP AND GRILL INC	EDR Digital Archive
	ICONIC ACCESSORIES	EDR Digital Archive
	CKK GROUP LLC	EDR Digital Archive
	S B GIFT	EDR Digital Archive
	MAGEES FARMER MARKET INC	EDR Digital Archive
	LIGHT MY FIRE	EDR Digital Archive
	PAMPAS GRILL	EDR Digital Archive
	326 LLC	EDR Digital Archive
	326 BEER & WINE	EDR Digital Archive
	TAMAR KALOUSTIAN	EDR Digital Archive
	MARKET OPTMTRIX DCTORS OPTMTRY	EDR Digital Archive
	WINE GARDEN CAFE	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	Source
2010	WEISS JEWELRY	EDR Digital Archive
	LEON WEISS SYSTEM WATCH & JWLY	EDR Digital Archive
	VANCE-WLLIVER HUNTINGTON MEATS	EDR Digital Archive
	DU PARS REST & BAKERIES CORP	EDR Digital Archive
	TBILISI & YEREVAN BAKERY	EDR Digital Archive
	FLOWER POWER	EDR Digital Archive
	CART PLANET INC	EDR Digital Archive
	MONROEGIFTS CO	EDR Digital Archive
	BALLOONS BALLOONS	EDR Digital Archive
	SHELTAM BOOKS	EDR Digital Archive
	WALDERS WINE & SPIRITS	EDR Digital Archive
	BREADWORKS BAKERY	EDR Digital Archive
	ERINSANDERS	EDR Digital Archive
	LITTLE SPAIN	EDR Digital Archive
	REFRESHER	EDR Digital Archive
	MARCONDAS MEATS INC	EDR Digital Archive
	ESSENCE OF NATURE	EDR Digital Archive
	TOKYO HOUSE	EDR Digital Archive
	LOTERIA GRILL AT FARMERS MKT	EDR Digital Archive
	JASON MARKS TALENT MANAGEMENT	EDR Digital Archive
	CREATIVE EDGE	EDR Digital Archive
	IMEDIA MARKETING	EDR Digital Archive
	HUTCHCO	EDR Digital Archive
	BARBERSHOP CLUB	EDR Digital Archive
	ULYSSES VOYAGE GREEK REST	EDR Digital Archive
	WOMENS APPAREL	EDR Digital Archive
	AKT HOLDINGS LLC	EDR Digital Archive
	PEAZN AND LOVE	EDR Digital Archive
	ALEXANDER GINA INC	EDR Digital Archive
	INDIAN DREAM ACCESSORIES	EDR Digital Archive
	KIPS TOYLAND	EDR Digital Archive
	PEKING KITCHEN	EDR Digital Archive
	WOODLAND EMBROIDERY	EDR Digital Archive
	LITTLEJOHNS CANDY	EDR Digital Archive
	PRIMESTAR TOURS & CHARTER	EDR Digital Archive
	DEANOS PIZZA	EDR Digital Archive
	COST PLUS INC	EDR Digital Archive
	RALPHS KEY SHOP	EDR Digital Archive

<u>Year</u>	<u>Uses</u>	Source
2010	MARMALADE LLC	EDR Digital Archive
	GAZAL ISAAC	EDR Digital Archive
	STARBUCKS CORPORATION	EDR Digital Archive
	FARM BOY	EDR Digital Archive
	DIVAS WEAR	EDR Digital Archive
	ZARA	EDR Digital Archive
	SHELTAM BOOKS	EDR Digital Archive
	DESIGNER DETAILS INC	EDR Digital Archive
	BUTTERFLY SUNSHADE	EDR Digital Archive
	E PLE	EDR Digital Archive
	GARDEN DISTRICT	EDR Digital Archive
	BATH & BODY WORKS INC	EDR Digital Archive
	ROYAL SILVER	EDR Digital Archive
	PA ACQUISITION CORP	EDR Digital Archive
	ITS A BLOOMING BUSINESS	EDR Digital Archive
	MOISHES	EDR Digital Archive
	AROYAN MOSES	EDR Digital Archive
	PURITAN POULTRY	EDR Digital Archive
	BRIEF TRANSIT INC	EDR Digital Archive
	THEES CONTINENTAL PASTRIES	EDR Digital Archive
	FARMERS MARKET SHOE REPAIR	EDR Digital Archive
	SUSHI A GOGO	EDR Digital Archive
	CHINA DEPOT	EDR Digital Archive
	FRENCH CREPE CO	EDR Digital Archive
	STROUK GROUP INC	EDR Digital Archive
	GIFT & GADGET NOOKS INC	EDR Digital Archive
	GILLS ICE CREAM CALIFORNIA	EDR Digital Archive
	SHINE GALLERY	EDR Digital Archive
	SUR LA TABLE INC	EDR Digital Archive
	LADOCA INC	EDR Digital Archive
	PAMPAS GRILL	EDR Digital Archive
	VANCE-WLLIVER HUNTINGTON MEATS	EDR Digital Archive
	TAMAR KALOUSTIAN	EDR Digital Archive
	MARKET OPTMTRIX DCTORS OPTMTRY	EDR Digital Archive
	WINE GARDEN CAFE	EDR Digital Archive
	GUMBO POT	EDR Digital Archive

W 3RD ST

6333 W 3RD ST

Year	<u>Uses</u>	Source
2006	INDIAN DREAM	Haines Company, Inc.
	ACCESSORIES	Haines Company, Inc.
	JACK GALLERY	Haines Company, Inc.
	JOHNNY ROCKETS	Haines Company, Inc.
	KIPSTOYLAND	Haines Company, Inc.
	KOKOMO CAFE	Haines Company, Inc.
	LATOURS OF	Haines Company, Inc.
	CALIFORNIA	Haines Company, Inc.
	LIGHTMYFIRE	Haines Company, Inc.
	LITTLE JOHNS	Haines Company, Inc.
	ENGLSH TFFEE HSE	Haines Company, Inc.
	LOTERIA GRILL AT	Haines Company, Inc.
	FARMERS MRKT	Haines Company, Inc.
	LUSTRE	Haines Company, Inc.
	MACHADO	Haines Company, Inc.
	BRAZIUAN JIU	Haines Company, Inc.
	JITSU	Haines Company, Inc.
	MAGEES	Haines Company, Inc.
	MAKING HISTORY	Haines Company, Inc.
	MARCONDASMEAT	Haines Company, Inc.
	MARKET GRILL	Haines Company, Inc.
	MARKET OPTOMTRX	Haines Company, Inc.
	DOCTRS OPTMTRY	Haines Company, Inc.
	MARMALADE CAFE	Haines Company, Inc.
	MOISHES	Haines Company, Inc.
	RESTAURANT	Haines Company, Inc.
	PAMPAS GRILL	Haines Company, Inc.
	PARTYAMERICA	Haines Company, Inc.
	PATSYS DAMORE	Haines Company, Inc.
	PIZZA	Haines Company, Inc.
	PATSYS PIZZA	Haines Company, Inc.
	PHILS DELISGRILL	Haines Company, Inc.
	PURITAN POULTRY	Haines Company, Inc.
	RALPHS KEYSHOP	Haines Company, Inc.
	ROYAL SILVER	Haines Company, Inc.

<u>Year</u>	<u>Uses</u>	Source
2006	SALAD BAR	Haines Company, Inc.
	SHELTAMS	Haines Company, Inc.
	SHELTAMS NEWS	Haines Company, Inc.
	ON THIRD	Haines Company, Inc.
	SINGAPORES	Haines Company, Inc.
	BANANA LEAF	Haines Company, Inc.
	SPORTEFASHION	Haines Company, Inc.
	STARBUCKS	Haines Company, Inc.
	COFFEE	Haines Company, Inc.
	STICKER PLANET	Haines Company, Inc.
	STICKERMADNESS	Haines Company, Inc.
	SURLATABLE	Haines Company, Inc.
	SUSHI A GOGO	Haines Company, Inc.
	TBILISI &YEREVAN	Haines Company, Inc.
	BAKERY	Haines Company, Inc.
	TESQUELLAS FISH	Haines Company, Inc.
	& OYSTER BAR	Haines Company, Inc.
	THE VILLAGE	Haines Company, Inc.
	THNEES	Haines Company, Inc.
	CONTINENTAL	Haines Company, Inc.
	PASTRIES	Haines Company, Inc.
	THIRD STREET	Haines Company, Inc.
	VENTURES	Haines Company, Inc.
	THKREE DOG	Haines Company, Inc.
	BAKERY	Haines Company, Inc.
	TONYS PIZZA	Haines Company, Inc.
	SPAGHETTI	Haines Company, Inc.
	TREASURES OFTHE	Haines Company, Inc.
	PACIFIC	Haines Company, Inc.
	FARMERS MARKET	Haines Company, Inc.
	BATH & BODY	Haines Company, Inc.
	WORKS	Haines Company, Inc.
	BUTTERFLY	Haines Company, Inc.
	ULTIMATE NUT&	Haines Company, Inc.
	CANDY COMPANY	Haines Company, Inc.
	ULYSSES VOYAGE	Haines Company, Inc.
	WEISS JEWELRY	Haines Company, Inc.
	WOODLAND	Haines Company, Inc.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	EMBROIDERY	Haines Company, Inc.
	WORLD MARKET	Haines Company, Inc.
	SUNSHADE	Haines Company, Inc.
	BY CANDLELIGHT	Haines Company, Inc.
	CHINA DEPOT	Haines Company, Inc.
	COFFEE BEAN&TEA	Haines Company, Inc.
	COST PLUS WORLD	Haines Company, Inc.
	MARKET	Haines Company, Inc.
	DESIGNER DETAILS	Haines Company, Inc.
	DU PARS	Haines Company, Inc.
	CORPORATE	Haines Company, Inc.
	OFFICES	Haines Company, Inc.
	DUCKSOUP	Haines Company, Inc.
	ESSENCEOF	Haines Company, Inc.
	NATURE	Haines Company, Inc.
	FARM FRESH	Haines Company, Inc.
	FARM FRESH	Haines Company, Inc.
	FARMERS MKT	Haines Company, Inc.
	FARMERS MKT	Haines Company, Inc.
	ADMINISTRATION	Haines Company, Inc.
	FARMERS MKT	Haines Company, Inc.
	NEWSTND	Haines Company, Inc.
	FARMERS MRKT	Haines Company, Inc.
	PHAR ENTP LLC	Haines Company, Inc.
	FLOWER POWER	Haines Company, Inc.
	FRANCESCAS	Haines Company, Inc.
	COLLECTIONS	Haines Company, Inc.
	FRENCH CREPECO	Haines Company, Inc.
	FRENCH CREPE	Haines Company, Inc.
	COMPANY FRUIT COMPANY	Haines Company, Inc.
	GILLOLD	Haines Company, Inc.
	FASHIONED ICE	Haines Company, Inc.
	CREAM	Haines Company, Inc.
	GILLSOLD	Haines Company, Inc.
	FASHIONED ICE	Haines Company, Inc.
	GUMBOPOTTHE	Haines Company, Inc.
	HUNTGTN MEATS	Haines Company, Inc.
	HUTCHCO	Haines Company, Inc.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	TECHNOLOGIES	Haines Company, Inc.
1985	GRAY LINE TOURS COMPANY	Pacific Bell
	Farmers Market	Pacific Bell
	B DALTON BOOKSELLER LOS ANGELES	Pacific Bell
	GRAY LINE SIGHTSEEING TOURS FARMERS MARKET	Pacific Bell
	DALTON B BOOKSELLER LOS ANGELES	Pacific Bell
	GRAY LINE SIGHTSEEING TOURS FARMERS MARKET	Pacific Bell
	GRAY LINE TOURS FARMERS MARKET	Pacific Bell
	GRAY LINE TOURS CHARTER SERVICE FARMERS MARKET	Pacific Bell
1980	Farmers Market	Pacific Telephone
	B DALTON BOOKSELLER LOS ANGELES	Pacific Telephone
1976	ALEXANDERS GROCERY	Pacific Telephone
	Altabets Flower Shop	Pacific Telephone
	B DALTON PICKWICK BOOKSELLERS	Pacific Telephone
	Los Angeles	Pacific Telephone
	BARENGO VINEYARDS INC	Pacific Telephone
	BARENGO WINE TASTING CELLAR	Pacific Telephone
	CASTILLOS SPANISH KITCHEN	Pacific Telephone
	Charlies	Pacific Telephone
	Egg Basket	Pacific Telephone
	FARMERS MKT FRUIT & PRODUCE	Pacific Telephone
	Farmers Market Magic & Fun Shop	Pacific Telephone
	Hanson Galleries	Pacific Telephone
	Junior League Of Los Angeles	Pacific Telephone
	La Frieda Meats	Pacific Telephone
	Meshulams Inc	Pacific Telephone
	Michaels Gourmet Pastry	Pacific Telephone
	Phils Roundup	Pacific Telephone
	Ralphs Key Shop	Pacific Telephone
	Rogers Wholesale Poultry	Pacific Telephone
	Tonys Pizza Spaghetti	Pacific Telephone
	Vegetable Haven	Pacific Telephone
	Worldwide Fashions	Pacific Telephone
	Young Hoong Corp	Pacific Telephone
1970	BLIND INFORMATION CENTER	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1970	BLIND INFORMATION CENTER	Pacific Telephone
	INFORMATION CENTER FOR THE BLND	Pacific Telephone
1967	BLIND INFORMATION CENTER FOR THE JUNIOR LEAGUE OF L A	Pacific Telephone
	CASTILLOS SPANISH KITCHEN	Pacific Telephone
	Farmers Mkt Newsstand	Pacific Telephone
	Fun Shop	Pacific Telephone
	Salem House	Pacific Telephone
	FARMERS MKT FRUIT & PRODUCE	Pacific Telephone
	Information Center for the Blind Junior League of L A	Pacific Telephone
	Junior League of L A Information Center for the Blind	Pacific Telephone
	Pitts Garden Shop	Pacific Telephone
	Salem House	Pacific Telephone
1966	BLIND INFORMATION CENTER FORTHE JUNIOR LEAGUE OF L A	Pacific Telephone
1965	BLIND INFORMATION CENTER FOR THE JUNIOR LEAGUE OF L A	Pacific Telephone
1958	Farmers Mkt Fruit & Produce	Pacific Telephone
	Hollywood Baseball Club	Pacific Telephone
	Kludjian Margaret Tropics prodc	Pacific Telephone
	Ocean Foods Fish Stall	Pacific Telephone
	Pelwhite Co fish	Pacific Telephone
	Stone Peggy Tropics prodc	Pacific Telephone
	Tropics prodc	Pacific Telephone

6334 W 3RD ST

<u>Year</u>	<u>Uses</u>	Source
2006	TOWN & COUNTRY	Haines Company, Inc.
	NEWSTAND	Haines Company, Inc.
1976	ALLEN WERTZ CANDIES Main Ofc & Store	Pacific Telephone
	Storez Allen Wertz Candies	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
1967	Neill Florence Candles	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Neill Florence Candies	Pacific Telephone

6336 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	FRAMES LENSES	Haines Company, Inc.
1976	TOWN & COUNTRY CENTER	Pacific Telephone
	Storez Charmaine	Pacific Telephone
	Charmaine	Pacific Telephone
1967	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Charmaine	Pacific Telephone
	Charmalne	Pacific Telephone

6338 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2006	WIGS TODAY	Haines Company, Inc.
1976	Storez Mr Lous Beauty Supplies & Wigs	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	Mr Lous Beauty Supplies & Wigs	Pacific Telephone
1967	Lillians Corset & Lingerie Shoppe	Pacific Telephone
	Lilyans Corset & Lingerle Shoppe	Pacific Telephone
	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Lilyans Corset & Lingerie Shoppe	Pacific Telephone

6342 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	Evas Bakery	Pacific Telephone
	TOWN & COUNTRY CENTER	Pacific Telephone
	Storez Evas Bakery	Pacific Telephone
1967	Evas Bakery	Pacific Telephone

6356 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1967	Love David G Dr Optmtrst	Pacific Telephone
	Vaupen Elliot Dr optmtrst	Pacific Telephone

6366 W 3RD ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1970	MR GUY GENTLEMENS OUTFTRS CLOTHING & HABERDASHERY	Pacific Telephone
	MR GUY GENTLEMENS OUTFTRS CLOTHING & HABERDASHERY	Pacific Telephone
1967	TOWN & COUNTRY CENTER Stores	Pacific Telephone
	Mr Guy gentlemens outftrs	Pacific Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1967	GUY MR gentlermens outftrs	Pacific Telephone
	MR GUY gentlemens outftrs Clothing & Haberdashery	Pacific Telephone
	Ladies Shop	Pacific Telephone
	MR GUY gentlemens outftrs Clothing & Haberdashery	Pacific Telephone
	MR GUY gentlemens outftrs Clothing & Haberdashery	Pacific Telephone
	Offices	Pacific Telephone
1966	MR GUY GENTLEMENS OUTFTRS CLOTHING & HABERDASHERY	Pacific Telephone
	MR GUY GENTLEMENS OUTFTRS CLOTHING & HABERDASHERY	Pacific Telephone

TARGET PROPERTY: ADDRESS NOT IDENTIFIED IN RESEARCH SOURCE

The following Target Property addresses were researched for this report, and the addresses were not identified in the research source.

Address Researched	Address Not Identified in Research Source
6310 W. Third Street	2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1991, 1985, 1975, 1972, 1970, 1969, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1958, 1957, 1956, 1955, 1954, 1960,
	1952, 1951, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1942, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1932, 1931, 1930, 1929, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920

ADJOINING PROPERTY: ADDRESSES NOT IDENTIFIED IN RESEARCH SOURCE

The following Adjoining Property addresses were researched for this report, and the addresses were not identified in research source.

Address Researched	Address Not Identified in Research Source
300 S Fairfax Ave	2006, 2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1991, 1990, 1986, 1985, 1981, 1980, 1976, 1975, 1972, 1971, 1970, 1969, 1967, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1958, 1957, 1956, 1955, 1954, 1952, 1951, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1942, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1933, 1932, 1931, 1930, 1929, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920
300 S Fairfax Ave	2006, 2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1991, 1990, 1986, 1985, 1981, 1980, 1976, 1975, 1972, 1971, 1970, 1969, 1967, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1958, 1957, 1956, 1955, 1954, 1952, 1951, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1942, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1933, 1932, 1931, 1930, 1929, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920
300 S FAIRFAX AVE	2014, 2010, 2006, 2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1991, 1985, 1981, 1980, 1976, 1975, 1972, 1971, 1970, 1969, 1967, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1958, 1957, 1956, 1955, 1954, 1952, 1951, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1942, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1933, 1932, 1931, 1930, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920
301 S FAIRFAX AVE	2014, 2010, 2006, 2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1990, 1980, 1976, 1975, 1972, 1970, 1969, 1967, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1957, 1956, 1955, 1954, 1952, 1951, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1933, 1932, 1931, 1930, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920
310 S FAIRFAX AVE	2014, 2010, 2006, 2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1991, 1990, 1986, 1985, 1981, 1980, 1976, 1975, 1972, 1971, 1970, 1969, 1967, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1958, 1957, 1956, 1955, 1954, 1952, 1951, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1942, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1932, 1931, 1930, 1929, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920
325 S FAIRFAX AVE	2014, 2010, 2006, 2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1991, 1990, 1985, 1980, 1975, 1972, 1970, 1969, 1967, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1957, 1956, 1955, 1954, 1952, 1951, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1942, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1933, 1932, 1931, 1930, 1929, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920
327 FAIRFAX AVE S	2014, 2010, 2006, 2004, 2003, 2001, 2000, 1999, 1996, 1995, 1992, 1991, 1990, 1986, 1985, 1981, 1980, 1976, 1975, 1972, 1971, 1970, 1969, 1967, 1966, 1965, 1964, 1963, 1962, 1961, 1960, 1958, 1957, 1956, 1955, 1954, 1952, 1950, 1949, 1948, 1947, 1946, 1945, 1944, 1942, 1940, 1939, 1938, 1937, 1936, 1935, 1934, 1933, 1932, 1931, 1930, 1929, 1928, 1927, 1926, 1925, 1924, 1923, 1921, 1920

APPENDIX C

Prior Report



National Environmental Management and Engineering Services

OCT 19 2004

PHASE I ENVIRONMENTAL SITE ASSESSMENT REPORT



TOWN & COUNTRY RETAIL 6310-6360 WEST THIRD STREET LOS ANGELES, CALIFORNIA

EBI Project #24-1775A

August 13, 2004

Prepared for:

AETNA REAL ESTATE INVESTMENTS 151 FARMINGTON AVENUE HARTFORD, CT 06156-9642

EBI Consulting

Four A Street Burlington, MA 01803 Phone: 781.273.2500 Toll Free: 800.786.2346 Fax: 781.273.3311

EBI CONSULTING FOUR A STREET BURLINGTON, MA 01803 800-786-2346 PROJECT #24-1775A

PHASE I ENVIRONMENTAL SITE ASSESSMENT

Town & Country Retail 6310-6360 West Third Street Los Angeles, California 90036

Prepared for:

Aetna Real Estate Investments 151 Farmington Avenue Hartford, CT 06156-9642



FOUR A STREET, BURLINGTON, MA 01803 TEL 781-273-2500 FAX 781-273-3311 www.ebiconsulting.com

August 13, 2004

Mr. Jack Maher Aetna Real Estate Investments 151 Farmington Avenue Hartford, CT 06156-9642

Subject:

Phase I Environmental Site Assessment Report, Town & Country Retail

6310-6360 West Third Street, Los Angeles, California

EBI Project #24-1775A

Dear Mr. Maher:

Attached please find our *Phase I Environmental Site Assessment Report*, (the *Report*) for the above-mentioned asset (the Subject Property). During the survey and research, our surveyor met with agents representing the Subject Property, or agents of the owner, and reviewed the Subject Property and its history. The *Report* was completed according to the terms and conditions authorized by you. This *Report* has been completed in general conformance with the ASTM Practice E 1527.

The purpose of this *Report* is to assist *Aetna Real Estate Investments* in its underwriting of a proposed mortgage loan on the Subject Property described herein.

This Report is addressed to Aetna Real Estate Investments and such other persons as may be designated by Aetna Real Estate Investments and their respective successors and assigns.

Reliance on the Report and the information contained herein shall mean (i) the Report may be relied upon by Aetna Real Estate Investments, in determining whether to make a loan evidenced by a note secured by the Subject Property ("the Mortgage Loan"); (ii) the Report may be relied upon by any loan purchaser in determining whether to purchase the Mortgage Loan from Aetna Real Estate Investments, or an interest in the Mortgage Loan or securities backed or secured by the Mortgage Loan, and any rating agency rating securities representing an interest in the Mortgage Loan or backed or secured by the Mortgage Loan; (iii) the Report may be referred to in and included, in whole or in part, with materials offering for sale the Mortgage Loan or an interest in the Mortgage Loan or securities backed or secured by the Mortgage Loan; (iv) the Report speaks only as of its date in the absence of a specific written update of the Report signed and delivered by EBI Consulting.

There are no intended or unintended third party beneficiaries to this Report, except as expressly stated herein.

EBI is an independent contractor, not an employee of either the issuer or the borrower, and its compensation was not based on the findings or recommendations made in the *Report* or on the closing of any business transaction.

Thank you for the opportunity to prepare this *Report*, and assist you with this project. Please call us if you have any questions or if we may be of further assistance.

Respectfully Submitted,

Tiffany Grant

Author/Environmental Scientist

Richard B. McKinney (661) 871-2281 Reviewer/Senior Program Director

Richard MacAulay Managing Consultant

ATLANTA, GA
BALTIMORE, MD
BURLINGTON, MA
CHICAGO, IL
DALLAS, TX

DENVER, CO

EXETER, NH HOUSTON, TX

NAPLES, FL

PHOENIX, AZ
PORTLAND, OR
SAN FRANCISCO, CA
SEATTLE, WA

WARWICK, RI YORK, PA

Los Angeles, CA

TABLE OF CONTENTS

	TIVE SUMMARY	
1.0 PU	RPOSE & LIMITATIONS	3
	BJECT PROPERTY CHARACTERISTICS	
2.1	Ownership and Location	
2.2	Description and Operations	
2.3	Municipal Services & Utilities	
	BJECT PROPERTY RECONNAISSANCE	g
3.1	Interior Survey	
3.2	Usage, Handling and Disposal of Petroleum Products and/or Hazardous Substances	Ω
3.3	Aboveground/Underground Storage Tanks (ASTs/USTs)	0
3.4	Asbestos-Containing Material (ACM)	۰
3.5	Radon	11
3.6	Lead-Based Paint (LBP)	11
3.7	Lead in Drinking Water	11
3.8	Exterior Survey	
3.9	Solid Waste Disposal	12
3.10		
3.11	Physical Setting	13
3.12	Adjacent Properties	14
3.13	Methane	14
4.0 SUB	JECT PROPERTY AND VICINITY HISTORY	.16
4.1	Previous Environmental Reports	
4.2	Fire Insurance Maps	
4.3	Historic Aerial Photographs	
4.4	City Directories.	21
4.5	Interviews	23
4.6	Property Tax Records	23
5.0 REG	CULATORY INFORMATION	24
5.1	Procedure	
5.2	Federal Office Records	24
5.3	State Office Records	25
5.4	Local Office Records	26
5.5	Other Records	27
6.0 FINI	DINGS AND OPINIONS	28
	OMMENDATIONS	
	ERENCES	
	References Contacted	
	IX A – PHOTOGRAPHS	<i>)</i> 1
	IX B - FIGURES, DRAWINGS AND MAPS	
	IX C – OTHER RELEVANT DOCUMENTS	
	IX D - PROFESSIONAL QUALIFICATIONS	
	IX E – REGULATORY DATABASE REPORT	
	IX F - HISTORICAL DOCUMENTATION	
	IX G - ANALYTICAL RESULTS	
APPEND	IX H – PORTIONS OF PREVIOUS REPORT	

EXECUTIVE SUMMARY

The Subject Property, known as Town & Country Retail, was reportedly constructed in 1961, and consists of a multi tenant retail center with three one, two, and three story buildings totaling 228,390± net rentable square feet on a 7.5-acre lot. The Subject Property is located in Los Angeles, Los Angeles County, California at 6310-6360 West Third Street. Los Angeles is located in Southern California, and the Subject Property is approximately 10 miles west of downtown Los Angeles. The current tenancy is retail use.

Ms. Tiffany Grant of EBI surveyed the Subject Property on July 28, 2004. She was accompanied by and interviewed Mr. Michael Turner, the owner's representative. At the time of the survey, the weather was sunny and approximately 75° Fahrenheit. During the survey, representative tenant spaces, mechanical spaces and/or equipment components were observed. EBI was not provided with access to the bank basement, behind counters, or vault areas. A Pre-Survey Questionnaire was forwarded to the designated Subject Property contact and has been returned.

Below is the Assessment Summary presenting our recommended actions for the Subject Property. Additional detail regarding each recommended action is provided in *Section 7.0*.

ASSESSMENT SUMMARY TABLE							
REPORT COMPONENT	SECTION (S)	CONCERN NOTED OR REPORTED	RECOMMENDED ACTIONS	ESTIMATED COST			
Current Tenant or Property Use Concerns	3.2	~	Methane gas pressure and gas concentration monitoring is ongoing at the Subject Property and appears to be performed in accordance with regulatory requirements. At this time, the results of the semi-weekly gas monitoring indicate no apparent environmental concern to the Subject Property or the Public.				
ASTs/USTs	3.3		No Further Action				
Suspect Asbestos Containing Material (ACM)	3.4	~	EBI laboratory results for asbestos are pending. Previous asbestos survey reports identified ACM at the Subject Property. Develop and implement an asbestos operations and maintenance (O&M) plan	\$500.00			
Radon	3.5		No Further Action				
Lead-based Paint	3.6		No Further Action				
Lead in Water	3.7.		No Further Action				
Suspect PCB-containing Equipment 3.10		~	Light ballasts potentially contain PCBs. Light ballasts should be discarded in accordance with regulatory disposal requirements.	Action Item			

EBI Consulting

	ASSESS	MENT SUM	IMARY TABLE	
REPORT COMPONENT	SECTION (S)	CONCERN NOTED OR REPORTED	RECOMMENDED ACTIONS	ESTIMATED COST
Historical Use of Subject Property	4.0	•	A previous limited subsurface soil investigation report indicated elevated concentrations of total petroleum hydrocarbons in soil. No further action was taken at that time. The potential exists for elevated concentrations, potentially hazardous concentrations, of contaminants of concern in subsurface soil at the Subject Property. EBI recommends further subsurface assessment of soil for contaminants of concern in the event of future soil excavation at the Subject Property. Two oil wells, abandoned in the 1930s, are located on the Subject Property. The abandoned wells may be a conduit for methane gas migration to the surface. The potential exists for a requirement at some time in the future to reabandon these wells. Costs associated with oil well reabandonment can be significant.	Action Item
Potential Off-site Sources	3.12, 5.0		The state of the s	
Federal, State and Local Agency Concerns	5.2, 5.3, 5.4			

1.0 PURPOSE & LIMITATIONS

The purpose of this *Phase I Environmental Site Assessment Report* (the *Report*) is to assist *Aetna Real Estate Investments* in its underwriting of a proposed mortgage loan on the Subject Property. This *Report* can be relied upon by only the parties stated in the transmittal letter at the front of this *Report*. EBI's liability to a purchaser wishing to use this *Report* is limited to the cost of the *Report*. Amendments to EBI's limitations as stated herein that may occur after issuance of the *Report* are considered to be included in this *Report*. Payment for the *Report* is made by, and EBI's contract and *Report* extends to *Aetna Real Estate Investments* only, in accordance with our *Standard Conditions For Engagement* and, *Authorization Letter* and *Agreement for Environmental Services*.

The additional purpose of this *Report* is to assess a parcel of *real estate* with respect to the range of contaminants within the scope of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) and *petroleum products*. As such, this practice is intended to permit *Aetna Real Estate Investments* to satisfy one of the requirements to qualify for the *innocent landowner defense* to CERCLA liability: that is, the practices that constitute "all appropriate inquiry into the previous ownership and uses of the Subject Property consistent with good commercial or customary practice" as defined in 42 USC § 9601(35)(B).

In defining a standard of good commercial and customary practice for conducting an environmental site assessment of a parcel of property, the goal of the processes established by this practice is to identify recognized environmental conditions. The term recognized environmental conditions (RECs) means the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, ground water, or surface water of the property. The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include de minimis conditions that generally do not present a material risk of harm to public health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. Conditions determined to be de minimis are not RECs.

EBI has performed this *Phase I Environmental Site Assessment* in conformance with the scope and limitations of ASTM Practice E 1527. This *Report* was prepared with no exceptions or deletions from ASTM Standard E1527.

SCOPE OF WORK

This Report was prepared for the use of Aetna Real Estate Investments. This Report has been prepared in accordance with our Standard Conditions For Engagement and Authorization Letter and Agreement for Environmental Services approved and signed by Aetna Real Estate Investments, and with the limitations described below, all of which are integral parts of this Report. A copy of the signed Standard Conditions For Engagement and Authorization Letter and Agreement for Environmental Services is maintained at the EBI Consulting office in Burlington, Massachusetts.

The information reported was obtained through sources deemed reasonably ascertainable, as defined in ASTM E1527-00; a visual site survey of areas readily observable, easily accessible or made accessible by the Subject Property contact and interviews with owners, agents, occupants, or other appropriate persons involved with the Subject Property. Municipal information was obtained through file reviews of reasonably ascertainable standard government record sources, and interviews with the authorities having jurisdiction over the Subject Property. Findings, conclusions and recommendations included in the *Report* are based on our visual observations in the field, the municipal information reasonably obtained, information provided by the Client, and/or a review of readily available and supplied drawings and documents. EBI relies completely on the information, whether written, graphic or verbal, provided by the Subject Property contact or as shown on any documents reviewed or received from the Subject Property contact, owner or agent, or municipal source, and assumes that information to be true and correct. Although there may have been some degree of overlap in the information provided by these various sources, EBI did not attempt to independently verify the accuracy or completeness of all information reviewed or received during the course of these *Environmental Services*.

The observations in this *Report* are valid on the date of the investigation. Where access to portions of the Subject Property or to structures on the Subject Property was unavailable or limited, EBI renders no opinion as to the presence of petroleum products or hazardous substances in that portion of the Subject Property or structure. Inaccessible portions of the Subject Property are described below. In addition, EBI renders no opinion as to the

EBI Consulting

presence of, or indirect evidence relating to, petroleum products or hazardous substances where direct observation of the interior walls, floor, or ceiling of a structure was obstructed by objects or coverings on or over these surfaces.

It is acknowledged that EBI judgments shall not be based on scientific or technical tests or procedures beyond the scope of the Services or beyond the time and budgetary constraints imposed by the Client. It is acknowledged further that EBI conclusions shall not rest on pure science but on such considerations as economic feasibility and available alternatives. Client also acknowledges that, because geologic and soil formations are inherently random, variable, and indeterminate in nature, the Services and opinions provided under this Agreement with respect to such Services, are not guaranteed to be a representation of actual conditions on the Subject Property, which are also subject to change with time as a result of natural or man-made processes, including water permeation. In performing the Services, EBI shall use that degree of care and skill ordinarily exercised by environmental consultants or engineers performing similar services in the same or similar locality. The standard of care shall be determined solely at the time the Services are rendered and not according to standards utilized at a later date. The Services shall be rendered without any other warranty, expressed or implied, including, without limitation, the warranty of merchantability and the warranty of fitness for a particular purpose.

Client and EBI agree that to the fullest extent permitted by law, EBI shall not be liable to Client for any special, indirect or consequential damages whatsoever, whether caused by EBI's negligence, errors, omissions, strict liability, breach of contract, breach of warranty or other cause or causes whatsoever.

The ASTM Standard E1527 does not encompass analytical testing to evaluate Asbestos Containing Materials (ACM), radon, lead-based paint (LBP), drinking water quality, indoor air quality, stored chemicals, debris, fill materials, surface water, or subsurface samples (soil and groundwater) as part of a Phase I ESA. EBI performed testing at the Subject Property in accordance with the Standard Conditions For Engagement and, Authorization Letter and Agreement for Environmental Services and the client-specific Scope of Work. Unless otherwise specified herein, such testing involves screening methods intended to provide a broad and approximate evaluation of conditions at readily accessible portions of the Subject Property, limited by project constraints, and should not be construed as a comprehensive program designed to comply with a specific regulatory program. If a thorough and regulatory-compliant study is warranted based on the findings of the Phase I ESA, EBI will recommend the appropriate further investigation. In certain cases, quantitative laboratory testing is performed as part of the assessment and analyses have been conducted by an outside laboratory. EBI relies upon the data provided by the outside laboratory, and has not conducted an independent evaluation of the reliability of this data.

The assessment was conducted in a manner consistent with the level of care and skill ordinarily exercised by members of the profession, and in accordance with generally accepted practices of other consultants currently practicing in the same locality under similar conditions. No other representation, expressed or implied, and no warranty or guarantee is included or intended. The *Report* speaks only as of its date, in the absence of a specific written update of the *Report*, signed and delivered by EBI. Additional information that becomes available after our survey and draft submission concerning the Subject Property should be provided to EBI so that our conclusions may be revised and modified if necessary, at additional cost. This *Report* has been prepared in accordance with our Standard Conditions for Engagement, which is an integral part of this *Report*.

INACCESSIBLE OR UN-SURVEYED PORTIONS OF SUBJECT PROPERTY

EBI was not provided access to the bank building basement, vault, or behind counter areas. There were no other notable portions of the Subject Property excluded from this survey.

ABBREVIATIONS

EBI may use various abbreviations to describe various site, building or system components or legal descriptions. Not all abbreviations may be applicable to all reports. The abbreviations most often utilized are defined below.

ACM	Asbestos-containing material	HVAC	Heating, ventilating and air conditioning
AST	Aboveground storage tank	MSDS	Material Safety Data Sheet(s)
CMU	Concrete masonry unit	REC	Recognized environmental condition
EIFS	Exterior insulating finishing system	RTU	Rooftop (HVAC) unit
FOIA	Freedom of Information Act	UST	Underground storage tank
LBP	Lead-based paint	VCT	Vinyl composition tile
			- *

2.0 SUBJECT PROPERTY CHARACTERISTICS

2.1 OWNERSHIP AND LOCATION

According to the Los Angeles County Assessor's Office and Mr. Michael Turner, the Subject Property is owned by Third & Fairfax, LLC. The Subject Property is zoned commercial industrial and consists of seven parcels numbered 5509-018-003, 004, 005, 010, 012, and 013. The Subject Property is located in Los Angeles, Los Angeles County, California at 6310-6360 West Third Street. The Subject Property is adjacent to the intersection of Third and Fairfax on the Southeast corner. Figure 1, Location Map attached to this Report depicts the Subject Property on a street map of the vicinity.

Figure 2, Topographic Map attached to this Report depicts the Subject Property on a portion of the Hollywood, California United States Geological Survey (USGS) Topographic Quadrangle.

Figure3, Site Plan attached to this Report depicts the immediate vicinity of the Subject Property.

2.2 DESCRIPTION AND OPERATIONS

LAND AND BUILDING AREAS

Areas of the Subject Property not improved with buildings include asphalt paving surrounding the buildings that is used as parking and trash collection areas. Minimal landscaping is scattered throughout the Subject Property. An outdoor eating area is located in an enclosure between the Subject Property buildings. The main building occupies the southern portion of the Subject Property. An alley with loading docks is located to the south of the buildings. A bank building is located on the northwestern corner of the Subject Property. The Savon, bank building and Kmart buildings have basements.

CURRENT TENANTS AND USE OF THE SUBJECT PROPERTY

At the time of EBI's survey, several retail tenants occupied the Subject Property. The current tenants and their activities/business type are summarized in the Table below. EBI was provided with a copy of the most recent rent roll, which is appended to this *Report*.

CURRENT TENANTS/ACTIVITIES						
TENANT NAME	REPORTED SQUARE FOOTAGE	USE OF TENANT	ARE HAZARDOUS MATERIALS PRESENT?	TYPE AND AMOUNT OF MATERIALS GENERATED	STAINING/CONDITION OF STORAGE/ CONTAINMENT	
Sav-On	23,040	Drug Store	Yes	Silver recovery from photo processing operations.	Minor staining, no secondary containment, poor housekeeping around developer.	
Whole Foods	29,928	Grocery Store	No	N/A	N/A	
Anna's Linens	7,033	Linen Store	No	N/A	N/A	
K-Mart	138,147	Retail Store	Yes	Silver recovery from photo processing operations.	Minor staining, secondary containment present.	
				Used Car Battery Cores	No staining, no secondary containment.	
Citibank	11,249	Bank	No	N/A	N/A	

EBI Consulting

TENANT NAME	REPORTED SQUARE FOOTAGE	USE OF TENANT	ARE HAZARDOUS MATERIALS PRESENT?	TYPE AND AMOUNT OF MATERIALS GENERATED	STAINING/CONDITION OF STORAGE/ CONTAINMENT
Payless Shoesource	3,804	Retail Shoe Store	No	N/A	N/A
Thai Patio	2,207	Restaurant	No	Grease waste from cooking disposed of in shared grease container.	Some cooking grease staining on asphalt/concrete, no secondary containment
Andre's of Town and Country	4,315	Restaurant	No	Grease waste from cooking disposed of in shared grease container.	Some cooking grease staining on asphalt/concrete, no secondary containment.
Fortune Plate	1,770	Restaurant	No	Grease waste from cooking disposed of in shared grease container.	Some cooking grease staining on asphalt/concrete, no secondary containment.
Fresh Start	1,908	Restaurant	No	Grease waste from cooking disposed of in shared grease container.	Some cooking grease staining on asphalt/concrete, no secondary containment.
Saka's Outlet	934	Retail	No	N/A	N/A
Fashion Studio	2,170	Retail	No	N/A	N/A
Tong-Shin Newsstand	612	Retail	No	N/A	N/A
Vista Optical	600	Retail	No	N/A	N/A
Wigs Today	675	Retail	No	N/A	N/A
Van Wagner Communicatio ns	Billboard	-	No	N/A	N/A
A-1 Keys	Kiosk	Retail	No	N/A	N/A
United Mobile Phone	72	Retail	No	N/A	N/A

The current uses of the Subject Property do not represent a potential environmental concern. However, improved housekeeping of photochemicals and placement of secondary containment beneath all photochemicals and photochemical waste is recommended to mitigate a release of chemicals to the flooring.

2.3 MUNICIPAL SERVICES & UTILITIES

2.3.1 Water & Sewer

Domestic drinking water is provided by the Los Angeles Department of Water and Power (LADWP). The Subject Property is reportedly connected to the municipal sewer system, which is maintained by the LADWP.

2.3.2 Gas/Oil

The Gas Company provides gas service to the Subject Property. No oil service is provided to the Subject Property.

2.3.3 Electrical

Los Angeles Department of Water and Power supplies electrical service to the Subject Property. Two pad-mounted transformers are located in the rear of the Subject Property buildings. No leaks or staining was observed around the transformers. According to the LADWP, four transformers are located at the Kmart Store. The transformers are discussed in Section 3.10 of this Report.

3.0 SUBJECT PROPERTY RECONNAISSANCE

3.1 INTERIOR SURVEY

The following table summarizes issues on which the survey of interior areas of the Subject Property focused:

INTERIOR SURVEY					
ITEM NOTED LOCATION AND DESCRIPTION					
Processes that generate petroleum products or hazardous substances		N/A			
Unusual odors		N/A			
Pools of liquid		N/A			
Containers not attributed to current use of the Subject Property		N/A			
Stains or corrosion		N/A			
Drains and Sumps	~	Floor drains are located throughout the Subject Property. Sumps are located in the Kmart basement area.			
Oil-containing equipment	~	Oil-containing equipment at interior portions of the Subject Property include hydraulic balers at Savon and KMart. (See Section 3.10)			

3.2 USAGE, HANDLING AND DISPOSAL OF PETROLEUM PRODUCTS AND/OR HAZARDOUS SUBSTANCES

Routine quantities of hazardous chemicals, oils, lubricants and cleaning chemicals are used to maintain the Subject Property. These materials include cleaning compounds, paints, thinners, gasoline and joint compounds. Materials observed at the Subject Property are utilized during routine operations and do not result in the generation of regulated waste. No evidence of significant leaks or spills was noted during EBI's site visit.

The Subject Property operations include two photo-developing stations located in Savon and KMart that use automated photo processors with small volumes of photochemicals. EBI observed the limited quantity of photo developing chemicals to be poorly stored and managed in the Savon and properly stored and maintained in KMart. EBI recommends improved housekeeping at the Savon photoprocessing center to mitigate the release of photochemicals or waste. The discharge of the used chemicals includes filtration of the chemicals through a silver recovery system. Recovered silver is contained in an approximately five-gallon plastic vessel in Kmart and in 55-Gallon Drums in Savon. The recovered material is shipped via parcel delivery to a central repository per corporate requirements. No hazardous wastes are disposed at the Subject Property. The spent photo processing chemicals are flushed into the sanitary sewer following filtration and removal of the silver, in accordance with regulatory requirements.

3.3 ABOVEGROUND/UNDERGROUND STORAGE TANKS (ASTS/USTS)

Based on observations, interviews and a review of state and local records, there are no indications of USTs or ASTs located at the Subject Property. Historic USTs and ASTs is/are discussed in Section 4.0 and Section 5.3 of this Report.

3.4 ASBESTOS-CONTAINING MATERIAL (ACM)

Asbestos-containing material (ACM) represents a concern when it is subject to damage that results in the release of fibers. Friable ACM, which can be crumbled by hand pressure and is therefore susceptible to damage, is of particular concern. Non-friable ACM is a potential concern if it is damaged by maintenance work, demolition or other activities.

The previous ESA cited in Section 4.1 of this Report did not include sampling and analysis of suspect ACM; however, the report did note suspect ACM in the form of acoustic ceiling spray in the bank building, ceiling panels, ceiling tiles, and flooring materials. The previous report notes a review of asbestos survey reports by Pacific Southwest, WPM Construction Technology, and CF Environmental that reportedly address renovation of limited areas of the property. No other information was provided. The previous report noted that no asbestos surveys were identified for the entire property. ACM identified in the previous asbestos reports reportedly include structural steel fireproofing, pipe insulation, asbestos-cement pipes, flooring materials, and roofing materials.

The Arba Group provided EBI with a previous pre-renovation ACM survey for the Whole Foods Store area. The previous report identified ACM in the form of flex joint, pipe insulation, floor tile, and floor tile mastic. Another previous report supplied by the ARBA Group titled PDG Environmental Close-Out for Whole Foods Space that documented asbestos abatement during September 2001. The report documented the removal of ACM in the form of floor tile, flex joint, and pipe insulation. It was unclear whether the floor tile mastic was removed.

EBI observed friable suspect ACM in the form of trowelled-on stucco and plaster in the basement of Savon, drywall throughout the Subject Property, textured ceiling surfacing, ceiling tile, and spray on fireproofing. In addition, non-friable suspect ACM was observed in the form of terrazzo, vinyl floor tile, roofing materials, and construction mastics at the Subject Property. Where observed, the suspect ACM is intact and in good condition except in the Kmart. It should be noted that additional suspect ACM may be present in portions of the structure that are not accessible, such as behind walls and above ceilings.

As directed by the scope of work for this ESA, EBI collected 20 representative samples of suspect ACM in the form of troweled-on stucco/plaster and drywall. Due to the inaccessible ceiling height, poor condition, and high friability and potential for ACM fiber release and human exposure potential, EBI did not collect samples of the fireproofing in the Kmart. The suspect ACM samples collected by EBI were submitted to Environmental Hazards Laboratory in Richmond, VA to be tested for the presence of asbestos by polarized light microscopy (PLM). The following table below presents the results of the testing.

ASBESTOS SAMPLING RESULTS						
SAMPLE ID	LOCATION	MATERIAL	% ASBESTOS	FRIABILITY	CONDITION	ESTIMATED AMOUNT FT2
040728- 01	Southwest Basement Corner of	Trowelled on stucco / plaster.	*	Friable	Damaged	500

EBI Consulting

ASBESTOS SAMPLING RESULTS SAMPLE LOCATION MATERIAL % ASBESTOS FRIABILITY CONDITION ESTIMAT							
ID		WATERIAL	70 ASDESTOS	PKIABILITY	CONDITION	ESTIMATE: AMOUNT FI	
	Savon						
040728- 02	Southwest Basement Corner of Savon	Trowelled on stucco / plaster.	No.	Friable	Damaged	500	
040728- 03	Southwest Basement Corner of Savon	Trowelled on stucco / plaster.	ИE	Friable	Damaged	500	
040728- 04	Main floor of Savon behind employee door.	Drywall	*	Friable	Good	23,040	
040728- 05	Main Floor stockroom	Drywall	*	Friable	Good	23,040	
040728- 06	Main Floor stockroom	Drywall	*	Friable	Good	23,040	
040728- 07	Main Floor stockroom	Drywall	*	Friable	Good	23,040	
040728- 08	Main Floor Stockroom	Drywall	*	Friable	Good	23,040	
040728- 09	Main Store	Drywall	*	Friable	Good	23,040	
040728- 10	Main Store	Drywall	Þβc	Friable	Good	23,040	
040728- 11	370	Drywall	2/5	Friable	Good	23,040	
040728- 12	370	Drywall	*	Friable	Good	23,040	
040728- 13	370	Drywall	*	Friable	Good	23,040	
040728- 14	Kmart Basement by escalator	Drywall	*	Friable	Good	138,147	
040728- 15	Kmart basement stockroom	Drywali	*	Friable	Good	138,147	
040728- 16	Kmart basement stockroom	Drywall	*	Friable	Good	138,147	
040728- 17	Kmart basement stockroom	Drywall	*	Friable	Good	138,147	
040728- 18	Kmart main floor by shoes	Drywall	*	Friable	Good	138,147	
040728- 19	Kmart upper stair well	Drywall	*	Friable	Good	138,147	
040728- 20	Kmart 3 rd Floor	Drywall	*	Friable	Damaged	138,147	

^{*} As of the date of this draft Report, EBI has not received the laboratory analysis results.

It should be noted that the visual asbestos screening survey conducted under the scope of this investigation does not constitute a full asbestos inspection, in which all areas of the buildings would have been thoroughly surveyed and sampled. The possibility exists for ACM to be present in areas of the buildings not accessed or sampled by EBI personnel.

Due to the continued distribution of a wide variety of asbestos-containing building materials, asbestos may be present in some of the roofing, flooring, caulking/putties, adhesives, spackling compounds, and/or non-accessible insulation materials at the Subject Property. Sampling of these types of materials require techniques that may be destructive to subject facilities and in the case of roofing material may void warranties. It is recommended that all such possible asbestos-containing materials be tested prior to renovation or demolition activities that could disturb the materials. Any testing, removal, or disturbance of ACM should be handled in compliance with federal, state, and local regulations. Licensed, qualified asbestos abatement personnel should be retained prior to demolition or renovation of subject facilities.

3.5 RADON

Radon is a naturally-occurring, colorless and odorless radioactive gas that is generated primarily in granitic rocks. The United States Surgeon General has published information that radon is a cause of lung cancer. Radon usually enters a building through openings in the foundation, and therefore is a potential health concern to residents of the lowest level of a building with inadequate ventilation.

Due to the non-residential use of the Subject Property, and in accordance with the scope of work for this ESA, radon testing was not performed.

3.6 LEAD-BASED PAINT (LBP)

Use of lead in household paint was banned by the Environmental Protection Agency (EPA) effective January 1, 1978. The EPA considers paint containing greater than 0.5% lead by weight to be "lead-based." Federal regulations specify that lead paint hazards must be abated in residential buildings occupied by children under the age six.

Based on the commercial use of the buildings and the scope of work for this ESA, an LBP survey was not conducted at the Subject Property.

3.7 LEAD IN DRINKING WATER

Lead has historically been used in pipes, solder, and brass fixtures used in water distribution systems and plumbing material. In 1986, EPA banned the use of lead at concentrations exceeding 0.2% lead in solder and 8% lead in other plumbing material. The Los Angeles Department of Water and Power provides domestic water. According to personnel at this agency, potable drinking water is obtained from the eastern Sierra, and the most recent analytical testing data indicates compliance with Safe Drinking Water Act (SDWA) requirements.

3.8 EXTERIOR SURVEY

The following table summarizes issues on which the survey of exterior areas of the Subject Property focused:

	EXTE	ERIOR SURVEY		
ITEM	NOTED	LOCATION AND DESCRIPTION		
Storage tanks	1	N/A		
Unusual odors		N/A		
Areas of asphalt patch or surface depressions		N/A		
Containers not attributed to current use of the Subject Property		N/A		
Oil-containing equipment	~	Two pad-mounted and Four underground transformers are located on the Subject Property (see Section 3.10).		
Stained soil or pavement		N/A		
Stressed vegetation		N/A		
Fill material of questionable origin/ Piles		N/A		
Wastewater		N/A		
Monitoring Wells		N/A		
Catch basins or dry wells	~	Water run-off catch basins are located on the Subject Property and drain to the municipal sewer system.		
Septic systems		N/A		

3.9 SOLID WASTE DISPOSAL

Solid waste generated at the Subject Property is typical domestic waste consisting of paper, plastics, and food refuse. Solid waste is collected in dumpsters located in enclosures throughout the Subject Property. No evidence of illicit dumping of solid waste was observed during EBI's site visit.

The on-site restaurants generate waste cooking grease. The waste grease is stored in a waste grease container, which are removed monthly by a private waste company. Minor staining was observed around the containers. Cooking grease is non-hazardous and not considered an environmental concern to the Subject Property.

3.10 POLYCHLORINATED BIPHENYLS (PCBs) EQUIPMENT

PCBs were used in the dielectric fluid of some transformers and capacitors manufactured prior to 1979. The EPA banned the use of PCBs in 1978. Potential PCB-containing equipment observed at the Subject Property included several pad-mounted and underground transformers. The transformers appeared to be in good condition and no indications of leaks or staining were observed on or below the transformer casings. The transformers are owned and operated by the regional utility company, *LADWP*, which has indicated that none of the Subject Property transformers contain PCBs over the EPA's maximum

allowable concentration of 50 ppm. A previous Phase I ESA, discussed in section 4.1 of this report stated that the Savon transformer contained 13 ppm of PCB's according to the LADWP, and that the transformers at the Kmart have PCB counts of 8, 9, 13, and 25. EBI contacted the LADWP and requested confirmation of the transformers and PCB results. The LADWP has not responded to EBI's request as of this report. If the provided information has a material affect on the findings of this *Report*, EBI will forward the new information, together with revised findings, as an addendum to this *Report*. If no response is received or no material violations are noted, our *Report* will not be modified. In the event of a release of dielectric fluid from one of its transformers, the utility company typically performs the cleanup.

Potential PCB-containing equipment observed at the Subject Property also includes two hydraulic balers and a trash compactor. There was indication of minor, de minimis, hydraulic fluid leakage around the Savon compactor and the Kmart compactor. No other hydraulically operated equipment was observed at the Subject Property. The Kmart compactor was provided by Consolidate Waste Services and appears to be newer than 1978. Due to the assumed date of construction of the Kmart compactor, it is not suspected to contain PCB's. The date of construction of the Savon hydraulic baler could not be determined; however, recent servicing of the hydraulics suggests the hydraulic fluid does not contain PCBs. No further action is recommended at this time with regards to the two compactor units.

The previous CA Environmental report discussed in section 4.1 of this report stated that PCB containing light ballasts may be present at the Subject Property. EBI noted older light ballasts at the Subject Property and recommended that the unlabeled fluorescent light ballasts should be assumed to contain PCB's and be handled and disposed of in accordance with EPA regulations.

3.11 PHYSICAL SETTING

TOPOGRAPHY

The Subject Property is at an elevation of approximately 183 feet above mean sea level (msl). The Subject Property is flat and sloped down gently to the south. The Subject Property is in a relatively flat and level area (see *Figure 2-Subject Locus Map*, which is a portion of the *Hollywood, California* USGS Quadrangle). The overall slope of the surrounding area is down to the south.

GEOLOGY

Information concerning the geology of the Subject Property was obtained from the USGS Ground Water Atlas of the United States, California region (1995). The Subject Property is located within the Pacific Border physiographic province, which is characterized by steep rolling hills and mountains and consists of severely folded, faulted, commonly metamorphosed marine and continental sediments.

HYDROLOGY/HYDROGEOLOGY

No surface water bodies are present on the Subject Property. Local groundwater gradient is expected to follow surface topography; therefore, groundwater flow near the Subject Property is expected to flow to the south / southeast. Groundwater depths and flow gradients are best evaluated by a subsurface investigation involving the installation of at least three groundwater monitoring wells and precise measurements of hydrostatic pressure.

A previous environmental report by California Environmental, referenced in Section 4.1 of this Report, stated that the Subject Property is located near the northwestern boundary of the Pressure Area of the Los Angeles Central Groundwater Basin. Silts, clays, and sands of the Pleistocene Lakewood Formation reportedly underlie the property. Groundwater occurs in the Exposition Aquifer at a depth of approximately 124 feet below ground surface (bgs). Perched ground water was encountered beneath the

site between 20 to 60 feet bgs. California environmental noted that the probable direction of groundwater flow is towards the south or southeast.

3.12 ADJACENT PROPERTIES

NORTH

The northern boundary of the Subject Property is adjacent to West Third Street. Across Third Street is the Los Angeles Farmers Market and further more commercial and residential areas. No evidence of adverse environmental conditions was observed during the survey of the northern boundary of the Subject Property.

SOUTH

Hancock Park Elementary School borders the Subject Property on the south. Beyond is Parklabrea, which includes the La Brea Tar and Fossil Pits. No evidence of adverse environmental conditions was observed during the survey of the southern boundary of the Subject Property.

EAST

The Subject Property is bordered on the east by Fairfax Avenue. Beyond Fairfax are various commercial properties including and office building, a dry cleaner, a nail salon, a pizza parlor, and a LUST facility discussed in section 5.2.

WEST

The Subject Property is bordered on the west by Ogden Drive. Beyond Ogden Drive is a Ross Department Store and parking area. Beyond are newer apartment buildings. No evidence of adverse environmental conditions was observed during the survey of the western boundary of the Subject Property.

3.13 METHANE

The Subject Property is located in the Salt Lake Oil Field. South of the Subject Property are the La Brea Tar and Fossil Pits. The Subject Property and surrounding area were used for oil production from the 1900's to the 1930's. In the 1930's the local oil derricks and wells were abandoned to make way for urban construction. Accumulation of methane gas, which migrates from the subsurface through soil or other preferential pathways, caused an explosion at the Ross retail store property in 1985, located approximately 500 feet west of the Subject Property. Explosive levels of methane gas were reportedly detected in the Subject Property Kmart store at that time. As a result of the explosion, the Los Angeles City Fire Department issued a methane ordinance requiring methane monitoring and mitigation measures in "High Potential Methane Zone" centered on the Salt Lake Oil Field. As the Subject Property is located within this zone, a methane mitigation and monitoring system was implemented on the Subject Property.

Methane gas is combustible at certain concentrations in air and is odorless, colorless, lighter than air, and formed by the decomposition of organic matter. It is common in swamps, wetlands, peat deposits, oilfields, and old landfills. The gas moves along the most unrestricted pathway, such as layers of sand, along pipelines, wells, or through underground structures such as a basement. At a concentration of between 5 and 15 percent methane in air, methane becomes an explosive hazard. Five percent or 50,000 parts per million (ppm) is defined as the lower explosive limit (LEL). Methane gas also can cause asphyxiation in a confined space. Sensors to measure methane display the concentration in three ways: percent by volume, parts per million, and percent of the LEL. (A concentration of 100 percent of the LEL is 5 percent by volume.)

The Subject Property methane gas monitoring system includes 12 street probes, located along the streets that abut the Subject Property, 7 gas vents and 10 parking lot gas vents (attached to light poles), 6 wells, and 3 gas probes located on the Town and Country property. Manual gas monitoring of the Kmart basement was discontinued in 1996 in accordance with approval by the Los Angeles City Fire Department (LAFD). An automated gas detection-alarm system operates at the Kmart location and was determined to be adequate for methane gas monitoring. The Whole Foods store reportedly has there own interior gas sensors and alarm system.

Methane gas monitoring has reportedly occurred at the Subject Property, as directed by the LAFD, since 1990. Currently, the Subject Property, in accordance with the LAFD oversight requirements, conducts semi-weekly methane gas monitoring and gas pressure monitoring and reporting. EBI reviewed recent semi-weekly Methane Gas Monitoring Reports prepared for the Subject Property and dated June 2004. Methane gas concentrations ranged from non-detect to 88% of the LEL, less than the LEL and not considered a concern to the public health and welfare at this time. The highest gas concentrations are reported in the eastern portion, exterior parking lot area, of the Subject Property. Gas pressure readings for this period indicated zero gas pressure at all of the pressure monitoring locations.

Two former oil wells, designated #99 and #102, were reportedly abandoned on the Subject Property in the 1930s. A previous ESA report attempted to locate these wells with geophysical techniques and identified a potential subsurface anomaly consistent with the estimated location of the abandoned well #102, located in the northwest perimeter of the Subject Property. The second oil well #99, estimated location in the northeast portion of the Subject Property, was not detected by geophysical methods. A previous ESA report (See Section 4.1, CA- April 1998) concluded that the highest rate of methane gas venting is in the same area as the suspected location of former oil well #99, northeast portion of the Subject Property. It was the opinion of CA Environmental that the methane gas problem in this area is at least partially due to a leaking well and if the well could be located and re-abandoned the methane problem will probably be reduced or eliminated. EBI's discussion with a representative of The Division of Oil and Gas (DOG) stated that a construction site review for the reported abandoned wells by the DOG would be required if the Subject Property proposed further development.

EBI contacted Mr. David Myers of the Los Angeles City Fire Department Environmental Unit, which has local agency oversight of methane compliance. Mr. Myers stated that the current concentrations of methane gas reported in the semi-weekly methane monitoring reports are not a concern to the Fire Department at this time.

EBI spoke with Mr. Ron Lofy, of Lofy Engineering, who conducts the semi-weekly onsite monitoring of methane gas monitoring system at the Subject Property. Mr. Lofy stated that the two gas venting mitigation wells, designated Kerbrat Well #2 and Fukuda Well #3, were installed in 1991/1992 after mud geysers and gas buildup occurred at the Subject Property and local vicinity. The mitigation wells were installed in conjunction with required horizontal vent pipes that are still in operation at the Subject Property. In 1997, the mitigation wells were abandoned at the direction of the property management firm, Investment Development Services. Mr. Lofy stated that this did not violate any local oversight agency requirements and that the Subject Property is currently in compliance with local, state, and federal regulations as long as the twice-weekly monitoring and onsite monitoring alarm systems are maintained.

4.0 SUBJECT PROPERTY AND VICINITY HISTORY

EBI obtained historical information regarding the Subject Property from the sources listed below. From review of the following, it appears that the Subject Property was previously an oil field (early 1900s to 1930), residences in 1939, single story commercial buildings in 1945 to 1960, a car wash in 1951, and the existing shopping center buildings since 1961. The discussion of the reviewed historical resources is provided below.

4.1 PREVIOUS ENVIRONMENTAL REPORTS

Mr. Michael Turner provided EBI with five previous environmental site assessments performed for the Subject Property:

Revised Updated Preliminary Phase I Environmental Site Assessment and Phase II Subsurface Environmental Site Assessment, performed by California Environmental (CA) of Westlake Village, California, dated April 1998. According to the CA report, the Subject Property was previously occupied by a car wash, which was constructed on the Subject Property in 1951. From 1906 to 1931, the Subject Property was used for oil production. The CA report noted two abandoned wells on the Subject Property, which were reportedly abandoned in 1930-1931 and were not abandoned in accordance with current oil well abandonment standards. CA noted a 1931 aerial photograph, which showed aboveground oil storage tanks and sumps on the Subject Property. CA discussed the onsite methane issue and concluded that the onsite methane mitigation measures comply with regulatory requirements and appear to adequately protect against loss of life due to methane fires or explosions.

The CA report documented a Phase II investigation of the Subject Property which included: an attempt to locate the former oil wells, reportedly abandoned in the 1930s, using geophysical methods; to characterize petroleum impacts in subsurface soils; and to determine whether hazardous wastes are present in soil beneath the Subject Property. Six soil borings were advanced to depths of 8 feet to 20 feet, and 18 soil samples were collected and analyzed for total petroleum hydrocarbons (TPH), volatile organic compounds, semi-volatile organic compounds, and metals.

• FORMER ONSITE OIL WELLS

The geophysical survey reportedly detected a subsurface anomaly in the area of suspected well #102, located at the northwest perimeter of the Subject Property. The anomaly was interpreted as either a deeply buried well casing, or metal debris at a shallower depth. No subsurface anomaly was found in the suspected area of the abandoned oil well #99 reportedly located in the northeastern portion of the Subject Property.

PETROLEUM IMPACTED SOIL LOCATED BENEATH SUBJECT PROPERTY

The CA Phase II report identified crude oil impacted soil in the suspected abandoned oil well locations and in two suspected former oil sump locations. The highest concentrations of contaminants were primarily less than 10 feet below ground surface (bgs). One location was reported to have elevated concentrations of contaminants to more than 20 feet bgs. Low level impacts were found at a depth of 3 feet in the drainage channel locations but did not extend to greater depths. No impacts were found in the suspect aboveground tank location. The highest total petroleum hydrocarbon (TPH) concentration that CA noted was 14,000 parts per million (ppm). Volatile and Semi-volatile compound concentrations in soil were trace to non-detect. Heavy metal concentrations were reported to be consistent with background metal concentrations in soil and not a potential concern. The CA report concluded that hazardous concentrations of

contaminants of concern may be present in the near surface (less that 25 feet bgs) and that crude oil impacted soil may be encountered during future grading activities at the site, if such activities are conducted.

- The CA report stated that based on the current development at the site and the lack of pathways for human exposure to the contaminated soil limited the human health risk. The CA report also stated that based on the hydrogeologic conditions at the Subject Property, the petroleum impacts do not present a significant risk to the groundwater resource beneath the Subject Property. The CA report stated that it was unlikely that the Los Angeles County Regional Water Quality Control Board (LARWQCB) would require the remediation of the impacted soil in the absence of redevelopment of the Subject Property even though the minimum level at which the LARWQCB would set a site specific action level for TPH would be 10,000 ppm (CA report quoting the Interim Site Assessment and Cleanup Guidebook, LARWQCB, May 1996, Table 4-1). The CA report stated that based on recent LARWQCB actions at other oil field properties, onsite refuse of petroleum impacted soil would likely be allowed at high levels. The CA report concluded that no further action was recommended for the petroleum impacts at the time of the report, but noted that if the soil is disturbed in the future, applicable regulations in effect at that time should be consulted to determine whether special handling will be necessary. Based on an estimated impacted soil volume of 6,000 cubic yards (9,000 tons), the 1998 estimate for excavation, loading, transportation, treatment, import, backfill, and compaction of the contaminated soil was \$324,000.00.
- The CA report concluded that the highest rate of methane gas venting is in the same area as the suspected location of former oil well #99, northeast portion of the Subject Property. CA stated, "It is the opinion of CA Environmental that the methane gas problem in this area is at least partially due to a leaking well. If the well can be located and re-abandoned the methane problem will probably be reduced or eliminated."

Updated Preliminary Environmental Site Assessment and Subsurface Investigation, performed by California Environmental (CA) of Westlake Village, California, dated April 1998. The revised Phase I, II ESA report recommended that an asbestos survey be conducted and an Operations and Maintenance Plan be instituted to manage the onsite asbestos containing material. The CA revised ESA report conclusions stated that a methane monitoring and maintenance plan should be developed and that the estimated cost of annual testing is \$25,000.00.

Pre-Renovation Asbestos Inspection performed by Camco Group (Camco) of Fonata, California, dated August 17, 2001. The Camco report addressed the area of the single story grocery store (now Whole Foods) and sampled for asbestos containing materials. The report identified ACM in the form of Flex Joint in the rear stock room attic, pipe insulation near the HVAC unit in the attic, floor tile (12" red brick pattern) on the sales floor, and associated floor tile mastic. It should be noted that this report only addresses the Whole Foods tenant space.

Abatement Report for Whole Foods Space, performed by PDG Environmental (PDG) of Fullerton, California, dated September 15, 2001. The previous report supplied by the ARBA Group titled PDG Environmental Close-Out for Whole Foods Space documented abatement during September 2001. The report documented the removal of floor tile, flex joint, and pipe insulation. It was unclear whether the floor tile mastic was removed. It should be noted that this report only addresses the Whole Foods tenant space.

Weekly Methane Monitoring Reports, performed by Lofy Engineering (Lofy) of Pasadena, California, dated July 3, 2004. The Los Angeles City Fire Department requires the routine semi-weekly methane gas monitoring of the Subject Property and submittal of a Methane Gas Monitoring report. EBI reviewed monitoring reports for 2004. The monitoring reports summarize probe testing of detectable levels of methane in 11 out of 12 probes at the Subject Property. Monitoring of exterior gas vent locations were performed. The weekly monitoring reports note the gas detection alarm systems in place at the Subject Property. The reports note the almost continuous pumping of an offsite well (Anthony #2) between Ogden Drive and the Ross Dress for Less. The report noted a new concrete subterranean clarifier next to Anthony well #2. The discharge water from Kerbrat well #2 and Fekuda Well #3 (on the Subject Property) have been redirected to a new 5,000 gallon tank located in the immediate vicinity of the Kerbrat well #2. During its existence, the 5,000 gallon tank at the Subject Property had been drained to the storm sewer a total of seven times prior to the tank being removed in 1997.

The monitoring report stated that in 1997, the onsite vent wells (kerbrat #2 and Fukuda #3) were abandoned at the direction of the property management firm. The wells had been a pathway for venting the methane gas in the area and reducing ambient pressure in the soil. These wells had served as key gas relief wells, which had prevented any gas build up in the Kmart basement since their activation in 1992. Reportedly, the operation was too expensive for the Subject Property management firm.

Relevant information from the previous reports is discussed in the appropriate sections of this *Report*. Portions of the previous reports are included as an Appendix to this *Report*.

4.2 FIRE INSURANCE MAPS

EBI reviewed Sanborn fire insurance maps as provided by the Los Angeles Public Library. Map sets dated 1888, 1894, 1900, and 1906 updated 1950 were reviewed. The review revealed the following:

- The 1888 map set did not encompass the Subject Property area.
- The 1894 1900 map set did not encompass the Subject Property area.
- In the 1906 updated 1950 map set, the Subject Property appears to by located in either Volume 8 or Volume 24. Neither volume was accessible on August 10, 2004.

The previous CA report reference Sanborn Fire Insurance Maps dated 1950 and 1969. The Previous report stated that following:

- The 1950 map depicts the Subject Property as occupied by the Town and Country Market with numerous shops and small restaurants. The service yard is occupied with an incinerator, three storage buildings, and a greenhouse is present along the southern property line. No underground tanks of hazardous waste generating activities were indicated on the Subject Property. Hancock Park School is adjacent to the south, with the large Park LaBrea residential development beyond. The area across Ogden Drive to the east is vacant. The map does not show the properties across Fairfax to the west or Third Street to the north
- The 1969 map depicts the Subject Property as occupied by the existing shopping center and bank buildings. No underground tanks or hazardous waste generating activities are indicated on the property. Hancock Park School is adjacent to the south, with the large Park La Brea residential development beyond. The area across Ogden Drive to the east is occupied by the Park La Brea

shopping center. The map does not show the properties across Fairfax to the west or Third Street to the north.

4.3 HISTORIC AERIAL PHOTOGRAPHS

EBI reviewed historical aerial photographs dated 1928, 1947, 1952, 1965, 1976, 1989, 1994, and 2002 as provided by EDR, Inc. The historical aerial photograph review revealed the following:

- The 1928 photo depicts the Subject Property as an oil production field. Large above ground storage tanks, apparently used to store crude oil, are located on the Subject Property. Dirt road accesses are located throughout the Subject Property. Residential areas are located to the west and northwest of the Subject Property. The areas to the south and east of the Subject Property are also a part of the large oil production field. The area to the north of the Subject Property across Third Street is apparently vacant land with intermittent uses including oil production. The larger surrounding area is moderately densely developed with residential areas.
- The 1947 photo depicts the Subject Property with several single story commercial buildings. The remaining portion of the Subject Property is utilized for parking, apparently unpaved. The Subject Property is bound to the west by Fairfax and then by sparse commercial buildings, to the north by Third and then by Farmers Market, to the east by undeveloped land (Ogden has not yet been constructed) and the south by a two-story school building and unpaved land. Further south is the La Brea Park Development.
- The 1952 photo depicts the Subject Property with the same single story commercial buildings as in 1947. The remaining portion of the Subject Property is utilized for parking, apparently unpaved. The Subject Property is bound to the west by Fairfax and then by commercial buildings, to the north by Third and then by Farmers Market, to the east by Ogden and undeveloped land, and the south by a two-story school building and unpaved land. Further south is the La Brea Park Development.
- The 1965 photo depicts the Subject Property as occupied by a shopping complex along the southern portion. The northwest corner of the Subject Property is occupied by a commercial building. The remaining portion of the Subject Property is covered with a parking lot. The Subject Property is bounded to the south by a school and parking lot, to the west by Fairfax and then by commercial properties, to the north by Third Street and then by Farmer's Market, to the east by Ogden and then by another commercial complex.
- The 1976 photo depicts the Subject Property and adjacent properties as in 1965.
- The 1989 photo depicts the Subject Property and adjacent properties as in 1965 and 1976. The surrounding area has been highly developed and is now a high-density urban area.
- The 1994 photo depicts the Subject Property and adjacent properties similar to those depicted in 1965, 1976, and 1989. No major changes were noted from 1989 to 1994.
- The 2002 photo depicts the Subject Property and adjacent properties similar to those depicted in 1965, 1976, 1989, 1994 and as the Subject Property appears today. The apartment buildings to the far east of the Subject Property have been constructed. The school to the south of the Subject Property has added more buildings.

19

EBI Consulting

The previous CA report reviewed historical aerial photographs as provided by Spence Aerial Photograph dated 1931, 1939, 1945, 1950, 1955, 1960, 1962, 1964, and 1969. The CA review revealed the following:

- The 1931 photo depicts the Subject Property as occupied by an oil field including three large aboveground storage tanks, an oil well derrick, and approximately 12 buildings. Six or seven shallow impoundments or sumps are present, four of which appear to contain oil. A drainage course leading from impoundments across Third Street to the northeast crosses the southeast corner of the property. Oil wells are present to the north, east, and south. A residential neighborhood is located to the west and northwest. A possible gas station is located on the southwest corner of Third and Fairfax. A real estate office is located in the northwest corner of 4th and Fairfax.
- The 1939 photo depicts the Subject Property as occupied by two single story dwellings and trees along the south-central portion of the Subject Property. The remaining portion of the Subject Property is undeveloped land. Billboards are located along the northwest corner and western portion of the Subject Property. No oil wells were noted on the Subject Property. The Subject Property is bordered on the south by a school; to the east by undeveloped land, to the north by Third Street and the farmers market, and to the west by Fairfax and then by sparse commercial buildings. There are service stations located on the southwest and northwest corners of Fairfax and Third.
- The 1945 photo depicts the Subject Property with the central portion occupied by several single story commercial buildings. The remaining portion of the Subject Property is utilized for parking, apparently unpaved. There are service stations located on the northwest and southwest corners of Fairfax and Third. The Subject Property is bound to the west by Fairfax and then by sparse commercial buildings, to the north by Third and then by Farmers Market, to the east by undeveloped land (Ogden has not yet been constructed) and the south by a two-story school building and unpaved land.
- The 1950 photo depicts the Subject Property with the same several single story commercial buildings as noted in 1945. The remaining portion of the Subject Property is utilized for parking, apparently unpaved. There is a service station located on the northwest corner of Fairfax and Third. There may be a service station located on the southwest corner of Third and Fairfax. The property is bounded on the north by Third and then by Farmer's Market, to the east by Ogden and then by a storage yard for lumber and possible sand, to the south by a school and single-story dwellings/school rooms, and to the west by Fairfax and then by commercial buildings.
- The 1955 photo depicts the Subject Property as occupied by a cluster of commercial buildings. There is a service station located along the northeast corner of the Subject Property. A single-story commercial structure is located along the eastern portion of the Subject Property. There appears to be a small single-story structure located along the west-central portion of the Subject Property. The Subject Property is bounded to the north by Third and then by Farmers Market, to the east by Ogden and then by a commercial shopping center, to the south by a school and playing field and to the east by Fairfax and then by commercial structures.
- The 1960 photo depicts the Subject Property as occupied by a cluster of commercial buildings in the central portion of the Subject Property. There are service stations located along the northeast and northwest corners of the Subject Property. A single story commercial structure (possible drive in restaurant) was located along the eastern property line. There appears to be an overhang along the eastern portion of this building. The property is bounded to the north by Third and then

by Farmers Market, to the east by Ogden and then by a commercial complex, to the south by a school and parking lot and to the west by Fairfax and then by commercial buildings.

- The 1962 photo depicts the Subject Property as occupied by a commercial building along the northwest corner of the Subject Property. The western portion of the shopping center has been constructed. The eastern portion of the site is under construction. A subsurface excavation for a basement is being constructed. The northern most and western portions of the site not occupied by buildings are covered with a paved parking lot. There are several service station located on the northwest and southwest corners of Fairfax and Third Streets. The Subject Property is bound to the south by a school and parking lot, to the west by Fairfax and then by commercial structures, to the north by Third and then Farmers Market, and to the east by Ogden and then by a commercial shopping center.
- The 1964 photo depicts the Subject Property as occupied by a commercial complex and a single commercial building along the northwest corner of the Subject Property. The remaining portion of the Subject Property is occupied by a parking lot. There are service stations located on the northwest and southwest corners of the Fairfax and Third. The Subject Property is bound to the south by an alley and then by a school along the southwestern portion and a parking lot along the remaining southern portion, to the east by Ogden and then by another commercial complex, to the north by Third Street and then a group of commercial buildings, and to the west by Fairfax and then by commercial property.
- The 1969 photo depicts the Subject Property as occupied by a shopping complex along the southern portion. The northwest corner of the Subject Property is occupied by a commercial building. The remaining portion of the Subject Property is covered with a parking lot. There are service stations on the northwest and southwest corners of Fairfax and Third Streets. The Subject Property is bounded to the south by a school and parking lot, to the west by Fairfax and then by commercial properties, to the north by Third Street and then by Farmer's Market, to the east by Ogden and then by another commercial complex.

4.4 CITY DIRECTORIES

City directories were reviewed at Sherman Library in Corona Del Mar, California. The city directory review revealed the following:

- The 1902 directory listed 3rd Street West up to 1422 where Witmer intersects but did not include the Subject Property.
- The 1910, 1920, 1925, 1931, and 1942 directories did not have reverse listings.
- The 1955 directory lists 6306 as Town and Country Market Auto Wash and West 3rd and Fairfax with many listings for Farmer's Market.
- The 1960 directory did not list the Subject Property, but had many listings for the adjacent Farmer's Market.
- The 1965 directory listed the Subject Property as 6310 Britt Department Store and many other retail and restaurant addresses.
- The 1970 and 1975 directories list the Subject Property with various retail and restaurant addresses.
- The 1980 directory lists the Subject Property as Kmart, Savon, and various retail stores.
- The 1985 directory lists the Subject Property as Kmart, Fox 50 minute color prints, and various retail stores.

• The 1987 and 1989 directories list the Subject Property as various retail stores.

EBI Consulting

4.5 INTERVIEWS

The following information was provided by individuals contacted by EBI in connection with the Subject Property.

INTERVIEW COMMENTS					
CONTACT	RELATION TO SUBJECT PROPERTY	DETAILS OF CONVERSATION			
Mr. Mark Gemache	Associate Oil and Gas Engineer, Division of Oil and Gas	Ms. Gemache explained to EBI that the local oil wells have previously acted as a release valve for the local underground methane build up. The methane is a naturally occurring by-product of the oil-producing zone below the surface. When the oil wells were abandoned, the methane's only route of evacuation from the underground soil is to permeate through the soil. When leached in this fashion, methane can accumulate in underground spaces and basements.			

4.6 PROPERTY TAX RECORDS

Property tax information was obtained from the Los Angeles County Tax Assessor's Office. The property owner is 3rd Fairfax LLC. According to the Subject Property the previous owner was the University of Southern California until 1998.

5.0 REGULATORY INFORMATION

5.1 PROCEDURE

A review of databases maintained by state and federal offices was completed through Environmental FirstSearch. The databases were searched for properties with reported environmental issues within radii specified by ASTM Standard E 1527-00, by using geocoding information that identified the coordinates of the properties in the databases or by checking the street addresses of practically reviewable non-geocoded "orphan" properties within the same zip code. The database report is included as an appendix to this *Report*.

The database report identified <u>917</u> "orphan sites." Orphan sites are those facilities, which could not be automatically mapped or geocoded due to inadequate location information. EBI did not identify listed orphan sites within the specified radii.

It should be noted that plotted locations of listed properties are not always accurate. With regard to listings that are determined or suspected to be inaccurate, based on information from other sources such as direct observation or consultation with individuals familiar with the property, EBI uses the best available data when evaluating the location of listed properties discussed below.

5.2 FEDERAL OFFICE RECORDS

NATIONAL PRIORITY LIST (NPL) FACILITIES

The NPL Report, also known as the Superfund List, is an EPA listing of the nation's worst uncontrolled or abandoned hazardous waste facilities. Listing as a Superfund Site is primarily based on a score that the facility receives from the EPA's Hazard Ranking System. These facilities are targeted for possible long-term remedial action under the Superfund Act. The NPL indicated that no NPL facilities are located within one mile of the Subject Property.

COMPREHENSIVE ENVIRONMENTAL RESPONSE, COMPENSATION & LIABILITY INFORMATION SYSTEM (CERCLIS) AND CERCLIS - NO FURTHER REMEDIAL ACTION PLANNED (CERCLIS-NFRAP) FACILITIES

CERCLIS is a compilation of the facilities EPA has investigated or is currently investigating for a release or threatened release of hazardous substances. The updated EPA Superfund Program CERCLIS List indicates that <u>no CERCLIS</u> facilities are located within a one-half mile radius of the Subject Property. <u>No CERCLIS-NFRAP</u> facilities were identified on or adjacent to the Subject Property.

CORRECTIVE ACTION TRACKING SYSTEM (CORRACTS)

CORRACTS is a list of facilities that are found to have had hazardous waste releases and require Resource Conservation and Recovery Act (RCRA) corrective action activity, which can range from site investigations to remediation. According to the CORRACTS list, no CORRACTS facilities are located within a one-mile radius of the Subject Property.

RESOURCE CONSERVATION AND RECOVERY INFORMATION SYSTEM (RCRIS)

The RCRIS report of hazardous waste generators and treatment, storage, and disposal (TSD) facilities contains information pertaining to facilities that are required to register their hazardous waste activity under RCRA). According to the RCRIS list, no RCRA TSD facilities are located within one-half mile of the Subject Property.

RCRA hazardous waste generators are identified as Large Quantity Generators (LQGs), Small Quantity Generators (SQGs), or Conditionally Exempt Small Quantity Generators (CESQG). RCRA LQGs are identified as those facilities, which generate at least 1,000 kilograms (2,200 pounds) of non-acutely hazardous waste (or 1 kilogram of acutely hazardous waste) monthly. RCRA SQGs are identified as those facilities that generate less than 1,000 kilograms of non-acutely hazardous waste monthly. According to the RCRIS list, no RCRA facilities were identified on or adjacent to the Subject Property. According to the RCRIS list, the Subject Property was not identified as a RCRA generator; however, three adjoining properties were identified as RCRA facilities. The following table presents the listed facilities:

RCRA GENERATOR FACILITIES						
NAME / ADDRESS	GENERATOR TYPE	DISTANCE / DIRECTION / GRADIENT	STATUS			
Kings Cleaners 349 S Fairfax	SQG	Adjacent to the west, crossgradient.	No reported violations in connection with this listing.			
LA USD Hancock Park Elementary 408South Fairfax Ave.	SQG	Adjacent to the south downgradient.	No reported violations in connection with this listing.			

None of the RCRA generator listings identified in the databases is suspected to have an adverse environmental impact on the Subject Property based on the absence of reported RCRA violations and no reported release incidents.

EMERGENCY RESPONSE NOTIFICATION SYSTEM (ERNS)

The ERNS is a national database used to collect information on reported releases of petroleum products or hazardous substances. The database contains information from spill reports made to federal authorities including the EPA, the U.S. Coast Guard, the National Response Center and the U.S. Department of Transportation. A review of this database was made in order to determine if any spills or incidents involving releases of petroleum products or hazardous substances have occurred at the Subject Property. According to this updated ERNS database, the Subject Property is not on file as being a release site.

5.3 STATE OFFICE RECORDS

LEAKING UNDERGROUND STORAGE TANKS (LUSTS)

According to the state LUST site list, nine LUST sites are located within a one-half mile radius of the Subject Property. Of the listed sites, 6 are located more than ¼-mile from the Subject Property, and based on the urban setting these are not suspected to represent an environmental concern to the Subject Property. Two of the remaining sites within ¼-mile of the Subject Property are listed as case closed, and on this basis are not suspected to represent an environmental concern to the Subject Property. The following table lists the one active LUST sites within ¼ mile:

LEAKI	NG UNDERGROUND STO	RAGE TANK FAC	ILITIES	
NAME / ADDRESS	DISTANCE / DIRECTION / GRADIENT	REPORT DATE / SUBSTANCE / MEDIA AFFECTED	STATUS	
Mas Auto Service	Adjacent to the	1991 / Gasoline /	Doma distina Dia	
371 Fairfax	west/crossgradient.	Other	Remediation Plan	

The Mas Auto Service LUST facility is also listed as an underground storage tank facility. The LUST listings identified in the database is not suspected to have an adverse environmental impact on the Subject

EBI Consulting

Property based on the crossgradient relationship to the Subject Property, the regulatory status, and the presence of an apparent responsible party.

STATE REGISTERED UNDERGROUND STORAGE TANKS (USTS)

According to the state UST database, no UST's are located on the Subject Property. However, one other UST facility is located adjacent to the Subject Property. The following table presents the listed facility:

UN	DERGROUND STORAGE	E TANK FACILITIES
NAME / ADDRESS	DISTANCE / DIRECTION / GRADIENT	NUMBER / TYPE / CONTENTS OF TANK
Los Angeles Unified School District 408 Fairfax	Adjacent / South / Downgradient	No details were available.

None of the UST listings identified in the databases is suspected to have an adverse environmental impact on the Subject Property based on the absence of reported releases and the apparent presence of an off-site responsible party in the event a release is discovered.

STATE SITES

According to the State database listing, the adjacent Elementary School is listed as having methane monitoring for methane issues at the property.

SOLID WASTE LANDFILLS

According to the State Active List of Solid Waste Landfill facilities, <u>no</u> reported landfills are located within one-half mile of the Subject Property.

5.4 LOCAL OFFICE RECORDS

Local offices consulted during the preparation of this *Report* included the Los Angeles Building, Planning, Engineering, County Public Works Department, County Health Department, Fire Department, and Regional Water Quality Control Board (LA-RWQCB). No documented adverse environmental conditions or complaints were reported at the Subject Property and readily on file at the Building, Planning, Engineering, County Public Works, or RWQCB offices.

- EBI contacted Mr. David Myers of the Los Angeles City Fire Department Environmental Unit, which has local agency oversight of the methane monitoring and compliance performed at the Subject Property. Mr. Myers stated that the Subject Property appears to be compliant with the current semi-weekly monitoring and reporting requirements and that the current concentrations of methane gas reported in the semi-weekly methane monitoring reports are not a concern to the Fire Department at this time.
- EBI submitted a FOIA requests to the Los Angeles County Health Department for information regarding storage tanks, chemical spills, and other potential environmental concerns in connection with the Subject Property. As of the date of this Report EBI has not received a response to this inquiry. Upon receipt of the agency response, if the provided information has a material affect on the findings of this Report, EBI will forward the new information, together with revised findings, as an addendum to this Report. If no response is received or no material violations are noted, our Report will not be modified.

EBI Consulting

5.5 OTHER RECORDS

The previous CA environmental report (Section 4.1) noted that one above ground storage tank was formerly used to store groundwater, but had been removed prior to the CA site visit. Based on the lack of noted violations, hazardous materials, and the AST reportedly holding groundwater, this former AST is not suspected to pose an adverse environmental impact to the Subject Property.

6.0 FINDINGS AND OPINIONS

EBI has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E 1527 of the Subject Property. Any exceptions to, or deletions from, this practice are described in *Section 1.0* of this *Report*. This assessment has revealed no evidence of recognized environmental conditions in connection with the Subject Property except for the following:

The Subject Property is located in the Salt Lake Oil Field. The Subject Property and surrounding area were used for oil production from the 1900's to the 1930's. In the 1930's the local oil derricks and wells were abandoned to make way for urban construction. Two oil wells were reportedly abandoned on the Subject Property in the 1930s. Elevated methane gas concentrations were identified on the Subject Property and adjacent properties in the mid-1980s, which resulted in methane monitoring and mitigation requirements. A methane gas pressure and gas concentration monitoring system was implemented on the Subject Property. Monitoring data for the Subject Property from June of 2004 indicate no detectable gas pressure and methane concentrations are less than the regulatory action level, the lower explosive limit (LEL). A previous ESA report for the Subject Property suggests a potential source for the detectable concentrations of methane to be methane migration through the previously abandoned oil well reportedly located in the northeastern portion of the Subject Property. Based on the information and documentation available to EBI for preparation of this *Report*, the methane gas monitoring program appears to be proceeding in accordance with regulatory requirements. Therefore, no further action is recommended at this time with regards to methane gas concentrations, methane gas pressure, or the previously abandoned oil wells.

A previous limited subsurface soil investigation report indicated elevated concentrations of total petroleum hydrocarbons (TPH) in soil. No further action was recommended at that time. However, the report concluded that hazardous concentrations of contaminants of concern may be present in the near surface (less that 25 feet bgs) and that crude oil impacted soil may be encountered during future grading activities at the site, if such activities are conducted. Refer to Section 7.0 of this *Report* for recommendations.

Although EBI recommends no further actions at this time, EBI is of the opinion that the potential
exists for significant Subject Property ownership liability for costs associated with any future
requirement for further actions related to the following environmental concerns: re-abandonment of
the two former oil wells reportedly abandoned on the Subject Property in the 1930s; subsurface
assessment and remediation of potentially contaminated surface and subsurface soils; and further
actions required to address any future elevated methane gas pressure and/or methane gas
concentrations.

The following non-ASTM conditions were also evaluated:

ACM identified in previous asbestos survey reports reportedly include structural steel fireproofing, pipe insulation, asbestos-cement pipes, flooring materials, and roofing materials. Asbestos abatement reportedly occurred at the Whole Foods tenant space during September 2001 and included the removal of ACM in the form of floor tile, flex joint, and pipe insulation. It was unclear whether the floor tile mastic was removed.

 EBI observed friable suspect ACM in the form of trowelled-on stucco and plaster in the basement of Savon, drywall throughout the Subject Property, textured ceiling surfacing, ceiling tile, and spray on fireproofing. In addition, non-friable suspect ACM was observed in the form of terrazzo, vinyl floor tile, roofing materials, and construction mastics at the Subject Property. Where observed, the suspect ACM is intact and in good condition except damaged drywall in the Kmart and damaged stucco/plaster in the Savon.

• As directed by the scope of work for this ESA, EBI collected 20 representative samples of suspect ACM in the form of troweled-on stucco/plaster and drywall. Due to the inaccessible ceiling height, poor condition, and high friability and potential for ACM fiber release and human exposure potential; EBI did not collect samples of the fireproofing in the Kmart. The suspect ACM samples collected by EBI were submitted to Environmental Hazards Laboratory in Richmond, VA to be tested for the presence of asbestos by polarized light microscopy (PLM). The results of the laboratory analysis for asbestos of suspect ACM collected by EBI is pending at this time.

A previous ESA report noted that suspect PCB containing light ballast may be present at the Subject Property.

7.0 RECOMMENDATIONS

The following additional actions are recommended:

- Based upon the presence of asbestos containing materials (ACM), EBI recommends development and implementation of an asbestos Operations and Maintenance (O&M) Plan for the Subject Property. This O&M Plan provides the procedures and guidelines that, when used during facility cleaning, maintenance, and general operations, will minimize human exposure to asbestos fibers and minimize release of asbestos fibers to the environment. This O&M Plan is a long-term management approach. Estimated cost: \$500
- EBI recommends that soil sampling and laboratory analysis be conducted for contaminants of concern should surface or subsurface soils be exposed during any future soil excavation activities.
- EBI recommends improved housekeeping of photochemical and waste chemical storage and placement of secondary containment beneath all photochemicals and photochemical waste in order to mitigate a release of chemicals to the flooring.
- Unlabeled fluorescent lights should be assumed to contain PCB's. Unlabeled ballasts and used lamp tubes should be handled and disposed of in accordance with local, state, and federal regulations.

8.0 REFERENCES

8.1 REFERENCES CONTACTED

A number of sources were contacted during the preparation of this *Report*. The following individuals were interviewed, and state, county or local municipal departments consulted. Documentation applicable to the Subject Property in those departments was requested and reviewed when and where reasonably ascertainable, as detailed in ASTM E-1527-00. Individuals listed without phone numbers were contacted in person or by e-mail.

RESOURCE	ADDRESS	CONTACT	INFORMATION PROVIDED	PHONE OR WEB	DATE
Los Angeles, California Building Inspection Office	Building Records Section 201 N. Figueroa Street 1st Floor, Room 110 Los Angeles, CA 90012		Code compliance & violations, Certificates of Occupancy	www.lacity.o	08/05/06
The Arba Group, Owner Representative	6380 Wilshire Blvd. Los Angeles, California	Mr. Michael S. Turner, Director of Development	Subject Property information, previous reports, questionnaire, etc.	323-651-1808	07/27/04
Los Angeles County Environmental Health Hazardous Materials	5555 Firguson Commerce, California 90022	FOIA Request	Hazardous Materials	323-728-0217	08/03/04
Los Angeles County Public Library			Sanborn Map Sets	www.lapl.org	08/03/04
Los Angeles County California Tax Assessors Office	500 West Temple Street Room 225 Los Angeles, California 90012		Subject Property historical information.	www.lacount yassessor.co m 888-807-2111	08/03/04
Los Angeles County Public Works	900 S Fremont Street Alhambra, California	Ms. Kim Taylor	Present and Historical UST information	626-458-5100	08/03/04
Los Angeles Regional Water Quality Control Board	320 W. 4 Street #200 Los Angeles, California 90013	Mr. Cesai Campos	SLIC and UST units for information on contamination and drycleaner closure.	(213) 576- 6600	08/04/04
Los Angeles Department of Water and Power (DWP)	111 N. Hope Street Los Angeles, California 90012		Water Quality and source information, transformer information.	213-367-0329	08/10/04

EBI Consulting 31

PHASE I ENVIRONMENTAL SITE ASSESSMENT REPORT REFERENCES						
RESOURCE	Address	CONTACT	INFORMATION PROVIDED	PHONE OR WEB	DATE	
Los Angeles City Fire Department Environmental Unit	200 North Main Street #1700 Los Angeles, California 90012	Inspector Houston	Methane compliance and monitoring.	213-978-3710	08/10/04	
Lofy Engineering	PO Box 5335 Pasadena, California 91117	Mr. Ronald Lofy	Methane compliance and monitoring.	626-351-2266	08/10/04	
Division of Oil and Gas	5816 Corporate Ave #200 Cypress, California 90630	Mr. Mark Gemache	Former oil well locations	714-816-6847	08/12/04	

EBI Consulting

APPENDIX A PHOTOGRAPHS




Subject Property
 Building viewed from
 Ogden Street.



Subject Property Quad area.



3. Subject Property Interior of K Mart.

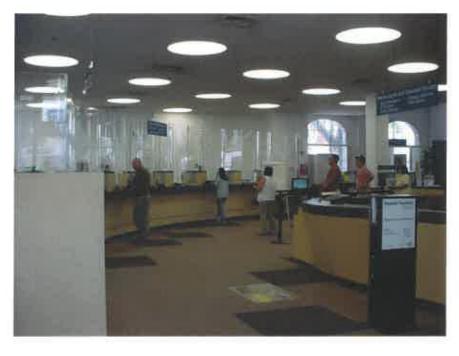

4. Subject Property City Bank Interior.



5. Kmart Baler.



Kmart used battery storage.



7. Kmart compactor.



8. Kmart photo processing.



9. Kmart photo processing.



10. Kmart fireproofing.



11. Shared oil grease waste container.




12. SavOn Baler.



13. Savon Photo processing waste.



14. Savon Photo processing.

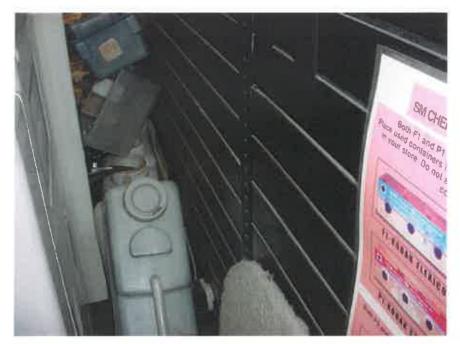

15. Savon photo processing chemical storage.



16. Methane detector inside the Whole Foods Store.



17. Methane detection system inside the Whole Foods Store.



18. Northern view from the Subject Property.



19. Northeastern view from the Subject Property.



20. Eastern view from the Subject Property.



21. Rear of the Subject Property.



22. Southwestern view from the Subject Property.



23. Western view from the Subject Property.

APPENDIX B FIGURES, DRAWINGS AND MAPS

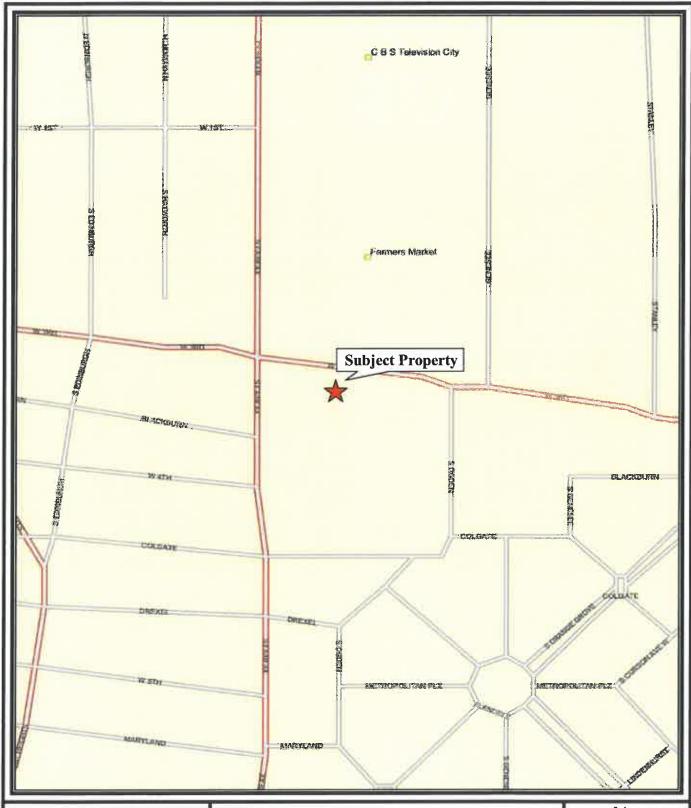




Figure 1: Location Map

Town & Country Retail 6310-6360 West Third Street Los Angeles, California



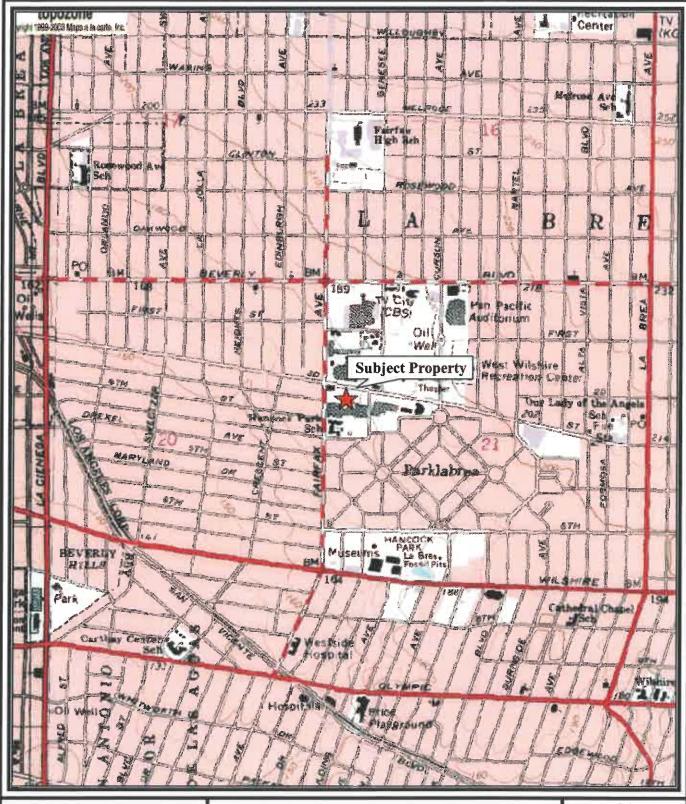




Figure 2: Locus Map

A portion of year, city, state USGS 7.5x15 Minute Quadrangle

TOWN & COUNTRY RETAIL 6310-6360 WEST THIRD STREET LOS ANGELES, CALIFORNIA



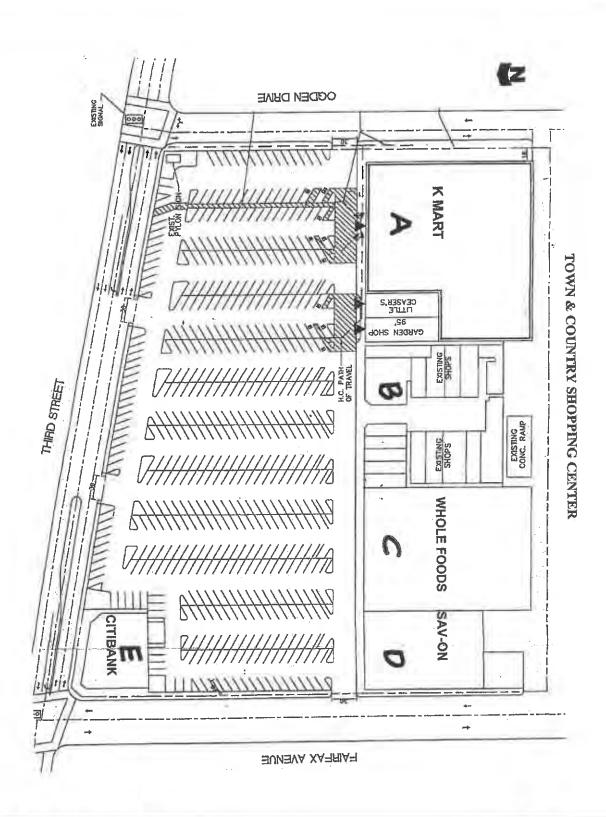




Figure 3: Site Plan

TOWN & COUNTRY RETAIL 6310-6360 WEST THIRD STREET LOS ANGELES, CALIFORNIA



APPENDIX C OTHER RELEVANT DOCUMENTS

Flood Insights test results for:

Latitude: 34.070923 Longitude: -118.360218 Geocoding Accuracy: Not Available

Flood Zone Determinations

Test Description

SFHA (Flood Zone) Within 250 feet of multiple flood zones?

Out

No

Community Community Name

Zone Panel Panel Date

LOS ANGELES, CITY OF

0063D July 06, 1998

FIPS Code

Census Tract

X

06037

060137

2145.00

Copyright 2000, First American Flood Data Services. All rights reserved.



This report was generated by: ebi on 07-20-2004

This Report is for the sole benefit of the Customer that ordered and paid for the Report and is based on the property information provided by that Customer. That Customer's use of this Report is subject to the terms agreed to by that Customer when accessing this product. No third party is authorized to use or rely on this Report for any purpose. NEITHER FIRST AMERICAN FLOOD DATA SERVICES NOR THE SELLER OF THIS REPORT MAKES ANY REPRESENTATIONS OR WARRANTIES TO ANY PARTY CONCERNING THE CONTENT, ACCURACY OR COMPLETENESS OF THIS REPORT, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Neither TFHC nor the seller of this Report shall have any liability to any third party for any use or misuse of this Report.

TOWN & COUNTRY SHOPPING CENTER

TENANT	UNIT	SQUARE FEET
Osco Drug, Inc. (Sav-On)	6360	23,040
Whole Foods	6350	29,928
Whole Foods	Patio	
Anna's Linens	6340	7,033
K-Mart Corporation	6310-6320	138,147
Citibank	300 Fairfax	11,249
Payless Shoesource	6324	3,804
Thai Patio	6332	2,207
Andre's of Town & Country	6332-17,18,19A	4,315
Fortune Plate	6332-19	1,770
Fresh Start	370 S. Fairfax	1,908
Saka's Outlet	6328	934
Fashion Studio	6322-6330	2,170
Tong Shin-Newsstand	6334	612
Vista Optical	6336	600
Wigs Today	6338	675
A-1 Keys	-	-
United Mobile Phone	6330 1/2	72



LOS ANGELES CITY FIRE DEPARTMENT

1: 140 H 4A (9 87

FIRE PROTECTION EQUIPMENT PERFORMANCE CERTIFICATE

THIS PAGE BY ITSELF IS NOT A COMPLETE DOCUMENT

Pege 2 of 3

\$47E(S) OF TESTING 11/15/01	6301-6360 W. 3rd St.	Los Angeles	(state) Ca.	(m) 90046	FIRM # 0.9.A.
Automatic Fi	re Sprinkler System				Access
NOTEMORTHY CHARACTE	DISTICE EVETCH GEORGE				

system description, procedures performed, and defects found in equipment tested (if mone, so note).

Local Alarm (ITV) Bell Test - FAIL - (see defects) Backflush of the fire dept. connection performed.

Spare sprinkler heads and wrench present - SEE DEFECTS

DEFECTS:

1) Sav-on Drug Store - 6360

a) Spare sprinkler head box is missing the following components: one 165F pendant head, two 165F uprights, two 280F uprights, and two 360F pendants.

b) OS&Y control valve is missing break lock and chain and a sign indicating are controlled (6360 entire only.)

- c) Doors leading to the control valve (located in the basement) are missing directional signs indicating the location to the
- d) Main floor area is missing 3 escurcheon skirts on sprinkler heads.
- e) Fire dept connection is missing sign "Peeds 6302-6360 3rd St."

2) Vacant Store (under remodeling) - 6350

- a) The underground sectional control valve (located outside the southeast entrance) is unidentified. Recommend sign to be placed on the building showing location (sectional control valve with arrow pointing downward.
- b) Electronic water flow device and tamper switch currently not tied to a central station monitoring panel (wires cut and previous panel removed.)
- c) Main control valve is missing a sign identifying area controlled (6350 only.)

d) Control valve is missing a break lock and chain.

e) Due to tenant space of approx. 30,000 square feet in size (which is currently under remodel) numerous drops (200) with ceiling removed are below and will obstruct upright sprinkler heads from operating properly. NOTE: Riser control valve was found two thirds closed during testing. Valve must remain open at all times.

3) 16 Tenant Spaces - 6340-6332

- a) Missing sprinkler riser inside signs showing direction to the riser (loading dock access areas above door.)
- b) Main riser control valve is currently unsupervised. Requires electronic tamper device and break lock and chain.

c) Missing a main control valve sign with area of control information (6340-6332 (16).)

d) Spare sprinkler heads are missing near the riser: three 165F F/L type uprights, three 165F F/L pendants, and three 165F

e) System side 300 PSI gauge is defective and gives incorrect readings.

4) Tenam Spaces - 6332-6310

a) Riser control valve is missing sees of control information sign (6332-6310.)

- b) Spare sprinkler head box is missing the following items: three 165F bulb white frame pendants, three 165F bulb chrome uprights, and three 165F F/L uprights.
- c) City feed side gauge is defective and requires replacement (gives improper reading.)

d) Inside 6310 address five escurcheon skirts are missing.

5) K-Mart - 6302

- a) Riser control valve are missing signs indicating area of control (basement level and ground level) to be mounted on wall below each control valve.
- b) Riser room is extremely packed with storage which prohibits access to control valves (minimum of three feet wide path

TESTERS HAME & CERTIFICATE P	EXPLATION DATE	TENTER'S SIGNATURE	TESTING AGENCY
Robert J. Brown R4007	5/2003	Tyno Staren	
Address of Testing Agency.			No.
2215	7 Clarendon S	t Woodland Hills, Ca.	91367

Third Fairfax LLC Capital Expenditures December 1998 - June 2004

Date	Vendor	Explanation	Amount
12/22/1998	12/22/1998 Comm. Paving and Coating	Paving	\$8,201.00
66//80/20	SPS Inc.	Paving	\$14,700.00
12/31/1999	12/31/1999 Somerset Builders	Contrete sidewalk	\$8,400.00
07/07/2000 Schaefer	Schaefer	Paving	\$2,340.00
12/31/2001 SPS	SPS	Earhtquake Retrofit	\$168,502.00
04/24/2002	04/24/2002 Metal Fencing	Fencing	\$13,635.00
06/17/2002 IMAC	IMAC	New Drive Approach	\$5,300.00
08/08/2004	08/08/2004 Apex Painting	Paint Center	\$55,130.00
12/09/2004	12/09/2004 Sign Exchange	Signs for Center	\$6,410.00

\$282,618.00



PHOENIX, ARIZONA OFFICE 500 E. THOMAS, SUITE 307, PHOENIX, AZ 85012 TEL. 602-279-7480 FAX 208-955-2873 wysasi@ebiconsulting.com

FACSIMILE TRANSMITTAL SHEET

To: Mr. Scott Krieger		ants – Phoenix, AZ Office July 28, 2004 I, Administrative Assistant			
Fax number or email address: scott@thearbagroup.com	Total number o	Total number of pages including cover:			
Please Complete		Urgent Please Reply			
Re: Property Condition Report & Env	vironmental Site Asses	sment Questionnaire for prope	erty known as or located at:		
Town & Country Retail; 6310-631	0 West Third Street,	Los Angeles, CA			
We have been requested by:	EBI Project #:	Subject:			
Aetna	24-1775	To complete an Engineering and Environmental survey of the above mentioned property.			

1. Please assemble this original questionnaire and one copy of property plans and documents, and forward all information to the site or the site contact for the Engineer to use during the site visit. This documentation will be included in our reports.

2. Provide a second copy of property plans and documents to: EBI Consultants, 4A Street, Burlington, MA 01803, attention Production Department, and include the

EBI project number shown above.

3. Please fill out this questionnaire to the best of your knowledge and FAX-BACK TO (208) 955-2873 or EMAIL TO wvsasi@ebiconsulting.com within three business days. Please remember to keep a copy of this questionnaire for the EBI Assessor who will be on site to perform the engineering assessment.

4. The Engineer and/or Scientist will contact you directly to schedule the site visit.

5. This information is extremely time sensitive and necessary to provide your lender with accurate and timely reports.



RE: 24-1775 PROPERTY CONDITION REPORT PRE-SURVEY QUESTIONNAIRE

Please fill out and sign this questionnaire to the best of your knowledge for the Engineer or Scientist's site visit.

• Fax a copy to EBI at (208) 955-2873, or email to wysasi@ebiconsulting.com for our report files, and keep the original to provide to the Engineer. • Additional plans and documents (see page 2) must be forwarded to the site for the Engineer or Scientist during the survey.

For questions not applicable to the subject property, please respond "N/A." Attach additional pages if necessary. This document and your responses to it will be included as an exhibit in the reports. Accurate and full completion of this Questionnaire is critical to a timely completion of our reports, and timely closing of your loan.

Town & Country Shopping Center Subject Property Name: Address: 6300-6370 W. 3rd Street; 300 S. Fairfax Avenue; and 300 S. Ogden Drive Subject Property Owner: Third Fairfax, LLC Purchase Date: (323) 651-1808 See Below On-Site Property Contact: Telephone: Fax: (323) 651-2222 Michael@TheArbaGroup.com Email: Michael S. Turner, Director of Development Your Name and title Signature

LOCAL JURISDICTIONAL INFORMATION

- 1. What is the property ID #, Lot and Block, or Township/Range ID #? See attached legal description
- 2. What is the legal Municipality or County that has jurisdiction over the property? City of Los Angeles

PROPERTY INFORMATION

- 3. What is the size of the subject property lot or lots, in acres? \pm 7.5 acres
- 4. How many parking spaces are present at the property? ± 487
- 5. How many buildings comprise the subject property? Three ?
- 6. What is the gross and net rentable square footage of the building(s)? 228,390
- 7. What is the date of construction of the building(s)? When was the building(s) first occupied? ± 1961
- 8. How many tenants are present? See attached Tenant List
 - a. If the property is apartments, please provide a unit and type count by bedroom and square feet. N/A
- Please list, to the best of your knowledge, any deficiencies or problems with the site, parking area, amenities
 or utilities. None Known
- 10. Please list, to the best of your knowledge, any structural, water infiltration, mold, roof, plumbing, HVAC, Fire Alarm or electrical deficiencies or problems. None Known

Does the property have	Yor N	Does the processy linve	Y or N
Polybutylene piping	3	Compressed wood or composite board siding	?
Galvanized steel water lines	?	EIFS exterior finishes	NO
ABS sanitary lines	?	Fire Retardant Treated plywood	?
Aluminum branch wiring	?	Cadet/Encore electric heaters installed 1982-99	2
Omega (Central or CSC) brand sprinkler heads	3	GE or Hotpoint dishwashers installed 1983-89	3

EBI Consultants

- 11. During the last five years, have any major capital improvements been made to the site or building(s)? If so, please explain, with the approximate cost. See attached
- 12. Please list any deficiencies noted during any Building, Fire or Health Department inspections in the last three years. See attached LA City Fire Sept. Inspection & Follow-up Inspection Clearance.
- 13. When were the fire alarm systems and/or sprinkler system (if any) last tested? Alarm 6/03: Sprinkler 1/03
- 14. Please list the following utility providers:

 Water: LA DWP

 Sanitary Sewer: City of Los Angeles

Trash Hauler: Consolidated

Storm Drainage: City of Los Angeles

Natural Gas or Oil: The Gas Co.

Electricity: LA DWP

and, Frequency of Pick-ups: 3 times - weekly

- 15. If you are performing or planning any repairs or replacement work to the property that will exceed an aggregate cost of \$2,000 please explain, with the approximate cost. N/A
- 16. Please list the responsible party for tenant improvements and maintenance of major systems (if applicable).

 Varies by Tenant. All tenants are responsible for their own HVAC. K-MART & Whole Foods are responsible for their own roofs. See leases for details.
- 17. Please attach a brief history of the property. This information helps us properly assess, evaluate and understand your property, and will assist in the financial analysis. The information should include:
 - The date of approvals and construction, the contractor who built the property
- History of fires or violations A list of any ongoing maintenance issues
- History of major capital improvements, repairs, additions or modifications
- Tenant history, approximate turnover rate

DOCUMENT AND INFORMATION CHECKLIST

Please provide the following information so the Engineer or Scientist can proceed with the survey of the property. Asterisk (*) items are critical to report completion. The documents will become exhibits in the Consultant's report.

A. Phins	B. Vinnicipal Documents	C. Additional Information
ALTA Survey or Site Plan*	Certificate of Occupancy*	Capital expense report for 1 to 3 years*
Architectural Building Plans*	Building Permit*	Tenant Rent Roll*
Extremely critical for properties in	Copy of tax cards	
Seismically active zones 3 and 4* STRUCTURAL PLANS – Seismic Assessments	Copy of violations	Schedule of Floor Area Measurements - Gross and Rentable Square Feet
are required for these properties. Structural	Ball NNC Projects	History of recent improvements
drawings must be provided at the time of the site visit. If no drawings are provided, the report will be delayed and the Seismic Assessment may be overly conservative.	*Department of Building Violations *Environmental Control Board Violations *Local Law 11 Facade Reports	Previous Due Diligence or Building Component (i.e., roof) Reports
Reduced scale Site and Building Plans		Copy of most Recent Appraisal

EBI ACCESS REQUIREMENTS

At the time of the site visit the Consultant is required to gain access to all areas of the property. This includes:

- All building roofs, unless pitched asphalt shingles. This may require you to obtain and provide a ladder.

 All building interiors, including common areas, lobbies, garages, community rooms, exercise rooms, pool areas,
- All building perimeters
- All site amenities

- All building interiors, including common areas, lobbies, garages, community rooms, exercise rooms, pool areas, storage rooms, attics and basements, if applicable, and a representative sampling of offices, retail spaces, manufacturing or assembly areas, or apartments.
- All mechanical, electric, sprinkler, HVAC, utility, service, elevator, storage and equipment rooms

ENVIRONMENTAL SITE ASSESSMENT PRE- SURVEY QUESTIONNAIRE

1.	Describe the current uses of the property noting tenant names and oil/chemical usage_ Retail Shopping Center - See Tenant List								
2.	Describe the past uses of the property noting tenant names and oil/chemical usage. Unknown								
3.	(N) Has a previous environmental site assessment report been prepared for the property? If yes, for what reason? Can EBI have a copy? Previously submitted								
4.	(N) Has a subsurface investigation ever been conducted on the property, including soil sampling, groundwater sampling, or installation of groundwater monitoring wells? If yes, for what reason? What were the results? Can EBI have a copy of the report? Are there any groundwater monitoring wells currently located on the property? Previously Submitted								
5.	(N) Has there ever been previous sampling for Asbestos, Lead-Based Paint, Lead in Water, or Radon? If yes, please describe. Previously Submitted								
6.	(Y) (N) Any known environmental liens, deed restrictions, or use limitations for the Property? If yes, please describe. None Known								
7.	(Y) (N) Any permitted or regulated activities (Hazardous waste generator, air) on the Property? If yes, please describe. Unknown								
8.	(Y) (N) Are there any transformers or other electrical equipment, which may contain PCBs? If yes, please describe. Where are they? Who owns the transformer(s)? Who services them? Unknown								
9.	(Y) (N) Has an industrial or manufacturing operation, gas station, motor repair facility, commercial printing facility, dry cleaners, photo-developing laboratory, junk yard, landfill or waste, treatment, storage, disposal processing or recycling facility ever been located at or adjacent to the property? If yes, please describe. Two current tenants have photo processing; unknown if other listed uses were present								
10.	(Y) (N) Are there any discarded drums, barrels or containers, construction debris, damaged or discarded automobile or industrial batteries, or pesticides, paints or other chemicals in individual containers or drums of greater than five gallons or fifty gallons in aggregate located on the property? If yes, please describe.								
11.	(Y) (N) Have there ever been any waste storage or treatment lagoons, pits, ponds, or surface impoundments on the property? If yes, please describe. None Known								
12.	(Y) (N) Does the property have floor drains not discharging to a sewer? Septic System? If yes, please describe, Unknown								
13.	(Y) (N) Are there currently aboveground or underground storage tanks at the property? If yes, complete table.								
	Type of Tank. Size Content Installation Date. Spill/Leak Detection?								
	Above or Underground gal								
	Above or Underground gal								
	Above or Underground gal								
	Above or Underground gal								
14.	Additional comments.								

EBI Consultants 3



LOS ANGELES CITY FIRE DEPARTMENT

FIRE PROTECTION EQUIPMENT PERFORMANCE CERTIFICATE

THIS PAGE BY ITSELF IS NOT A COMPLETE DOCUMENT

Page 3 of 3

ATE(S) OF TESTING 11/15/01	6301-6360 W. 3rd St.	Los Angeles	(BSAR) Ča.	(zin) 90046	Arba Group	
EQUIPMENT TESTED AN	D DESCRIPTION:					
Automatic Fi	ire Sprinkler System					

NOTEWORTHY CHARACTERISTICS, SYSTEM DESCRIPTION, PROCEDURES PERFORMED, AND DEFECTS FOUND IN EQUIPMENT TESTED (IF HONE, SO NOTE)

c) Spare sprinkler head box is missing the following items: three 165F F/L uprights, six 165F bulb type pendants, three 260 F/L uprights.

NO OTHER DEFECTS WERE FOUND.


TESTERS HAME & CERTIFICATE #	EXPINATION DATE	TESTER SACHATURE	TESTING AGENCY
Robert J. Brown R4007	5/2003	South of from	All Systems Fire Protection
ADDRESS OF TESTING AGENCY.	7	7	
2215	7 Clarendon	t. Woodland Hills, Ca.	91367

LOS ANGELES CITY FOR REPAITMENT

(LESSCHOLENT)

SPONSIBLE PARTY						*HC4 &
ropeck, Mary		Prope	rty Supervisor	PRINCIPLE OF THE		
380 Wilshire Blvd.,	#1108 Los	Acres 1	P5/8	Third Fa	Processor	
MET ADDRESS NAMED A		THE WILL		(\$200)	HEST MYS HE	
302-6360 W. 3rd S	Street, Los A	ingeles, cA 9		ETHLETISM TYPE	323-6	51-1808
B-2		1	1970's	STALLSCALE THE		Square Pt
INL TET			***			
(A) O TOTAL	TOTAL ACTO				71	
CONTRACTOR ACCURATE STATES		हेस्त्रभ	-mg	(me)		
WHEN TOTAL HO RESCRIBE		Garnes	-		-	CONTINU
Automatic Sprinkle	er System	AE XXVVIII	4			₹6 [] <i>#</i> 5
1	140		5			95 [] 30
				4		785 🗍 🖘
 .) Riser locations i .) Spare head kits .) Food court - gu 	have proper age replaced	pperly. r heads and w d. properly.		al control va		
3.) Riser locations i 3.) Spare head kits 3.) Food court - gua 4.) Outside local be	dentified pro have proper age replaced ells operate p	pperly. r heads and w d. properly. NO OTHER I	renches.			
B.) Riser locations in Spare head kits D.) Food court - gua E.) Outside local be	dentified pro have proper age replaced alls operate p	pperly. r heads and w d. properly. NO OTHER I	renches. DEFECTS FOL		Little the State of S	CONCE AND THAT THE
Riser locations () Spare head kits) Food court - gus) Outside local be communication or affective and a communication and	dentified pro have proper age replaced alls operate p	perly. r heads and w d. croperly. NO OTHER I	Tenches. DEFECTS FOL	UND	-ma	
Riser locations i Spare head kits Spare head kits Outside local be Communication or affect Communication or affett	dentified pro have proper age replaced ils operate p	perly. r heads and w d. properly. NO OTHER I	DEFECTS FOL	UND		
Riser locations in Spare head kits Description of the Spare head kits Description of the Spare head kits Description of the Spare head head head head head head head hea	dentified pro have proper age replaced ils operate p	perly. r heads and w d. properly. NO OTHER I	DEFECTS FOL	UND		
Appare head kits Described head kits Described head kits Described head head head Described head head head Described head head Described head head Described head head Described head	dentified pro have proper age replaced ells operate p	perly. r heads and w d. croperly. NO OTHER I	DEFECTS FOL	UND SELECTION NO. 4 OF THE TOTAL AND SHALL SECTION SELECT TO DESCRIPTE TO	Plates an section a sect of a many con	a Postania, but by Helina
Niser locations in Spare head kits Spare head kits Tood court - gus Outside local be Continued to the second s	dentified pro have proper age replaced alls operate p	perly. The ads and with the ads and the ads an	Tire Protect:	JND MARINE NO. 4 OF THE TOTAL AND SHALL SECTION LOT	Plates an section a sect of a many con	
Appare head kits Descriptions in the property of the property	dentified pro have proper age replaced als operate p	perly. The ads and with the ads and the ads an	Tire Protect:	JND MARINE NO. 4 OF THE TOTAL AND SHALL SECTION LOT	Plates an section a sect of a many con	a Postana Laure by No. in L
Riser locations in Spare head kits Described by the Spare head head head head head head head hea	dentified pro have proper age replaced ells operate pro- lance property of the alon St. Workston	perly. The ads and wid.	Tire Protect:	JND Relation to a of the second of the seco	(818)	340-9600
Riser locations in Spare head kits Description of Spare head head head head head head head hea	dentified property in the property of the prop	perly. The ads and wid.	Tire Protect:	JND Relation to a of the second of the seco	(818)	340-9600 200 THE
Riser locations () Spare head kits) Food court - gus) Outside local be According to the court of the co	dentified property in the property of the prop	perly. The ads and wid.	Tire Protect:	JND COLUMN NO. 4 OF THE COLUMN THE DECEMBER TO TO THE STATE OF THE DECEMBER TO THE STATE OF	(818)	340-0600

(ASSOCIATION) (PROVE)

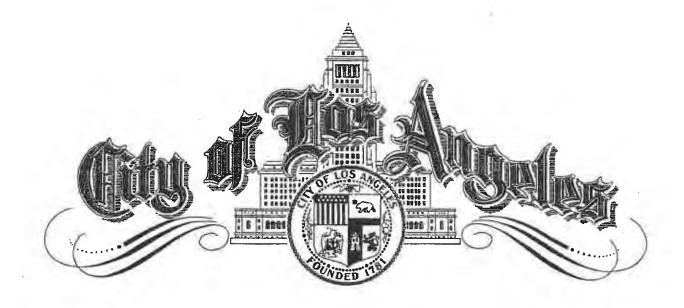

The

Department of Building and Safety

Issues this

CERTIFICATE OF COMPLIANCE WITH THE MINIMUM EARTHQUAKE STANDARDS OF DIVISION 91

Building Address:

6360 W. 3RD STREET

A.K.A. 350 - 70 S. FAIRFAX AVENUE

This certifies that the Building described below has been found on this date to be in substantial compliance with division 91 provisions of Article 1, Chapter IX of the Los Angeles Municipal code for existing building with the rating classification of GROUP - II

Description of building:

One story, Type III, 100' x 150' Concrete Tilt-up building.

PERMIT: # 00016-10000-06253

VALUATION:

\$ 26,910.00

The issuance of this certificate shall not be construed by any person to be a representation, guarantee, warranty of the premises for any purpose including but not limited to fitness, suitability, or freedom from defects, either latent or patent. Not is the issuance of this certificate to be of any immunity provided to public enmities and public employees under state law, including but not limited to those immunities provided by Division 3.6 of Title 1 of the California Government Code. Ordinance No. 145,306.

Owner:

3RD FAIRFAX LLC.


6380 WILSHIRE BOULEVARD LOS ANGELES, CA 90048

May 04. 2001

Date

John Kelly

Building Inspector

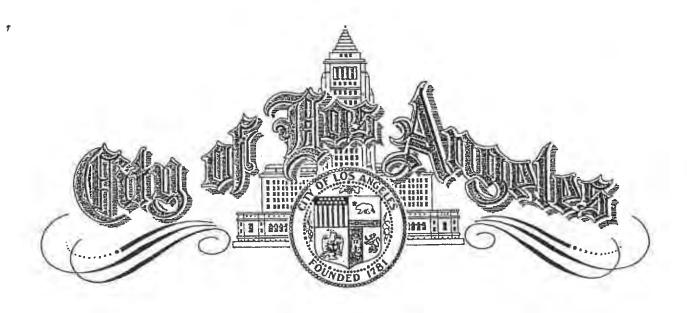

The Department of Building and Safety

Issues this
CERTIFICATE OF COMPLIANCE WITH THE MINIMUM
EARTHQUAKE STANDARDS OF DIVISION 91

Building Address: 370 S. FAIRFAX AVE

This certifies that the Building described below has been found on this date to be in substantial compliance with Division 91 provisions of Article 1, of Chapter IX of the Los Angeles Municipal code for existing buildings with the rating classification of:

GROUP-II

Description of building:

One story, Type III-N, 40' X 48' Concrete Tilt-up building. PERMIT: #97016-20000-29369 VALUATION: \$2,880.00

The issuance of this certificate shall not be construed by any person to be a representation, guarantee, warranty of the premises for any purpose including but not limited to fitness, suitability, or freedom from defects, either latent or patent. Nor is the issuance of this certificate to be of any immunity provided to public enmities and public employees under state law, including but not limited to those immunities provided by Division 3.6 of Title 1 of the California Government Code. Ordinance No. 145,306.

Owner:

THE UNIVERSITY OF SO. CALIFORNIA C/O GREGORY J. SWEDWLSON, ESQ.


555 S. FLOWER ST

LOS ANGELES, CA. 90071

JUL 0 6 1999

Date

Pat Mischlish By Bies Forter

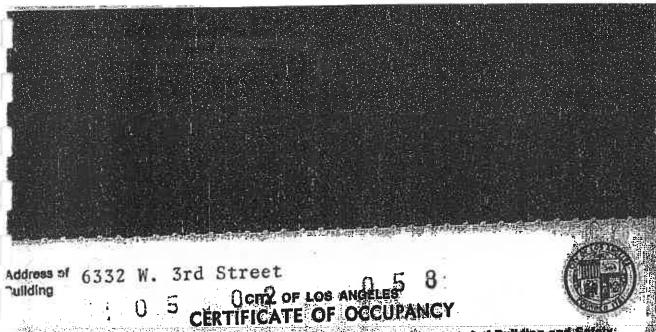



iOTE: Any change of use or occupancy must be approved by the Department of Building and Safety.

It cartifies that, so far se ascertained by or made known to the understand the hullding at the above address complies the cartifies that, so far se ascertained by or made known to the understand the hullding at the above address complies with the spoiloshie requirements of the Municipal Code, as following occupandes:

and with applicable requirements of State Fouring Law—for following occupandes:

saued

6-12-85

Permit No. and Year LA 02299/84


One story, Type V, 11'x16', retail flower shop. No parking required. G1 occupancy.

Laurie Kierstein 6332 W. 3rd Street Los Angeles, CA

11321 Pico Blvd.

Address of



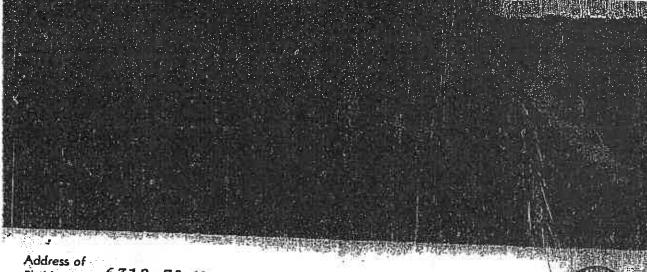

Building 6310-70 W. 3rd Street

CERTIFICATE OF OCCUPANCY

Note: Any change of use or occupancy must be approved by the Department of Suliding and Safety.

This certifies that, so far as ascertained or made known to the undersigned, the vacant land, building or portion of a building described below and located at the above address compiles with the applicable construction requirements (Chapter 9) and/or the applicable construction requirements (Chapter 1) of the Los Angeles Municipal Code for the use, or occupancy group in which it is classified.

issued 12/19/79

Permit No. and Year

LA 89175/79

1 story, type IV, 22'.6" x 52' space frame canopy, G

Owner 370 S. Fairfax Owner's Los Angeles, Ca.

Form 8-95b

Address of

Building	6306-08 W.	3rd Street	
	No of		200000

	Permit No.	Year	Zone	F.D.	No. of Stories	Class	Size	Group	Completed
1 Use	6367	46			7				
Use 2 Use 3	3349	51				t si			
	Kh 70	51							
Use Use 5	7321	51				5 Y			
Use 6									: 6
Use 7					ر (1 0	3 / 3) 2	1 1
Use 8									
Use				1					

CITY OF LOS ANGELES — DEPARTMENT OF BUILDING & SAFETY — PERMIT RECORD See Reverse Side for Certificate of Compliance Information

Form 8-99



Address of Bullding

6336-38 W. 3rd St.

CITY OF LOS ANGELES CERTIFICATE OF OCCUPANCY



Note: Any change of use or occupancy must be approved by the Department of I This certifies that, so for in excertained or male income to the anterdand, the usual had, its lights or period below and located at the above actions complies with the applicable constructing importunings (Chapter 5) and requirements (Chapter 1) of the Los Aspites Montelpal Code for the use, or extraord page is missed it is classified as a construction of the code of the use, or extraord page is missed in the classified and the code of the use of the code o

Pennit No. and Year ssued


> One story, type-V, 30 x45 portion of Store converted into a Yoghrh Store . so a in parking AFF 27 1216, 87 1195 B2 occupancy.

* ALSO SUBJECT TO ANY AFFIDAVITS ON SUILDING AND ZONING CODE MODIFICATIONS WHEAT ABOVE OR NOT.

1727 Wichols Cyn.

L.A. Ca. 90046

L & S B-85a (7. 5/86)

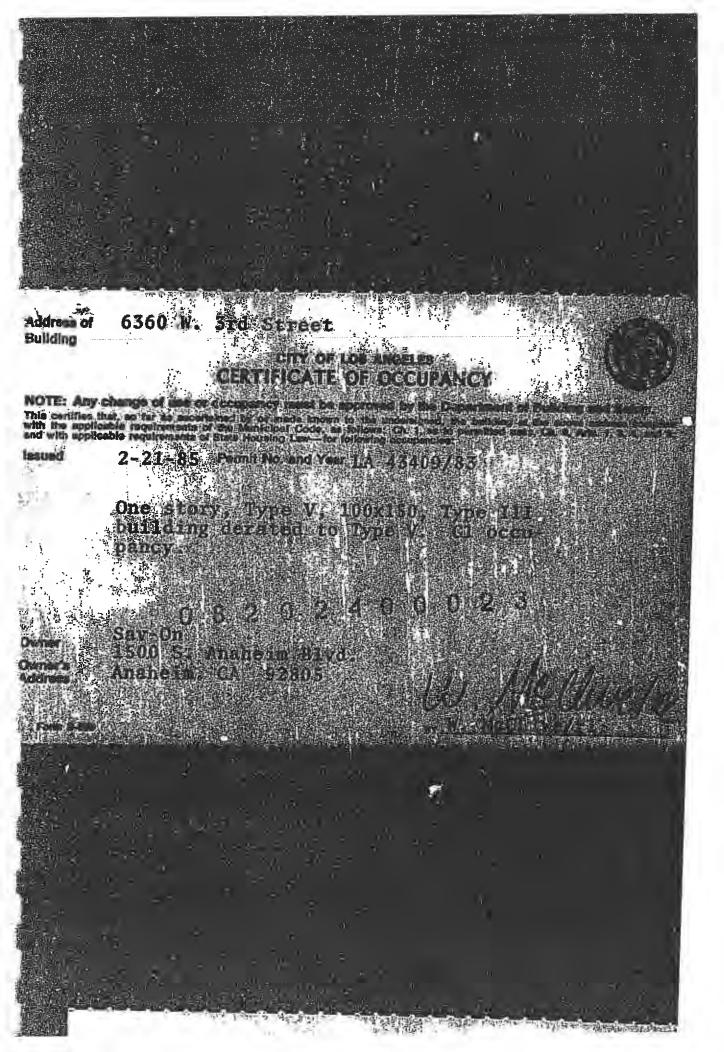



CITY OF LOS ANGELES CERTIFICATE OF OCCUPANCY

and the state of the same and the same state of the same state of



ADDRESS OF BUILDING: 6350 W. 3RD STREET

NOTE: Any change of use of occupancy must be approved by the Department of Building and Safety.

This certifies that, so far as ascertained or made known to the undersigned, the vacant land, building or portion of building described below and located at the address complies with the appricable construction requirements (Chapter 9) and/or the applicable zoning requirements (Chapter 1) of the Los Angeles Municipal Code for the use, or occupancy group in which it is classified.*

(Non-ResidentialUses)

This certifies that, so far as ascertained by or make known to the undersigned, the building or portion of building described below and located at the above address complieds with the applicable requirements of the Municipal Code, as follows: Ch. 1, as to permitted uses, Ch. 9, Arts. 1,3,4, and 5; and with applicable requirements of State Housing Law-for following occupancies: (Residential uses)

Permit NO. and Year: 92LA86774/89VN62032.

ONE STORY, TYPE III-N, 150' X 200', CHANGE OF USE FROM A MARKET TO A MARKET/RETAIL (DELI/BAKESHOP/FISH PREP).

B2 OCCUPANCY.

ind Co

· 🕻 🖠

*ZI 1117, 1195, 1370, 78-037-B.

Total Parking Required: [X] No Change in Parking Requirement.

Total Parking Provided:= Standard: + Compact: + Disabled:

* ALSO SUBJECT TO ANY AFFIDAVITS OR BUILDING AND ZONING CODE MODIFICATIONS WHETHER LISTED ABOVE OR NOT.

Issued By/Office:

Bureau:

Division:

(LA)-VN-WLA-SP-C.D. #:

(BLDG) -BCS:

(GI)-MS-MSS-EQ-BMI-COMM:

OWNER:

RALPHS GROCERY CO.

OWNER'S

1100 W. ARTESIA BLVD. COMPTON, CA. 90220

Issued:

11-22-94

BY: R. SKARIN/H.K./M.K.

01-1-95C (R.11/85)

Address of Building

6316/6318 W. 3rd St.

CITY OF LOS ANGELES CERTIFICATE OF OCCUPANCY



Note:	Any change of use of occupancy must be approved by the Department of Buildiand Safety.
req	his certifies that, so far as ascertained or made known to the undersigned, the vacant land, building ortion of building described below and located at the address complies with the applicable construction of building described below and located at the address complies with the applicable construction of building (Chapter 9) and/or the applicable zoning requirements (Chapter 1) of the Los Angeles Municipals of the use, or occupancy group in which it is classified.* (Non-Residential Uses)
of t	his certifies that, so far as ascertained by or made known to the undersigned, the building or portification of building described below and located at the above address compiles with the applicable requirement the Municipal Code, as follows: Ch. 1, as to permitted uses, Ch. 9, Arts. 1, 3, 4, and 5; and with applical quirements of State Housing Law-for following occupancies: "(Residential Uses)
Permit No	No. and Year 93LA06061
flo	evert a 29' x 99', portion of the first oor of an existing two story, Type III-N, x 200', retail building to a restaurant.
B2/2 - 9	A3 occupancy. (Maximum occupant load
*ZI BF (1195, 1370, 1216, 1440 /AFF. 90-587124/ 890516.
Total Pari	rking Required No Change in Parking requirement
Total Park	rking Provided Standard · Compact · Disabled
' ALSO S	SUBJECT TO ANY AFFIDAVITS OR BUILDING AND ZONING CODE MODIFICATIONS WHETHE
Issued E	By Office: LA-YN-WLA-SP-C.D *BLDG-BCS GMS-MSS-EQ-BMI-COMM
Owner	K-mart Corporation
Owner's	3100 W Dig Bonner Di
Address	
les d	6-28-94 P. Thayne (H. F. /ut)
Issued.	6-28-94 By. T. Thayne/H.K./vj \.\

08-B-95A (R.11/89)

Building 6360 West 3rd Street

CITY OF LOS ANGELES Certificate of Occupancy



NOTE: Any change of use or occupancy must be approved by the Department of Building and Sufery.

This certifies that Disc far as ascertained by or made known to the undersigned the building at above address complex with reportant returnments of the Bunitional Cose as follows: Ch. 1, as to permitted uses 2.9 Arts. 1.3.4 and 3 and with applicant returnments of the Bunition Cose as following occupancies.

1ssued 3-2-62

Permit No and Year

LA 88697 - 51

1 story, type IIIB, 100' x 150' arug store. 30 required parking spaces provided. G-1 occupancy. MELT COMM SS.CHERS EXCEPTION FOR THE PROPERTY OF AND AND ADDRESS.

University of Southern California University Park CAFE Los Angeles, Calif.

Form 8 955-28 Sett-8-61 Color

. C MINN'NS Supermember of Building-E. K. W. HULL

Address of Building

6360 West Site Street CITY OF LOS ANGELES Certificate of Occupancy



NOTE: Any change of use or occupancy must be approved by the Department of Building and Safety.

This certifies that, so far as ascertained by or made known to the undersigned the building at the above address complies with the applicable requirements of the Municipal Code, as follows:

Ch. 1, as to permitted uses. Ch. 9, Arts. 1, 3, 4, and 5; and with applicable requirements of State Housing Act—for following occupancies:

Issued

7-1-63

Permit No. and Year

1A 36573 - 63

l story, type III-1, 30' x 30' storage room addition to existing 100' : 150' repail spore. G-1 occupancy.

Sav-On Drug Co.


GAHER'S

335 W. Salita Lancara

hos Angeles, Cali.

E-- B. 956-2M Sets-3-62 (C-10)

J. C. MONNING Superintendent of Building-By I. W.

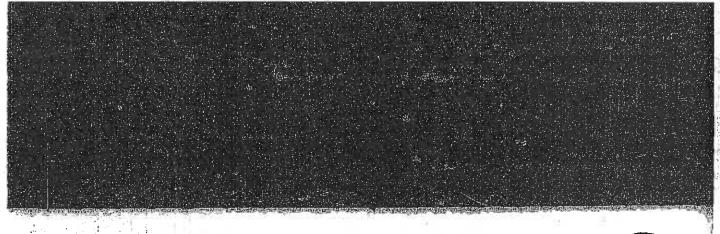

Address of 6017 West 3rd Street

CITY OF LOS ANGELES

Tertificate of Occupancy



NOTE: Any change of use or occupancy must be approved by the Department of Building and Sefety. This certifies that, so far as ascertained by or made known to the undersigned, the building at the above address complies with the applicable requirements of the Municipal Code, as follows: Ch. 1, as to permitted uses, Ch. 9 Arts. 1, 3, 4, and 5; and with applicable requirements of State Housing Act—for following occupancies:

Issued

Permit No. and Year

LA_4410/04

polish. type IV, 10 / 2 & carwas. and

Owner

Uroim Enterprises 10/33 West Pipo Owner's Address

Lis Inceles, Utli:

Form B-956-2M Sht. Sets-12-64 (C-10)

. . . ن ت

Address of Building

8015 West 3rd Street CITY OF LOS ANGELES Certificate of Occupancy



NOTE: Any change of use or occupancy must be approved by the Department of Building and Safety. This certifies that, so far as ascertained by or made known to the unpersigned the building at the above address complies with the applicable requirements of the Municipal Code, as follows: Ch 1 as to permitte: uses Ch. 9 Arts 1 3 4, and 5; and with applicable requirements of the Municipal Code, as follows: Ch 1 as to permitte: uses Ch. 9 Arts 1 3 4, and 5; and with applicable requirements of the Municipal Code, as follows: Ch 1 as to permitte: uses Ch. 9 Arts 1 3 4, and 5; and with applicable requirements.

10-23-62 Permit No. and Year

LA 2176 - 62

98' x 265' parking lot. For use of land only.

Saner

Owner's Address.

University of So. California University Park

Los Angeles, Calif.

30

Form B-95b—2M Sets—3-62 (C-10)

J. C. MONNING Superintendent of Building—By K. W. HIII. myte

८ अल्हा च्या विभिन्न १ का सम्बद्धाः । इ.स.च्या १ का सम्बद्धाः । (Chailleanneau (Chaileann Cailleann Chailleann Chailleann Chailleann Chailleann Chailleann Chailleann Chaillean

McTest Security (duple) and the security

And the state of the control of the eneture (star a rectangle) produce in lower outle under star to produce the star and star to produce the star and star

The second secon

West gra Street

CITY OF LOS ANGELES Certificate of Occummanty

re Department of Building and Safety.

NOTE. Any change of use or occupancy must be approved by

-e-4

Fer- No and Year Lies

lett an resulta one-half as a clouding avoris - 1-2 2 (s. - 1-3) inten.

SOU ONE-LEE Ella Liable in require. 15 000 1.5 .

liui. Emi Ull

** VINNING Superit Arter # 34 V:NV:NG Suner

Building 6332 W. 3rd St. CERTIFICATION DEACGOUPANGY NOTE: Any change of use or occupancy must be approved by the Usotromen of Buttles et al.

This pertities that so far as ascertained by or other than the information of the Monte of the Manicipal Code as follows:

This pertities that so far as ascertained by or other than the information of the Manicipal Code as follows:

The applicable requirements of State Housing use—for ploying occupances: leaued 11-19-84 Permit No. and Yes N 34459/76 One story, Type IV, 25x30; Store com addition in the exsting one story, type LIB, 2002600 commuse the ing over existing Type I basement; making a total of 200x650(irr building) 1.454 occupancy. T & C Properties Owner 10889 Wilshire Blvd. Owner's Los Angeles, CA 90024

		Veresialis ac				(1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1) (18 / 1)	,
iding mit No. Y i Year rtificate	00 S. Fai olanda!s			OTE: An	eliange proved by	F OCCUP of use or oc the Depart	cupanc
is certifies that, mplies with the Arts. 1, 3, 4, an	so far as ascertal applicable require d 5; and with app	ned by or ma ements of the plicable requir	de known to the Municipal Code, ements of State	undersigne as follows: Housing A	d, the build Ch 1, as to ct,—for foll	ing at above permitted a owing occupa	addre#5 \$6\$; Ch. ncles:
	PT LUAD AG ROF:			: 4-20	-53		51
ner ner's							
iress							
	–12–52 g. E. MOZ	RIS, Euperizi	andent of Buildi	ng By			

Address of 19300 Bouto Batras, Avenue

GERTIFICATE OF GCCUPANCY



NOTE. Any change of use or occupancy must be approved by the Department of Building and Sole Remit No. and Year TA 149257

L story, cybe V, 50" & 80" change of occupation restaurant G-2 occupancy to office Q-1%occupanc

Ожлек з

Aetha Savings & Boan Assoc. Owners 2137 Bellinlower Boullevard
Long Beach, Calling

(8 Form B 956-1500 S FEE Sets-3-69 (6-10)

CARAGO Webb SEA SURERA

CITY OF POSTAUGUES Cortificate of Observersamen

OTE: Any change of the or occupancy must be approved by

Tak No and Year Album Tak

2 story, type IDIA; TD 2 2019 of cultury used en pessessan ors-half as a crotture store cervice spaces produced. est one-call and Bast 14 regular. 5#2 occursion

University of Joseph Galles University days Los Mikelegottik Salling and Market Jos(50) Vielsič (Syril Street)v

CITAL OF USE AVGILLER verificate of Germany

Any change lot use or occupancy must be approved to the beautiment of Building land to the land to the

l story, type tire, 1001 & 1501 dru score. 30 neguines parking spaces province Gall occupancy. CHOEFT FOR DE LA THE REPERT DE BANGE

University of Southern University Park LOB Angelies, Calki.



GING 6360 WESS STORE OF LOSSANGERS

GIVE OF THE OF COMMENTS

GIVE OF STORE OF COMMENTS

GIVE OF COMMEN

l story, type TII-L. Bories of room addition to external 10 retail store.

Sav-On Drug Gog 3055 W. Sante & Los Amberres Ca

Bulletine : 6350 Nesty Sv. 1 Projection (Maintenance)



NOTE: Any change of use to be upality must be approved by the Department of Building and Safety.

This certifies that we far at acceptable to the first known to the unterjoyed as building at the above address complet with the monitonic and requirements of the Municipals Code act follows: And as a topographic super Code (Article 2) as a failed 5 and with approvable or durements of Safety and the Municipals Code act follows: And as topographic super Safety (Article 2) as a failed 5 and with approvable or durements of Safety (Code act follows: And as topographic super Safety (Article 2) as a failed 5 and with approvable or durements.

Assect 1 . 8.28 62 . Rednir No. 19nd Vear LA 88698 - 61

L story, Proe IIIB; L50' K 200' Shore (Graces), 60 required per Cing Spaces. G=2 acol how, SUPERSEES CERTIFICATE OF GCCURANCY ISSUED ON 3-2-62.

Unity of Southern Caldiornia

(a. L. Circles Caldi

aram 0.950=201910_2

OM SEL CO (COLO) - COLO STODE AMONNING SUPERING CORE FOR BUILDING BY OF STODE OF THE STORY

Building

6342 West Bro Street. Certificate of Occupancy



NOTE 1: Any change of use or occupancy multipersupprove, by the Department of Building and Safety
NOTE 1: Any change of use or occupancy multipersupprove, by the Department of Building and Safety
Interception that so later strong median of more than a decrease of the partment of the pa

red 11-29-63 Femily: and year FA 29660 = 168

Tame Arson 350 S. Faltriak Ave. Los Angeles, Callis.

DASC TO SECTION (CIO) TO THE INDUSTRIES OF MAINING SUperhished of Shulling By (C) (S) 173(6) PIL LUMP.

(6882 Weste Stool Springs Los Andres Control (Charling Control (Charling Control (Charling Control (Control (Con



IOTE: Any change of use of a capaney must be approved by the Department of Building and S

acceptive that a by a state of the capaney must be approved by the Department of Building and S

acceptive that a by a state of the capaney must be approved by the Department of Building and S

acceptive that a by a state of the capaney of the c

L story, type IV, 5% x 160 shelter and two 5% x 160, two 4% x 8% double-race

Tom & Country Parao Shops 633 West 3rd Street.

C. MONNING Superintendent of Bulland By K.

dras drv. 1. 680,22 vests seed Streets

THE PROPERTY OF THE PROPERTY O TOTAL CONTROL OF THE PROPERTY OF THE PROPERTY

HOTE. Any change of use 67 occupancy must be approved by the Department of Building and
This certifies that, so faces accertained by or made known to the undersigned, he building at the above address complex with the
requirements of the Building Lody as follows: Oh 1 'as to permitted uses. Ch 9 Arts 1,3.4 and 5 and with applicable of
Sistate Housibia Act of following occupancies.

sued 3/12/04 Permit Novend Year LA 51511/63, 53465/69

25 x 301 page shop converted from a portion of one-stony, Types Lifes and I, 200' x 650' commercial buildings - No cooking G-2 Occupancy

See: 6310-42 %. 3rd St

University of Southern Calif. c/o dr. A. H. Stotler 370 South: Basertay: Avenue

Address of 7 6332 West 31 6 Starters in

GERTHE GERTHE OF OCCUPANICY · Production of the service in the s



NOTE: Any change of use of occupancy must be approved by the Department of Building and This conflict soft as accurated by or made known to the understand the building at the above address complies with the producentents of the Municipal Code as follows: On 1, as to permitted uses Ch. 9, Arts 2, 9, 4, and 5, and with applicable, red of State Housing Act Conformation occupancies:

3-14-67 Permit No and Year . DA 38995767.

A 251 x 301 bakery contion of a one-story Type I and III-Bi 2001 x 6501 building changed to bakery and cafe. 6-1 and 6-2 Occupancy

File No. X65504

University of Southern Call Lounia das 370 South Telefole Ave Les Angeles Callicarnia

Asidiren edi. Budhina

Certificate of Occupanty



CTE: Any Change of use or occupancy/must be approved by the Department of Building and Safety in according to the understanding and safety requirement of state with the application and the understanding and safety requirement of the Winning Safety of the Winning and Safety requirement of the Winning Safety of the Winning Safety

ued 10=12=03 / Reffit No and Years 교육 253년1/1562 년 11년

l story, type IV, 10' : 11' spatter and four o' x o' roof signs and miscollaneous structures G-1 occupancy.

Town and Country Patio Scopes 6330 West 3rd Street Los Angeless California

B 950—214 Sept—2 63 (it = 0 + 1 + 1 + 1 + 1

DOC MONITING Superintendent of Bortoline By

NOTE: Any change of the or occupancy must be upproved by the Department of Building and 5 this certifies that so far at assertained by or man thought to the appearance the building and the appearance the building at the appearance above to follow the appearance that the appearance of the American Cook is follows: Ch. 1 at the permitted assert the Art. 1 3 and 5, and with applicable reduced the Building Action to low my occupances. Pernu Ne and Year EA SCUZE 2 story, type I & I/I 20 20 cafetera. Maximum 75 cos 3-2 occupancy. See/# No.15 Owner University of So. California University Rank Address at Low Angeles, California

APPENDIX D

EDR Radius Map Report

Town & Country Retail 6310 W. Third Street Los Angeles, CA 90036

Inquiry Number: 4930273.2s

May 08, 2017

The EDR Radius Map™ Report with GeoCheck®



TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map.	2
Detail Map	 3
Map Findings Summary	4
Map Findings.	8
Orphan Summary.	
Government Records Searched/Data Currency Tracking	GR-1
GEOCHECK ADDENDUM	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-13
Physical Setting Source Map Findings.	A-14
Physical Setting Source Records Searched.	PSGR-1

Thank you for your business. Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

6310 W. THIRD STREET LOS ANGELES, CA 90036

COORDINATES

Latitude (North): 34.0706990 - 34° 4' 14.51" Longitude (West): 118.3603240 - 118° 21' 37.16"

Universal Tranverse Mercator: Zone 11 UTM X (Meters): 374473.9 UTM Y (Meters): 3770635.2

Elevation: 180 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 5630741 HOLLYWOOD, CA

Version Date: 2012

West Map: 5630733 BEVERLY HILLS, CA

Version Date: 2012

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from: 20140515, 20140513

Source: USDA

MAPPED SITES SUMMARY

Target Property Address: 6310 W. THIRD STREET LOS ANGELES, CA 90036

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS		RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	KMART CORPORATION	6310 W 3RD ST	CA HAZNET		TP
A2	THE KMART CORP	6310 W 3RD ST	CA HAZNET		TP
3	CVS PHARMACY NO 9661	6360 W THIRD ST	RCRA-LQG, FINDS, ECHO	Higher	262, 0.050, NNW
B4	KINGS CLEANERS	349 S FAIRFOX AVE	RCRA-SQG, FINDS, ECHO, CA HAZNET	Lower	350, 0.066, West
B5	FAIR FINE DRYCLEANER	349 S FAIRFAX AVE	CA DRYCLEANERS	Lower	350, 0.066, West
B 6		349 S FAIRFAX AVE	EDR Hist Cleaner	Lower	350, 0.066, West
B7	WILLIAM L OLSON INC	301 S FAIRFAX AVE	CA SWEEPS UST, CA FID UST	Lower	354, 0.067, West
C8	HANCOCK PARK ELEMENT	408 SOUTH FAIRFAX AV	CA ENVIROSTOR, CA SCH	Lower	437, 0.083, South
C9	LA USD HANCOCK PARK	408 S FAIRFAX AVE	RCRA-SQG, FINDS, ECHO	Lower	437, 0.083, South
C10	LOS ANGELES UNIFIED	408 S FAIRFAX AVE	CA UST	Lower	437, 0.083, South
D11	MAS AUTO SERVICE	371 FAIRFAX	CA LUST, CA HIST CORTESE	Lower	443, 0.084, WSW
D12		371 S FAIRFAX AVE	EDR Hist Auto	Lower	443, 0.084, WSW
D13	MASAUKI MAS YOSHIOKA	371 S FAIRFAX AVE	CA SWEEPS UST, CA HIST UST, CA FID UST	Lower	443, 0.084, WSW
D14	MAS AUTO SERVICE	371 SOUTH FAIRFAX AV	CA LUST	Lower	470, 0.089, WSW
D15	MAS TEXACO SERVICE	371 S FAIRFAX AVE	CA HIST UST	Lower	470, 0.089, WSW
16	THE GROVE AT FARMERS	6301 003RD	CA SLIC	Higher	515, 0.098, ENE
D17		401 S FAIRFAX AVE	EDR Hist Cleaner	Lower	547, 0.104, SW
18	URICK F A	7051/2 W 3D	EDR Hist Cleaner	Lower	579, 0.110, NW
19	SNYDER A G	419 S FAIRFAX AVE	EDR Hist Auto	Lower	605, 0.115, SW
E20	FARMERS MARKET AUTOM	166 S FAIRFAX	EDR Hist Auto	Higher	623, 0.118, NNW
E21	FARMERS MARKET AUTOM	166 S FAIRFAX AVE	CA HIST UST	Higher	623, 0.118, NNW
E22	FARMERS MARKET AUTOM	166 S FAIRFAX AVE	CA SWEEPS UST, CA HIST UST, CA FID UST	Higher	623, 0.118, NNW
23	THE GROVE AT FARMERS	6301 WEST THIRD ST	CA SLIC	Higher	742, 0.141, NNE
F24	P & K ACCOCIATES	145 SOUTH FAIRFAX AV	CT MANIFEST	Higher	940, 0.178, NNW
F25	FARMERS MARKET CAR W	118 S FAIRFAX AVE	CALUST	Higher	944, 0.179, NNW
G26	FARMERS MARKET AUTO	166 FAIRFAX AVE S	CA LUST, CA HIST CORTESE	Higher	988, 0.187, NNW
G27	JERALD FRIEDMAN/J KO	145 S FAIRFAX AVE	CA SWEEPS UST, CA FID UST, CA HAZNET	Higher	1070, 0.203, NNW
28	MAC 695441	189 THE GROVE DR SPC	RCRA-SQG, ECHO	Higher	1173, 0.222, ENE
H29	MAJESTIC CAR WASH	8017 003RD ST W	CA LUST, CA HIST CORTESE	Lower	1176, 0.223, WNW
30	PARAMOUNT CLEANERS	487 S FAIRFAX AVE	CA DRYCLEANERS	Lower	1190, 0.225, SSW
H31	MAJESTIC CAR WASH	8017 W THIRD STREET	CA HIST UST	Lower	1286, 0.244, WNW
H32	MAJESTIC CAR WASH	8017 W 3RD ST	CA SWEEPS UST, CA FID UST	Lower	1286, 0.244, WNW
H33	MAJESTIC CAR WASH	8017 W 3RD ST	CA HIST UST	Lower	1286, 0.244, WNW
34	AUTO SERVICE CHUCKS	105 S FAIRFAX AVE	CA SWEEPS UST, CA FID UST	Higher	1310, 0.248, NNW
135	CBS TELEVISION CITY	7800 BEVERLY	CA LUST, CA HIST CORTESE	Higher	1548, 0.293, North
I36	CBS TELEVISION CITY	7800 BEVERLY BLVD	CA LUST, CA HIST UST, CA CHMIRS, CA EMI	Higher	1548, 0.293, North
J37	WORLD OIL CO	7900 BEVERLY BLVD	RCRA-SQG, CA LUST, CA SWEEPS UST, CA HIST UST,	CA Higher	1973, 0.374, NNW
J38	APRO STATION #02	7900 BEVERLY BLVD.	CALUST	Higher	1973, 0.374, NNW
J39	WORLD OIL #64	7900 BEVERLY	CA LUST, CA HIST CORTESE	Higher	1973, 0.374, NNW

MAPPED SITES SUMMARY

Target Property Address: 6310 W. THIRD STREET LOS ANGELES, CA 90036

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS		RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
K40	TEXACO	7718 BEVERLY BLVD	CA LUST, CA HIST UST	Higher	2033, 0.385, NNE
K41	TEXACO	7718 BEVERLY	CA LUST, CA HIST CORTESE	Higher	2033, 0.385, NNE
L42	76 PRODUCT STATION N	7751 BEVERLY BOULEVA	CA LUST, CA ENF, CA HIST CORTESE	Higher	2130, 0.403, NNE
L43	TOSCO - 76 STATION #	7751 BEVERLY BLVD	CA LUST	Higher	2130, 0.403, NNE
44	AL-SAL OIL (OLD UNOC	6050 006TH ST W	CA LUST, CA HIST CORTESE	Lower	2198, 0.416, SSW
45	AL SIMON	8023 BEVERLY BLVD	CA SLIC, CA BROWNFIELDS, CA SWEEPS UST, CA FID	Higher	2426, 0.459, NNW
46	LIZ'S ANTIQUE HARDWA	453 S LA BREA AVENUE	CA ENVIROSTOR, CA EMI	Higher	4106, 0.778, East
47	LA BREA MOTORS	339 SOUTH LA BREA AV	CA ENVIROSTOR, CA VCP, CA HIST CORTESE	Higher	5013, 0.949, East
48	LA BREA AVENUE MOTOR	359 SOUTH LA BREA AV	CA ENVIROSTOR	Higher	5028, 0.952, ESE
49	LA BREA AVENUE MOTOR	401 SOUTH LA BREA AV	CA ENVIROSTOR	Higher	5166, 0.978, ESE

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
KMART CORPORATION 6310 W 3RD ST LOS ANGELES, CA 90036	CA HAZNET GEPAID: CAL000018571	N/A
THE KMART CORP 6310 W 3RD ST LOS ANGELES, CA 90063	CA HAZNET GEPAID: CAC002367991	N/A

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list	
NPL	National Priority List Proposed National Priority List Sites
NPL LIENS	
Federal Delisted NPL site	list
Delisted NPL	National Priority List Deletions
Federal CERCLIS list	
	Federal Facility Site Information listing Superfund Enterprise Management System
Federal CERCLIS NFRAP	site list
SEMS-ARCHIVE	Superfund Enterprise Management System Archive
Federal RCRA CORRACTS	S facilities list
CORRACTS	Corrective Action Report
Federal RCRA non-CORRA	ACTS TSD facilities list
RCRA-TSDF	RCRA - Treatment, Storage and Disposal
	. 5

Federal	RCRA	generators	list
---------	------	------------	------

RCRA-CESQG...... RCRA - Conditionally Exempt Small Quantity Generator

Federal institutional controls / engineering controls registries

LUCIS....... Land Use Control Information System US ENG CONTROLS...... Engineering Controls Sites List US INST CONTROL...... Sites with Institutional Controls

Federal ERNS list

ERNS..... Emergency Response Notification System

State- and tribal - equivalent NPL

CA RESPONSE..... State Response Sites

State and tribal landfill and/or solid waste disposal site lists

CA SWF/LF..... Solid Waste Information System

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

FEMA UST...... Underground Storage Tank Listing
CA AST...... Aboveground Petroleum Storage Tank Facilities
INDIAN UST..... Underground Storage Tanks on Indian Land

State and tribal voluntary cleanup sites

INDIAN VCP..... Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

CA WMUDS/SWAT..... Waste Management Unit Database

CA SWRCY...... Recycler Database

CA HAULERS Registered Waste Tire Haulers Listing

ODI....... Open Dump Inventory IHS OPEN DUMPS...... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

CA AOCONCERN..... San Gabriel Valley Areas of Concern

US HIST CDL..... Delisted National Clandestine Laboratory Register

CA HIST Cal-Sites..... Historical Calsites Database CA CDL..... Clandestine Drug Labs

Local Land Records

CA LIENS..... Environmental Liens Listing LIENS 2..... CERCLA Lien Information CA DEED..... Deed Restriction Listing

Records of Emergency Release Reports

HMIRS_____ Hazardous Materials Information Reporting System

CA LDS..... Land Disposal Sites Listing CA MCS..... Military Cleanup Sites Listing CA SPILLS 90 data from FirstSearch

Other Ascertainable Records

RCRA NonGen / NLR....... RCRA - Non Generators / No Longer Regulated

FUDS..... Formerly Used Defense Sites DOD...... Department of Defense Sites

SCRD DRYCLEANERS...... State Coalition for Remediation of Drycleaners Listing

US FIN ASSUR..... Financial Assurance Information

EPA WATCH LIST..... EPA WATCH LIST

2020 COR ACTION...... 2020 Corrective Action Program List TSCA...... Toxic Substances Control Act

TRIS...... Toxic Chemical Release Inventory System

SSTS..... Section 7 Tracking Systems ROD...... Records Of Decision RMP..... Risk Management Plans

RAATS......RCRA Administrative Action Tracking System

PRP..... Potentially Responsible Parties PADS...... PCB Activity Database System

ICIS...... Integrated Compliance Information System

Act)/TSCA (Toxic Substances Control Act)

Material Licensing Tracking System COAL ASH DOE..... Steam-Electric Plant Operation Data

COAL ASH EPA..... Coal Combustion Residues Surface Impoundments List

PCB TRANSFORMER...... PCB Transformer Registration Database

RADINFO...... Radiation Information Database

HIST FTTS..... FIFRA/TSCA Tracking System Administrative Case Listing

DOT OPS...... Incident and Accident Data

CONSENT..... Superfund (CERCLA) Consent Decrees

INDIAN RESERV.....Indian Reservations

FUSRAP..... Formerly Utilized Sites Remedial Action Program

UMTRA..... Uranium Mill Tailings Sites

LEAD SMELTERS..... Lead Smelter Sites

US AIRS..... Aerometric Information Retrieval System Facility Subsystem

US MINES...... Mines Master Index File ABANDONED MINES..... Abandoned Mines

UXO...... Unexploded Ordnance Sites

DOCKET HWC..... Hazardous Waste Compliance Docket Listing FUELS PROGRAM..... EPA Fuels Program Registered Listing

CA BOND EXP. PLAN..... Bond Expenditure Plan

CA CUPA Listings...... CUPA Resources List

CA Financial Assurance Information Listing

CA ICE.....ICE

CA LOS ANGELES CO. HMS. HMS: Street Number List

CA HWP..... EnviroStor Permitted Facilities Listing

CA HWT...... Registered Hazardous Waste Transporter Database

CA MINES..... Mines Site Location Listing

CA MWMP..... Medical Waste Management Program Listing

CA NPDES Permits Listing

CA PEST LIC..... Pesticide Regulation Licenses Listing

CA PROC..... Certified Processors Database

CA Notify 65..... Proposition 65 Records LA Co. Site Mitigation List

CA WDS...... Waste Discharge System
CA WIP...... Well Investigation Program Case List

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP..... EDR Proprietary Manufactured Gas Plants

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

CA RGA LF..... Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 12/12/2016 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CVS PHARMACY NO 9661	6360 W THIRD ST	NNW 0 - 1/8 (0.050 mi.)	3	10

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 12/12/2016 has revealed that there are 3 RCRA-SQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MAC 695441	189 THE GROVE DR SPC	ENE 1/8 - 1/4 (0.222 mi.)	28	44
Lower Elevation	Address	Direction / Distance	Map ID	Page
KINGS CLEANERS	349 S FAIRFOX AVE	W 0 - 1/8 (0.066 mi.)	B4	12
LA USD HANCOCK PARK	408 S FAIRFAX AVE	S 0 - 1/8 (0.083 mi.)	C9	20

State- and tribal - equivalent CERCLIS

CA ENVIROSTOR: The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifies sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

A review of the CA ENVIROSTOR list, as provided by EDR, and dated 10/31/2016 has revealed that there are 5 CA ENVIROSTOR sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
LIZ'S ANTIQUE HARDWA Facility Id: 60001631 Status: No Further Action	453 S LA BREA AVENUE	E 1/2 - 1 (0.778 mi.)	46	98
LA BREA MOTORS Facility Id: 60001395 Status: No Further Action	339 SOUTH LA BREA AV	E 1/2 - 1 (0.949 mi.)	47	100
LA BREA AVENUE MOTOR Facility Id: 60001611 Status: No Further Action	359 SOUTH LA BREA AV	ESE 1/2 - 1 (0.952 mi.)	48	103
LA BREA AVENUE MOTOR Facility Id: 60001610 Status: No Further Action	401 SOUTH LA BREA AV	ESE 1/2 - 1 (0.978 mi.)	49	105
Lower Elevation	Address	Direction / Distance	Map ID	Page
HANCOCK PARK ELEMENT Facility Id: 19000014 Status: Inactive - Needs Evaluation	408 SOUTH FAIRFAX AV	S 0 - 1/8 (0.083 mi.)	C8	18

State and tribal leaking storage tank lists

CA LUST: Leaking Underground Storage Tank (LUST) Sites included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

A review of the CA LUST list, as provided by EDR, has revealed that there are 15 CA LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FARMERS MARKET CAR W Database: LUST, Date of Governme Status: Completed - Case Closed Global Id: T060377671	118 S FAIRFAX AVE nt Version: 03/13/2017	NNW 1/8 - 1/4 (0.179 mi.)	F25	38
FARMERS MARKET AUTO Database: LUST REG 4, Date of Go Database: LUST, Date of Governme Status: Completed - Case Closed Facility Id: 900360207 Status: Case Closed Global Id: T0603700901 Global ID: T0603700901		NNW 1/8 - 1/4 (0.187 mi.)	G26	39
CBS TELEVISION CITY Database: LUST, Date of Governme Status: Completed - Case Closed Global Id: T0603700889	7800 BEVERLY nt Version: 03/13/2017	N 1/4 - 1/2 (0.293 mi.)	<i>1</i> 35	51
CBS TELEVISION CITY Database: LUST REG 4, Date of Gor Facility Id: 900360089	7800 BEVERLY BLVD vernment Version: 09/07/2004	N 1/4 - 1/2 (0.293 mi.)	<i>1</i> 36	53

Otation Once Observe				
Status: Case Closed Global ID: T0603700889				
WORLD OIL CO Database: LUST REG 4, Date of Governr Database: LUST, Date of Government Versitatus: Completed - Case Closed Facility Id: 900480070 Status: Case Closed Global Id: T0603701107 Global ID: T0603701107		NNW 1/4 - 1/2 (0.374 mi.)	J37	58
APRO STATION #02 Database: LUST REG 4, Date of Governr Facility Id: 900480070A Status: Remedial action (cleanup) Underv Global ID: T0603788529		NNW 1/4 - 1/2 (0.374 mi.)	J38	67
WORLD OIL #64 Database: LUST, Date of Government Verstatus: Completed - Case Closed Global Id: T0603788529	7900 BEVERLY ersion: 03/13/2017	NNW 1/4 - 1/2 (0.374 mi.)	J39	68
TEXACO Database: LUST REG 4, Date of Governr Facility Id: I-16219 Status: Remediation Plan Global ID: T0603704395	7718 BEVERLY BLVD nent Version: 09/07/2004	NNE 1/4 - 1/2 (0.385 mi.)	K40	74
TEXACO Database: LUST, Date of Government Ve Status: Completed - Case Closed Global Id: T0603704395	7718 BEVERLY ersion: 03/13/2017	NNE 1/4 - 1/2 (0.385 mi.)	K41	76
76 PRODUCT STATION N Database: LUST, Date of Government Ve Status: Completed - Case Closed Global Id: T0603700900	7751 BEVERLY BOULEVA ersion: 03/13/2017	NNE 1/4 - 1/2 (0.403 mi.)	L42	83
TOSCO - 76 STATION # Database: LUST REG 4, Date of Governr Facility Id: 900360198 Status: Remediation Plan Global ID: T0603700900	7751 BEVERLY BLVD nent Version: 09/07/2004	NNE 1/4 - 1/2 (0.403 mi.)	L43	92
Lower Elevation	Address	Direction / Distance	Map ID	Page
MAS AUTO SERVICE Database: LUST REG 4, Date of Governr Facility Id: 900360107 Status: Remediation Plan Global ID: T0603700891	371 FAIRFAX nent Version: 09/07/2004	WSW 0 - 1/8 (0.084 mi.)	D11	22
MAS AUTO SERVICE Database: LUST, Date of Government Ve Status: Open - Remediation Global ld: T0603700891	371 SOUTH FAIRFAX AV prsion: 03/13/2017	WSW 0 - 1/8 (0.089 mi.)	D14	25
MAJESTIC CAR WASH Database: LUST REG 4, Date of Government Verbalance o		WNW 1/8 - 1/4 (0.223 mi.)	H29	45

Status: Completed - Case Closed

Facility Id: 900480089 Status: Case Closed Global Id: T0603701108 Global ID: T0603701108

AL-SAL OIL (OLD UNOC 6050 006TH ST W SSW 1/4 - 1/2 (0.416 mi.) 44 94

Database: LUST REG 4, Date of Government Version: 09/07/2004 Database: LUST, Date of Government Version: 03/13/2017

Status: Completed - Case Closed

Facility Id: 900360125 Status: Case Closed Global Id: T0603700893 Global ID: T0603700893

CA SLIC: Cleanup Program Sites (CPS; also known as Site Cleanups [SC] and formerly known as Spills, Leaks, Investigations, and Cleanups [SLIC] sites) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

A review of the CA SLIC list, as provided by EDR, has revealed that there are 3 CA SLIC sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
THE GROVE AT FARMERS Database: SLIC REG 4, Date of Go Facility Status: Post Remediation N		ENE 0 - 1/8 (0.098 mi.)	16	33
THE GROVE AT FARMERS Database: SLIC, Date of Government Facility Status: Open - Verification Global Id: SL2049G1726		NNE 1/8 - 1/4 (0.141 mi.)	23	36
AL SIMON	8023 BEVERLY BLVD	NNW 1/4 - 1/2 (0.459 mi.)	45	96

Database: SLIC, Date of Government Version: 03/13/2017

Facility Status: Completed - Case Closed

Global Id: T10000000452

State and tribal registered storage tank lists

CA UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the State Water Resources Control Board's Hazardous Substance Storage Container Database.

A review of the CA UST list, as provided by EDR, has revealed that there is 1 CA UST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
LOS ANGELES UNIFIED	408 S FAIRFAX AVE	S 0 - 1/8 (0.083 mi.)	C10	22
Database: UST, Date of Government Version: 09/12/2016				
Facility Id: 24381				

State and tribal Brownfields sites

CA BROWNFIELDS: A listing of sites the SWRCB considers to be Brownfields since these are sites have come to them through the MOA Process.

A review of the CA BROWNFIELDS list, as provided by EDR, and dated 01/03/2017 has revealed that there is 1 CA BROWNFIELDS site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
AL SIMON	8023 BEVERLY BLVD	NNW 1/4 - 1/2 (0.459 mi.)	45	96

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Hazardous waste / Contaminated Sites

CA SCH: This category contains proposed and existing school sites that are being evaluated by DTSC for possible hazardous materials contamination. In some cases, these properties may be listed in the CalSites category. depending on the level of threat to public health and safety or the. environment they pose.

A review of the CA SCH list, as provided by EDR, and dated 10/31/2016 has revealed that there is 1 CA SCH site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
HANCOCK PARK ELEMENT Facility Id: 19000014	408 SOUTH FAIRFAX AV	S 0 - 1/8 (0.083 mi.)	C8	18
Status: Inactive - Needs Evaluation				

Local Lists of Registered Storage Tanks

CA SWEEPS UST: Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1990's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

A review of the CA SWEEPS UST list, as provided by EDR, and dated 06/01/1994 has revealed that there are 6 CA SWEEPS UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FARMERS MARKET AUTOM Comp Number: 1767	166 S FAIRFAX AVE	NNW 0 - 1/8 (0.118 mi.)	E22	35
JERALD FRIEDMAN/J KO Comp Number: 7981	145 S FAIRFAX AVE	NNW 1/8 - 1/4 (0.203 mi.)	G27	42
AUTO SERVICE CHUCKS Comp Number: 4055	105 S FAIRFAX AVE	NNW 1/8 - 1/4 (0.248 mi.)	34	50
Lower Elevation	Address	Direction / Distance	Map ID	Page
WILLIAM L OLSON INC	301 S FAIRFAX AVE	W 0 - 1/8 (0.067 mi.)	B7	17

Comp Number: 6996

MASAUKI MAS YOSHIOKA Comp Number: 4053	371 S FAIRFAX AVE	WSW 0 - 1/8 (0.084 mi.)	D13	23
MAJESTIC CAR WASH Status: A	8017 W 3RD ST	WNW 1/8 - 1/4 (0.244 mi.)	H32	49

Comp Number: 6041

CA HIST UST: Historical UST Registered Database.

A review of the CA HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 6 CA HIST UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FARMERS MARKET AUTOM Facility Id: 00000029388	166 S FAIRFAX AVE	NNW 0 - 1/8 (0.118 mi.)	E21	34
FARMERS MARKET AUTOM	166 S FAIRFAX AVE	NNW 0 - 1/8 (0.118 mi.)	E22	35
Lower Elevation	Address	Direction / Distance	Map ID	Page
MASAUKI MAS YOSHIOKA MAS TEXACO SERVICE Facility Id: 00000067259	371 S FAIRFAX AVE 371 S FAIRFAX AVE	WSW 0 - 1/8 (0.084 mi.) WSW 0 - 1/8 (0.089 mi.)	D13 D15	23 32
MAJESTIC CAR WASH MAJESTIC CAR WASH Facility Id: 00000065816	8017 W THIRD STREET 8017 W 3RD ST	WNW 1/8 - 1/4 (0.244 mi.) WNW 1/8 - 1/4 (0.244 mi.)	H31 H33	48 50

CA FID UST: The Facility Inventory Database contains active and inactive underground storage tank locations. The source is the State Water Resource Control Board.

A review of the CA FID UST list, as provided by EDR, and dated 10/31/1994 has revealed that there are 6 CA FID UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FARMERS MARKET AUTOM Facility Id: 19017476 Status: I	166 S FAIRFAX AVE	NNW 0 - 1/8 (0.118 mi.)	E22	35
JERALD FRIEDMAN/J KO Facility Id: 19054692 Status: I	145 S FAIRFAX AVE	NNW 1/8 - 1/4 (0.203 mi.)	G27	42
AUTO SERVICE CHUCKS Facility Id: 19027094 Status: A	105 S FAIRFAX AVE	NNW 1/8 - 1/4 (0.248 mi.)	34	50
Lower Elevation	Address	Direction / Distance	Map ID	Page
WILLIAM L OLSON INC Facility Id: 19056411 Status: A	301 S FAIRFAX AVE	W 0 - 1/8 (0.067 mi.)	B7	17
MASAUKI MAS YOSHIOKA	371 S FAIRFAX AVE	WSW 0 - 1/8 (0.084 mi.)	D13	23

Facility Id: 19003243

Status: I

MAJESTIC CAR WASH 8017 W 3RD ST WNW 1/8 - 1/4 (0.244 mi.) H32 49

Facility Id: 19038137

Status: A

Other Ascertainable Records

CA DRYCLEANERS: A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes: power laundries, family and commercial; garment pressing and cleaners' agents; linen supply; coin-operated laundries and cleaning; drycleaning plants except rugs; carpet and upholster cleaning; industrial launderers; laundry and garment services.

A review of the CA DRYCLEANERS list, as provided by EDR, and dated 09/02/2016 has revealed that there are 2 CA DRYCLEANERS sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
FAIR FINE DRYCLEANER EPA Id: CAL000320722 EPA Id: CAL000277769	349 S FAIRFAX AVE	W 0 - 1/8 (0.066 mi.)	B5	15
PARAMOUNT CLEANERS EPA Id: CAL000264885	487 S FAIRFAX AVE	SSW 1/8 - 1/4 (0.225 mi.)	30	48

CA HIST CORTESE: The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES]. This listing is no longer updated by the state agency.

A review of the CA HIST CORTESE list, as provided by EDR, and dated 04/01/2001 has revealed that there are 8 CA HIST CORTESE sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FARMERS MARKET AUTO Reg ld: 900360207	166 FAIRFAX AVE S	NNW 1/8 - 1/4 (0.187 mi.)	G26	39
CBS TELEVISION CITY Reg ld: 900360089	7800 BEVERLY	N 1/4 - 1/2 (0.293 mi.)	<i>1</i> 35	51
WORLD OIL #64 Reg ld: 900480070	7900 BEVERLY	NNW 1/4 - 1/2 (0.374 mi.)	J39	68
TEXACO Reg ld: I-16219	7718 BEVERLY	NNE 1/4 - 1/2 (0.385 mi.)	K41	76
76 PRODUCT STATION N Reg Id: 900360198	7751 BEVERLY BOULEVA	NNE 1/4 - 1/2 (0.403 mi.)	L42	83
Lower Elevation	Address	Direction / Distance	Map ID	Page
MAS AUTO SERVICE Reg ld: 900360107	371 FAIRFAX	WSW 0 - 1/8 (0.084 mi.)	D11	22
MAJESTIC CAR WASH	8017 003RD ST W	WNW 1/8 - 1/4 (0.223 mi.)	H29	45

Reg Id: 900480089

AL-SAL OIL (OLD UNOC 6050 006TH ST W SSW 1/4 - 1/2 (0.416 mi.) 44 94

Reg Id: 900360125

CT MANIFEST: Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

A review of the CT MANIFEST list, as provided by EDR, and dated 07/30/2013 has revealed that there is 1 CT MANIFEST site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
P & K ACCOCIATES	145 SOUTH FAIRFAX AV	NNW 1/8 - 1/4 (0.178 mi.)	F24	37
EPA Id: CTP000007200				

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 3 EDR Hist Auto sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FARMERS MARKET AUTOM	166 S FAIRFAX	NNW 0 - 1/8 (0.118 mi.)	E20	34
Database: EDR Hist Auto, Date of	Government Version: 02/20/2007			
Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	371 S FAIRFAX AVE	WSW 0 - 1/8 (0.084 mi.)	D12	23
SNYDER A G	419 S FAIRFAX AVE	SW 0 - 1/8 (0.115 mi.)	19	33
Database: EDR Hist Auto, Date of	Government Version: 02/20/2007			

EDR Hist Cleaner: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical"

Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there are 3 EDR Hist Cleaner sites within approximately 0.125 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	349 S FAIRFAX AVE	W 0 - 1/8 (0.066 mi.)	B6	17
Not reported	401 S FAIRFAX AVE	SW 0 - 1/8 (0.104 mi.)	D17	33
URICK F A	7051/2 W 3D	NW 0 - 1/8 (0.110 mi.)	18	33
Database: EDR Hist Cleaner	Date of Government Version: 02/20/200	7		


Due to poor or inadequate address information, the following sites were not mapped. Count: 2 records.

Site Name Database(s)

FARMERS MARKET CAR WASH (FORMER) SALT LAKE PROPERTY

CA LUST CA ENVIROSTOR

OVERVIEW MAP - 4930273.2S

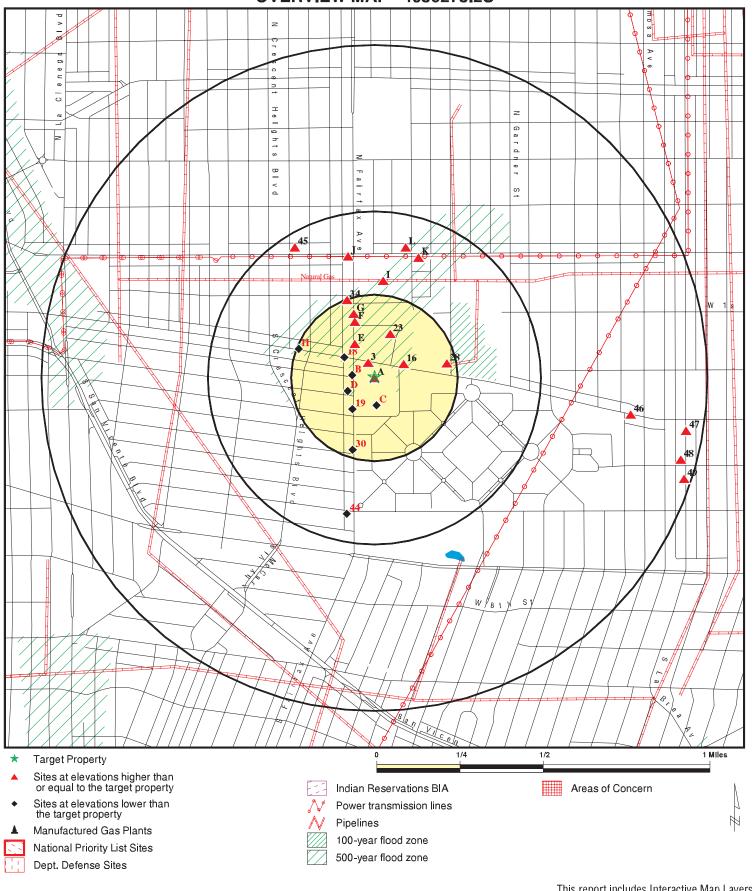


This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street ARCADIS U.S., Inc. CLIENT: CONTACT: Janet Holtz Los Angeles CA 90036 INQUIRY#: 4930273.2s LAT/LONG: 34.070699 / 118.360324

DATE: May 08, 2017 2:37 pm

DETAIL MAP - 4930273.2S

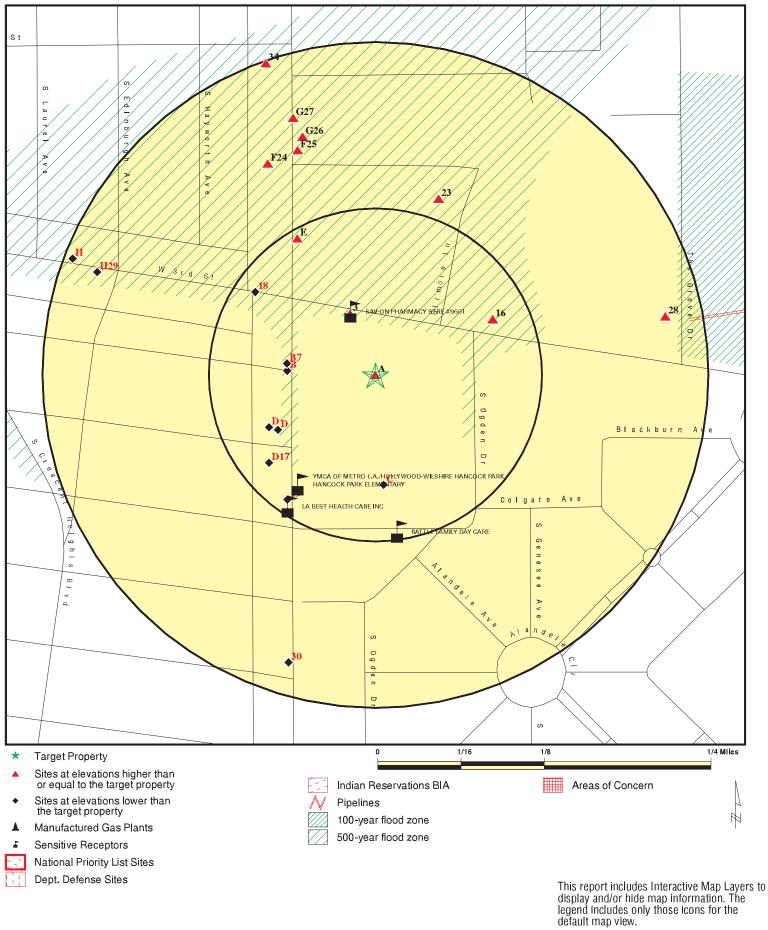

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street

LAT/LONG:

Los Angeles CA 90036

34.070699 / 118.360324

INQUIRY #: 4930273.2s DATE: May 08, 2017 2:41 pm

Copyright © 2017 EDR, Inc. © 2015 TomTom Rel. 2015.

ARCADIS U.S., Inc.

CLIENT:

CONTACT: Janet Holtz

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMEN	TAL RECORDS							
Federal NPL site list								
NPL Proposed NPL NPL LIENS	1.000 1.000 TP		0 0 NR	0 0 NR	0 0 NR	0 0 NR	NR NR NR	0 0 0
Federal Delisted NPL sit	e list							
Delisted NPL	1.000		0	0	0	0	NR	0
Federal CERCLIS list								
FEDERAL FACILITY SEMS	0.500 0.500		0 0	0 0	0 0	NR NR	NR NR	0 0
Federal CERCLIS NFRA	P site list							
SEMS-ARCHIVE	0.500		0	0	0	NR	NR	0
Federal RCRA CORRAC	TS facilities li	st						
CORRACTS	1.000		0	0	0	0	NR	0
Federal RCRA non-COR	RACTS TSD f	acilities list						
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Federal RCRA generator	rs list							
RCRA-LQG RCRA-SQG RCRA-CESQG	0.250 0.250 0.250		1 2 0	0 1 0	NR NR NR	NR NR NR	NR NR NR	1 3 0
Federal institutional controls / engineering controls registries								
LUCIS US ENG CONTROLS US INST CONTROL	0.500 0.500 0.500		0 0 0	0 0 0	0 0 0	NR NR NR	NR NR NR	0 0 0
Federal ERNS list								
ERNS	TP		NR	NR	NR	NR	NR	0
State- and tribal - equiva	alent NPL							
CA RESPONSE	1.000		0	0	0	0	NR	0
State- and tribal - equiva	alent CERCLIS	8						
CA ENVIROSTOR	1.000		1	0	0	4	NR	5
State and tribal landfill and/or solid waste disposal site lists								
CA SWF/LF	0.500		0	0	0	NR	NR	0
State and tribal leaking	storage tank l	ists						
CA LUST	0.500		2	3	10	NR	NR	15

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted	
INDIAN LUST CA SLIC	0.500 0.500		0 1	0 1	0 1	NR NR	NR NR	0 3	
State and tribal registere	d storage tar	ık lists							
FEMA UST CA UST CA AST INDIAN UST	0.250 0.250 0.250 0.250		0 1 0 0	0 0 0 0	NR NR NR NR	NR NR NR NR	NR NR NR NR	0 1 0 0	
State and tribal voluntary	/ cleanup site	es							
CA VCP INDIAN VCP	0.500 0.500		0	0 0	0 0	NR NR	NR NR	0 0	
State and tribal Brownfie	lds sites								
CA BROWNFIELDS	0.500		0	0	1	NR	NR	1	
ADDITIONAL ENVIRONMENTAL RECORDS									
Local Brownfield lists									
US BROWNFIELDS	0.500		0	0	0	NR	NR	0	
Local Lists of Landfill / S Waste Disposal Sites	Solid								
CA WMUDS/SWAT CA SWRCY CA HAULERS INDIAN ODI DEBRIS REGION 9 ODI IHS OPEN DUMPS	0.500 0.500 TP 0.500 0.500 0.500 0.500		0 0 NR 0 0 0	0 0 NR 0 0 0	0 0 NR 0 0 0	NR NR NR NR NR NR	NR NR NR NR NR NR	0 0 0 0 0 0	
Local Lists of Hazardous waste / Contaminated Sites									
CA AOCONCERN US HIST CDL CA HIST Cal-Sites CA SCH CA CDL CA Toxic Pits US CDL	1.000 TP 1.000 0.250 TP 1.000		0 NR 0 1 NR 0 NR	0 NR 0 0 NR 0 NR	0 NR 0 NR NR 0 NR	0 NR 0 NR NR 0 NR	NR NR NR NR NR NR	0 0 0 1 0 0	
Local Lists of Registered Storage Tanks									
CA SWEEPS UST CA HIST UST CA FID UST	0.250 0.250 0.250		3 4 3	3 2 3	NR NR NR	NR NR NR	NR NR NR	6 6 6	
Local Land Records									
CA LIENS LIENS 2 CA DEED	TP TP 0.500		NR NR 0	NR NR 0	NR NR 0	NR NR NR	NR NR NR	0 0 0	

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Records of Emergency I	Release Repo	rts						
HMIRS CA CHMIRS CA LDS CA MCS CA SPILLS 90	TP TP TP TP TP		NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	0 0 0 0
Other Ascertainable Rec	ords							
RCRA NonGen / NLR FUDS DOD SCRD DRYCLEANERS US FIN ASSUR EPA WATCH LIST 2020 COR ACTION TSCA TRIS SSTS ROD RMP RAATS PRP PADS ICIS FTTS MLTS COAL ASH DOE COAL ASH EPA PCB TRANSFORMER RADINFO HIST FTTS DOT OPS CONSENT INDIAN RESERV FUSRAP UMTRA LEAD SMELTERS US AIRS US MINES ABANDONED MINES FINDS UXO DOCKET HWC ECHO FUELS PROGRAM CA BOND EXP. PLAN CA Cortese	0.250 1.000 1.000 0.500 TP TP TP 0.250 TP TP TP 1.000 TP		0 0 0 0 0 RR 0 RR RR 0 RR RR RR RR RR O RR RR O O O O	0 0 0 0 0 R R O R R R O R R R R R R R R	NOOORRRRRORRRRRRRRRRORRRROOOORRRORORRROOO	$N \circ \circ N R R R R R R R R$	\text{NKC}	
CA CORESE CA CUPA Listings CA DRYCLEANERS CA EMI	0.250 0.250 TP		0 1 NR	0 0 1 NR	NR NR NR	NR NR NR NR	NR NR NR NR	0 0 2 0

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
CA ENF	TP		NR	NR	NR	NR	NR	0
CA Financial Assurance	TP		NR	NR	NR	NR	NR	Ö
CA HAZNET	TP	2	NR	NR	NR	NR	NR	2
CAICE	TP	_	NR	NR	NR	NR	NR	0
CA HIST CORTESE	0.500		1	2	5	NR	NR	8
CA LOS ANGELES CO. HI	MS TP		NR	NR	NR	NR	NR	0
CA HWP	1.000		0	0	0	0	NR	0
CA HWT	0.250		0	0	NR	NR	NR	0
CT MANIFEST	0.250		0	1	NR	NR	NR	1
CA MINES	TP		NR	NR	NR	NR	NR	0
CA MWMP	0.250		0	0	NR	NR	NR	0
CA NPDES	TP		NR	NR	NR	NR	NR	0
CA PEST LIC	TP		NR	NR	NR	NR	NR	0
CA PROC	0.500		0	0	0	NR	NR	0
CA Notify 65	1.000		0	0	0	0	NR	0
LA Co. Site Mitigation	TP		NR	NR	NR	NR	NR	0
CA UIC	TP		NR	NR	NR	NR	NR	0
CA WASTEWATER PITS	0.500		0	0	0	NR	NR	0
CA WDS	TP		NR	NR	NR	NR	NR	0
CA WIP	0.250		0	0	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	0	0	0	NR	0
EDR Hist Auto	0.125		3	NR	NŘ	NR	NR	3
EDR Hist Cleaner	0.125		3	NR	NR	NR	NR	3
			ŭ					Ü
EDR RECOVERED GOVERN	MENT ARCHIV	<u>/ES</u>						
Exclusive Recovered Gov	t. Archives							
CA RGA LF	TP		NR	NR	NR	NR	NR	0
CA RGA LUST	TP		NR	NR	NR	NR	NR	Ö
G	••							· ·
- Totals		2	27	17	17	4	0	67

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID MAP FINDINGS

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

A1 KMART CORPORATION CA HAZNET S113028126
Target 6310 W 3RD ST N/A

Property LOS ANGELES, CA 90036

Site 1 of 2 in cluster A

Actual:

HAZNET:

180 ft.

envid: \$113028126 Year: 2015

GEPAID: CAL000018571
Contact: CYNTHIA MILLER
Telephone: 8472860037
Mailing Name: Not reported

Mailing Address: 3333 BEVERLY RD B5-348A
Mailing City,St,Zip: HOFFMAN ESTATES, IL 601790000

Gen County: Los Angeles
TSD EPA ID: CAD008364432
TSD County: Los Angeles

Waste Category: Off-specification, aged or surplus inorganics

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.4075

Cat Decode: Off-specification, aged or surplus inorganics

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Los Angeles

envid: \$113028126 Year: 2015

GEPAID: CAL000018571
Contact: CYNTHIA MILLER
Telephone: 8472860037
Mailing Name: Not reported

Mailing Address: 3333 BEVERLY RD B5-348A
Mailing City,St,Zip: HOFFMAN ESTATES, IL 601790000

Gen County: Los Angeles
TSD EPA ID: NVD980895338

TSD County: 99

Waste Category: Not reported

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.004 Cat Decode: Not reported

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Los Angeles

envid: \$113028126 Year: 2015

GEPAID: CAL000018571
Contact: CYNTHIA MILLER
Telephone: 8472860037
Mailing Name: Not reported

Mailing Address: 3333 BEVERLY RD B5-348A
Mailing City,St,Zip: HOFFMAN ESTATES, IL 601790000

Gen County: Los Angeles
TSD EPA ID: CAD008364432
TSD County: Los Angeles

Waste Category: Off-specification, aged or surplus organics

Map ID MAP FINDINGS

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

KMART CORPORATION (Continued)

S113028126

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

0.6545 Tons:

Cat Decode: Off-specification, aged or surplus organics

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Los Angeles

S113028126 envid: Year: 2015

GEPAID: CAL000018571 **CYNTHIA MILLER** Contact: Telephone: 8472860037 Mailing Name: Not reported

Mailing Address: 3333 BEVERLY RD B5-348A Mailing City, St, Zip: HOFFMAN ESTATES, IL 601790000

Gen County: Los Angeles NVD980895338 TSD EPA ID:

TSD County:

Off-specification, aged or surplus organics Waste Category:

Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery Disposal Method:

(H010-H129) Or (H131-H135)

Tons: 0.0055

Cat Decode: Off-specification, aged or surplus organics

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Los Angeles

envid: S113028126 Year: 2015

GEPAID: CAL000018571 Contact: CYNTHIA MILLER Telephone: 8472860037 Mailing Name: Not reported

3333 BEVERLY RD B5-348A Mailing Address: Mailing City, St, Zip: HOFFMAN ESTATES, IL 601790000

Gen County: Los Angeles TSD EPA ID: CAD008364432 TSD County: Los Angeles

Waste Category: Alkaline solution without metals pH >= 12.5

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.375

Cat Decode: Alkaline solution without metals pH >= 12.5

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Los Angeles

> Click this hyperlink while viewing on your computer to access 55 additional CA HAZNET: record(s) in the EDR Site Report.

Direction Distance

Elevation Site Database(s) EPA ID Number

A2 THE KMART CORP CA HAZNET S112916175
Target 6310 W 3RD ST N/A

Property LOS ANGELES, CA 90063

Site 2 of 2 in cluster A

Actual: HAZNET:

180 ft. envid: S112916175

Facility County:

Year: 2001

GEPAID: CAC002367991
Contact: ANNETTE LABOY
Telephone: 6268937081
Mailing Name: Not reported

Mailing Address: 3100 W BIG BEAVER RD Mailing City, St, Zip: TROY, MI 480840000

Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported

Waste Category: Unspecified oil-containing waste

Los Angeles

Disposal Method: Recycler
Tons: 0.62
Cat Decode: Not reported
Method Decode: Not reported

CVS PHARMACY NO 9661

3 CVS PHARMACY NO 9661 NNW 6360 W THIRD ST < 1/8 LOS ANGELES, CA 90036

0.050 mi. 262 ft.

Relative: RCRA-LQG:

Higher Date form received by agency: 03/27/2013

Facility name:

Actual: Facility address: 6360 W THIRD ST 180 ft. LOS ANGELES CA 90036

80 ft. LOS ANGELES, CA 90036 EPA ID: CAR000238063

Mailing address: CAR000238063

ONE CVS DR

WOONSOCKET, RI 02895
Contact: WENDY L BRANT

Contact address: ONE CVS DR
WOONSOCKET, RI 02895

ntact country.

Contact country: US

Contact telephone: 401-765-1500

Contact email: WENDY.BRANT@CVSCAREMARK.COM

EPA Region: 09

Classification: Large Quantity Generator

Description: Handler: generates 1,000 kg or more of hazardous waste during any

calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely

hazardous waste during any calendar month, and accumulates more than

100 kg of that material at any time

RCRA-LQG

FINDS

ECHO

1016140182

CAR000238063

EDR ID Number

Direction Distance Elevation

Site Database(s) EPA ID Number

CVS PHARMACY NO 9661 (Continued)

1016140182

EDR ID Number

Owner/Operator Summary:

Owner/operator name: GARFIELD BEACH CVS LLC

Owner/operator address: Not reported

Not reported

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: 06/02/2006 Owner/Op end date: Not reported

Owner/operator name: THIRD FAIRFAX LLC

Owner/operator address: 6380 WILSHIRE BLVD STE 800

LOS ANGELES, CA 90048

Owner/operator country: US

Owner/operator telephone: 323-651-1808
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 12/01/1986
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Waste code: D001

. Waste name: IGNITABLE WASTE

Waste code: D002

Waste name: CORROSIVE WASTE

. Waste code: D009
. Waste name: MERCURY

Waste code: P001

Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS,

WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, &

SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%

. Waste code: P042

. Waste name: 1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR)

EPINEPHRINE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CVS PHARMACY NO 9661 (Continued)

1016140182

Waste code: P075

NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & Waste name:

SALTS

Waste code: P081

1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R) Waste name:

Violation Status: No violations found

FINDS:

Registry ID: 110055439208

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

STATE MASTER

ECHO:

1016140182 Envid: Registry ID: 110055439208

DFR URL: http://echo.epa.gov/detailed facility report?fid=110055439208

B4 KINGS CLEANERS RCRA-SQG 1000236914 West 349 S FAIRFOX AVE **FINDS** CAD981984180

< 1/8 0.066 mi.

LOS ANGELES, CA 90036 **ECHO CA HAZNET**

Site 1 of 4 in cluster B 350 ft.

Relative:

RCRA-SQG:

Lower

Date form received by agency: 09/01/1996 KINGS CLEANERS

Facility name: Actual: Facility address:

349 S FAIRFOX AVE

178 ft. EPA ID:

LOS ANGELES, CA 90036 CAD981984180

Contact: Not reported Not reported Contact address: Not reported Contact country: US

Contact telephone: Not reported Not reported Contact email:

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: KIM PIL

Distance

Elevation Site Database(s) EPA ID Number

KINGS CLEANERS (Continued)

1000236914

EDR ID Number

Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country:
Owner/operator telephone:
Legal status:
Owner/Operator Type:
Owner/Op start date:
Owner/Op end date:
Not reported
Not reported
Not reported

Owner/operator name: NOT REQUIRED Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country:

Owner/operator telephone:

Legal status:

Owner/Operator Type:

Owner/Op start date:

Owner/Op end date:

Not reported

Not reported

Not reported

Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Nο Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 04/02/1987

Site name: KINGS CLEANERS
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110002764768

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Direction Distance Elevation

Database(s) EPA ID Number

Database(s) EPA ID Number

KINGS CLEANERS (Continued)

1000236914

ECHO:

Envid: 1000236914 Registry ID: 110002764768

DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110002764768

HAZNET:

envid: 1000236914 Year: 2000

GEPAID: CAD981984180

Contact: --Telephone: --

Mailing Name: Not reported
Mailing Address: PO BOX 741202

Mailing City, St, Zip: LOS ANGELES, CA 900049203

Gen County: Not reported
TSD EPA ID: CAD981397417
TSD County: Not reported

Waste Category: Halogenated solvents (chloroforms, methyl chloride, perchloroethylene,

etc)

Disposal Method: Recycler Tons: 0.21

Cat Decode: Not reported Method Decode: Not reported Facility County: Los Angeles

envid: 1000236914 Year: 1998

GEPAID: CAD981984180
Contact: Not reported
Telephone: 000000000
Mailing Name: Not reported
Mailing Address: 349 S FAIRFAX AVE

Mailing Address: 349 S FAIRFAX AVE

Mailing City, St, Zip: LOS ANGELES, CA 900363124

Gen County: Not reported
TSD EPA ID: CAD981397417
TSD County: Not reported

Waste Category: Halogenated solvents (chloroforms, methyl chloride, perchloroethylene,

etc)

Disposal Method: Recycler
Tons: .2107
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Los Angeles

envid: 1000236914

Year: 1997

GEPAID: CAD981984180
Contact: Not reported
Telephone: 000000000
Mailing Name: Not reported

Mailing Address: 349 S FAIRFAX AVE

Mailing City, St, Zip: LOS ANGELES, CA 900363124

Gen County: Not reported
TSD EPA ID: CAD981397417
TSD County: Not reported

Waste Category: Halogenated solvents (chloroforms, methyl chloride, perchloroethylene,

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

KINGS CLEANERS (Continued)

1000236914

etc)

Disposal Method: Recycler Tons: .2107 Cat Decode: Not reported Method Decode: Not reported Facility County: Los Angeles

envid: 1000236914 Year: 1997

GEPAID: CAD981984180 Contact: Not reported 000000000 Telephone: Mailing Name: Not reported

Mailing Address: 349 S FAIRFAX AVE

Mailing City, St, Zip: LOS ANGELES, CA 900363124

Gen County: Not reported TSD EPA ID: CAD981397417 TSD County: Not reported Waste Category: Not reported Disposal Method: Recycler .0000 Tons: Cat Decode: Not reported

Method Decode: Not reported Facility County: Los Angeles

envid: 1000236914 Year: 1996

GEPAID: CAD981984180 Contact: Not reported 000000000 Telephone: Mailing Name: Not reported 349 S FAIRFAX AVE Mailing Address:

Mailing City, St, Zip: LOS ANGELES, CA 900363124

Gen County: Not reported

TSD EPA ID: CAD981397417 TSD County: Not reported

Waste Category: Halogenated solvents (chloroforms, methyl chloride, perchloroethylene,

etc)

Recycler Disposal Method: Tons: .2107 Cat Decode: Not reported Method Decode: Not reported Facility County: Los Angeles

> Click this hyperlink while viewing on your computer to access 2 additional CA_HAZNET: record(s) in the EDR Site Report.

B5 FAIR FINE DRYCLEANERS CA DRYCLEANERS \$108540828 N/A

West 349 S FAIRFAX AVE < 1/8 LOS ANGELES, CA 90036

0.066 mi.

350 ft. Site 2 of 4 in cluster B DRYCLEANERS:

Relative: EPA Id: CAL000320722 Lower

NAICS Code: 81232

Actual: NAICS Description: Drycleaning and Laundry Services (except Coin-Operated)

178 ft. SIC Code: 7211

Direction Distance

Elevation Site Database(s) **EPA ID Number**

FAIR FINE DRYCLEANERS (Continued)

S108540828

EDR ID Number

SIC Description: Power Laundries, Family and Commercial

06/14/2007 Create Date:

Facility Active: No

Inactive Date: 06/30/2014 Facility Addr2: Not reported

CORNER STONE M&J CORP Owner Name:

Owner Address: 349 S FAIRFAX AVE

Owner Address 2: Not reported Owner Telephone: 3236537778 Contact Name: JOY AN

349 S FAIRFAX AVE Contact Address:

Contact Address 2: Not reported 3236537778 Contact Telephone: Mailing Name: Not reported

349 S FAIRFAX AVE Mailing Address 1: Mailing Address 2: Not reported

Mailing City: LOS ANGELES Mailing State: CA

900360000 Mailing Zip: 000000000 Owner Fax:

Region Code: 3

EPA Id: CAL000277769

NAICS Code:

NAICS Description: Drycleaning and Laundry Services (except Coin-Operated)

SIC Code:

SIC Description: Power Laundries, Family and Commercial

Create Date: 01/05/2004

Facility Active: No

Inactive Date: 06/15/2007 Facility Addr2: Not reported Owner Name: **HUNG JUNG** Owner Address: 349 S FAIRFAX AVE

Owner Address 2: Not reported

2132722424 Owner Telephone: Contact Name: HONG JUNG

Contact Address: 535 S CURSON AVE APT 3K

Contact Address 2: Not reported Contact Telephone: 2132722424 Mailing Name: Not reported Mailing Address 1: 349 S FAIRFAX AVE

Mailing Address 2: Not reported Mailing City: LOS ANGELES

Mailing State: CA

Mailing Zip: 900363124 Owner Fax: Not reported

Region Code:

Direction Distance

Elevation Site Database(s) **EPA ID Number**

B6 EDR Hist Cleaner 1015047425 West 349 S FAIRFAX AVE

N/A

S101588173

N/A

CA SWEEPS UST

CA FID UST

EDR ID Number

< 1/8 LOS ANGELES, CA 90036

0.066 mi.

350 ft. Site 3 of 4 in cluster B

Relative:

EDR Historical Cleaners: Name:

Lower

FAIR CLEANERS Year: 2010

Actual:

349 S FAIRFAX AVE

178 ft.

Name: FAIR CLEANERS

Year:

Address:

2011

Address:

349 S FAIRFAX AVE

Name:

FAIR CLEANERS

Year:

Address:

349 S FAIRFAX AVE

B7 WILLIAM L OLSON INC West **301 S FAIRFAX AVE** < 1/8 LOS ANGELES, CA 90048

0.067 mi.

354 ft. Site 4 of 4 in cluster B

Relative: Lower

SWEEPS UST:

Status: Not reported 6996

Comp Number:

Actual: 178 ft.

Number: Not reported Board Of Equalization: Not reported Not reported Referral Date: Action Date: Not reported Created Date: Not reported Owner Tank Id: Not reported SWRCB Tank Id: Not reported Not reported Tank Status: Not reported Capacity: Active Date: Not reported Tank Use: Not reported Not reported STG: Not reported Content: Number Of Tanks: Not reported

CA FID UST:

19056411 Facility ID: Regulated By: UTNKA Regulated ID: Not reported Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2130000000 Mail To: Not reported

Mailing Address: 301 S FAIRFAX AVE

Mailing Address 2: Not reported

Mailing City, St, Zip: LOS ANGELES 900480000

Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported NPDES Number: Not reported EPA ID: Not reported

TC4930273.2s Page 17

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

WILLIAM L OLSON INC (Continued) S101588173

Comments: Not reported Status: Active

C8 HANCOCK PARK ELEMENTARY SCHOOL CA ENVIROSTOR S105628457
South 408 SOUTH FAIRFAX AVENUE CA SCH N/A

< 1/8 LOS ANGELES, CA 90036

0.083 mi.

437 ft. Site 1 of 3 in cluster C

Relative: ENVIROSTOR:
Lower Facility ID: 19000014

Status: Inactive - Needs Evaluation

Actual: Status Date: 11/22/2005 **179 ft.** Site Code: 300796

Site Type: School Investigation

Site Type Detailed: School
Acres: 0
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Not reported
Supervisor: Thomas Cota

Division Branch: Southern California Schools & Brownfields Outreach

Assembly: 50 Senate: 26

Special Program: Not reported

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED School District Funding: Latitude: 34.06950 Longitude: -118.3602 APN: 5509018902 Past Use: * UNKNOWN Potential COC: NONE SPECIFIED Confirmed COC: NONE SPECIFIED Potential Description: NONE SPECIFIED

Alias Name: HANCOCK PARK ELEM. SCHOOL

Alias Type: Alternate Name

Alias Name: HANCOCK PARK ELEMENTARY SCHOOL

Alias Type: Alternate Name

Alias Name: LOS ANGELES UNIFIED SCHOOL DISTRICT

Alias Type: Alternate Name
Alias Name: 5509018902
Alias Type: APN
Alias Name: 300796

Alias Type: Project Code (Site Code)

Alias Name: 19000014

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Environmental Oversight Agreement

Completed Date: 02/10/2000 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

HANCOCK PARK ELEMENTARY SCHOOL (Continued)

S105628457

EDR ID Number

Completed Document Type: Cost Recovery Closeout Memo

Completed Date: 05/17/2002 Comments: Not reported

Future Area Name: Not reported Not reported Future Sub Area Name: Not reported Future Document Type: Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

SCH:

Facility ID: 19000014

Site Type: School Investigation

Site Type Detail: School

Site Mgmt. Req.: NONE SPECIFIED

Acres: 0
National Priorities List: NO
Cleanup Oversight Agencies: SMBRP
Lead Agency: SMBRP

Lead Agency Description: DTSC - Site Cleanup Program

Project Manager: Not reported Supervisor: Thomas Cota

Division Branch: Southern California Schools & Brownfields Outreach

 Site Code:
 300796

 Assembly:
 50

 Senate:
 26

Special Program Status: Not reported

Status: Inactive - Needs Evaluation

11/22/2005 Status Date: Restricted Use: NO Funding: School District 34.06950 Latitude: Longitude: -118.3602 5509018902 APN: * UNKNOWN Past Use: Potential COC: NONE SPECIFIED Confirmed COC: NONE SPECIFIED

Alias Name: HANCOCK PARK ELEM. SCHOOL

Alias Type: Alternate Name

Alias Name: HANCOCK PARK ELEMENTARY SCHOOL

Alias Type: Alternate Name

Alias Name: LOS ANGELES UNIFIED SCHOOL DISTRICT

NONE SPECIFIED

Alias Type: Alternate Name
Alias Name: 5509018902
Alias Type: APN
Alias Name: 300796

Alias Type: Project Code (Site Code)

Alias Name: 19000014

Alias Type: Envirostor ID Number

Completed Info:

Potential Description:

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

HANCOCK PARK ELEMENTARY SCHOOL (Continued)

S105628457

ECHO

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Environmental Oversight Agreement Completed Document Type:

Completed Date: 02/10/2000 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Cost Recovery Closeout Memo

Completed Date: 05/17/2002 Comments: Not reported

Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Future Due Date: Not reported Not reported Schedule Area Name: Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

C9 LA USD HANCOCK PARK EL RCRA-SQG 1000427657 CAD981980196 South **408 S FAIRFAX AVE FINDS**

0.083 mi.

< 1/8

437 ft. Site 2 of 3 in cluster C

RCRA-SQG: Relative:

Date form received by agency: 04/09/1987 Lower

LOS ANGELES, CA 90036

Facility name: LA USD HANCOCK PARK EL Actual: Facility address: 408 S FAIRFAX AVE

179 ft. LOS ANGELES, CA 90036

EPA ID: CAD981980196

Mailing address: 1425 S SAN PEDRO RM 215 LOS ANGELES, CA 90015

Contact: ENVIRONMENTAL MANAGER

Contact address: 408 S FAIRFAX AVE

LOS ANGELES, CA 90036

Contact country: US

Contact telephone: (213) 742-7371 Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED Owner/operator address: NOT REQUIRED

NOT REQUIRED. ME 99999

Owner/operator country: Not reported Owner/operator telephone: (415) 555-1212 Legal status: Municipal

Direction Distance Elevation

n Site Database(s) EPA ID Number

LA USD HANCOCK PARK EL (Continued)

1000427657

EDR ID Number

Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: LA USD

Owner/operator address: NOT REQUIRED

NOT REQUIRED, ME 99999

Owner/operator country:

Owner/operator telephone:

Legal status:

Owner/Operator Type:

Owner/Op start date:

Owner/Op end date:

Not reported

Not reported

Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: Nο On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110002763313

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

ECHO:

Envid: 1000427657 Registry ID: 110002763313

DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110002763313

Direction Distance

Distance EDR ID Number
Database(s) EPA ID Number

C10 LOS ANGELES UNIFIED SCHOOL CA UST U003780820

N/A

South 408 S FAIRFAX AVE < 1/8 LOS ANGELES, CA 90036

0.083 mi.

437 ft. Site 3 of 3 in cluster C

Relative: UST:

Lower Facility ID: 24381

Permitting Agency: LOS ANGELES, CITY OF

04

 Actual:
 Latitude:
 34.070851

 179 ft.
 Longitude:
 -118.358867

D11 MAS AUTO SERVICE CA LUST S101296987

WSW 371 FAIRFAX CA HIST CORTESE N/A

< 1/8 LOS ANGELES, CA 90036

0.084 mi.

443 ft. Site 1 of 6 in cluster D

Relative: LUST REG 4:

Lower Region:
Regional Board:

Actual: County: Los Angeles
177 ft. Facility Id: 900360107
Status: Remediation Plan

Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater

Abatement Method Used at the Site: Excavate and Dispose

Global ID: T0603700891
W Global ID: Not reported
Staff: MSH
Local Agency: 19050
Cross Street: FOURTH ST
Enforcement Type: SEL
Date Leak Discovered: Not reported

Date Leak First Reported: 11/25/1991

Date Leak Record Entered: 11/10/1991
Date Confirmation Began: Not reported
Date Leak Stopped: Not reported

Date Case Last Changed on Database: 7/16/2002
Date the Case was Closed: Not reported

How Leak Discovered: Not reported How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK Operator: Not reported Water System: Not reported Well Name: Not reported

Hist Max MTBE Conc in Groundwater:

Approx. Dist To Production Well (ft): 6716.6290563079577834084051655

Source of Cleanup Funding: UNK Preliminary Site Assessment Workplan Submitted: 11/25/1991 Preliminary Site Assessment Began: 12/7/1998 Pollution Characterization Began: 4/14/1999 Remediation Plan Submitted: 3/25/2004 Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: 11/25/1991 4/14/1999 **Enforcement Action Date:** Historical Max MTBE Date: 12/19/2000

840

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAS AUTO SERVICE (Continued)

S101296987

Hist Max MTBE Conc in Soil: Not reported Yes

Significant Interim Remedial Action Taken:

GW Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported Responsible Party: KIYUKO YOSHIOKA RP Address: 6351 COLGATE AVE.

Program: LUST

Lat/Long: 34.0703499 / -1

Local Agency Staff: PEJ

Beneficial Use: Not reported Not reported Priority: Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported

QUARTERLY GW MONITORING RPT; 5/18/00 1ST QTR GW MON RPT 2000; 7/14/00 Summary:

2ND QTR GW MON RPT 2000; 9/19/00 3RD QTR GW MON RPT 2000; 1/8/01 4TH

QTR GW MON RPT 2000

HIST CORTESE:

Region: **CORTESE** Facility County Code: 19 Reg By: **LTNKA** 900360107 Reg Id:

D12 **EDR Hist Auto** 1015454225

N/A

CA SWEEPS UST

CA HIST UST

CA FID UST

< 1/8 0.084 mi.

wsw

371 S FAIRFAX AVE LOS ANGELES, CA 90036

443 ft. Site 2 of 6 in cluster D

EDR Historical Auto Stations: Relative:

MAS AUTO SERVICE Name: Lower

Year: 1999

Actual: Address: 371 S FAIRFAX AVE 177 ft.

Name: MAS AUTO SERVICE

Year: 2003

371 S FAIRFAX AVE Address:

D13 **MASAUKI MAS YOSHIOKA**

wsw **371 S FAIRFAX AVE** < 1/8 LOS ANGELES, CA 90036

0.084 mi.

443 ft. Site 3 of 6 in cluster D

SWEEPS UST: Relative:

Status: Not reported Lower

Comp Number: 4053 Actual: Number: Not reported

177 ft. Board Of Equalization: Not reported

Referral Date: Not reported Action Date: Not reported Created Date: Not reported Owner Tank Id: Not reported

S101583269

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MASAUKI MAS YOSHIOKA (Continued)

S101583269

SWRCB Tank Id: Not reported Not reported Tank Status: Not reported Capacity: Active Date: Not reported Tank Use: Not reported STG: Not reported Not reported Content: Number Of Tanks: Not reported

HIST UST:

File Number: 00027A9E

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00027A9E.pdf

Not reported Region: Facility ID: Not reported Facility Type: Not reported Not reported Other Type: Contact Name: Not reported Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City,St,Zip: Not reported Total Tanks: Not reported

Not reported Tank Num: Not reported Container Num: Year Installed: Not reported Tank Capacity: Not reported Tank Used for: Not reported Type of Fuel: Not reported Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

CA FID UST:

Facility ID: 19003243 Regulated By: UTNKI Regulated ID: Not reported Cortese Code: Not reported Not reported SIC Code: Facility Phone: 2130000000 Mail To: Not reported 371 S FAIRFAX AVE Mailing Address:

Mailing Address 2: Not reported

Mailing City, St, Zip: LOS ANGELES 900360000

Contact: Not reported Contact Phone: Not reported DUNs Number: Not reported Not reported NPDES Number: Not reported EPA ID: Comments: Not reported Status: Inactive

Direction Distance

Elevation Site Database(s) EPA ID Number

D14 MAS AUTO SERVICE CA LUST S114458527
WSW 371 SOUTH FAIRFAX AVE N/A

WSW 371 SOUTH FAIRFAX AVE < 1/8 LOS ANGELES, CA 90036

0.089 mi.

470 ft. Site 4 of 6 in cluster D

Relative: LUST:

 Lower
 Region:
 STATE

 Global Id:
 T0603700891

 Actual:
 Latitude:
 34.070142520

 Actual:
 Latitude:
 34.0701425203473

 176 ft.
 Longitude:
 -118.361669810451

 Case Type:
 LUST Cleanup Site

 Status:
 Open - Remediation

Status Date: 09/16/2005

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker: DPP

Local Agency: LOS ANGELES, CITY OF

RB Case Number: 900360107
LOC Case Number: Not reported
File Location: Regional Board

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603700891

Contact Type: Regional Board Caseworker
Contact Name: DANIEL PIROTTON

Contact Name: DANIEL PIROTTON

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: Not reported City: R4 UNKNOWN

Email: dpirotton@waterboards.ca.gov

Phone Number: 2135766714

Global Id: T0603700891

Contact Type: Local Agency Caseworker

Contact Name: ELOY LUNA

Organization Name: LOS ANGELES, CITY OF Address: 200 North Main Street, Suite 1780

Address: 200 North Main Street, City: LOS ANGELES

City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

Status History:

Global Id: T0603700891

Status: Open - Case Begin Date

Status Date: 11/25/1991

Global Id: T0603700891
Status: Open - Remediation

Status Date: 09/22/2003

Global Id: T0603700891 Status: Open - Remediation

Status Date: 06/18/2004

Global Id: T0603700891

EDR ID Number

Direction Distance Elevation

levation Site Database(s) EPA ID Number

MAS AUTO SERVICE (Continued)

S114458527

EDR ID Number

Status: Open - Remediation

Status Date: 11/10/2004

 Global Id:
 T0603700891

 Status:
 Open - Remediation

 Status Date:
 09/16/2005

Global Id: T0603700891

Status: Open - Site Assessment

Status Date: 11/25/1991

Global Id: T0603700891

Status: Open - Site Assessment

Status Date: 12/07/1998

Global Id: T0603700891

Status: Open - Site Assessment

Status Date: 04/14/1999

Regulatory Activities:

 Global Id:
 T0603700891

 Action Type:
 ENFORCEMENT

 Date:
 05/07/2015

 Action:
 Staff Letter

 Global Id:
 T0603700891

 Action Type:
 RESPONSE

 Date:
 07/15/2004

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700891

 Action Type:
 RESPONSE

 Date:
 07/15/2004

Action: Remedial Progress Report

 Global Id:
 T0603700891

 Action Type:
 RESPONSE

 Date:
 04/15/2016

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700891

 Action Type:
 ENFORCEMENT

 Date:
 04/24/2003

 Action:
 Staff Letter

 Global Id:
 T0603700891

 Action Type:
 ENFORCEMENT

 Date:
 06/25/2002

 Action:
 Staff Letter

 Global Id:
 T0603700891

 Action Type:
 ENFORCEMENT

 Date:
 06/15/2009

 Action:
 Staff Letter

Global Id: T0603700891
Action Type: ENFORCEMENT

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAS AUTO SERVICE (Continued)

S114458527

Date: 12/16/2013 Action: Staff Letter

Global Id: T0603700891 Action Type: **ENFORCEMENT** Date: 01/13/2016

Action: Waste Discharge Requirements

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/15/2003

Monitoring Report - Quarterly Action:

T0603700891 Global Id: Action Type: **RESPONSE** Date: 01/27/2011

Action: Clean Up Fund - 5-Year Review Summary

Global Id: T0603700891 **RESPONSE** Action Type: Date: 10/15/2002

Action: Monitoring Report - Quarterly

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/15/2016

Action: Pilot Study/ Treatability Report

T0603700891 Global Id: Action Type: **RESPONSE** 10/31/2015 Date:

Action: Well Installation Report

Global Id: T0603700891 RESPONSE Action Type: 07/15/2005 Date:

Action: Monitoring Report - Quarterly

T0603700891 Global Id: Action Type: **RESPONSE** Date: 10/15/2004

Action: Monitoring Report - Quarterly

Global Id: T0603700891 **RESPONSE** Action Type: Date: 04/15/2004

Action: Monitoring Report - Quarterly

T0603700891 Global Id: Action Type: **RESPONSE** Date: 04/15/2005

Action: Monitoring Report - Quarterly

Global Id: T0603700891 Action Type: RESPONSE Date: 04/15/2004

Action: CAP/RAP - Feasibility Study Report

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAS AUTO SERVICE (Continued)

S114458527

Global Id: T0603700891 RESPONSE Action Type: 01/15/2006 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603700891 **RESPONSE** Action Type: Date: 07/15/2016

Action: Remedial Progress Report

T0603700891 Global Id: Action Type: **RESPONSE** Date: 04/15/2002

Action: Monitoring Report - Quarterly

T0603700891 Global Id: **RESPONSE** Action Type: 07/15/2002 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/31/2002

Action: Other Report / Document

Global Id: T0603700891 Action Type: RESPONSE Date: 07/15/2002

Action: Soil and Water Investigation Report

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/15/2005

Action: Remedial Progress Report

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/27/2012

Action: Soil and Water Investigation Workplan

T0603700891 Global Id: Action Type: **RESPONSE** Date: 07/15/2016

Monitoring Report - Semi-Annually Action:

Global Id: T0603700891 Action Type: **ENFORCEMENT** Date: 03/29/2005

Action: Site Visit / Inspection / Sampling

T0603700891 Global Id: Action Type: **ENFORCEMENT** 01/13/2016 Date: Action: Staff Letter

Global Id: T0603700891 Action Type: Other

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAS AUTO SERVICE (Continued)

S114458527

Date: 11/25/1991 Action: Leak Reported Global Id: T0603700891

Action Type: **RESPONSE** 05/08/2003 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603700891 Action Type: **RESPONSE** Date: 05/08/2003

Monitoring Report - Quarterly Action:

T0603700891 Global Id: Action Type: **RESPONSE** Date: 01/15/2013

Action: Monitoring Report - Semi-Annually

Global Id: T0603700891 **RESPONSE** Action Type: Date: 01/15/2013

Action: Soil and Water Investigation Report

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/15/2012

Action: Monitoring Report - Semi-Annually

T0603700891 Global Id: Action Type: **RESPONSE** 01/31/2017 Date:

Action: Clean Up Fund - 5-Year Review Summary

Global Id: T0603700891 **ENFORCEMENT** Action Type: 09/22/2003 Date: Action: Staff Letter

T0603700891 Global Id: Action Type: **ENFORCEMENT** Date: 04/14/1999 Action: Staff Letter

Global Id: T0603700891 **RESPONSE** Action Type: Date: 10/15/2004

Action: Remedial Progress Report

T0603700891 Global Id: Action Type: **RESPONSE** Date: 10/15/2007

Action: Monitoring Report - Quarterly

T0603700891 Global Id: Action Type: RESPONSE Date: 07/15/2013

Action: Monitoring Report - Semi-Annually

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAS AUTO SERVICE (Continued)

S114458527

Global Id: T0603700891 RESPONSE Action Type: Date: 09/25/2013

Action: Soil and Water Investigation Workplan - Regulator Responded

Global Id: T0603700891 Action Type: **RESPONSE** Date: 04/15/2014

Action: Corrective Action Plan / Remedial Action Plan - Regulator Responded

T0603700891 Global Id: **ENFORCEMENT** Action Type: Date: 09/11/2012 Action: Staff Letter

T0603700891 Global Id: **RESPONSE** Action Type: Date: 07/15/2011

Action: Monitoring Report - Semi-Annually

Global Id: T0603700891 Action Type: **RESPONSE** Date: 01/19/2012

Action: Clean Up Fund - 5-Year Review Summary

Global Id: T0603700891 Action Type: **RESPONSE** Date: 10/15/2013

Action: Monitoring Report - Semi-Annually

Global Id: T0603700891 Action Type: **RESPONSE** Date: 11/11/2013 Action: Request for Closure

Global Id: T0603700891 **RESPONSE** Action Type: Date: 07/15/2014

Well Installation Report Action:

T0603700891 Global Id: **RESPONSE** Action Type: Date: 07/15/2014

Action: Monitoring Report - Semi-Annually

Global Id: T0603700891 Action Type: **RESPONSE** Date: 01/27/2014

Action: Clean Up Fund - 5-Year Review Summary

T0603700891 Global Id: Action Type: **RESPONSE** Date: 06/15/2015

Well Installation Workplan - Regulator Responded Action:

Global Id: T0603700891 Action Type: **ENFORCEMENT**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAS AUTO SERVICE (Continued)

S114458527

Date: 04/08/2008 Action: Staff Letter

Global Id: T0603700891 Action Type: **ENFORCEMENT** Date: 07/13/2015 Action: Staff Letter

Global Id: T0603700891 Action Type: **RESPONSE** Date: 10/15/2003

Action: Monitoring Report - Quarterly

Global Id: T0603700891 Action Type: **RESPONSE** Date: 06/25/2003

CAP/RAP - Feasibility Study Report Action:

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/15/2004

Action: CAP/RAP - Final Remediation / Design Plan

Global Id: T0603700891 Action Type: **RESPONSE** Date: 07/15/2006

Action: Monitoring Report - Quarterly

T0603700891 Global Id: **RESPONSE** Action Type: 01/15/2005 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603700891 RESPONSE Action Type: Date: 07/15/2016

Action: Pilot Study/ Treatability Report

T0603700891 Global Id: Action Type: **RESPONSE** Date: 07/15/2015

Action: Monitoring Report - Semi-Annually

T0603700891 Global Id: **RESPONSE** Action Type: Date: 01/15/2015

Action: Monitoring Report - Semi-Annually

T0603700891 Global Id: Action Type: REMEDIATION Date: 01/15/2004

Action: In Situ Physical/Chemical Treatment (other than SVE)

Global Id: T0603700891 Action Type: REMEDIATION 04/06/2004 Date:

Action: In Situ Physical/Chemical Treatment (other than SVE)

Direction Distance

Elevation Site Database(s) EPA ID Number

D15 MAS TEXACO SERVICE CA HIST UST U001561429
WSW 371 S FAIRFAX AVE N/A

< 1/8 LOS ANGELES, CA 90036

0.089 mi.

470 ft. Site 5 of 6 in cluster D

Relative: Lower HIST UST:
File Number:
URL:
Not reported
Not reported

Actual: 176 ft.

STATE Region: Facility ID: 00000067259 Facility Type: Gas Station Other Type: Not reported Contact Name: MAS YOSHIOKA 2138529183 Telephone: Owner Name: MAS YOSHIOKA Owner Address: 371 S. FAIRFAX AVE. Owner City, St, Zip: LOS ANGELES, CA 90036

Total Tanks: 0004

Tank Num: 001 Container Num: 1

Year Installed:

Tank Capacity:

Tank Used for:

Type of Fuel:

Not reported
00004010
WASTE
2

Container Construction Thickness: X

Leak Detection: Stock Inventor

Tank Num: 002 Container Num: 2

Year Installed:
Tank Capacity:
O0003750
Tank Used for:
Type of Fuel:
Container Construction Thickness:
Leak Detection:
Not reported
Stock Inventor

Tank Num: 003 Container Num: 3 Year Installed: 1965 Tank Capacity: 0008000 **PRODUCT** Tank Used for: Type of Fuel: UNLEADED Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 004 Container Num: 4

Year Installed:
Tank Capacity:
O0000500
Tank Used for:
WASTE
Type of Fuel:
Container Construction Thickness:
Leak Detection:
Not reported
None

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

16 THE GROVE AT FARMERS MARKET **CA SLIC** S104404706 N/A

ENE 6301 003RD

LOS ANGELES, CA 90036 < 1/8

0.098 mi. 515 ft.

SLIC REG 4: Relative:

Higher Region:

Post Remediation Monitoring Facility Status:

Actual: SLIC: 0898 185 ft. Substance: TPH

> Staff: John Geroch

D17 **EDR Hist Cleaner** 1015055010

SW **401 S FAIRFAX AVE** < 1/8 LOS ANGELES, CA 90036

0.104 mi.

547 ft. Site 6 of 6 in cluster D

EDR Historical Cleaners: Relative:

Lower Name: THRIFTY TAILOR & DRY CLEANERS

2005 Year:

Actual: 401 S FAIRFAX AVE Address:

176 ft.

THRIFTY TAILOR & DRY CLEANERS Name:

2006 Year:

Address: 401 S FAIRFAX AVE

URICK F A **EDR Hist Cleaner** 1009188469 18

NW 7051/2 W 3D

< 1/8 LOS ANGELES, CA

0.110 mi. 579 ft.

EDR Historical Cleaners: Relative:

Name: URICK F A Lower

Year:

Actual: Type: CLOTHES CLEANERS PRESSERS AND DYERS 178 ft.

SNYDER A G EDR Hist Auto 1009080701

19

SW **419 S FAIRFAX AVE** LOS ANGELES, CA < 1/8

0.115 mi. 605 ft.

EDR Historical Auto Stations: Relative:

SNYDER A G Lower Name:

Year: 1937

Actual: Type: GASOLINE AND OIL SERVICE STATIONS

176 ft.

N/A

N/A

Direction Distance

Elevation Site Database(s) **EPA ID Number**

E20 **FARMERS MARKET AUTOMOTIVE SV EDR Hist Auto** 1009082217 N/A

NNW **166 S FAIRFAX**

LOS ANGELES, CA 90036 < 1/8

0.118 mi.

623 ft. Site 1 of 3 in cluster E

EDR Historical Auto Stations: Relative:

ANDERSON V L Higher Name:

Year: 1942

Actual: Type: GASOLINE AND OIL SERVICE STATIONS

180 ft.

Name: SCHULTZ FRED E FARMERS MARKET AUTOMOTIVE CENTER

Year: 1999

166 S FAIRFAX AVE Address:

FARMERS MARKET AUTOMOTIVE CENT U001561420 E21 **CA HIST UST** N/A

NNW **166 S FAIRFAX AVE** LOS ANGELES, CA 90036 < 1/8

HIST UST:

0.118 mi.

Site 2 of 3 in cluster E 623 ft.

Relative: Higher

File Number: Not reported URL: Not reported

Actual: Region: STATE 180 ft. 00000029388 Facility ID: Facility Type: Gas Station Other Type: Not reported

> Contact Name: Not reported Telephone: 2139357251 FRED E. SCHULTZ Owner Name: Owner Address: 166 SO. FAIRFAX AVE Owner City, St, Zip: LOS ANGELES, CA 90036

Total Tanks: 0003

Tank Num: 001 Container Num: 1 Year Installed: 1964 Tank Capacity: 00000500 Tank Used for: **PRODUCT REGULAR** Type of Fuel: Container Construction Thickness: Not reported

Leak Detection: None

Tank Num: 002 Container Num: 3 Year Installed: 1971 Tank Capacity: 00080000 Tank Used for: **PRODUCT** UNLEADED Type of Fuel: Container Construction Thickness: Not reported

Leak Detection: None

Tank Num: 003 Container Num: 2 Year Installed: 1964 Tank Capacity: 00006000 **PRODUCT** Tank Used for: Type of Fuel: **PREMIUM** Container Construction Thickness: Not reported **EDR ID Number**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FARMERS MARKET AUTOMOTIVE CENT (Continued)

U001561420

Leak Detection: None

E22 **FARMERS MARKET AUTOMOTIVE CENT** **CA SWEEPS UST** S101617378 **CA HIST UST** N/A

NNW **166 S FAIRFAX AVE** LOS ANGELES, CA 90036 < 1/8

CA FID UST

0.118 mi.

623 ft. Site 3 of 3 in cluster E

SWEEPS UST: Relative:

Status: Not reported Higher Comp Number: 1767 Actual: Number: Not reported 180 ft. Board Of Equalization: 44-011964 Referral Date:

Not reported Action Date: Not reported Created Date: Not reported Owner Tank Id: Not reported

SWRCB Tank Id: 19-050-001767-000001

Tank Status: Not reported

Capacity: 500

Active Date: Not reported Tank Use: M.V. FUEL **PRODUCT** STG: **REG UNLEADED** Content:

Number Of Tanks:

Status: Not reported Comp Number: 1767

Not reported Number: Board Of Equalization: 44-011964 Referral Date: Not reported Action Date: Not reported Created Date: Not reported Not reported Owner Tank Id:

19-050-001767-000002 SWRCB Tank Id:

Not reported Tank Status: Capacity: 8000 Active Date: Not reported M.V. FUEL Tank Use: **PRODUCT** STG: Content: **REG UNLEADED** Number Of Tanks: Not reported

Not reported Status: Comp Number: 1767

Number: Not reported Board Of Equalization: 44-011964 Not reported Referral Date: Action Date: Not reported Created Date: Not reported Owner Tank Id: Not reported

19-050-001767-000003 SWRCB Tank Id:

Not reported Tank Status: Capacity: 6000 Active Date: Not reported M.V. FUEL Tank Use: **PRODUCT** STG: Content: **REG UNLEADED**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FARMERS MARKET AUTOMOTIVE CENT (Continued)

S101617378

Number Of Tanks: Not reported

HIST UST:

File Number: 000268EB

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/000268EB.pdf

Region: Not reported Facility ID: Not reported Facility Type: Not reported Other Type: Not reported Contact Name: Not reported Telephone: Not reported Owner Name: Not reported Not reported Owner Address: Owner City, St, Zip: Not reported Total Tanks: Not reported

Tank Num: Not reported Container Num: Not reported Year Installed: Not reported Tank Capacity: Not reported Tank Used for: Not reported Type of Fuel: Not reported Container Construction Thickness: Not reported Leak Detection: Not reported

Click here for Geo Tracker PDF:

CA FID UST:

19017476 Facility ID: Regulated By: UTNKI Regulated ID: 00029388 Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2139357251 Mail To: Not reported Mailing Address: 166 S FAIRFAX AVE Mailing Address 2: Not reported

Mailing City, St, Zip: LOS ANGELES 900360000

Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported NPDES Number: Not reported EPA ID: Not reported Not reported Comments: Status: Inactive

23 THE GROVE AT FARMERS MARKET NNE

6301 WEST THIRD ST 1/8-1/4 LOS ANGELES, CA

0.141 mi. 742 ft.

SLIC: Relative:

Region: STATE Higher

Facility Status: Open - Verification Monitoring

Actual: Status Date: 01/21/2000 186 ft. Global Id: SL2049G1726 CA SLIC S106484026

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

THE GROVE AT FARMERS MARKET (Continued)

S106484026

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Lead Agency Case Number: Not reported Latitude: 34.071211 Longitude: -118.358632

Case Type: Cleanup Program Site

Case Worker: KL

Local Agency: Not reported RB Case Number: 0898

File Location: Regional Board

Potential Media Affected: Indoor Air, Aquifer used for drinking water supply, Soil, Soil Vapor

Potential Contaminants of Concern: Not reported

Site History: The Grove is a 16-acre commercial development site, has been

historically related to oil production operations. Soil, soil gas, and groundwater beneath the property are impacted by petroleum hydrocarbons. No free product is present at the site. No municipal supply well is located within three miles from the site. Shallow aquifer is at 5 to 25 feet below grade. Several phases of

environmental assessments including health risk assessment and remediation were conducted through 2000. Site soil gas mitigation system under residential landuse including vapor barrier and venting system for indoor air exposure pathway was permitted and installed. The complete site improvements satisfied human health protection requirements. The site has been redeveloped as commercial land-use

prevents additional excavation.

Click here to access the California GeoTracker records for this facility:

F24 P & K ACCOCIATES CT MANIFEST S109737066

NNW 145 SOUTH FAIRFAX AVE 1/8-1/4 LOS ANGELES, CA 90036

0.178 mi.

940 ft. Site 1 of 2 in cluster F

Relative: CT MANIFEST:

Higher

Detail:

Actual: 180 ft.

 Year:
 1987

 Manifest Id:
 INA0229106

 EPA ID:
 CTP000007200

 TSDF EPA ID:
 IND078911146

TSDF Name: ADAMS CENTER LANDFILL TSDF Address: 4636 ADAMS CENTER RD TSDF City,St,Zip: FORT WAYNE, ND 46806

TSDF Country: USA

TSDF Telephone: Not reported
Transport Date: 04/07/1987
Transporter EPA ID: NYD051809952
Transporter Name: BUFFALO FUEL CORP

Transporter Address: Not reported

Transporter City,St,Zip: CT
Transporter Country: USA
Transporter Phone: Not r

Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported

Trans 2 City,St,Zip: CT
Trans 2 Country: USA

Direction Distance

Elevation Site Database(s) **EPA ID Number**

P & K ACCOCIATES (Continued)

S109737066

EDR ID Number

Trans 2 Phone: Not reported 2139378200 Generator Phone:

Generator Mailing Addr: 145 SOUTH FAIRFAX AVE

Generator Mailing City/State/Zip: 90036 Generator Mailing Country: USA Special Handling: Yes Discrepancies: No Date Shipped: 04/07/1987 Date Received: Not reported Last modified date: 04/27/2004 Last modified by: IG

Comments: Not reported

Waste:

Year: 1987 Manifest Id: INA0229106

Waste Occurence: 1 UNNA: 9189 Hazard Class: ORM-E

HAZARDOUS WASTE SOLID NOS (CREOSOTE) US Dot Description:

001 No of Containers: Container Type: DT Quantity: 18 Weight/Volume: Υ Additional Description: Υ

Not reported Handling Code: Date Record Was Last Modified: 2004-04-27 00:00:00

DEO Who Last Modified Record: IG EPA Waste Code: U051 Recycled Waste?: False

Date Record Was Last Modified: 2004-04-27 00:00:00

F25 **FARMERS MARKET CAR WASH (FORMER)**

118 S FAIRFAX AVE LOS ANGELES, CA 90036

1/8-1/4 0.179 mi.

NNW

Site 2 of 2 in cluster F 944 ft.

LUST: Relative:

Higher Region: STATE Global Id: T060377671 Actual: Latitude: 34.0731887 181 ft. -118.361385 Longitude:

> Case Type: **LUST Cleanup Site** Status: Completed - Case Closed

Status Date: 01/22/2002 Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker: JH

Local Agency: LOS ANGELES, CITY OF

900360243 RB Case Number: LOC Case Number: Not reported File Location: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Site History: Not reported CA LUST

S109283858

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FARMERS MARKET CAR WASH (FORMER) (Continued)

S109283858

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T060377671

Contact Type: Regional Board Caseworker

Contact Name: JAY HUANG

Organization Name: LOS ANGELES RWQCB (REGION 4) 320 WEST 4TH STREET, SUITE 200 Address:

City: LOS ANGELES

Email: jhuang@waterboards.ca.gov

Phone Number: 2135766711

Status History:

Global Id: T060377671

Status: Completed - Case Closed

Status Date: 01/22/2002

Global Id: T060377671

Open - Case Begin Date Status:

Status Date: 10/31/2001

Regulatory Activities:

Global Id: T060377671 Action Type: Other Date: 10/31/2001 Leak Reported Action:

G26 FARMERS MARKET AUTO CENTER NNW **166 FAIRFAX AVE S**

1/8-1/4 PARK LA BREA, CA 90036

0.187 mi.

988 ft. Site 1 of 2 in cluster G

LUST: Relative: Higher

Region: STATE Global Id: T0603700901 Latitude: 34.0732958

Actual: 181 ft. Longitude: -118.3612758 Case Type: LUST Cleanup Site Completed - Case Closed Status:

> Status Date: 08/21/2000

Lead Agency: LOS ANGELES, CITY OF

Case Worker:

LOS ANGELES, CITY OF Local Agency:

RB Case Number: 900360207 LOC Case Number: Not reported File Location: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Not reported Site History:

Click here to access the California GeoTracker records for this facility:

Contact:

T0603700901 Global Id:

Contact Type: Local Agency Caseworker CA LUST S104159596

N/A

CA HIST CORTESE

Direction Distance

Elevation Site Database(s) EPA ID Number

FARMERS MARKET AUTO CENTER (Continued)

Contact Name: ELOY LUNA

Organization Name: LOS ANGELES, CITY OF
Address: 200 North Main Street, Suite 1780

City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

Global Id: T0603700901

Contact Type: Regional Board Caseworker

Contact Name: YUE RONG

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: 320 W. 4TH ST., SUITE 200

City: Los Angeles

Email: yrong@waterboards.ca.gov

Phone Number: Not reported

Status History:

Global Id: T0603700901

Status: Completed - Case Closed

Status Date: 08/21/2000

Global Id: T0603700901

Status: Open - Case Begin Date

Status Date: 05/13/1992

Global Id: T0603700901 Status: Open - Remediation

Status Date: 08/03/1992

Regulatory Activities:

 Global Id:
 T0603700901

 Action Type:
 Other

 Date:
 05/13/1992

 Action:
 Leak Discovery

 Global Id:
 T0603700901

 Action Type:
 Other

 Date:
 08/03/1992

 Action:
 Leak Reported

LUST REG 4:

Region: 4 Regional Board: 04

County: Los Angeles
Facility Id: 900360207
Status: Case Closed
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported

Case Type: Soil

Abatement Method Used at the Site: Not reported

Global ID: T0603700901
W Global ID: Not reported
Staff: UNK
Local Agency: 19050

TC4930273.2s Page 40

S104159596

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FARMERS MARKET AUTO CENTER (Continued)

S104159596

Cross Street: W 003RD ST **Enforcement Type:** Not reported Date Leak Discovered: 5/13/1992

Date Leak First Reported: 8/3/1992

Date Leak Record Entered: 5/23/1995 Date Confirmation Began: Not reported Date Leak Stopped: Not reported

Date Case Last Changed on Database: 5/23/1995 Date the Case was Closed: 4/14/1993

How Leak Discovered: Tank Closure How Leak Stopped: Not reported Cause of Leak: UNK UNK Leak Source:

Operator: **OLD CASENO WAS 052395-15**

Water System: Not reported Well Name: Not reported

Approx. Dist To Production Well (ft): 7084.2179942216602106888247912

Source of Cleanup Funding: UNK

Preliminary Site Assessment Workplan Submitted: Not reported Preliminary Site Assessment Began: Not reported Pollution Characterization Began: Not reported Remediation Plan Submitted: 8/3/1992 Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: Not reported Not reported **Enforcement Action Date:** Not reported Historical Max MTBE Date: Hist Max MTBE Conc in Groundwater: Not reported Hist Max MTBE Conc in Soil: Not reported Significant Interim Remedial Action Taken: Not reported

GW Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported A.F. GILMORE CO Responsible Party:

RP Address: PO BOX 480314 LA CA 90048

LUST Program: 34.0732958 / -1 Lat/Long: Local Agency Staff: PEJ

Beneficial Use: Not reported Priority: Not reported Cleanup Fund Id: Not reported Suspended: Not reported

Assigned Name: Not reported

GROUNDWATER @ 22.7' BGS Summary:

HIST CORTESE:

CORTESE Region: Facility County Code: 19 **LTNKA** Reg By: 900360207 Reg Id:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

G27 JERALD FRIEDMAN/J KORNWASSEP **CA SWEEPS UST** S101586998 **CA FID UST** N/A

CA HAZNET

NNW 145 S FAIRFAX AVE 1/8-1/4 LOS ANGELES, CA 90036

0.203 mi.

1070 ft. Site 2 of 2 in cluster G

SWEEPS UST: Relative:

Higher Status: Not reported

Comp Number: 7981 Actual: Number: Not reported 181 ft. Not reported

Board Of Equalization: Referral Date: Not reported Action Date: Not reported Not reported Created Date: Not reported Owner Tank Id: SWRCB Tank Id: Not reported Tank Status: Not reported Not reported Capacity: Active Date: Not reported Tank Use: Not reported STG: Not reported Content: Not reported

CA FID UST:

Number Of Tanks:

19054692 Facility ID: Regulated By: UTNKI Regulated ID: Not reported Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2130000000 Not reported Mail To: Mailing Address: UNK

Mailing Address 2: Not reported

LOS ANGELES 900360000 Mailing City, St, Zip:

Not reported

Contact: Not reported Not reported Contact Phone: Not reported **DUNs Number:** NPDES Number: Not reported EPA ID: Not reported Not reported Comments: Status: Inactive

HAZNET:

envid: S101586998 Year: 2015

GEPAID: CAL000390271

Contact: RHONDA STARKS OPERATIONS MGR

Telephone: 3235492115 Mailing Name: Not reported Mailing Address: 6301 W 3RD ST

Mailing City, St, Zip: LOS ANGELES, CA 900360000

Gen County: Los Angeles TSD EPA ID: PAD089352983 TSD County: Not reported

Waste Category: Other inorganic solid waste

Disposal Method: Metals Recovery Including Retoring, Smelting, Chemicals, Ect

Tons: 0.9275

Direction Distance

Elevation Site Database(s) EPA ID Number

JERALD FRIEDMAN/J KORNWASSEP (Continued)

S101586998

EDR ID Number

Cat Decode: Other inorganic solid waste

Method Decode: Metals Recovery Including Retoring, Smelting, Chemicals, Ect

Facility County: Los Angeles

envid: \$101586998 Year: 2015

GEPAID: CAL000390271

Contact: RHONDA STARKS OPERATIONS MGR

Telephone: 3235492115
Mailing Name: Not reported
Mailing Address: 6301 W 3RD ST

Mailing City, St, Zip: LOS ANGELES, CA 900360000

Gen County: Los Angeles
TSD EPA ID: CAD097030993
TSD County: Los Angeles

Waste Category: Unspecified oil-containing waste

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 1.43805

Cat Decode: Unspecified oil-containing waste

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Los Angeles

envid: \$101586998 Year: 2014

GEPAID: CAL000390271

Contact: RHONDA STARKS OPERATIONS MGR

Telephone: 3235492115
Mailing Name: Not reported
Mailing Address: 6301 W 3RD ST

Mailing City, St, Zip: LOS ANGELES, CA 900360000

Gen County: Los Angeles
TSD EPA ID: CAD097030993
TSD County: Los Angeles

Waste Category: Unspecified oil-containing waste

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 2.33805
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Los Angeles

envid: \$101586998

Year: 2013

GEPAID: CAL000390271
Contact: RHONDA STARKS
Telephone: 3235492115
Mailing Name: Not reported
Mailing Address: 6301 W 3RD ST

Mailing City, St, Zip: LOS ANGELES, CA 90036

Gen County: Los Angeles
TSD EPA ID: CAD097030993
TSD County: Los Angeles
Waste Category: Not reported

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

JERALD FRIEDMAN/J KORNWASSEP (Continued)

S101586998

Tons: 0.75

Cat Decode: Not reported Not reported Method Decode: Not reported Facility County:

28 MAC 695441

RCRA-SQG 1019899519 189 THE GROVE DR SPC. 0-20 CAR000265785 **ECHO** LOS ANGELES, CA 90036

1/8-1/4 0.222 mi. 1173 ft.

ENE

RCRA-SQG: Relative:

Higher Date form received by agency: 06/17/2016 Facility name: MAC 695441

Actual: Facility address: 189 THE GROVE DR SPC. 0-20 193 ft.

LOS ANGELES, CA 90036

EPA ID: CAR000265785 Mailing address: PYOTT RD. STE.100

LAKE IN THE HILLS, CA 60156

Contact: JESSICA A OTTO Contact address: PYOTT RD. STE.100

LAKE IN THE HILLS, CA 60156

Contact country:

(815) 862-3501 Contact telephone:

Contact email: JESSICA.OTTO@G2REV.COM

EPA Region:

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: ESTEE LAUDER, INC.

Owner/operator address: FIFTH AVE

NEW YORK, NY 10153

Owner/operator country: US

Owner/operator telephone: (212) 572-4200

Legal status: Private

Owner/Operator Type: Operator Owner/Op start date: 07/01/2016 Owner/Op end date: Not reported

Owner/operator name: ESTEE LAUDER, INC.

Owner/operator address: FIFTH AVE

NEW YORK, NY 10153

Owner/operator country: US

(212) 572-4200 Owner/operator telephone: Legal status: Private Owner/Operator Type: Owner Owner/Op start date: 07/01/2016 Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAC 695441 (Continued) 1019899519

Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No

Used oil transfer facility: No Used oil transporter: No

Waste code: 352 352 Waste name:

Waste code: D001

Waste name: **IGNITABLE WASTE**

Violation Status: No violations found

ECHO:

Envid: 1019899519 Registry ID: 110069706562

DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110069706562

STATE

H29 **MAJESTIC CAR WASH** CA LUST S104406314 **CA HIST CORTESE** WNW 8017 003RD ST W N/A

1/8-1/4 0.223 mi.

1176 ft. Site 1 of 4 in cluster H

LOS ANGELES, CA 90048

LUST: Relative: Region: Lower

Global Id: T0603701108 Actual: Latitude: 34.0719638 174 ft. Longitude: -118.3642348 Case Type: LUST Cleanup Site Status: Completed - Case Closed

Status Date: 04/29/1996

Lead Agency: LOS ANGELES, CITY OF

Case Worker: FΙ

LOS ANGELES, CITY OF Local Agency:

900480089 RB Case Number: LOC Case Number: Not reported File Location: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Gasoline Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603701108

Contact Type: Local Agency Caseworker

ELOY LUNA Contact Name:

LOS ANGELES, CITY OF Organization Name:

Address: 200 North Main Street, Suite 1780

Direction Distance

Elevation Site Database(s) EPA ID Number

MAJESTIC CAR WASH (Continued)

S104406314

EDR ID Number

City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

Global Id: T0603701108

Contact Type: Regional Board Caseworker

Contact Name: YUE RONG

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: 320 W. 4TH ST., SUITE 200

City: Los Angeles

Email: yrong@waterboards.ca.gov

Phone Number: Not reported

Status History:

Global Id: T0603701108

Status: Completed - Case Closed

Status Date: 04/29/1996

Global Id: T0603701108

Status: Open - Case Begin Date

Status Date: 03/07/1995

Global Id: T0603701108
Status: Open - Remediation

Status Date: 12/11/1995

Global Id: T0603701108

Status: Open - Site Assessment

Status Date: 03/07/1995

Regulatory Activities:

 Global Id:
 T0603701108

 Action Type:
 Other

 Date:
 03/07/1995

 Action:
 Leak Discovery

 Global Id:
 T0603701108

 Action Type:
 Other

 Date:
 03/07/1995

 Action:
 Leak Stopped

 Global Id:
 T0603701108

 Action Type:
 Other

 Date:
 12/11/1995

 Action:
 Leak Reported

LUST REG 4:

Region: 4 Regional Board: 04

County: Los Angeles
Facility Id: 900480089
Status: Case Closed
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAJESTIC CAR WASH (Continued)

S104406314

Case Type: Soil

Abatement Method Used at the Site: Excavate and Dispose

Global ID: T0603701108 W Global ID: Not reported Staff: UNK Local Agency: 19050

Cross Street: **EDINGBURGH Enforcement Type:** Not reported Date Leak Discovered: 3/7/1995

Date Leak First Reported: 12/11/1995

Date Leak Record Entered: 12/28/1995 Date Confirmation Began: Not reported Date Leak Stopped: 3/7/1995

Date Case Last Changed on Database: 4/29/1996 Date the Case was Closed: 4/29/1996

How Leak Discovered: Tank Closure How Leak Stopped: Not reported Cause of Leak: Corrosion Leak Source: Tank

IGOR PAKHOVER Operator: Water System: Not reported Well Name: Not reported

Approx. Dist To Production Well (ft): 6080.7792379764029781189229577

Source of Cleanup Funding: Tank

Preliminary Site Assessment Workplan Submitted: Not reported Not reported Preliminary Site Assessment Began: Pollution Characterization Began: 3/7/1995 Remediation Plan Submitted: 12/11/1995 Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: Not reported **Enforcement Action Date:** Not reported Historical Max MTBE Date: Not reported Hist Max MTBE Conc in Groundwater: Not reported Hist Max MTBE Conc in Soil: Not reported Significant Interim Remedial Action Taken: Not reported

GW Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported

Responsible Party: MAJESTIC CAR WASH

RP Address: 8017 003RD ST W, LOS ANGELES 90048

Program: LUST

Lat/Long: 34.0719638 / -1

Local Agency Staff: PEJ

Beneficial Use: Not reported Not reported Priority: Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported

Summary: OLD CASE #951228-01

HIST CORTESE:

CORTESE Region: Facility County Code: 19 Reg By: **LTNKA** Reg Id: 900480089

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

30 PARAMOUNT CLEANERS CA DRYCLEANERS S106077027 SSW 487 S FAIRFAX AVE N/A

SSW 487 S FAIRFAX AVE 1/8-1/4 LOS ANGELES, CA 90036

0.225 mi. 1190 ft.

Relative: DRYCLEANERS:

Lower EPA ld: CAL000264885

NAICS Code: 81232

Actual: NAICS Description: Drycleaning and Laundry Services (except Coin-Operated)

173 ft. SIC Code: 7211

SIC Description: Power Laundries, Family and Commercial

Create Date: 01/14/2003
Facility Active: No
Inactive Date: 06/30/2008
Facility Addr2: Not reported

Owner Name: PARAMOUNT CLEANERS
Owner Address: 487 S FAIRFAX AVE

Owner Address 2: Not reported Owner Telephone: 3239331421

Contact Name: JOSEPH SHABATIAN/OWNER

Contact Address: 487 S FAIRFAX AVE

Contact Address 2: Not reported Contact Telephone: 3239331421

Mailing Name: JOSEPH SHABATIAN/OWNER

Mailing Address 1: 487 S FAIRFAX AVE
Mailing Address 2: Not reported
Mailing City: LOS ANGELES

Mailing State: CA

Mailing Zip: 900360000
Owner Fax: Not reported

Region Code: 3

H31 MAJESTIC CAR WASH CA HIST UST S118412625 WNW 8017 W THIRD STREET N/A

WNW 8017 W THIRD STREET 1/8-1/4 LOS ANGELES, CA 90048

0.244 mi.

1286 ft. Site 2 of 4 in cluster H

Relative: Lower HIST UST:

Region:

File Number: 0002639B

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002639B.pdf

Not reported

Actual: 173 ft.

Facility ID: Not reported Facility Type: Not reported Other Type: Not reported Contact Name: Not reported Telephone: Not reported Owner Name: Not reported Owner Address: Not reported Owner City, St, Zip: Not reported Total Tanks: Not reported

Tank Num:

Container Num:

Year Installed:

Tank Capacity:

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MAJESTIC CAR WASH (Continued)

S118412625

S101617532

N/A

CA SWEEPS UST

CA FID UST

Leak Detection: Not reported

Click here for Geo Tracker PDF:

H32 **MAJESTIC CAR WASH** WNW 8017 W 3RD ST

1/8-1/4

0.244 mi.

LOS ANGELES, CA 90048

1286 ft. Site 3 of 4 in cluster H

Relative: Lower

SWEEPS UST:

Status: Active Comp Number: 6041 Number:

Actual: 173 ft.

Board Of Equalization: Not reported

03-03-93 Referral Date: Action Date: 04-11-94 Created Date: 02-29-88 Owner Tank Id: Not reported SWRCB Tank Id: Not reported Not reported Tank Status: Capacity: Not reported Active Date: Not reported Not reported Tank Use: STG: Not reported Not reported Content: Number Of Tanks: Not reported

CA FID UST:

Facility ID: 19038137 Regulated By: **UTNKA** Regulated ID: Not reported Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2139337393 Mail To: Not reported Mailing Address: 8017 W 3RD ST Mailing Address 2: Not reported

LOS ANGELES 900480000 Mailing City, St, Zip:

Contact: Not reported Contact Phone: Not reported Not reported **DUNs Number:** NPDES Number: Not reported EPA ID: Not reported Comments: Not reported Status: Active

TC4930273.2s Page 49

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

H33 MAJESTIC CAR WASH CA HIST UST U001561958 WNW 8017 W 3RD ST N/A

1/8-1/4 LOS ANGELES, CA 90048

0.244 mi.

Actual:

173 ft.

1286 ft. Site 4 of 4 in cluster H

Relative: HIST UST: Lower File Num

File Number:
URL:
Region:
STATE
Facility ID:
Other
Other Type:
Contact Name:
Not reported
Not reported
Ooto00065816
CAR WASH
Not reported

Telephone: 2139337394

Owner Name: ANVERSICE INC.

Owner Address: 8017 W. THIRD STREET

Owner City, St, Zip: LOS ANGELES, CA 90048

Total Tanks: 0003

Tank Num: 001 Container Num: 1

Year Installed:
Tank Capacity:
O0010000
Tank Used for:
Type of Fuel:
Container Construction Thickness:
Leak Detection:
Not reported
Stock Inventor

Tank Num: 002 Container Num: 4

Year Installed:
Tank Capacity:
O0000000
Tank Used for:
Type of Fuel:
Container Construction Thickness:
Leak Detection:
Not reported
Not reported
Visual

Tank Num: 003 Container Num: 2

Year Installed:

Tank Capacity:

Tank Used for:

Type of Fuel:

Container Construction Thickness:

Leak Detection:

Not reported

PREMIUM

Not reported

Stock Inventor

AUTO SERVICE CHUCKS 105 S FAIRFAX AVE LOS ANGELES, CA 90036

1/8-1/4 0.248 mi. 1310 ft.

34 NNW

Relative: SWEEPS UST:

Higher Status: Not reported

Comp Number: 4055
Actual: Number: Not reported

181 ft.

Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: Not reported

Not reported

N/A

CA FID UST

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AUTO SERVICE CHUCKS (Continued)

S101585651

Created Date: Not reported Owner Tank Id: Not reported SWRCB Tank Id: Not reported Not reported Tank Status: Capacity: Not reported Not reported Active Date: Not reported Tank Use: STG: Not reported Not reported Content: Number Of Tanks: Not reported

CA FID UST:

19027094 Facility ID: Regulated By: **UTNKA** Regulated ID: Not reported Cortese Code: Not reported SIC Code: Not reported Facility Phone: 2130000000 Mail To: Not reported Mailing Address: 105 S FAIRFAX AVE

Mailing Address 2: Not reported

LOS ANGELES 900360000 Mailing City, St, Zip:

Contact: Not reported Contact Phone: Not reported **DUNs Number:** Not reported NPDES Number: Not reported Not reported EPA ID: Comments: Not reported Status: Active

CA LUST S104583666 **CBS TELEVISION CITY** 7800 BEVERLY **CA HIST CORTESE** N/A

1/4-1/2 LOS ANGELES, CA 90036 0.293 mi.

Site 1 of 2 in cluster I 1548 ft. LUST:

Relative: Higher

Actual:

190 ft.

135

North

Region: STATE T0603700889 Global Id: Latitude: 34.075137 Longitude: -118.360165

Case Type: LUST Cleanup Site Status: Completed - Case Closed

Status Date: 09/17/1998

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker:

Local Agency: LOS ANGELES, CITY OF

RB Case Number: 900360089 LOC Case Number: Not reported File Location: Not reported

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Diesel Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603700889

Direction Distance

Elevation Site Database(s) EPA ID Number

CBS TELEVISION CITY (Continued)

S104583666

EDR ID Number

Contact Type: Regional Board Caseworker

Contact Name: CHANDRA TYLER

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: Not reported City: R4 UNKNOWN

Email: cetyler@waterboards.ca.gov

Phone Number: Not reported

Global Id: T0603700889

Contact Type: Local Agency Caseworker

Contact Name: ELOY LUNA

Organization Name: LOS ANGELES, CITY OF

Address: 200 North Main Street, Suite 1780

City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

Status History:

Global Id: T0603700889

Status: Completed - Case Closed

Status Date: 09/17/1998

Global Id: T0603700889

Status: Open - Case Begin Date

Status Date: 11/13/1987

Global Id: T0603700889

Status: Open - Site Assessment

Status Date: 05/09/1990

Global Id: T0603700889

Status: Open - Site Assessment

Status Date: 05/11/1993

Global Id: T0603700889

Status: Open - Site Assessment

Status Date: 12/01/1993

Regulatory Activities:

 Global Id:
 T0603700889

 Action Type:
 Other

 Date:
 11/13/1987

 Action:
 Leak Discovery

 Global Id:
 T0603700889

 Action Type:
 Other

 Date:
 05/09/1990

 Action:
 Leak Reported

HIST CORTESE:

Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900360089

Direction Distance

Elevation Site Database(s) EPA ID Number

I36 CBS TELEVISION CITY CA LUST U001561418
North 7800 BEVERLY BLVD CA HIST UST N/A

1/4-1/2 LOS ANGELES, CA 90036

0.293 mi.

1548 ft. Site 2 of 2 in cluster I

Relative: LUST REG 4:

Higher Region: 4
Regional Board: 04

Actual: County: Los Angeles
190 ft. Facility ld: 900360089

Status: Case Closed
Substance: Diesel
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater

Abatement Method Used at the Site: EDET

Global ID: T0603700889
W Global ID: Not reported
Staff: CEC
Local Agency: 19050

Cross Street: GENESEE AVE
Enforcement Type: Not reported
Date Leak Discovered: 11/13/1987

Date Leak First Reported: 5/9/1990

Date Leak Record Entered: 5/16/1990
Date Confirmation Began: 5/9/1990
Date Leak Stopped: Not reported

Date Case Last Changed on Database: 2/4/1998
Date the Case was Closed: 9/17/1998

How Leak Discovered: OM

How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: Tank Operator: Not reported Water System: Not reported Well Name: Not reported

Approx. Dist To Production Well (ft): 7968.651235996145687417852384

Source of Cleanup Funding: Tank Preliminary Site Assessment Workplan Submitted: Not reported 5/11/1993 Preliminary Site Assessment Began: Pollution Characterization Began: 12/1/1993 Remediation Plan Submitted: Not reported Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: Not reported **Enforcement Action Date:** Not reported Historical Max MTBE Date: 1/1/1965 Hist Max MTBE Conc in Groundwater: 600 Hist Max MTBE Conc in Soil: 6280

Significant Interim Remedial Action Taken: Not reported GW Qualifier: Not reported

Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported

Responsible Party: CBS INC. TELEVISION CITY

RP Address: 7800 BEVERLY BLVD, LOS ANGELES CA 90036

Program: LUST Lat/Long: 34.0759397 / -1

Local Agency Staff: PEJ

EDR ID Number

CA CHMIRS

CA EMI

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CBS TELEVISION CITY (Continued)

U001561418

Beneficial Use: Not reported

LOP/LOW - MINOR OR NO POTENTIAL WATER RESOURCE IMPACT Priority:

Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported

7718 BEVERLY BLVD. CONDUCTING GW MONITORING AND SAMPLING PROGRAM Summary:

FOR ONSITE AND OFFSITE WELLS AT CBS FACILITY.

HIST UST:

File Number: 00026A87

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00026A87.pdf

Region: STATE Facility ID: 00000066198 Facility Type: Other

Other Type: TV PRODUCTION Contact Name: LEO GREGORY Telephone: 2138522461

Owner Name: CBS, INC. ATTN: DIRECTOR, FAC

Owner Address: 7800 BEVERLY BLVD. LOS ANGELES, CA 90036 Owner City, St, Zip:

Total Tanks: 0003

Tank Num: 001 Container Num: #1 1952 Year Installed: Tank Capacity: 00001000 Tank Used for: WASTE Type of Fuel:

Container Construction Thickness: Χ

Leak Detection: Stock Inventor, None

Tank Num: 002 Container Num: #2 Year Installed: 1952 Tank Capacity: 0008000 Tank Used for: **PRODUCT** Type of Fuel: DIESEL Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 003 Container Num: #3 Year Installed: 1952 0008000 Tank Capacity: **PRODUCT** Tank Used for: DIESEL Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Click here for Geo Tracker PDF:

CHMIRS:

OES Incident Number: 2-0382 OES notification: 01/20/2002 OES Date: Not reported **OES Time:** Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

CBS TELEVISION CITY (Continued)

U001561418

EDR ID Number

Date Completed: Not reported Property Use: Not reported Not reported Agency Id Number: Agency Incident Number: Not reported Time Notified: Not reported Time Completed: Not reported Surrounding Area: Not reported **Estimated Temperature:** Not reported **Property Management:** Not reported More Than Two Substances Involved?: Not reported Resp Agncy Personel # Of Decontaminated: Not reported Responding Agency Personel # Of Injuries: Not reported Responding Agency Personel # Of Fatalities: Not reported Others Number Of Decontaminated: Not reported Others Number Of Injuries: Not reported Others Number Of Fatalities: Not reported Not reported Vehicle Make/year: Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA DOT PUC/ICC Number: Not reported Company Name: Not reported Not reported Reporting Officer Name/ID: Report Date: Not reported Facility Telephone: Not reported Waterway Involved: Yes

Waterway: Ballona Creek Spill Site: Not reported Cleanup By: Reporting Party Containment: Not reported Not reported What Happened: Type: Not reported Measure: Not reported Other: Not reported Date/Time: Not reported Year: 2002

Agency: City of Los Angeles Incident Date: 1/20/200212:00:00 AM

Admin Agency: Los Angeles City Fire Department

Amount:

Contained:

Yes
Site Type:
Road
E Date:
Not reported
Substance:
Sewage
Gallons:
4643
Unknown:

Not reported
Sewage

Substance #2: Not reported Substance #3: Not reported

Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0

#1 Pipeline:

#2 Pipeline:

#3 Pipeline:

#1 Vessel >= 300 Tons:

#2 Vessel >= 300 Tons:

#3 Vessel >= 300 Tons:

Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CBS TELEVISION CITY (Continued)

U001561418

Evacs: Not reported Injuries: Not reported Fatals: Not reported Comments: Not reported

Description: A grease blockage in line caused overflow.

EMI:

1990 Year: County Code: 19 Air Basin: SC Facility ID: 54167 Air District Name: SC SIC Code: 3398

SOUTH COAST AQMD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 75 Reactive Organic Gases Tons/Yr: 7 Carbon Monoxide Emissions Tons/Yr: 31 NOX - Oxides of Nitrogen Tons/Yr: 7 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 1993 County Code: 19 Air Basin: SC Facility ID: 54167 Air District Name: SC 3398 SIC Code:

Air District Name: SOUTH COAST AQMD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 37 Reactive Organic Gases Tons/Yr: 3 Carbon Monoxide Emissions Tons/Yr: 28 NOX - Oxides of Nitrogen Tons/Yr: 6 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 1995 County Code: 19 SC Air Basin: Facility ID: 54167 Air District Name: SC SIC Code: 3398

SOUTH COAST AQMD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 37 Reactive Organic Gases Tons/Yr: Carbon Monoxide Emissions Tons/Yr: 28 NOX - Oxides of Nitrogen Tons/Yr: 6 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Direction Distance

Elevation Site Database(s) EPA ID Number

CBS TELEVISION CITY (Continued)

U001561418

EDR ID Number

 Year:
 1996

 County Code:
 19

 Air Basin:
 SC

 Facility ID:
 54167

 Air District Name:
 SC

 SIC Code:
 3398

Air District Name: SOUTH COAST AQMD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 210
Reactive Organic Gases Tons/Yr: 19
Carbon Monoxide Emissions Tons/Yr: 24
NOX - Oxides of Nitrogen Tons/Yr: 31
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 1997

 County Code:
 19

 Air Basin:
 SC

 Facility ID:
 54167

 Air District Name:
 SC

 SIC Code:
 3398

Air District Name: SOUTH COAST AQMD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 156
Reactive Organic Gases Tons/Yr: 14
Carbon Monoxide Emissions Tons/Yr: 22
NOX - Oxides of Nitrogen Tons/Yr: 5
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 1998

 County Code:
 19

 Air Basin:
 SC

 Facility ID:
 54167

 Air District Name:
 SC

 SIC Code:
 3398

Air District Name: SOUTH COAST AQMD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 193
Reactive Organic Gases Tons/Yr: 18
Carbon Monoxide Emissions Tons/Yr: 22
NOX - Oxides of Nitrogen Tons/Yr: 5
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 1999

 County Code:
 19

 Air Basin:
 SC

 Facility ID:
 54167

 Air District Name:
 SC

 SIC Code:
 3398

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CBS TELEVISION CITY (Continued)

U001561418

Air District Name: SOUTH COAST AQMD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 156 Reactive Organic Gases Tons/Yr: 14 Carbon Monoxide Emissions Tons/Yr: 22 NOX - Oxides of Nitrogen Tons/Yr: 5 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: 0 Part. Matter 10 Micrometers and Smllr Tons/Yr:0

2000 Year: County Code: 19 Air Basin: SC Facility ID: 54167 Air District Name: SC SIC Code: 3398

SOUTH COAST AQMD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 156 Reactive Organic Gases Tons/Yr: 14 Carbon Monoxide Emissions Tons/Yr: 22 NOX - Oxides of Nitrogen Tons/Yr: 5 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Λ Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Year: 2001 County Code: 19 Air Basin: SC Facility ID: 54167 Air District Name: SC SIC Code: 3398

SOUTH COAST AQMD Air District Name:

Community Health Air Pollution Info System: Not reported

Consolidated Emission Reporting Rule: В Total Organic Hydrocarbon Gases Tons/Yr: 156 Reactive Organic Gases Tons/Yr: 14 Carbon Monoxide Emissions Tons/Yr: 22 NOX - Oxides of Nitrogen Tons/Yr: 5 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

WORLD OIL CO **J37** RCRA-SQG 1000278377 NNW 7900 BEVERLY BLVD CA LUST CAD981160831

1/4-1/2 LOS ANGELES, CA 90048 0.374 mi.

1973 ft. Site 1 of 3 in cluster J

FINDS Relative: **ECHO** Higher **CA HAZNET**

Actual: RCRA-SQG:

192 ft. Date form received by agency: 09/01/1996

Facility name: WORLD OIL CO Facility address: 7900 BEVERLY BLVD **CA SWEEPS UST CA HIST UST**

CA FID UST

Direction Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

WORLD OIL CO (Continued)

1000278377

LOS ANGELES, CA 90048

EPA ID: CAD981160831 9302 S GARFIELD Mailing address:

SOUTH GATE, CA 90280

Contact: Not reported Contact address: Not reported

Not reported

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

WORLD OIL MARKETING CO #64 Owner/operator name:

NOT REQUIRED Owner/operator address:

NOT REQUIRED, ME 99999

Owner/operator country: Not reported Owner/operator telephone: (415) 555-1212 Legal status: Private Owner/Operator Type: Owner

Owner/Op start date: Not reported Owner/Op end date: Not reported

NOT REQUIRED Owner/operator name: Owner/operator address: **NOT REQUIRED**

NOT REQUIRED, ME 99999

Not reported

Owner/operator country: Not reported Owner/operator telephone: (415) 555-1212 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported

Handler Activities Summary:

Owner/Op end date:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Direction Distance

Elevation Site Database(s) EPA ID Number

WORLD OIL CO (Continued) 1000278377

Historical Generators:

Date form received by agency: 10/29/1985
Site name: WORLD OIL CO
Classification: Large Quantity Generator

Violation Status: No violations found

LUST:

 Region:
 STATE

 Global Id:
 T0603701107

 Latitude:
 34.075787

 Longitude:
 -118.36178

 Case Type:
 LUST Cleanup Site

 Status:
 Completed - Case Closed

Status Date: 12/13/1996

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker: YR

Local Agency: LOS ANGELES, CITY OF

RB Case Number: 900480070
LOC Case Number: Not reported
File Location: Not reported

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603701107

Contact Type: Local Agency Caseworker

Contact Name: ELOY LUNA

Organization Name: LOS ANGELES, CITY OF

Address: 200 North Main Street, Suite 1780

City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

Global Id: T0603701107

Contact Type: Regional Board Caseworker

Contact Name: YUE RONG

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: 320 W. 4TH ST., SUITE 200

City: Los Angeles

Email: yrong@waterboards.ca.gov

Phone Number: Not reported

Status History:

Global Id: T0603701107

Status: Completed - Case Closed

Status Date: 12/13/1996

Global Id: T0603701107

Status: Open - Case Begin Date

Status Date: 02/26/1991

Global Id: T0603701107

Status: Open - Site Assessment

Direction Distance

Elevation Site Database(s) EPA ID Number

WORLD OIL CO (Continued) 1000278377

Status Date: 02/26/1991

Regulatory Activities:

 Global Id:
 T0603701107

 Action Type:
 RESPONSE

 Date:
 06/04/2009

Action: Clean Up Fund - 5-Year Review Summary

 Global Id:
 T0603701107

 Action Type:
 Other

 Date:
 02/26/1991

 Action:
 Leak Reported

LUST REG 4:

Region: 4 Regional Board: 04

County: Los Angeles
Facility Id: 900480070
Status: Case Closed
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater

Abatement Method Used at the Site: Not reported

Global ID: T0603701107
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: Not reported
Enforcement Type: Not reported
Date Leak Discovered: Not reported

Date Leak First Reported: 2/26/1991

Date Leak Record Entered: 2/27/1991
Date Confirmation Began: Not reported
Date Leak Stopped: Not reported

Date Case Last Changed on Database: 1/8/1998 Date the Case was Closed: 12/13/1996

How Leak Discovered: Not reported How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK

Operator: OLD CASE #030591-01

Water System: Not reported Well Name: Not reported

Approx. Dist To Production Well (ft): 7407.9258270835150607202030091

Source of Cleanup Funding: UNK
Preliminary Site Assessment Workplan Submitted: Not reported

2/26/1991 Preliminary Site Assessment Began: Pollution Characterization Began: Not reported Remediation Plan Submitted: Not reported Not reported Remedial Action Underway: Post Remedial Action Monitoring Began: Not reported **Enforcement Action Date:** Not reported Historical Max MTBE Date: 1/1/1965 Hist Max MTBE Conc in Groundwater: 2900

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WORLD OIL CO (Continued) 1000278377

Hist Max MTBE Conc in Soil: .08

Significant Interim Remedial Action Taken: Not reported

GW Qualifier: Not reported

Soil Qualifier:

Organization: Not reported Owner Contact: Not reported

Responsible Party: WORLD OIL MARKETING CO

RP Address: 9302 S GARFIELD AVE, SOUTH GATE CA 90280

Program: LUST Lat/Long: 34.0759347 / -1

Local Agency Staff: PEJ

Beneficial Use: Not reported Not reported Priority: Cleanup Fund Id: Not reported Not reported Suspended: Not reported Assigned Name:

Summary: 12/27/96 - STATUS OF GW MONITORING & VE WELLS 12/31/96 -

> TRANSMITTAL OF GW MONITORING REPORT 06/24/97 - REC'D LOC

LETTER

SWEEPS UST:

Status: Active Comp Number: 334 Number:

Board Of Equalization: 44-011113 Referral Date: 03-04-93 Action Date: 03-04-93 Created Date: 02-29-88 Owner Tank Id: Not reported

19-050-000334-000001 SWRCB Tank Id:

Tank Status: Α

Capacity: 12000 Active Date: 04-20-88 Tank Use: M.V. FUEL

STG:

REG UNLEADED Content:

Number Of Tanks:

Status: Active Comp Number: 334 Number:

Board Of Equalization: 44-011113 Referral Date: 03-04-93 Action Date: 03-04-93 Created Date: 02-29-88 Owner Tank Id: Not reported

19-050-000334-000002 SWRCB Tank Id:

Tank Status: Α 12000 Capacity: Active Date: 04-20-88 Tank Use: M.V. FUEL

STG:

REG UNLEADED Content: Number Of Tanks: Not reported

Status: Active Comp Number: 334

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WORLD OIL CO (Continued)

1000278377

Number:

Board Of Equalization: 44-011113 Referral Date: 03-04-93 Action Date: 03-04-93 Created Date: 02-29-88 Owner Tank Id: Not reported

SWRCB Tank Id: 19-050-000334-000003

Tank Status: Capacity: 12000 Active Date: 04-20-88 M.V. FUEL Tank Use:

STG:

REG UNLEADED Content: Number Of Tanks: Not reported

Status: Active Comp Number: 334 Number:

Board Of Equalization: 44-011113 Referral Date: 03-04-93 Action Date: 03-04-93 Created Date: 02-29-88 Owner Tank Id: Not reported

SWRCB Tank Id: 19-050-000334-000004

Tank Status:

Capacity: 12000 Active Date: 04-20-88 Tank Use: M.V. FUEL

STG:

REG UNLEADED Content: Number Of Tanks: Not reported

Status: Active Comp Number: 334 Number:

Board Of Equalization: 44-011113 Referral Date: 03-04-93 Action Date: 03-04-93 02-29-88 Created Date: Not reported Owner Tank Id:

19-050-000334-000005 SWRCB Tank Id:

Tank Status: Α Capacity: 12000 04-20-88 Active Date: M.V. FUEL Tank Use:

STG:

Content: **REG UNLEADED** Number Of Tanks: Not reported

Status: Active Comp Number: 334 Number:

Board Of Equalization: 44-011113 Referral Date: 03-04-93 03-04-93 Action Date: Created Date: 02-29-88 Owner Tank Id: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

WORLD OIL CO (Continued)

1000278377

EDR ID Number

SWRCB Tank Id: 19-050-000334-000006

 Tank Status:
 A

 Capacity:
 12000

 Active Date:
 04-20-88

 Tank Use:
 M.V. FUEL

STG: P

Content: REG UNLEADED Number Of Tanks: Not reported

HIST UST:

File Number: 000288E0

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/000288E0.pdf

Region: STATE
Facility ID: 0000003941
Facility Type: Gas Station
Other Type: Not reported
Contact Name: RON COLEMAN
Telephone: 2135608801

Owner Name: WORLD OIL MARKETING COMPANY

Owner Address: 9302 S. GARFIELD AVENUE
Owner City,St,Zip: LOS ANGELES, CA 90280

Total Tanks: 0006

001 Tank Num: Container Num: 6401 Year Installed: Not reported Tank Capacity: 00012000 Tank Used for: **PRODUCT** Type of Fuel: REGULAR Container Construction Thickness: Not reported Leak Detection: Stock Inventor

002 Tank Num: Container Num: 6402 Year Installed: Not reported Tank Capacity: 00012000 Tank Used for: **PRODUCT** Type of Fuel: **REGULAR** Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 003 Container Num: 6403 Year Installed: Not reported Tank Capacity: 00012000 Tank Used for: **PRODUCT** Type of Fuel: UNLEADED Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 004
Container Num: 6404
Year Installed: Not reported
Tank Capacity: 00012000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

WORLD OIL CO (Continued) 1000278377

Leak Detection: Stock Inventor

005 Tank Num: Container Num: 6405 Year Installed: Not reported 00012000 Tank Capacity: Tank Used for: **PRODUCT** Type of Fuel: **UNLEADED** Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Tank Num: 006 Container Num: 6406 Year Installed: Not reported 00012000 Tank Capacity: Tank Used for: **PRODUCT** UNLEADED Type of Fuel: Container Construction Thickness: Not reported Leak Detection: Stock Inventor

Click here for Geo Tracker PDF:

CA FID UST:

Facility ID: 19003038
Regulated By: UTNKA
Regulated ID: 00003941
Cortese Code: Not reported
SIC Code: Not reported
Facility Phone: 2135608801
Mail To: Not reported

Mailing Address: 9302 S GARFIELD AVE

Mailing Address 2: Not reported

Mailing City, St, Zip: LOS ANGELES 900480000

Contact: Not reported
Contact Phone: Not reported
DUNs Number: Not reported
NPDES Number: Not reported
EPA ID: Not reported
Comments: Not reported
Status: Active

FINDS:

Registry ID: 110002678406

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

Direction Distance

Elevation Site Database(s) EPA ID Number

WORLD OIL CO (Continued)

1000278377

EDR ID Number

corrective action activities required under RCRA.

ECHO:

Envid: 1000278377 Registry ID: 110002678406

DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110002678406

HAZNET:

envid: 1000278377 Year: 2015

GEPAID: CAL000398711
Contact: ALLEN FAASS
Telephone: 9492895286
Mailing Name: Not reported
Mailing Address: 17311 S MAIN ST
Mailing City,St,Zip: GARDENA, CA 90248

Gen County: Los Angeles
TSD EPA ID: CAD028409019
TSD County: Los Angeles

Waste Category: Other organic solids

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Tons: 0.075

Cat Decode: Other organic solids

Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

(H010-H129) Or (H131-H135)

Facility County: Los Angeles

envid: 1000278377 Year: 2015

GEPAID: CAL000398711
Contact: ALLEN FAASS
Telephone: 9492895286
Mailing Name: Not reported
Mailing Address: 17311 S MAIN ST
Mailing City,St,Zip: GARDENA, CA 90248

Gen County: Los Angeles
TSD EPA ID: CAD028409019
TSD County: Los Angeles
Waste Category: Tank bottom waste

Disposal Method: Discharge To Sewer/Potw Or Npdes(With Prior Storage--With Or Without

Treatment) 0.22935

Cat Decode: Tank bottom waste

Method Decode: Discharge To Sewer/Potw Or Npdes(With Prior Storage--With Or Without

Treatment)

Facility County: Los Angeles

Tons:

Direction Distance

Elevation Site Database(s) **EPA ID Number**

J38 **APRO STATION #02 CA LUST** S105690138 NNW 7900 BEVERLY BLVD. N/A

1/4-1/2 LOS ANGELES, CA 90048

0.374 mi.

1973 ft. Site 2 of 3 in cluster J

Relative: Higher

LUST REG 4: Region: 04 Regional Board:

Actual: 192 ft.

County: Los Angeles Facility Id: 900480070A

Status: Remedial action (cleanup) Underway

Substance: Gasoline Substance Quantity: Not reported Local Case No: Not reported Case Type: Soil

Abatement Method Used at the Site: Not reported

Global ID: T0603788529 W Global ID: Not reported Staff: **TCS** Local Agency: 19050 Not reported Cross Street: **Enforcement Type:** TA-GEN Date Leak Discovered: 9/25/2001

Date Leak First Reported: 11/16/2001

Date Leak Record Entered: Not reported Date Confirmation Began: Not reported Date Leak Stopped: Not reported

Date Case Last Changed on Database: Not reported Date the Case was Closed: Not reported

How Leak Discovered: OM How Leak Stopped: Close Tank UNK Cause of Leak: Leak Source: UNK Operator: Not reported Water System: Not reported Not reported

Well Name:

7367.2368304074327680374610598 Approx. Dist To Production Well (ft):

Source of Cleanup Funding: UNK Preliminary Site Assessment Workplan Submitted: Not reported Preliminary Site Assessment Began: Not reported Pollution Characterization Began: Not reported Remediation Plan Submitted: Not reported Remedial Action Underway: 11/16/2001 Post Remedial Action Monitoring Began: Not reported Not reported **Enforcement Action Date:** Not reported Historical Max MTBE Date: Hist Max MTBE Conc in Groundwater: Not reported Hist Max MTBE Conc in Soil: Not reported Significant Interim Remedial Action Taken: Not reported

GW Qualifier: Not reported Soil Qualifier: Not reported Not reported Organization: Owner Contact: Not reported

MS. EDNA GALINDO Responsible Party: RP Address: 17311 S. MAIN ST.

Program: LUST 34.075963 / -1 Lat/Long: Local Agency Staff: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

APRO STATION #02 (Continued)

S105690138

Beneficial Use: Not reported Not reported Priority: Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported Summary: Not reported

J39 **WORLD OIL #64** CA LUST S103672296 CA HIST CORTESE NNW 7900 BEVERLY N/A

LOS ANGELES, CA 90048 1/4-1/2

0.374 mi.

1973 ft. Site 3 of 3 in cluster J

LUST: Relative:

STATE Higher Region: Global Id: T0603788529 Actual: Latitude: 34.075963 192 ft. Longitude: -118.361665

LUST Cleanup Site Case Type: Status: Completed - Case Closed

01/04/2013 Status Date:

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker: **DMB**

LOS ANGELES, CITY OF Local Agency:

RB Case Number: 900480070A LOC Case Number: Not reported File Location: Regional Board

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline Not reported Site History:

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603788529

Contact Type: Regional Board Caseworker Contact Name: DAVID M. BJOSTAD

LOS ANGELES RWQCB (REGION 4) Organization Name:

320 W. 4th Street, Suite 200 Address:

City: Los Angeles

dave.bjostad@waterboards.ca.gov Email:

Phone Number: Not reported

Global Id: T0603788529

Local Agency Caseworker Contact Type:

Contact Name: **ELOY LUNA**

LOS ANGELES, CITY OF Organization Name: 200 North Main Street, Suite 1780 Address:

LOS ANGELES City:

Email: eloy.luna@lacity.org Phone Number: Not reported

Status History:

Global Id: T0603788529

Status: Completed - Case Closed

01/04/2013 Status Date:

Global Id: T0603788529

MAP FINDINGS Map ID Direction

Distance Elevation

Site Database(s) **EPA ID Number**

WORLD OIL #64 (Continued)

S103672296

EDR ID Number

Open - Case Begin Date Status:

09/25/2001 Status Date:

Global Id: T0603788529

Status: Open - Eligible for Closure

12/21/2012 Status Date:

T0603788529 Global Id: Status: Open - Remediation

Status Date: 11/08/2001

T0603788529 Global Id: Status: Open - Remediation

Status Date: 02/11/2008

Global Id: T0603788529 Open - Remediation Status:

02/24/2011 Status Date:

Global Id: T0603788529

Status: Open - Site Assessment

04/23/2002 Status Date:

Global Id: T0603788529

Open - Site Assessment Status:

06/05/2002 Status Date:

Global Id: T0603788529

Status: Open - Site Assessment 02/04/2008

Global Id: T0603788529

Status: Open - Site Assessment

Status Date: 11/03/2008

Global Id: T0603788529

Status: Open - Verification Monitoring

Status Date: 02/12/2009

Regulatory Activities:

Status Date:

Global Id: T0603788529 Action Type: **ENFORCEMENT** Date: 10/31/2012

Action: Notification - Preclosure

Global Id: T0603788529 Action Type: **ENFORCEMENT** Date: 06/30/2011 Staff Letter Action:

Global Id: T0603788529 Action Type: **RESPONSE** Date: 07/15/2008

Action: Monitoring Report - Quarterly

Global Id: T0603788529 **RESPONSE** Action Type:

Distance

Elevation Site Database(s) EPA ID Number

WORLD OIL #64 (Continued)

S103672296

EDR ID Number

Date: 10/15/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 01/15/2009

Action: Well Installation Report

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2010

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 ENFORCEMENT

 Date:
 06/15/2009

 Action:
 Staff Letter

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2008

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 05/20/2008

Action: Soil and Water Investigation Workplan

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 10/15/2011

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 01/15/2011

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 10/15/2010

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2009

Action: Monitoring Report - Quarterly

 Global Id:
 T0603788529

 Action Type:
 ENFORCEMENT

 Date:
 07/21/2008

 Action:
 Staff Letter

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 09/08/2005

Action: Request for Closure

Distance

Elevation Site Database(s) EPA ID Number

WORLD OIL #64 (Continued)

S103672296

EDR ID Number

 Global Id:
 T0603788529

 Action Type:
 ENFORCEMENT

 Date:
 02/05/2008

Action: Site Visit / Inspection / Sampling

 Global Id:
 T0603788529

 Action Type:
 ENFORCEMENT

 Date:
 02/04/2008

 Action:
 Staff Letter

 Global Id:
 T0603788529

 Action Type:
 ENFORCEMENT

 Date:
 01/15/2008

 Action:
 Staff Letter

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 07/15/2009

Action: Monitoring Report - Semi-Annually

Global Id: T0603788529
Action Type: RESPONSE
Date: 01/15/2010

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 10/15/2009

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 01/15/2012

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 05/20/2008

Action: Soil and Water Investigation Workplan

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2012

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 07/15/2012

Action: Monitoring Report - Semi-Annually

Global Id: T0603788529
Action Type: ENFORCEMENT

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WORLD OIL #64 (Continued)

S103672296

Date: 01/04/2013

Closure/No Further Action Letter Action:

Global Id: T0603788529 Action Type: **RESPONSE** 07/15/2010 Date:

Action: Monitoring Report - Semi-Annually

Global Id: T0603788529 Action Type: RESPONSE Date: 05/25/2011 Action: Other Workplan

Global Id: T0603788529 Action Type: RESPONSE Date: 05/15/2013

Action: Well Destruction Report

Global Id: T0603788529 **ENFORCEMENT** Action Type: Date: 08/02/2002

Action: Technical Correspondence / Assistance / Other

Global Id: T0603788529 Action Type: RESPONSE Date: 07/15/2002

Action: Soil and Water Investigation Report

T0603788529 Global Id: Action Type: RESPONSE 07/15/2012 Date:

Action: Soil and Water Investigation Report

Global Id: T0603788529 Action Type: Other 11/16/2001 Date: Action: Leak Reported

T0603788529 Global Id: Action Type: RESPONSE Date: 07/15/2011

Action: Remedial Progress Report

Global Id: T0603788529 **RESPONSE** Action Type: Date: 01/15/2008

Action: Other Report / Document

T0603788529 Global Id: Action Type: **ENFORCEMENT** 05/08/2002 Date: Action: Staff Letter

Global Id: T0603788529 Action Type: **ENFORCEMENT** Date: 04/18/2008 Action: Staff Letter

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

WORLD OIL #64 (Continued)

S103672296

 Global Id:
 T0603788529

 Action Type:
 Other

 Date:
 09/25/2001

 Action:
 Leak Discovery

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 07/15/2011

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 07/15/2007

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 10/15/2004

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2005

Action: Other Report / Document

Global Id: T0603788529
Action Type: RESPONSE
Date: 01/15/2006

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2006

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 10/15/2006

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 01/15/2007

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 04/15/2007

Action: Other Report / Document

 Global Id:
 T0603788529

 Action Type:
 RESPONSE

 Date:
 10/15/2007

Action: Other Report / Document

Global Id: T0603788529
Action Type: RESPONSE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WORLD OIL #64 (Continued) S103672296

Date: 11/05/2003

Soil and Water Investigation Report Action:

Global Id: T0603788529 Action Type: **RESPONSE** 11/05/2003 Date:

Action: Soil and Water Investigation Workplan

Global Id: T0603788529 Action Type: REMEDIATION Date: 11/08/2001 Action: Excavation

Global Id: T0603788529 Action Type: REMEDIATION Date: 02/11/2008 Action: Excavation

Global Id: T0603788529 Action Type: REMEDIATION 02/24/2011 Date:

Action: Pump & Treat (P&T) Groundwater

HIST CORTESE:

Region: **CORTESE** Facility County Code: 19 Reg By: **LTNKA** Reg Id: 900480070

K40 U001561439 **TEXACO** CA LUST **CA HIST UST** N/A

NNE 7718 BEVERLY BLVD 1/4-1/2 LOS ANGELES, CA 90036

0.385 mi.

Site 1 of 2 in cluster K 2033 ft.

LUST REG 4: Relative: Region: Higher Regional Board: 04

Actual: County: Los Angeles 199 ft.

Facility Id: I-16219 Remediation Plan Status:

Gasoline Substance: Substance Quantity: Not reported Local Case No: Not reported

Case Type: Groundwater Abatement Method Used at the Site: Not reported

Global ID: T0603704395 W Global ID: Not reported Staff: MSH Local Agency: 19000

GENESEE AVE Cross Street:

Enforcement Type: SEL Date Leak Discovered: 12/18/1990

Date Leak First Reported: 1/3/1991

Date Leak Record Entered: 12/7/1991 Date Confirmation Began: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TEXACO (Continued) U001561439

Date Leak Stopped: Not reported

Date Case Last Changed on Database: 9/26/2002 Date the Case was Closed: Not reported

How Leak Discovered: OM How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK TEXACO Operator: Water System: Not reported Well Name: Not reported

Approx. Dist To Production Well (ft): 8464.003026760982981621946476

Source of Cleanup Funding: UNK Preliminary Site Assessment Workplan Submitted: Not reported Preliminary Site Assessment Began: 1/3/1991 Pollution Characterization Began: Not reported Remediation Plan Submitted: 9/6/2002 Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: Not reported **Enforcement Action Date:** 6/14/1999 Historical Max MTBE Date: 1/1/1965 Hist Max MTBE Conc in Groundwater: 75000 Hist Max MTBE Conc in Soil:

Not reported Significant Interim Remedial Action Taken: Not reported

GW Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported Responsible Party: Y. M. TUAN

RP Address: 145 SOUTH COLLEGE BLVD.

Program: LUST Lat/Long: 34.0761597 / -1 Local Agency Staff: Not reported Beneficial Use: Not reported Priority: Not reported Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported

Summary: ADJACENT CBS FACILITY LOCATED AT 7800 BEVERLY BLVD. TANKS/LINES

> TESTED TIGHT DURING OCT/NOV 90 TANK TEST. INITIAL SITE ASSESSMENT REPORT BEING PREPARED FOR SUBMITTAL. FREE PRODUCT (4"-6" IN ONE OF 4

WELLS ON-SITE) APPEARS TO

HIST UST:

File Number: 00028AC0

URL: http://geotracker.waterboards.ca.gov/ustpdfs/pdf/00028AC0.pdf

Region: STATE 00000017379 Facility ID: Facility Type: Gas Station Not reported Other Type:

GEORGE A. ADAMIAN Contact Name:

Telephone: 2139328637 Owner Name: TEXACO U.S.A.

P.O.BOX 3756-3350 WILSHIRE BLV Owner Address:

Owner City, St, Zip: LOS ANGELES, CA 90010

Total Tanks: 0004

001 Tank Num:

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TEXACO (Continued) U001561439

Container Num:

Not reported Year Installed: Tank Capacity: 00012000 Tank Used for: **PRODUCT** Type of Fuel: DIESEL Container Construction Thickness: Not reported Leak Detection: Stock Inventor, 10

Tank Num: 002 Container Num: 2

Year Installed: Not reported 00010000 Tank Capacity: **PRODUCT** Tank Used for: Type of Fuel: **UNLEADED** Container Construction Thickness: Not reported Leak Detection: Stock Inventor, 10

003 Tank Num: Container Num:

Not reported Year Installed: 00010000 Tank Capacity: **PRODUCT** Tank Used for: Type of Fuel: REGULAR Container Construction Thickness: Not reported Leak Detection: Stock Inventor, 10

Tank Num: 004 Container Num:

Year Installed: Not reported Tank Capacity: 00010000 PRODUCT Tank Used for: Type of Fuel: **PREMIUM** Container Construction Thickness: Not reported Leak Detection: Stock Inventor, 10

Click here for Geo Tracker PDF:

K41 CA LUST S103671859 **TEXACO CA HIST CORTESE** NNE 7718 BEVERLY N/A

1/4-1/2 LOS ANGELES, CA 90036

0.385 mi.

199 ft.

2033 ft. Site 2 of 2 in cluster K

LUST: Relative:

Region: STATE Higher Global Id: T0603704395 Actual: Latitude: 34.0761597 Longitude: -118.3577477

Case Type: **LUST Cleanup Site** Completed - Case Closed Status:

Status Date: 11/29/2012

LOS ANGELES RWQCB (REGION 4) Lead Agency:

Case Worker: CET

LOS ANGELES COUNTY Local Agency:

RB Case Number: I-16219 LOC Case Number: Not reported File Location: Regional Board

Potential Media Affect: Aquifer used for drinking water supply

Direction Distance

Elevation Site Database(s) EPA ID Number

TEXACO (Continued) S103671859

Potential Contaminants of Concern: Gasoline Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603704395

Contact Type: Regional Board Caseworker

Contact Name: CHANDRA TYLER

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: Not reported City: R4 UNKNOWN

Email: cetyler@waterboards.ca.gov

Phone Number: Not reported

Global Id: T0603704395

Contact Type: Local Agency Caseworker

Contact Name: JOHN AWUJO

Organization Name: LOS ANGELES COUNTY Address: 900 S FREMONT AVE

City: ALHAMBRA

Email: jawujo@dpw.lacounty.gov

Phone Number: 6264583507

Status History:

Global Id: T0603704395

Status: Completed - Case Closed

Status Date: 11/29/2012

Global Id: T0603704395

Status: Open - Case Begin Date

Status Date: 12/18/1990

Global Id: T0603704395
Status: Open - Remediation

Status Date: 09/20/1996

Global Id: T0603704395
Status: Open - Remediation

Status Date: 09/06/2002

Global Id: T0603704395 Status: Open - Remediation

Status Date: 12/02/2002

Global Id: T0603704395
Status: Open - Remediation

Status Date: 01/21/2005

Global Id: T0603704395 Status: Open - Remediation

Status Date: 04/21/2006

Global Id: T0603704395 Status: Open - Remediation

Status Date: 11/20/2006

Distance

Elevation Site Database(s) EPA ID Number

TEXACO (Continued) S103671859

Global Id: T0603704395

Status: Open - Site Assessment

Status Date: 01/03/1991

Global Id: T0603704395

Status: Open - Site Assessment

Status Date: 08/13/2010

Global Id: T0603704395

Status: Open - Site Assessment

Status Date: 08/16/2010

Regulatory Activities:

Global Id: T0603704395
Action Type: ENFORCEMENT
Date: 09/28/2012

Action: Notification - Preclosure

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 04/15/2004

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 01/15/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 10/15/2009

Action: Remedial Progress Report

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 06/28/2007

Action: Request for Closure

Global Id: T0603704395
Action Type: RESPONSE
Date: 01/15/2011

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603704395

 Action Type:
 Other

 Date:
 12/18/1990

 Action:
 Leak Discovery

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 06/07/2004

Action: Interim Remedial Action Plan

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 01/15/2006

Action: Remedial Progress Report

Distance

Elevation Site Database(s) EPA ID Number

TEXACO (Continued) S103671859

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 07/15/2006

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 01/15/2007

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 04/15/2005

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 07/15/2007

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 ENFORCEMENT

 Date:
 06/15/2009

 Action:
 Staff Letter

 Global Id:
 T0603704395

 Action Type:
 ENFORCEMENT

 Date:
 08/16/2010

 Action:
 Staff Letter

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 07/15/2003

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 ENFORCEMENT

 Date:
 11/29/2012

Action: Closure/No Further Action Letter

 Global Id:
 T0603704395

 Action Type:
 ENFORCEMENT

 Date:
 11/29/2012

Action: Closure/No Further Action Letter

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 01/15/2010

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 07/15/2005

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: RESPONSE

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TEXACO (Continued) S103671859

Date: 07/15/2008

Monitoring Report - Quarterly Action:

Global Id: T0603704395 Action Type: **RESPONSE** 10/15/2002 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: **RESPONSE** Date: 07/15/2002

CAP/RAP - Feasibility Study Report Action:

Global Id: T0603704395 Action Type: RESPONSE 04/15/2002 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603704395 **RESPONSE** Action Type: Date: 07/15/2002

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: **RESPONSE** Date: 07/15/2010

Action: Monitoring Report - Semi-Annually

T0603704395 Global Id: Action Type: **RESPONSE** 04/15/2012 Date:

Action: Monitoring Report - Semi-Annually

Global Id: T0603704395 RESPONSE Action Type: Date: 03/26/2012

Action: Soil and Water Investigation Report

T0603704395 Global Id: Action Type: **RESPONSE** Date: 10/15/2005

Action: Monitoring Report - Quarterly

Global Id: T0603704395 **RESPONSE** Action Type: Date: 01/15/2006

Action: Monitoring Report - Quarterly

T0603704395 Global Id: Action Type: Other 01/03/1991 Date: Action: Leak Reported

T0603704395 Global Id: Action Type: RESPONSE Date: 07/06/2010 Action: Other Workplan

Direction Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

TEXACO (Continued) S103671859

Global Id: T0603704395 RESPONSE Action Type: 04/15/2009 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603704395 **ENFORCEMENT** Action Type: Date: 04/12/2002 Action: Staff Letter

T0603704395 Global Id: **ENFORCEMENT** Action Type: Date: 06/19/2006

Action: Site Visit / Inspection / Sampling

Global Id: T0603704395 **RESPONSE** Action Type: 07/15/2009 Date:

Action: Monitoring Report - Semi-Annually

Global Id: T0603704395 **RESPONSE** Action Type: Date: 10/15/2007

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: **RESPONSE** Date: 04/15/2008

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: **RESPONSE** Date: 07/15/2004

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: **RESPONSE** Date: 01/15/2003

Monitoring Report - Quarterly Action:

T0603704395 Global Id: Action Type: **RESPONSE** Date: 10/15/2004

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: **ENFORCEMENT** Date: 09/06/2002 Action: Staff Letter

T0603704395 Global Id: Action Type: **RESPONSE** 01/15/2009 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603704395 Action Type: **RESPONSE**

Direction Distance Elevation

vation Site Database(s) EPA ID Number

TEXACO (Continued) S103671859

Date: 04/15/2010

Action: Monitoring Report - Semi-Annually

Global Id: T0603704395
Action Type: RESPONSE
Date: 10/15/2006

Action: Remedial Progress Report

 Global Id:
 T0603704395

 Action Type:
 ENFORCEMENT

 Date:
 07/02/2004

 Action:
 Staff Letter

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 10/15/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 04/15/2007

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 10/15/2003

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 01/15/2004

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 04/15/2003

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 10/15/2006

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 RESPONSE

 Date:
 01/15/2005

Action: Monitoring Report - Quarterly

 Global Id:
 T0603704395

 Action Type:
 REMEDIATION

 Date:
 05/13/1994

Action: Soil Vapor Extraction (SVE)

 Global Id:
 T0603704395

 Action Type:
 REMEDIATION

 Date:
 12/02/2002

Action: In Situ Physical/Chemical Treatment (other than SVE)

EDR ID Number

Direction Distance

Distance Elevation Site EDR ID Number Database(s) EPA ID Number

TEXACO (Continued) S103671859

 Global Id:
 T0603704395

 Action Type:
 REMEDIATION

 Date:
 12/02/2002

Action: In Situ Physical/Chemical Treatment (other than SVE)

HIST CORTESE:

Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: I-16219

 L42
 76 PRODUCT STATION NO. 4454
 CA LUST
 \$103064863

 NNE
 7751 BEVERLY BOULEVARD
 CA ENF
 N/A

 1/4-1/2
 LOS ANGELES, CA 90013
 CA HIST CORTESE

0.403 mi.

2130 ft. Site 1 of 2 in cluster L

Relative: LUST:

Higher Region: STATE
Global Id: T0603700900

Actual: Latitude: 34.0761597
200 ft. Longitude: -118.3584257
Case Type: LUST Cleanup Site

Status: Completed - Case Closed

Status Date: 03/06/2015

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker: DPP

Local Agency: LOS ANGELES, CITY OF

RB Case Number: 900360198
LOC Case Number: Not reported
File Location: Regional Board

Potential Media Affect: Aquifer used for drinking water supply Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon

Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603700900

Contact Type: Regional Board Caseworker Contact Name: DANIEL PIROTTON

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: Not reported City: R4 UNKNOWN

Email: dpirotton@waterboards.ca.gov

Phone Number: 2135766714

Global Id: T0603700900

Contact Type: Local Agency Caseworker

Contact Name: ELOY LUNA

Organization Name: LOS ANGELES, CITY OF

Address: 200 North Main Street, Suite 1780 City: LOS ANGELES

Email: eloy.luna@lacity.org
Phone Number: Not reported

Distance Elevation

n Site Database(s) EPA ID Number

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

EDR ID Number

Status History:

Global Id: T0603700900

Status: Completed - Case Closed

Status Date: 03/06/2015

Global Id: T0603700900

Status: Open - Case Begin Date

Status Date: 08/31/1993

Global Id: T0603700900

Status: Open - Eligible for Closure

Status Date: 12/17/2012

Global Id: T0603700900
Status: Open - Remediation

Status Date: 12/19/2002

Global Id: T0603700900

Status: Open - Site Assessment

Status Date: 08/10/1998

Global Id: T0603700900

Status: Open - Site Assessment

Status Date: 11/06/1998

Global Id: T0603700900

Status: Open - Site Assessment

Status Date: 08/06/1999

Global Id: T0603700900

Status: Open - Site Assessment

Status Date: 03/22/2007

Regulatory Activities:

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 01/22/2004

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2005

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 04/15/2006

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2006

Action: Monitoring Report - Quarterly

Global Id: T0603700900
Action Type: RESPONSE

Direction Distance

Elevation Site Database(s) EPA ID Number

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

EDR ID Number

Date: 01/15/2010

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2011

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 08/15/2008

Action: Well Installation Report

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 04/15/2010

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2014

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/26/2014

Action: Other Report / Document

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 03/06/2015

Action: Closure/No Further Action Letter

 Global Id:
 T0603700900

 Action Type:
 Other

 Date:
 05/26/1994

 Action:
 Leak Discovery

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2009

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2007

Action: Monitoring Report - Quarterly

Global Id: T0603700900
Action Type: RESPONSE
Date: 07/15/2004

Action: Monitoring Report - Quarterly

Direction Distance

Elevation Site Database(s) EPA ID Number

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

EDR ID Number

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2011

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 04/15/2009

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2010

Action: Monitoring Report - Semi-Annually

Global Id: T0603700900
Action Type: RESPONSE
Date: 04/15/2014

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2009

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2005

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2006

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 12/02/2010

 Action:
 Other Workplan

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 04/11/2002

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 08/20/2004

Action: Soil and Water Investigation Report

Global Id: T0603700900
Action Type: RESPONSE

Direction Distance

Elevation Site Database(s) EPA ID Number

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

EDR ID Number

Date: 04/15/2004

Action: Monitoring Report - Quarterly

Global Id: T0603700900
Action Type: ENFORCEMENT
Date: 12/07/2009

Action: Waste Discharge Requirements

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 12/07/2007

Action: Well Installation Report

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 04/15/2008

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2004

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2010

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2005

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 Other

 Date:
 05/26/1994

 Action:
 Leak Stopped

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 06/29/2004

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 08/06/1999

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 06/05/2003

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 Other

 Date:
 05/26/1994

 Action:
 Leak Reported

Direction Distance

Elevation Site Database(s) EPA ID Number

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

EDR ID Number

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 08/25/2009

Action: Corrective Action Plan / Remedial Action Plan - Addendum

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 02/17/2009

Action: Well Installation Report

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2012

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2012

Action: Monitoring Report - Semi-Annually

Global Id: T0603700900
Action Type: RESPONSE
Date: 01/15/2013

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 11/06/2002

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 08/26/2014

Action: Notification - Preclosure

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 06/15/2009

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2009

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2003

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2003

Action: Well Installation Report

Global Id: T0603700900
Action Type: RESPONSE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

Date: 10/15/2003 Action: Unknown

Global Id: T0603700900 Action Type: **RESPONSE** 08/20/2004 Date:

Action: Remedial Progress Report

Global Id: T0603700900 Action Type: **RESPONSE** Date: 04/15/2007

Action: Monitoring Report - Quarterly

Global Id: T0603700900 Action Type: **RESPONSE** Date: 07/15/2002

Action: Monitoring Report - Quarterly

Global Id: T0603700900 **RESPONSE** Action Type: Date: 07/15/2002

Interim Remedial Action Plan Action:

Global Id: T0603700900 Action Type: **RESPONSE** Date: 04/15/2003

Action: Monitoring Report - Quarterly

T0603700900 Global Id: Action Type: **RESPONSE** 10/15/2002 Date:

Action: Monitoring Report - Quarterly

Global Id: T0603700900 RESPONSE Action Type: 07/15/2002 Date:

Action: CAP/RAP - Feasibility Study Report

T0603700900 Global Id: Action Type: **RESPONSE** Date: 07/15/2002

Action: Soil and Water Investigation Report

T0603700900 Global Id: **RESPONSE** Action Type: Date: 12/20/2002

Action: CAP/RAP - Final Remediation / Design Plan

Global Id: T0603700900 Action Type: **RESPONSE** Date: 04/15/2005

Action: Monitoring Report - Quarterly

T0603700900 Global Id: Action Type: RESPONSE Date: 10/15/2004

Action: Monitoring Report - Quarterly

Direction Distance

Elevation Site Database(s) EPA ID Number

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

EDR ID Number

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2014

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 07/15/2013

Action: Monitoring Report - Semi-Annually

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 12/17/2013

Action: Other Workplan - Regulator Responded

 Global Id:
 T0603700900

 Action Type:
 ENFORCEMENT

 Date:
 07/29/2010

 Action:
 Staff Letter

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2008

Action: Monitoring Report - Quarterly

Global Id: T0603700900
Action Type: RESPONSE
Date: 06/18/2014

Action: Request for Closure - Regulator Responded

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2007

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 03/22/2007

Action: Soil and Water Investigation Workplan

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2007

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 10/15/2003

Action: Monitoring Report - Quarterly

 Global Id:
 T0603700900

 Action Type:
 RESPONSE

 Date:
 01/15/2003

Action: Monitoring Report - Quarterly

Global Id: T0603700900
Action Type: RESPONSE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

Date: 07/15/2006

Monitoring Report - Quarterly Action:

ENF:

Region: 4

Facility Id: 203642

Agency Name: ConocoPhillips Company Long Beach

Place Type:

Place Subtype: Groundwater Cleanup Site Facility Type: All other facilities

Agency Type: Privately-Owned Business

Of Agencies:

Place Latitude: 34.076111 Place Longitude: 118.357500 SIC Code 1: 5541

SIC Desc 1: Gasoline Service Stations

SIC Code 2: Not reported SIC Desc 2: Not reported SIC Code 3: Not reported SIC Desc 3: Not reported NAICS Code 1: Not reported NAICS Desc 1: Not reported NAICS Code 2: Not reported NAICS Desc 2: Not reported NAICS Code 3: Not reported NAICS Desc 3: Not reported

Of Places:

Source Of Facility: Reg Meas Not reported Design Flow:

Threat To Water Quality: 3 Complexity:

X - Facility is not a POTW Pretreatment:

Facility Waste Type: Not reported Facility Waste Type 2: Not reported Facility Waste Type 3: Not reported Facility Waste Type 4: Not reported

WDRNONMUNIPRCS Program:

Program Category1: **WDR** Program Category2: WDR # Of Programs:

WDID: 4B198300008 Reg Measure Id: 170242 Reg Measure Type: Enrollee Region:

Order #: R4-2005-0030 Npdes# CA#: Not reported Not reported Major-Minor: Npdes Type: Not reported Reclamation: N - No Dredge Fill Fee: Not reported 301H: Not reported Application Fee Amt Received: 1690 Status: Historical Status Date: 03/21/2014 Effective Date: 07/13/2005 Expiration/Review Date: 12/31/2012

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

76 PRODUCT STATION NO. 4454 (Continued)

S103064863

12/07/2009 Termination Date: WDR Review - Amend: Not reported WDR Review - Revise/Renew: Not reported WDR Review - Rescind: Not reported WDR Review - No Action Required: Not reported WDR Review - Pending: Not reported WDR Review - Planned: Not reported

Status Enrollee: Individual/General:

Fee Code: 15 - WDRs pending rescission

Direction/Voice: **Passive** 371531 Enforcement Id(EID): Region: Order / Resolution Number: NOV

Notice of Violation Enforcement Action Type: Effective Date: 08/06/2009

Adoption/Issuance Date: 08/06/2009 Achieve Date: Not reported Termination Date: 08/06/2009 ACL Issuance Date: Not reported EPL Issuance Date: Not reported Status: Historical

Title: NOV sent 8/6/09 for overdue, late & deficient monitoring reports.

Description: NOV sent 8/6/09 for overdue, late & deficient monitoring

> reports. **WDR**

Latest Milestone Completion Date: Not reported

Of Programs1: **Total Assessment Amount:** 0 Initial Assessed Amount: 0 Liability \$ Amount: 0 Project \$ Amount: 0 Liability \$ Paid: 0 Project \$ Completed: 0 Total \$ Paid/Completed Amount: 0

HIST CORTESE:

Program:

Region: **CORTESE** Facility County Code: 19 Reg By: **LTNKA** 900360198 Reg Id:

CA LUST S105693924 L43 **TOSCO - 76 STATION #4454**

NNE 7751 BEVERLY BLVD 1/4-1/2 PARK LA BREA, CA 90036

0.403 mi.

2130 ft. Site 2 of 2 in cluster L

LUST REG 4: Relative: Higher Region: Regional Board: 04

Actual: Los Angeles County: 200 ft. Facility Id: 900360198

Status: Remediation Plan Substance: Hydrocarbons Substance Quantity: Not reported Local Case No: Not reported

N/A

Direction Distance Elevation

tion Site Database(s) EPA ID Number

TOSCO - 76 STATION #4454 (Continued)

S105693924

EDR ID Number

Case Type: Groundwater

Abatement Method Used at the Site: Not reported

Global ID: T0603700900
W Global ID: Not reported
Staff: DP
Local Agency: 19050
Cross Street: GENESSEE
Enforcement Type: DLSEL
Date Leak Discovered: 5/26/1994

Date Leak First Reported: 5/26/1994

Date Leak Record Entered: 9/2/1993
Date Confirmation Began: Not reported
Date Leak Stopped: 5/26/1994

Date Case Last Changed on Database: Not reported Date the Case was Closed: Not reported

How Leak Discovered: OM

How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK

Operator: DEE, THOMAS C
Water System: Not reported
Well Name: Not reported

Approx. Dist To Production Well (ft): 8277.616283299861536542029273

Not reported

Source of Cleanup Funding: UNK Preliminary Site Assessment Workplan Submitted: 8/10/1998 Preliminary Site Assessment Began: 11/6/1998 Pollution Characterization Began: 8/6/1999 Remediation Plan Submitted: 12/19/2002 Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: Not reported Not reported **Enforcement Action Date:** Historical Max MTBE Date: 4/1/1998 Hist Max MTBE Conc in Groundwater: 380000 Hist Max MTBE Conc in Soil: 16000

Significant Interim Remedial Action Taken: GW Qualifier: Not reported

Soil Qualifier: =

Organization: Not reported Owner Contact: Not reported

Responsible Party: MS. SHARI LONDON

RP Address: 3611 HARBOR BL., STE. #200

Program: LUST

Lat/Long: 34.0761597 / -1

Local Agency Staff: PEJ

Beneficial Use: Not reported Priority: Not reported Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported Summary: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

44 AL-SAL OIL (OLD UNOCAL) CA LUST S102423794
SSW 6050 006TH ST W CA HIST CORTESE N/A

1/4-1/2 LOS ANGELES, CA 90036

0.416 mi. 2198 ft.

Relative: LUST: Lower Region: STATE

Global Id: T0603700893

Actual: Latitude: 34.0646731

167 ft. Longitude: -118.3603376

Case Type: LUST Cleanure

Case Type: LUST Cleanup Site
Status: Completed - Case Closed

Status Date: 07/30/1996

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker: YR

Local Agency: LOS ANGELES, CITY OF

RB Case Number: 900360125
LOC Case Number: Not reported
File Location: Not reported

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Contact:

Global Id: T0603700893

Contact Type: Local Agency Caseworker

Contact Name: ELOY LUNA

Organization Name: LOS ANGELES, CITY OF

Address: 200 North Main Street, Suite 1780

City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

Global Id: T0603700893

Contact Type: Regional Board Caseworker

Contact Name: YUE RONG

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: 320 W. 4TH ST., SUITE 200

City: Los Angeles

Email: yrong@waterboards.ca.gov

Phone Number: Not reported

Status History:

Global Id: T0603700893

Status: Completed - Case Closed

Status Date: 07/30/1996

Global Id: T0603700893

Status: Open - Case Begin Date

Status Date: 01/26/1994

Global Id: T0603700893

Status: Open - Site Assessment

Status Date: 08/27/1994

Global Id: T0603700893

Direction Distance

Elevation Site Database(s) EPA ID Number

AL-SAL OIL (OLD UNOCAL) (Continued)

S102423794

EDR ID Number

Status: Open - Site Assessment

Status Date: 01/13/1995

Regulatory Activities:

 Global Id:
 T0603700893

 Action Type:
 Other

 Date:
 01/26/1994

 Action:
 Leak Discovery

 Global Id:
 T0603700893

 Action Type:
 Other

 Date:
 08/27/1994

 Action:
 Leak Reported

LUST REG 4:

Region: 4 Regional Board: 04

County: Los Angeles
Facility Id: 900360125
Status: Case Closed
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater

Abatement Method Used at the Site: Not reported

Global ID: T0603700893
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: FAIRFAX AVE
Enforcement Type: Not reported
Date Leak Discovered: 1/26/1994

Date Leak First Reported: 8/27/1994

Date Leak Record Entered: 4/27/1995
Date Confirmation Began: Not reported
Date Leak Stopped: Not reported

Date Case Last Changed on Database: 7/10/1997
Date the Case was Closed: 7/30/1996

How Leak Discovered: Subsurface Monitoring

How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK

Historical Max MTBE Date:

Operator: SAME AS ABOVE Water System: Not reported Well Name: Not reported

Approx. Dist To Production Well (ft): 5870.2467939727901815689784835

Not reported

Source of Cleanup Funding:

Preliminary Site Assessment Workplan Submitted: 8/27/1994

Preliminary Site Assessment Began:

Pollution Characterization Began:

Remediation Plan Submitted:

Remedial Action Underway:

Post Remedial Action Monitoring Began:

Enforcement Action Date:

Not reported

Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AL-SAL OIL (OLD UNOCAL) (Continued)

S102423794

CA SLIC

CA EMI

CA BROWNFIELDS

CA SWEEPS UST

CA FID UST

S101585566

N/A

Hist Max MTBE Conc in Groundwater: Not reported Not reported Hist Max MTBE Conc in Soil:

Significant Interim Remedial Action Taken: No

GW Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported

Responsible Party: AL-SAL OIL COMPANY, INC.

RP Address: 3410 E. FOOTHILL BLVD., PASADENA, CA 91107

Program: LUST Lat/Long: 34.0646731 / -1

PEJ Local Agency Staff:

Beneficial Use: Not reported Priority: Not reported Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported Summary: Not reported

HIST CORTESE:

CORTESE Region: Facility County Code: 19 Reg By: LTNKA 900360125 Reg Id:

45 **AL SIMON** NNW **8023 BEVERLY BLVD**

LOS ANGELES, CA 90048 1/4-1/2 0.459 mi.

SLIC:

2426 ft.

Actual:

186 ft.

STATE

Relative: Region: Higher **Facility Status:**

Status Date: 05/07/2012 Global Id: T10000000452

LOS ANGELES RWQCB (REGION 4) Lead Agency:

Lead Agency Case Number: Not reported Latitude: 34.076228 Longitude: -118.36444

Case Type: Cleanup Program Site

Case Worker: BA

Local Agency: Not reported RB Case Number: 1236

File Location: Regional Board

Potential Media Affected: Aquifer used for drinking water supply, Soil

Potential Contaminants of Concern: Benzene, Tetrachloroethylene (PCE), Toluene, Trichloroethylene (TCE),

MTBE / TBA / Other Fuel Oxygenates, Gasoline

The site consists of a rectangular parcel of land occupied by an Site History:

Completed - Case Closed

L-shaped shopping center building. Historical aerial photographs show that the site was vacant prior to at least 1928. It was then occupied by an auto repair and gas station from approximately 1933 to 1985. The gas station maintained three underground storage tanks (USTs) with storage capacities of 1.000 gallons, 3.000 gallons, and 5.000 gallons, respectively. The USTs were removed in approximately 1985 when the gas station was demolished for the construction of the shopping center. After the construction of the shopping center, a dry

Direction Distance Elevation

levation Site Database(s) EPA ID Number

AL SIMON (Continued) S101585566

cleaner occupied one of the units of the building and operated from approximately 1987 to 1991. According to site assessment reports submitted to the Regional Board, the soil and groundwater beneath the site are contaminated with low level volatile organic compounds (VOCs) and petroleum hydrocarbons. After evaluation of the site assessment data and the results of a human health risk assessment, the site has been closed with a deed restriction on the property for commercial/inductrial land use.

Click here to access the California GeoTracker records for this facility:

BROWNFIELDS:

 Global ID:
 T10000000452

 Latitude:
 34.076228

 Longitude:
 -118.36444

Project Type: Cleanup Program Site
Status: Completed - Case Closed

Status Date: 05/07/2012

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Last Correspondence Date: 05/07/2012

Release Type: Other Type of Release, Underground Storage Tank System - UST

Contaminant(s) of Concern:

Benzene, Tetrachloroethylene (PCE), Toluene, Trichloroethylene (TCE), MTBE / TBA / Other l

Media of Concern: Aquifer used for drinking water supply, Soil

Past Use(s) that Caused Contamination: DRY CLEANING, FUEL - VEHICLE STORAGE/ REFUELING

Human Health Exposure Controlled: YES
Human Health Exposure Controlled Date: Not reported
Groundwater Migration Controlled: NOT APPLICABLE
Groundwater Migration Controlled Date: Primary Caseworker Name: BIZUAYEHU AYELE

Primary Caseworker Organization Name: LOS ANGELES RWQCB (REGION 4)

Primary Caseworker Phone Number: 213-576-6623

Primary Caseworker Address: 320 W 4TH STREET; SUITE 200

Primary Caseworker Address: LOS ANGELES

Primary Caseworker Address: CA

Primary Caseworker Email: bayele@waterboards.ca.gov

SWEEPS UST:

Status: Not reported Comp Number: 6798 Not reported Number: Not reported Board Of Equalization: Referral Date: Not reported Not reported Action Date: Not reported Created Date: Owner Tank Id: Not reported SWRCB Tank Id: Not reported Tank Status: Not reported Capacity: Not reported Active Date: Not reported Tank Use: Not reported STG: Not reported Content: Not reported

Number Of Tanks: 0

CA FID UST:

Facility ID: 19025352

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AL SIMON (Continued) S101585566

Regulated By: **UTNKA** Regulated ID: Not reported Cortese Code: Not reported SIC Code: Not reported 2130000000 Facility Phone: Mail To: Not reported

Mailing Address: 8023 BEVERLY BLVD

Mailing Address 2: Not reported

Mailing City,St,Zip: LOS ANGELES 900480000

Contact: Not reported Not reported Contact Phone: Not reported **DUNs Number:** NPDES Number: Not reported EPA ID: Not reported Comments: Not reported Status: Active

EMI:

Year: 1987 County Code: 19 Air Basin: SC Facility ID: 55547 Air District Name: SC SIC Code: 9999

SOUTH COAST AQMD Air District Name:

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: Reactive Organic Gases Tons/Yr: 0 0 Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr: 0 SOX - Oxides of Sulphur Tons/Yr: 0 Particulate Matter Tons/Yr: Part. Matter 10 Micrometers and Smllr Tons/Yr:0

LIZ'S ANTIQUE HARDWARE

1/2-1 0.778 mi. 4106 ft.

46

East

ENVIROSTOR: Relative:

Facility ID: 60001631 Higher Status:

453 S LA BREA AVENUE

LOS ANGELES, CA 90036

No Further Action Actual: Status Date: 05/15/2012 212 ft. Site Code: 301558 Site Type: Evaluation Site Type Detailed: Evaluation

Acres: 0.1 NO **SMBRP** Regulatory Agencies: Lead Agency: **SMBRP** Program Manager: Not reported Supervisor: Javier Hinoiosa Division Branch: Cleanup Chatsworth

Assembly: 50 26 Senate:

TC4930273.2s Page 98

S106834719

N/A

CA ENVIROSTOR

CA EMI

Direction Distance

Elevation Site Database(s) EPA ID Number

LIZ'S ANTIQUE HARDWARE (Continued)

S106834719

EDR ID Number

Special Program: Not reported

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED Funding: Responsible Party Latitude: 34.06635

Latitude: 34.06635 Longitude: -118.3441 APN: 5508-006-012 Past Use: DRY CLEANING

Potential COC: Tetrachloroethylene (PCE Confirmed COC: Tetrachloroethylene (PCE

Potential Description: SOIL, SV

 Alias Name:
 5508-006-012

 Alias Type:
 APN

 Alias Name:
 301558

Alias Type: Project Code (Site Code)

Alias Name: 60001631

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Endangerment Assessment Report

Completed Date: 04/04/2012
Comments: NFA Letter issued

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement Termination Notification

Completed Date: 04/12/2012

Comments: Sent out VCA end letter

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: No Further Action Letter

Completed Date: 04/04/2012 Comments: NFA Letter issued

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement

Completed Date: 02/24/2012 Comments: VCA

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Cost Recovery Closeout Memo

Completed Date: 05/15/2012 Comments: CRU memo sent.

Future Area Name: Not reported Future Sub Area Name: Not reported Not reported Future Document Type: Future Due Date: Not reported Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

LIZ'S ANTIQUE HARDWARE (Continued)

S106834719

EDR ID Number

EMI:

 Year:
 1987

 County Code:
 19

 Air Basin:
 SC

 Facility ID:
 36789

 Air District Name:
 SC

 SIC Code:
 7216

Air District Name: SOUTH COAST AQMD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 0
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

 Year:
 1990

 County Code:
 19

 Air Basin:
 SC

 Facility ID:
 36789

 Air District Name:
 SC

 SIC Code:
 7216

Air District Name: SOUTH COAST AQMD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 0
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

47 LA BREA MOTORS

East 339 SOUTH LA BREA AVENUE 1/2-1 LOS ANGELES, CA 90036

0.949 mi. 5013 ft.

Relative:

ENVIROSTOR:

 Higher
 Facility ID:
 60001395

 Status:
 No Further Action

 Actual:
 Status Date:
 02/14/2012

 Actual:
 Status Date:
 02/14/20

 214 ft.
 Site Code:
 301517

Site Type: Voluntary Cleanup
Site Type Detailed: Voluntary Cleanup

Acres: 0.37
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Not reported
Supervisor: Javier Hinojosa
Division Branch: Cleanup Chatsworth

Assembly: 50 Senate: 26 S105024639

N/A

CA ENVIROSTOR

CA HIST CORTESE

CA VCP

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LA BREA MOTORS (Continued)

S105024639

Special Program: Voluntary Cleanup Program

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED Funding: Responsible Party Latitude: 34.06775

-118.3440 Longitude:

APN: 5508-001-008, 5508-001-009, 5508-001-010

Past Use: VEHICLE MAINTENANCE

Potential COC: Tetrachloroethylene (PCE Trichloroethylene (TCE Confirmed COC: Tetrachloroethylene (PCE Trichloroethylene (TCE

Potential Description: OTH

Alias Name: 5508-001-008

Alias Type: APN

Alias Name: 5508-001-009

Alias Type: APN Alias Name: 5508-001-010

APN Alias Type: Alias Name: 301517

Alias Type: Project Code (Site Code)

Alias Name: 60001395

Alias Type: **Envirostor ID Number**

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Endangerment Assessment Report

Completed Date: 03/30/2011

Comments: DTSC issued letter requesting Risk Assessment.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Risk Assessment Report

Completed Date: 06/10/2011

Comments: Response to DTSC comments on Risk Assessment considered acceptable.

DTSC issued NFA letter.

PROJECT WIDE Completed Area Name: Not reported Completed Sub Area Name:

Completed Document Type: Voluntary Cleanup Agreement Termination Notification

Completed Date: 06/16/2011 Comments: Sent letter

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Cost Recovery Closeout Memo

Completed Date: 07/22/2011 Comments: Not reported

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported

Completed Document Type: No Further Action Letter

Completed Date: 06/10/2011 Comments: Issued NFA Letter

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement

Completed Date: 01/11/2011

Direction Distance

Elevation Site Database(s) **EPA ID Number**

LA BREA MOTORS (Continued)

S105024639

EDR ID Number

Comments: VCA executed

Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Not reported Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

VCP:

Facility ID: 60001395 Site Type: Voluntary Cleanup Site Type Detail: Voluntary Cleanup NONE SPECIFIED Site Mgmt. Req.:

0.37 National Priorities List: NO Cleanup Oversight Agencies: **SMBRP SMBRP** Lead Agency:

Lead Agency Description: DTSC - Site Cleanup Program

Project Manager: Not reported Supervisor: Javier Hinojosa Cleanup Chatsworth Division Branch:

Site Code: 301517 50 Assembly: Senate: 26

Special Programs Code: Voluntary Cleanup Program

No Further Action Status: Status Date: 02/14/2012

Restricted Use: NO

Funding: Responsible Party 34.06775 / -118.3440 Lat/Long:

APN: 5508-001-008, 5508-001-009, 5508-001-010

VEHICLE MAINTENANCE Past Use:

Potential COC: 30022, 30027 Confirmed COC: 30022,30027 Potential Description: OTH Alias Name: 5508-001-008 Alias Type: APN

Alias Name: 5508-001-009 APN

Alias Type: Alias Name: 5508-001-010

Alias Type: APN

Alias Name: 301517

Alias Type: Project Code (Site Code)

Alias Name: 60001395

Envirostor ID Number Alias Type:

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Endangerment Assessment Report

Completed Date: 03/30/2011

Comments: DTSC issued letter requesting Risk Assessment.

Direction Distance

Elevation Site Database(s) EPA ID Number

LA BREA MOTORS (Continued)

S105024639

EDR ID Number

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Risk Assessment Report

Completed Date: 06/10/2011

Comments: Response to DTSC comments on Risk Assessment considered acceptable.

DTSC issued NFA letter.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement Termination Notification

Completed Date: 06/16/2011 Comments: Sent letter

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Cost Recovery Closeout Memo

Completed Date: 07/22/2011 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: No Further Action Letter

Completed Date: 06/10/2011 Comments: Issued NFA Letter

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement

Completed Date: 01/11/2011 Comments: VCA executed

Future Area Name: Not reported Not reported Future Sub Area Name: Future Document Type: Not reported Not reported Future Due Date: Not reported Schedule Area Name: Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported

HIST CORTESE:

Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900360034

48 LA BREA AVENUE MOTORS - 359 S. LA BREA PROPERTY

CA ENVIROSTOR S111418022

359 SOUTH LA BREA AVENUE N/A

1/2-1 LA BREA, CA 90036 0.952 mi.

5028 ft.

ESE

Relative: ENVIROSTOR:

Higher Facility ID: 60001611

Status: No Further Action
Actual: Status Date: 04/03/2012

210 ft.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LA BREA AVENUE MOTORS - 359 S. LA BREA PROPERTY (Continued)

S111418022

Site Code: 301551 Site Type: Evaluation Site Type Detailed: Evaluation Acres: 0.31 NPL: NO **SMBRP** Regulatory Agencies: **SMBRP** Lead Agency: Program Manager: Not reported Supervisor: Javier Hinojosa Division Branch: Cleanup Chatsworth

Assembly: 50 Senate: 26

Special Program: Voluntary Cleanup Program

Restricted Use:

Site Mgmt Req: NONE SPECIFIED Funding: Responsible Party

Latitude: 34.06714 Longitude: -118.3442

APN: NONE SPECIFIED Past Use: **VEHICLE MAINTENANCE**

Potential COC: Under Investigation Tetrachloroethylene (PCE TPH-diesel TPH-gas

TPH-MOTOR OIL Trichloroethylene (TCE 1,1-Dichloroethane

1.1-Dichloroethylene

Confirmed COC: 30022-NO 30024-NO 30025-NO 30192-NO 3002502-NO 30027-NO 30194-NO

31001-NO

Potential Description: OTH, SOIL, SV Alias Name: 301551

Alias Type: Project Code (Site Code)

Alias Name: 60001611

Envirostor ID Number Alias Type:

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Endangerment Assessment Report

Completed Date: 02/10/2012

Comments: DTSC determined FA is required to fully assess potential site

impacts. Additional soil gas investigation and GW assessment is

necessary.

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported

Completed Document Type: Site Characterization Workplan

Completed Date: 02/21/2012

Comments: DTSC approved the work plan on 02/21/2012

PROJECT WIDE Completed Area Name: Completed Sub Area Name: Not reported

Completed Document Type: *Correspondence - Received

Completed Date: 02/15/2012 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Site Characterization Report

Completed Date: 04/03/2012

Comments: DTSC concurs with the conclusion of the SSI Report that further

environmental investigation of the Site is not required and approves

Direction Distance

Elevation Site Database(s) EPA ID Number

LA BREA AVENUE MOTORS - 359 S. LA BREA PROPERTY (Continued)

S111418022

EDR ID Number

the Report. DTSC issued No Further Action Determination Letter on

April 3, 2012.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement Termination Notification

Completed Date: 04/12/2012

Comments: VCA Termination. NFA required.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement

Completed Date: 12/09/2011 Comments: VCA executed.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Cost Recovery Closeout Memo

Completed Date: 05/15/2012

Comments: CRU Closeout Memo

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: No Further Action Letter

Completed Date: 04/03/2012

Comments: DTSC issued No Further Action Determination Letter on April 3, 2012.

Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Not reported Future Due Date: Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Not reported Schedule Due Date: Schedule Revised Date: Not reported

49 LA BREA AVENUE MOTORS - 401 S. LA BREA PROPERTY

ESE 401 SOUTH LA BREA AVENUE

1/2-1 LA BREA, CA 90036

0.978 mi. 5166 ft.

Relative: ENVIROSTOR:

Higher Facility ID: 60001610

Status: No Further Action

Actual: Status Date: 04/03/2012

207 ft. Site Code: 301552

Site Type: Evaluation Site Type Detailed: Evaluation Acres: 1.25 NO NPL: **SMBRP** Regulatory Agencies: Lead Agency: **SMBRP** Program Manager: Not reported Supervisor: Javier Hinojosa Division Branch: Cleanup Chatsworth

Assembly: 50

CA ENVIROSTOR \$111418021

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

LA BREA AVENUE MOTORS - 401 S. LA BREA PROPERTY (Continued)

S111418021

EDR ID Number

Senate: 26

Special Program: Voluntary Cleanup Program

Restricted Use: NO

Site Mgmt Req: NONE SPECIFIED Funding: Responsible Party Latitude: 34.06668 Longitude: -118.3442

APN: NONE SPECIFIED

Past Use: RETAIL - VEHICLES, VEHICLE MAINTENANCE

Potential COC: Tetrachloroethylene (PCE TPH-gas Trichloroethylene (TCE

Confirmed COC: 30022-NO 30025-NO 30027-NO

Potential Description: OTH, SOIL, SV Alias Name: 301552

Alias Type: Project Code (Site Code)

Alias Name: 60001610

Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Preliminary Endangerment Assessment Report

Completed Date: 02/10/2012

Comments: DTSC determined FA is required.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Site Characterization Workplan

Completed Date: 02/21/2012 Comments: Not reported

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Site Characterization Report

Completed Date: 04/03/2012

Comments: DTSC concurs with the conclusion of the SSI Report that further

environmental investigation of the Site is not required and approves the Report. DTSC issued No Further Action Determination Letter on

April 3, 2012.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement Termination Notification

Completed Date: 04/12/2012

Comments: VCA Termination Letter. NFA determination

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: No Further Action Letter

Completed Date: 04/03/2012

Comments: DTSC issued NFA Determination Letter April 3, 2012.

Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported

Completed Document Type: Cost Recovery Closeout Memo

Completed Date: 05/15/2012

Comments: CRU Closeout Memo

Completed Area Name: PROJECT WIDE

Map ID MAP FINDINGS Direction

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

LA BREA AVENUE MOTORS - 401 S. LA BREA PROPERTY (Continued)

S111418021

Completed Sub Area Name: Not reported

Completed Document Type: Voluntary Cleanup Agreement

Completed Date: 12/09/2011
Comments: VCA executed

Future Area Name: Not reported Not reported Future Sub Area Name: Future Document Type: Not reported Future Due Date: Not reported Schedule Area Name: Not reported Not reported Schedule Sub Area Name: Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported Count: 2 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
LOS ANGELES	S105180961	FARMERS MARKET CAR WASH (FORMER)	118 FAIRFAX AVE	90036	CA LUST
LOS ANGELES	S106092350	SALT LAKE PROPERTY	111 S.STANLEY AVE.	90036	CA ENVIROSTOR

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 12/05/2016 Source: EPA
Date Data Arrived at EDR: 01/05/2017 Telephone: N/A

Number of Days to Update: 29 Next Scheduled EDR Contact: 07/17/2017
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1 EPA Region 6

Telephone 617-918-1143 Telephone: 214-655-6659

EPA Region 3 EPA Region 7

Telephone 215-814-5418 Telephone: 913-551-7247

EPA Region 4 EPA Region 8

Telephone 404-562-8033 Telephone: 303-312-6774

EPA Region 5 EPA Region 9

Telephone 312-886-6686 Telephone: 415-947-4246

EPA Region 10

Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 12/05/2016 Source: EPA
Date Data Arrived at EDR: 01/05/2017 Telephone: N/A

Number of Days to Update: 29 Next Scheduled EDR Contact: 07/17/2017
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Source: EPA

Date of Government Version: 10/15/1991 Date Data Arrived at EDR: 02/02/1994 Date Made Active in Reports: 03/30/1994

Number of Days to Update: 56

Telephone: 202-564-4267 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: No Update Planned

Federal Delisted NPL site list

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 12/05/2016 Date Data Arrived at EDR: 01/05/2017 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 29

Source: EPA Telephone: N/A

Last EDR Contact: 04/21/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Quarterly

Federal CERCLIS list

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 11/07/2016 Date Data Arrived at EDR: 01/05/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 92

Source: Environmental Protection Agency

Telephone: 703-603-8704 Last EDR Contact: 04/07/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 02/07/2017 Date Data Arrived at EDR: 04/19/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 16

Source: EPA

Telephone: 800-424-9346 Last EDR Contact: 04/21/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Quarterly

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 02/07/2017 Date Data Arrived at EDR: 04/19/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 16

Source: EPA

Telephone: 800-424-9346 Last EDR Contact: 04/25/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 12/12/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 44

Source: EPA

Telephone: 800-424-9346 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 04/10/2017 Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 12/12/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 44

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 04/10/2017 Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 12/12/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 44

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 04/10/2017 Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 12/12/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 44

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 04/10/2017 Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 12/12/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 44

Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 04/10/2017 Data Release Frequency: Varies

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/28/2016 Date Data Arrived at EDR: 01/04/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 93

Source: Department of the Navy Telephone: 843-820-7326 Last EDR Contact: 02/13/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 11/15/2016 Date Data Arrived at EDR: 11/29/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 66

Source: Environmental Protection Agency

Telephone: 703-603-0695 Last EDR Contact: 02/28/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 11/15/2016 Date Data Arrived at EDR: 11/29/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 66

Source: Environmental Protection Agency

Telephone: 703-603-0695 Last EDR Contact: 02/28/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 09/26/2016 Date Data Arrived at EDR: 09/29/2016 Date Made Active in Reports: 11/11/2016

Number of Days to Update: 43

Source: National Response Center, United States Coast Guard

Telephone: 202-267-2180 Last EDR Contact: 03/29/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Annually

State- and tribal - equivalent NPL

RESPONSE: State Response Sites

Identifies confirmed release sites where DTSC is involved in remediation, either in a lead or oversight capacity.

These confirmed release sites are generally high-priority and high potential risk.

Date of Government Version: 10/31/2016 Date Data Arrived at EDR: 11/01/2016 Date Made Active in Reports: 01/18/2017

Number of Days to Update: 78

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Quarterly

State- and tribal - equivalent CERCLIS

ENVIROSTOR: EnviroStor Database

The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifes sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

Date of Government Version: 10/31/2016 Date Data Arrived at EDR: 11/01/2016 Date Made Active in Reports: 01/18/2017

Number of Days to Update: 78

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Quarterly

State and tribal landfill and/or solid waste disposal site lists

SWF/LF (SWIS): Solid Waste Information System

Active, Closed and Inactive Landfills. SWF/LF records typically contain an inventory of solid waste disposal facilities or landfills. These may be active or inactive facilities or open dumps that failed to meet RCRA Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 02/13/2017 Date Data Arrived at EDR: 02/15/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 76

Source: Department of Resources Recycling and Recovery

Telephone: 916-341-6320 Last EDR Contact: 02/15/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Quarterly

State and tribal leaking storage tank lists

LUST: Leaking Underground Fuel Tank Report (GEOTRACKER)

Leaking Underground Storage Tank (LUST) Sites included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 03/13/2017 Date Data Arrived at EDR: 03/14/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 49

Source: State Water Resources Control Board

Telephone: see region list Last EDR Contact: 03/14/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

LUST REG 4: Underground Storage Tank Leak List

Los Angeles, Ventura counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/07/2004 Date Data Arrived at EDR: 09/07/2004 Date Made Active in Reports: 10/12/2004

Number of Days to Update: 35

Source: California Regional Water Quality Control Board Los Angeles Region (4)

Telephone: 213-576-6710 Last EDR Contact: 09/06/2011

Next Scheduled EDR Contact: 12/19/2011 Data Release Frequency: No Update Planned

LUST REG 9: Leaking Underground Storage Tank Report

Orange, Riverside, San Diego counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 03/01/2001 Date Data Arrived at EDR: 04/23/2001 Date Made Active in Reports: 05/21/2001

Number of Days to Update: 28

Source: California Regional Water Quality Control Board San Diego Region (9)

Telephone: 858-637-5595 Last EDR Contact: 09/26/2011

Next Scheduled EDR Contact: 01/09/2012
Data Release Frequency: No Update Planned

LUST REG 8: Leaking Underground Storage Tanks

California Regional Water Quality Control Board Santa Ana Region (8). For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/14/2005 Date Data Arrived at EDR: 02/15/2005 Date Made Active in Reports: 03/28/2005

Number of Days to Update: 41

Source: California Regional Water Quality Control Board Santa Ana Region (8)

Telephone: 909-782-4496 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: Varies

LUST REG 7: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Imperial, Riverside, San Diego, Santa Barbara counties.

Date of Government Version: 02/26/2004 Date Data Arrived at EDR: 02/26/2004 Date Made Active in Reports: 03/24/2004

Number of Days to Update: 27

Source: California Regional Water Quality Control Board Colorado River Basin Region (7)

Telephone: 760-776-8943 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011 Data Release Frequency: No Update Planned

LUST REG 6V: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Inyo, Kern, Los Angeles, Mono, San Bernardino counties.

Date of Government Version: 06/07/2005 Date Data Arrived at EDR: 06/07/2005 Date Made Active in Reports: 06/29/2005

Number of Days to Update: 22

Source: California Regional Water Quality Control Board Victorville Branch Office (6)

Telephone: 760-241-7365

Last EDR Contact: 09/12/2011 Next Scheduled EDR Contact: 12/26/2011

Data Release Frequency: No Update Planned

LUST REG 6L: Leaking Underground Storage Tank Case Listing

For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/09/2003 Date Data Arrived at EDR: 09/10/2003 Date Made Active in Reports: 10/07/2003

Number of Days to Update: 27

Source: California Regional Water Quality Control Board Lahontan Region (6)

Telephone: 530-542-5572 Last EDR Contact: 09/12/2011

Next Scheduled EDR Contact: 12/26/2011 Data Release Frequency: No Update Planned

LUST REG 5: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Alameda, Alpine, Amador, Butte, Colusa, Contra Costa, Calveras, El Dorado, Fresno, Glenn, Kern, Kings, Lake, Lassen, Madera, Mariposa, Merced, Modoc, Napa, Nevada, Placer, Plumas,

Sacramento, San Joaquin, Shasta, Solano, Stanislaus, Sutter, Tehama, Tulare, Tuolumne, Yolo, Yuba counties.

Date of Government Version: 07/01/2008 Date Data Arrived at EDR: 07/22/2008 Date Made Active in Reports: 07/31/2008

Number of Days to Update: 9

Source: California Regional Water Quality Control Board Central Valley Region (5)

Telephone: 916-464-4834 Last EDR Contact: 07/01/2011

Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: No Update Planned

LUST REG 3: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Monterey, San Benito, San Luis Obispo, Santa Barbara, Santa Cruz counties.

Date of Government Version: 05/19/2003 Date Data Arrived at EDR: 05/19/2003 Date Made Active in Reports: 06/02/2003

Number of Days to Update: 14

Source: California Regional Water Quality Control Board Central Coast Region (3)

Telephone: 805-542-4786 Last EDR Contact: 07/18/2011

Next Scheduled EDR Contact: 10/31/2011 Data Release Frequency: No Update Planned

LUST REG 2: Fuel Leak List

Leaking Underground Storage Tank locations. Alameda, Contra Costa, Marin, Napa, San Francisco, San Mateo, Santa

Clara, Solano, Sonoma counties.

Date of Government Version: 09/30/2004 Date Data Arrived at EDR: 10/20/2004 Date Made Active in Reports: 11/19/2004

Number of Days to Update: 30

Source: California Regional Water Quality Control Board San Francisco Bay Region (2)

Telephone: 510-622-2433 Last EDR Contact: 09/19/2011

Next Scheduled EDR Contact: 01/02/2012 Data Release Frequency: Quarterly

LUST REG 1: Active Toxic Site Investigation

Del Norte, Humboldt, Lake, Mendocino, Modoc, Siskiyou, Sonoma, Trinity counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/01/2001 Date Data Arrived at EDR: 02/28/2001 Date Made Active in Reports: 03/29/2001

Number of Days to Update: 29

Source: California Regional Water Quality Control Board North Coast (1)

Telephone: 707-570-3769 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011 Data Release Frequency: No Update Planned

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 10/14/2016 Date Data Arrived at EDR: 01/27/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 98

Source: EPA Region 4 Telephone: 404-562-8677 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Semi-Annually

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 10/01/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 6 Telephone: 214-665-6597 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 09/01/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 10/17/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 8 Telephone: 303-312-6271 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 10/06/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: Environmental Protection Agency Telephone: 415-972-3372

Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 10/07/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 11/14/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA, Region 5 Telephone: 312-886-7439 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 11/14/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 1 Telephone: 617-918-1313 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

SLIC: Statewide SLIC Cases (GEOTRACKER)

Cleanup Program Sites (CPS; also known as Site Cleanups [SC] and formerly known as Spills, Leaks, Investigations, and Cleanups [SLIC] sites) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 03/13/2017 Date Data Arrived at EDR: 03/14/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 49

Source: State Water Resources Control Board Telephone: 866-480-1028

Last EDR Contact: 03/14/2017

Next Scheduled EDR Contact: 06/26/2017

Data Release Frequency: Varies

SLIC REG 1: Active Toxic Site Investigations

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2003 Date Data Arrived at EDR: 04/07/2003 Date Made Active in Reports: 04/25/2003

Number of Days to Update: 18

Source: California Regional Water Quality Control Board, North Coast Region (1)

Telephone: 707-576-2220 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011 Data Release Frequency: No Update Planned

SLIC REG 2: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 09/30/2004 Date Data Arrived at EDR: 10/20/2004 Date Made Active in Reports: 11/19/2004

Number of Days to Update: 30

Source: Regional Water Quality Control Board San Francisco Bay Region (2)

Telephone: 510-286-0457 Last EDR Contact: 09/19/2011

Next Scheduled EDR Contact: 01/02/2012 Data Release Frequency: Quarterly

SLIC REG 3: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 05/18/2006 Date Data Arrived at EDR: 05/18/2006 Date Made Active in Reports: 06/15/2006

Number of Days to Update: 28

Source: California Regional Water Quality Control Board Central Coast Region (3)

Telephone: 805-549-3147 Last EDR Contact: 07/18/2011

Next Scheduled EDR Contact: 10/31/2011 Data Release Frequency: Semi-Annually

SLIC REG 4: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 11/17/2004 Date Data Arrived at EDR: 11/18/2004 Date Made Active in Reports: 01/04/2005

Number of Days to Update: 47

Source: Region Water Quality Control Board Los Angeles Region (4)

Telephone: 213-576-6600 Last EDR Contact: 07/01/2011

Next Scheduled EDR Contact: 10/17/2011

Data Release Frequency: Varies

SLIC REG 5: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 04/01/2005 Date Data Arrived at EDR: 04/05/2005 Date Made Active in Reports: 04/21/2005

Number of Days to Update: 16

Source: Regional Water Quality Control Board Central Valley Region (5)

Telephone: 916-464-3291 Last EDR Contact: 09/12/2011

Next Scheduled EDR Contact: 12/26/2011 Data Release Frequency: Semi-Annually

SLIC REG 6V: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 05/24/2005 Date Data Arrived at EDR: 05/25/2005 Date Made Active in Reports: 06/16/2005

Number of Days to Update: 22

Source: Regional Water Quality Control Board, Victorville Branch

Telephone: 619-241-6583 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: Semi-Annually

SLIC REG 6L: SLIC Sites

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 09/07/2004 Date Data Arrived at EDR: 09/07/2004 Date Made Active in Reports: 10/12/2004

Number of Days to Update: 35

Source: California Regional Water Quality Control Board, Lahontan Region

Telephone: 530-542-5574 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: No Update Planned

SLIC REG 7: SLIC List

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 11/24/2004 Date Data Arrived at EDR: 11/29/2004 Date Made Active in Reports: 01/04/2005

Number of Days to Update: 36

Source: California Regional Quality Control Board, Colorado River Basin Region

Telephone: 760-346-7491 Last EDR Contact: 08/01/2011

Next Scheduled EDR Contact: 11/14/2011 Data Release Frequency: No Update Planned

SLIC REG 8: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2008 Date Data Arrived at EDR: 04/03/2008 Date Made Active in Reports: 04/14/2008

Number of Days to Update: 11

Source: California Region Water Quality Control Board Santa Ana Region (8)

Telephone: 951-782-3298 Last EDR Contact: 09/12/2011

Next Scheduled EDR Contact: 12/26/2011 Data Release Frequency: Semi-Annually

SLIC REG 9: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality

from spills, leaks, and similar discharges.

Date of Government Version: 09/10/2007 Date Data Arrived at EDR: 09/11/2007 Date Made Active in Reports: 09/28/2007

Number of Days to Update: 17

Source: California Regional Water Quality Control Board San Diego Region (9)

Telephone: 858-467-2980 Last EDR Contact: 08/08/2011

Next Scheduled EDR Contact: 11/21/2011 Data Release Frequency: Annually

State and tribal registered storage tank lists

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010 Date Data Arrived at EDR: 02/16/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 55

Source: FEMA

Telephone: 202-646-5797 Last EDR Contact: 04/11/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Varies

UST: Active UST Facilities

Active UST facilities gathered from the local regulatory agencies

Date of Government Version: 09/12/2016 Date Data Arrived at EDR: 09/14/2016 Date Made Active in Reports: 10/14/2016

Number of Days to Update: 30

Source: SWRCB Telephone: 916-341-5851 Last EDR Contact: 03/16/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Semi-Annually

AST: Aboveground Petroleum Storage Tank Facilities

A listing of aboveground storage tank petroleum storage tank locations.

Date of Government Version: 07/06/2016 Date Data Arrived at EDR: 07/12/2016 Date Made Active in Reports: 09/19/2016

Number of Days to Update: 69

Source: California Environmental Protection Agency

Telephone: 916-327-5092 Last EDR Contact: 03/24/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 10/07/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 10/06/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 9 Telephone: 415-972-3368 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 10/17/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 8 Telephone: 303-312-6137 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 09/01/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 11/14/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA, Region 1 Telephone: 617-918-1313 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 10/14/2016 Date Data Arrived at EDR: 01/27/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 98

Source: EPA Region 4 Telephone: 404-562-9424 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Semi-Annually

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 01/14/2017 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 5 Telephone: 312-886-6136 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 10/01/2016 Date Data Arrived at EDR: 01/26/2017 Date Made Active in Reports: 05/05/2017

Number of Days to Update: 99

Source: EPA Region 6 Telephone: 214-665-7591 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Semi-Annually

State and tribal voluntary cleanup sites

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015 Date Data Arrived at EDR: 09/29/2015 Date Made Active in Reports: 02/18/2016

Number of Days to Update: 142

Source: EPA, Region 1 Telephone: 617-918-1102 Last EDR Contact: 03/27/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008 Date Data Arrived at EDR: 04/22/2008 Date Made Active in Reports: 05/19/2008

Number of Days to Update: 27

Source: EPA, Region 7 Telephone: 913-551-7365 Last EDR Contact: 04/20/2009

Next Scheduled EDR Contact: 07/20/2009 Data Release Frequency: Varies

VCP: Voluntary Cleanup Program Properties

Contains low threat level properties with either confirmed or unconfirmed releases and the project proponents have request that DTSC oversee investigation and/or cleanup activities and have agreed to provide coverage for DTSC's costs.

Date of Government Version: 10/31/2016 Date Data Arrived at EDR: 11/01/2016 Date Made Active in Reports: 01/18/2017

Number of Days to Update: 78

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Quarterly

State and tribal Brownfields sites

BROWNFIELDS: Considered Brownfieds Sites Listing

A listing of sites the SWRCB considers to be Brownfields since these are sites have come to them through the MOA

Date of Government Version: 01/03/2017 Date Data Arrived at EDR: 01/04/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 57

Source: State Water Resources Control Board

Telephone: 916-323-7905 Last EDR Contact: 03/29/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Varies

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 03/02/2017 Date Data Arrived at EDR: 03/02/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 36

Source: Environmental Protection Agency Telephone: 202-566-2777

Last EDR Contact: 03/02/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

WMUDS/SWAT: Waste Management Unit Database

Waste Management Unit Database System. WMUDS is used by the State Water Resources Control Board staff and the Regional Water Quality Control Boards for program tracking and inventory of waste management units. WMUDS is composed of the following databases: Facility Information, Scheduled Inspections Information, Waste Management Unit Information, SWAT Program Information, SWAT Report Summary Information, SWAT Report Summary Data, Chapter 15 (formerly Subchapter 15) Information, Chapter 15 Monitoring Parameters, TPCA Program Information, RCRA Program Information, Closure Information, and Interested Parties Information.

Date of Government Version: 04/01/2000 Date Data Arrived at EDR: 04/10/2000 Date Made Active in Reports: 05/10/2000

Number of Days to Update: 30

Source: State Water Resources Control Board

Telephone: 916-227-4448 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017 Data Release Frequency: No Update Planned

SWRCY: Recycler Database

A listing of recycling facilities in California.

Date of Government Version: 03/13/2017 Date Data Arrived at EDR: 03/14/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 50

Source: Department of Conservation Telephone: 916-323-3836 Last EDR Contact: 03/14/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

HAULERS: Registered Waste Tire Haulers Listing A listing of registered waste tire haulers.

Date of Government Version: 08/25/2016 Date Data Arrived at EDR: 08/26/2016 Date Made Active in Reports: 10/14/2016

Number of Days to Update: 49

Source: Integrated Waste Management Board

Telephone: 916-341-6422 Last EDR Contact: 02/13/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998 Date Data Arrived at EDR: 12/03/2007 Date Made Active in Reports: 01/24/2008

Number of Days to Update: 52

Source: Environmental Protection Agency

Telephone: 703-308-8245 Last EDR Contact: 05/01/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Varies

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009 Date Data Arrived at EDR: 05/07/2009 Date Made Active in Reports: 09/21/2009

Number of Days to Update: 137

Source: EPA, Region 9 Telephone: 415-947-4219 Last EDR Contact: 04/24/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: No Update Planned

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Subtitle D Criteria.

Date of Government Version: 06/30/1985 Date Data Arrived at EDR: 08/09/2004 Date Made Active in Reports: 09/17/2004

Number of Days to Update: 39

Source: Environmental Protection Agency

Telephone: 800-424-9346 Last EDR Contact: 06/09/2004 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014 Date Data Arrived at EDR: 08/06/2014 Date Made Active in Reports: 01/29/2015

Number of Days to Update: 176

Source: Department of Health & Human Serivces, Indian Health Service

Telephone: 301-443-1452 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 09/30/2016 Date Data Arrived at EDR: 01/05/2017 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 36

Source: Drug Enforcement Administration

Telephone: 202-307-1000 Last EDR Contact: 02/28/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: No Update Planned

HIST CAL-SITES: Calsites Database

The Calsites database contains potential or confirmed hazardous substance release properties. In 1996, California EPA reevaluated and significantly reduced the number of sites in the Calsites database. No longer updated by the state agency. It has been replaced by ENVIROSTOR.

Date of Government Version: 08/08/2005 Date Data Arrived at EDR: 08/03/2006 Date Made Active in Reports: 08/24/2006

Number of Days to Update: 21

Source: Department of Toxic Substance Control

Telephone: 916-323-3400 Last EDR Contact: 02/23/2009

Next Scheduled EDR Contact: 05/25/2009 Data Release Frequency: No Update Planned

SCH: School Property Evaluation Program

This category contains proposed and existing school sites that are being evaluated by DTSC for possible hazardous materials contamination. In some cases, these properties may be listed in the CalSites category depending on the level of threat to public health and safety or the environment they pose.

Date of Government Version: 10/31/2016 Date Data Arrived at EDR: 11/01/2016 Date Made Active in Reports: 01/18/2017

Number of Days to Update: 78

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Quarterly

CDL: Clandestine Drug Labs

A listing of drug lab locations. Listing of a location in this database does not indicate that any illegal drug lab materials were or were not present there, and does not constitute a determination that the location either requires or does not require additional cleanup work.

Date of Government Version: 08/31/2016 Date Data Arrived at EDR: 11/18/2016 Date Made Active in Reports: 12/22/2016

Number of Days to Update: 34

Source: Department of Toxic Substances Control

Telephone: 916-255-6504 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 07/24/2017

Data Release Frequency: Varies

TOXIC PITS: Toxic Pits Cleanup Act Sites

Toxic PITS Cleanup Act Sites. TOXIC PITS identifies sites suspected of containing hazardous substances where cleanup has not yet been completed.

Date of Government Version: 07/01/1995 Date Data Arrived at EDR: 08/30/1995 Date Made Active in Reports: 09/26/1995

Number of Days to Update: 27

Source: State Water Resources Control Board

Telephone: 916-227-4364 Last EDR Contact: 01/26/2009

Next Scheduled EDR Contact: 04/27/2009 Data Release Frequency: No Update Planned

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/30/2016 Date Data Arrived at EDR: 12/05/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 67

Source: Drug Enforcement Administration

Telephone: 202-307-1000 Last EDR Contact: 02/28/2017

Next Scheduled EDR Contact: 06/12/2017
Data Release Frequency: Quarterly

Local Lists of Registered Storage Tanks

SWEEPS UST: SWEEPS UST Listing

Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1990's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

Date of Government Version: 06/01/1994 Date Data Arrived at EDR: 07/07/2005 Date Made Active in Reports: 08/11/2005

Number of Days to Update: 35

Source: State Water Resources Control Board

Telephone: N/A

Last EDR Contact: 06/03/2005 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

UST MENDOCINO: Mendocino County UST Database

A listing of underground storage tank locations in Mendocino County.

Date of Government Version: 12/01/2016 Date Data Arrived at EDR: 12/06/2016 Date Made Active in Reports: 01/10/2017

Number of Days to Update: 35

Source: Department of Public Health Telephone: 707-463-4466

Last EDR Contact: 02/27/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Annually

HIST UST: Hazardous Substance Storage Container Database

The Hazardous Substance Storage Container Database is a historical listing of UST sites. Refer to local/county

source for current data.

Date of Government Version: 10/15/1990 Date Data Arrived at EDR: 01/25/1991 Date Made Active in Reports: 02/12/1991

Number of Days to Update: 18

Source: State Water Resources Control Board

Telephone: 916-341-5851 Last EDR Contact: 07/26/2001 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

CA FID UST: Facility Inventory Database

The Facility Inventory Database (FID) contains a historical listing of active and inactive underground storage tank locations from the State Water Resource Control Board. Refer to local/county source for current data.

Date of Government Version: 10/31/1994 Date Data Arrived at EDR: 09/05/1995 Date Made Active in Reports: 09/29/1995

Number of Days to Update: 24

Source: California Environmental Protection Agency

Telephone: 916-341-5851 Last EDR Contact: 12/28/1998 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

Local Land Records

LIENS: Environmental Liens Listing

A listing of property locations with environmental liens for California where DTSC is a lien holder.

Date of Government Version: 03/06/2017 Date Data Arrived at EDR: 03/07/2017 Date Made Active in Reports: 04/21/2017

Number of Days to Update: 45

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Varies

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/18/2014 Date Data Arrived at EDR: 03/18/2014 Date Made Active in Reports: 04/24/2014

Number of Days to Update: 37

Source: Environmental Protection Agency

Telephone: 202-564-6023 Last EDR Contact: 04/21/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

DEED: Deed Restriction Listing

Site Mitigation and Brownfields Reuse Program Facility Sites with Deed Restrictions & Hazardous Waste Management Program Facility Sites with Deed / Land Use Restriction. The DTSC Site Mitigation and Brownfields Reuse Program (SMBRP) list includes sites cleaned up under the program's oversight and generally does not include current or former hazardous waste facilities that required a hazardous waste facility permit. The list represents deed restrictions that are active. Some sites have multiple deed restrictions. The DTSC Hazardous Waste Management Program (HWMP) has developed a list of current or former hazardous waste facilities that have a recorded land use restriction at the local county recorder's office. The land use restrictions on this list were required by the DTSC HWMP as a result of the presence of hazardous substances that remain on site after the facility (or part of the facility) has been closed or cleaned up. The types of land use restriction include deed notice, deed restriction, or a land use restriction that binds current and future owners.

Date of Government Version: 12/06/2016 Date Data Arrived at EDR: 12/06/2016 Date Made Active in Reports: 01/20/2017

Number of Days to Update: 45

Source: DTSC and SWRCB Telephone: 916-323-3400 Last EDR Contact: 03/07/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/28/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 37

Source: U.S. Department of Transportation

Telephone: 202-366-4555 Last EDR Contact: 03/29/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Annually

CHMIRS: California Hazardous Material Incident Report System

California Hazardous Material Incident Reporting System. CHMIRS contains information on reported hazardous material incidents (accidental releases or spills).

Date of Government Version: 09/26/2016 Date Data Arrived at EDR: 10/26/2016 Date Made Active in Reports: 01/17/2017

Number of Days to Update: 83

Source: Office of Emergency Services

Telephone: 916-845-8400 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

LDS: Land Disposal Sites Listing (GEOTRACKER)

Land Disposal sites (Landfills) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 03/13/2017 Date Data Arrived at EDR: 03/14/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 49

Source: State Water Qualilty Control Board

Telephone: 866-480-1028 Last EDR Contact: 03/14/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

MCS: Military Cleanup Sites Listing (GEOTRACKER)

Military sites (consisting of: Military UST sites; Military Privatized sites; and Military Cleanup sites [formerly known as DoD non UST]) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 03/13/2017 Date Data Arrived at EDR: 03/14/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 49

Source: State Water Resources Control Board

Telephone: 866-480-1028 Last EDR Contact: 03/14/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 06/06/2012 Date Data Arrived at EDR: 01/03/2013 Date Made Active in Reports: 02/22/2013 Number of Days to Update: 50

Source: FirstSearch Telephone: N/A

Last EDR Contact: 01/03/2013 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 12/12/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 02/10/2017 Source: Environmental Protection Agency

Telephone: (415) 495-8895 Last FDR Contact: 05/02/2017

Number of Days to Update: 44

Next Scheduled EDR Contact: 04/10/2017 Data Release Frequency: Varies

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/31/2015 Date Data Arrived at EDR: 07/08/2015

Source: U.S. Army Corps of Engineers

Date Made Active in Reports: 10/13/2015

Telephone: 202-528-4285 Last EDR Contact: 02/24/2017

Number of Days to Update: 97

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 11/10/2006

Source: USGS

Date Made Active in Reports: 01/11/2007

Telephone: 888-275-8747 Last EDR Contact: 04/14/2017

Number of Days to Update: 62

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Semi-Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 02/06/2006 Date Made Active in Reports: 01/11/2007 Source: U.S. Geological Survey Telephone: 888-275-8747 Last EDR Contact: 04/14/2017

Number of Days to Update: 339

Next Scheduled EDR Contact: 07/24/2017

Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 01/01/2017 Date Data Arrived at EDR: 02/03/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 63

Source: Environmental Protection Agency

Telephone: 615-532-8599 Last EDR Contact: 02/03/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 10/11/2016 Date Data Arrived at EDR: 11/16/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 79

Source: Environmental Protection Agency

Telephone: 202-566-1917 Last EDR Contact: 02/15/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013 Date Data Arrived at EDR: 03/21/2014 Date Made Active in Reports: 06/17/2014

Number of Days to Update: 88

Source: Environmental Protection Agency

Telephone: 617-520-3000 Last EDR Contact: 02/03/2017

Next Scheduled EDR Contact: 05/22/2017 Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 04/22/2013 Date Data Arrived at EDR: 03/03/2015 Date Made Active in Reports: 03/09/2015

Number of Days to Update: 6

Source: Environmental Protection Agency Telephone: 703-308-4044

Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017

Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2012 Date Data Arrived at EDR: 01/15/2015 Date Made Active in Reports: 01/29/2015

Number of Days to Update: 14

Source: EPA

Telephone: 202-260-5521 Last EDR Contact: 03/24/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2014 Date Data Arrived at EDR: 11/24/2015 Date Made Active in Reports: 04/05/2016

Number of Days to Update: 133

Source: EPA

Telephone: 202-566-0250 Last EDR Contact: 02/24/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009 Date Data Arrived at EDR: 12/10/2010 Date Made Active in Reports: 02/25/2011

Number of Days to Update: 77

Source: EPA Telephone: 202-564-4203 Last EDR Contact: 04/26/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 11/25/2013 Date Data Arrived at EDR: 12/12/2013 Date Made Active in Reports: 02/24/2014

Number of Days to Update: 74

Source: EPA

Telephone: 703-416-0223 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 02/01/2017 Date Data Arrived at EDR: 02/09/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 57

Source: Environmental Protection Agency Telephone: 202-564-8600

Last EDR Contact: 04/21/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995 Date Data Arrived at EDR: 07/03/1995 Date Made Active in Reports: 08/07/1995

Number of Days to Update: 35

Source: EPA

Telephone: 202-564-4104 Last EDR Contact: 06/02/2008

Next Scheduled EDR Contact: 09/01/2008 Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 10/25/2013 Date Data Arrived at EDR: 10/17/2014 Date Made Active in Reports: 10/20/2014

Number of Days to Update: 3

Source: EPA

Telephone: 202-564-6023 Last EDR Contact: 04/25/2017

Next Scheduled EDR Contact: 05/22/2017 Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 01/20/2016 Date Data Arrived at EDR: 04/28/2016 Date Made Active in Reports: 09/02/2016

Number of Days to Update: 127

Source: EPA

Telephone: 202-566-0500 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016 Date Data Arrived at EDR: 11/23/2016 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 79

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances

Telephone: 202-566-1667 Last EDR Contact: 02/17/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA

Telephone: 202-566-1667 Last EDR Contact: 02/17/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Quarterly

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 08/30/2016 Date Data Arrived at EDR: 09/08/2016 Date Made Active in Reports: 10/21/2016

Number of Days to Update: 43

Source: Nuclear Regulatory Commission Telephone: 301-415-7169

Last EDR Contact: 02/03/2017 Next Scheduled EDR Contact: 05/22/2017 Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 08/07/2009 Date Made Active in Reports: 10/22/2009

Number of Days to Update: 76

Source: Department of Energy Telephone: 202-586-8719 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 07/01/2014 Date Data Arrived at EDR: 09/10/2014 Date Made Active in Reports: 10/20/2014

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: N/A

Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 02/01/2011 Date Data Arrived at EDR: 10/19/2011 Date Made Active in Reports: 01/10/2012

Number of Days to Update: 83

Source: Environmental Protection Agency

Telephone: 202-566-0517 Last EDR Contact: 04/28/2017

Next Scheduled EDR Contact: 08/07/2017

Data Release Frequency: Varies

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 01/04/2017 Date Data Arrived at EDR: 01/06/2017 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 35

Source: Environmental Protection Agency

Telephone: 202-343-9775 Last EDR Contact: 04/06/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2007

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2008

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 07/31/2012 Date Data Arrived at EDR: 08/07/2012 Date Made Active in Reports: 09/18/2012

Number of Days to Update: 42

Source: Department of Transporation, Office of Pipeline Safety

Telephone: 202-366-4595 Last EDR Contact: 05/02/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 09/30/2016 Date Data Arrived at EDR: 11/18/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 77

Source: Department of Justice, Consent Decree Library

Telephone: Varies

Last EDR Contact: 03/27/2017

Next Scheduled EDR Contact: 07/10/2017

Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2013 Date Data Arrived at EDR: 02/24/2015 Date Made Active in Reports: 09/30/2015

Number of Days to Update: 218

Source: EPA/NTIS Telephone: 800-424-9346 Last EDR Contact: 02/22/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014 Date Data Arrived at EDR: 07/14/2015 Date Made Active in Reports: 01/10/2017

Number of Days to Update: 546

Source: USGS

Telephone: 202-208-3710 Last EDR Contact: 04/14/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 12/23/2016 Date Data Arrived at EDR: 12/27/2016 Date Made Active in Reports: 02/17/2017

Number of Days to Update: 52

Source: Department of Energy Telephone: 202-586-3559 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017 Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010 Date Data Arrived at EDR: 10/07/2011 Date Made Active in Reports: 03/01/2012

Number of Days to Update: 146

Source: Department of Energy Telephone: 505-845-0011 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 12/05/2016 Date Data Arrived at EDR: 01/05/2017 Date Made Active in Reports: 02/10/2017

Number of Days to Update: 36

Source: Environmental Protection Agency

Telephone: 703-603-8787 Last EDR Contact: 04/21/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites

may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001 Date Data Arrived at EDR: 10/27/2010 Date Made Active in Reports: 12/02/2010

Number of Days to Update: 36

Source: American Journal of Public Health

Telephone: 703-305-6451 Last EDR Contact: 12/02/2009 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016 Date Data Arrived at EDR: 10/26/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 100

Source: EPA

Telephone: 202-564-2496 Last EDR Contact: 03/07/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data A listing of minor source facilities.

Date of Government Version: 10/12/2016 Date Data Arrived at EDR: 10/26/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 100

Source: EPA

Telephone: 202-564-2496 Last EDR Contact: 03/07/2017

Next Scheduled EDR Contact: 04/10/2017 Data Release Frequency: Annually

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/08/2017 Date Data Arrived at EDR: 02/28/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 38

Source: Department of Labor, Mine Safety and Health Administration

Telephone: 303-231-5959 Last EDR Contact: 02/28/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Semi-Annually

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 12/05/2005 Date Data Arrived at EDR: 02/29/2008 Date Made Active in Reports: 04/18/2008

Number of Days to Update: 49

Source: USGS

Telephone: 703-648-7709 Last EDR Contact: 03/03/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011 Date Data Arrived at EDR: 06/08/2011 Date Made Active in Reports: 09/13/2011

Number of Days to Update: 97

Source: USGS

Telephone: 703-648-7709 Last EDR Contact: 03/03/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 03/14/2017 Date Data Arrived at EDR: 03/17/2017 Date Made Active in Reports: 04/07/2017

Number of Days to Update: 21

Source: Department of Interior Telephone: 202-208-2609 Last EDR Contact: 03/13/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 07/15/2016 Date Data Arrived at EDR: 09/07/2016 Date Made Active in Reports: 11/11/2016

Number of Days to Update: 65

Source: EPA

Telephone: (415) 947-8000 Last EDR Contact: 04/07/2017

Next Scheduled EDR Contact: 06/19/2017
Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 10/25/2015 Date Data Arrived at EDR: 01/29/2016 Date Made Active in Reports: 04/05/2016

Number of Days to Update: 67

Source: Department of Defense Telephone: 571-373-0407 Last EDR Contact: 04/17/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Varies

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 06/02/2016 Date Data Arrived at EDR: 06/03/2016 Date Made Active in Reports: 09/02/2016

Number of Days to Update: 91

Source: Environmental Protection Agency

Telephone: 202-564-0527 Last EDR Contact: 02/24/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Varies

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 12/11/2016 Date Data Arrived at EDR: 12/20/2016 Date Made Active in Reports: 02/17/2017

Number of Days to Update: 59

Source: Environmental Protection Agency

Telephone: 202-564-2280 Last EDR Contact: 03/21/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: Quarterly

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels

Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 11/21/2016 Date Data Arrived at EDR: 11/22/2016 Date Made Active in Reports: 02/03/2017

Number of Days to Update: 73

Source: EPA

Telephone: 800-385-6164 Last EDR Contact: 02/22/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Quarterly

CA BOND EXP. PLAN: Bond Expenditure Plan

Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of

Hazardous Substance Cleanup Bond Act funds. It is not updated.

Date of Government Version: 01/01/1989 Date Data Arrived at EDR: 07/27/1994 Date Made Active in Reports: 08/02/1994

Number of Days to Update: 6

Source: Department of Health Services

Telephone: 916-255-2118 Last EDR Contact: 05/31/1994 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

CORTESE: "Cortese" Hazardous Waste & Substances Sites List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste

Board (SWF/LS), and the Department of Toxic Substances Control (Cal-Sites).

Date of Government Version: 12/28/2016 Date Data Arrived at EDR: 12/28/2016 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 64

Source: CAL EPA/Office of Emergency Information

Telephone: 916-323-3400 Last EDR Contact: 03/29/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Quarterly

DRYCLEANERS: Cleaner Facilities

A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes: power laundries, family and commercial; garment pressing and cleaner's agents; linen supply; coin-operated laundries and cleaning; drycleaning plants, except rugs; carpet and upholster cleaning; industrial launderers; laundry and garment services.

Date of Government Version: 09/02/2016 Date Data Arrived at EDR: 09/27/2016 Date Made Active in Reports: 12/15/2016

Number of Days to Update: 79

Source: Department of Toxic Substance Control

Telephone: 916-327-4498 Last EDR Contact: 03/27/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Annually

EMI: Emissions Inventory Data

Toxics and criteria pollutant emissions data collected by the ARB and local air pollution agencies.

Date of Government Version: 12/31/2014 Date Data Arrived at EDR: 09/23/2016 Date Made Active in Reports: 10/24/2016

Number of Days to Update: 31

Source: California Air Resources Board

Telephone: 916-322-2990 Last EDR Contact: 03/21/2017

Next Scheduled EDR Contact: 07/03/2017

Data Release Frequency: Varies

ENF: Enforcement Action Listing

A listing of Water Board Enforcement Actions. Formal is everything except Oral/Verbal Communication, Notice of Violation, Expedited Payment Letter, and Staff Enforcement Letter.

Date of Government Version: 12/06/2016 Date Data Arrived at EDR: 12/09/2016 Date Made Active in Reports: 01/18/2017

Number of Days to Update: 40

Source: State Water Resoruces Control Board

Telephone: 916-445-9379 Last EDR Contact: 04/24/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

Financial Assurance 1: Financial Assurance Information Listing

Financial Assurance information

Date of Government Version: 04/25/2016 Date Data Arrived at EDR: 04/29/2016 Date Made Active in Reports: 06/21/2016

Number of Days to Update: 53

Source: Department of Toxic Substances Control

Telephone: 916-255-3628 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

Financial Assurance 2: Financial Assurance Information Listing

A listing of financial assurance information for solid waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 11/16/2016 Date Data Arrived at EDR: 11/18/2016 Date Made Active in Reports: 01/20/2017

Number of Days to Update: 63

Source: California Integrated Waste Management Board

Telephone: 916-341-6066 Last EDR Contact: 02/13/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Varies

HAZNET: Facility and Manifest Data

Facility and Manifest Data. The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000 - 1,000,000 annually, representing approximately 350,000 - 500,000 shipments. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, and disposal method. This database begins with calendar year 1993.

Date of Government Version: 12/31/2015 Date Data Arrived at EDR: 10/12/2016 Date Made Active in Reports: 12/15/2016

Number of Days to Update: 64

Source: California Environmental Protection Agency

Telephone: 916-255-1136 Last EDR Contact: 04/14/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Annually

ICE: ICE

Contains data pertaining to the Permitted Facilities with Inspections / Enforcements sites tracked in Envirostor.

Date of Government Version: 11/21/2016 Date Data Arrived at EDR: 11/22/2016 Date Made Active in Reports: 01/23/2017

Number of Days to Update: 62

Source: Department of Toxic Subsances Control

Telephone: 877-786-9427 Last EDR Contact: 02/22/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Quarterly

HIST CORTESE: Hazardous Waste & Substance Site List

The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES]. This listing is no longer updated by the state agency.

Date of Government Version: 04/01/2001 Date Data Arrived at EDR: 01/22/2009 Date Made Active in Reports: 04/08/2009

Number of Days to Update: 76

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 01/22/2009 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

HWP: EnviroStor Permitted Facilities Listing

Detailed information on permitted hazardous waste facilities and corrective action ("cleanups") tracked in EnviroStor.

Date of Government Version: 11/21/2016 Date Data Arrived at EDR: 11/22/2016 Date Made Active in Reports: 01/23/2017

Number of Days to Update: 62

Source: Department of Toxic Substances Control

Telephone: 916-323-3400 Last EDR Contact: 02/22/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Quarterly

HWT: Registered Hazardous Waste Transporter Database

A listing of hazardous waste transporters. In California, unless specifically exempted, it is unlawful for any person to transport hazardous wastes unless the person holds a valid registration issued by DTSC. A hazardous waste transporter registration is valid for one year and is assigned a unique registration number.

Date of Government Version: 04/11/2017 Date Data Arrived at EDR: 04/13/2017 Date Made Active in Reports: 04/26/2017

Number of Days to Update: 13

Source: Department of Toxic Substances Control

Telephone: 916-440-7145 Last EDR Contact: 04/13/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Quarterly

MINES: Mines Site Location Listing

A listing of mine site locations from the Office of Mine Reclamation.

Date of Government Version: 09/12/2016 Date Data Arrived at EDR: 09/14/2016 Date Made Active in Reports: 10/14/2016

Number of Days to Update: 30

Source: Department of Conservation

Telephone: 916-322-1080 Last EDR Contact: 03/13/2017

Next Scheduled EDR Contact: 06/26/2017

Data Release Frequency: Varies

MWMP: Medical Waste Management Program Listing

The Medical Waste Management Program (MWMP) ensures the proper handling and disposal of medical waste by permitting and inspecting medical waste Offsite Treatment Facilities (PDF) and Transfer Stations (PDF) throughout the state. MWMP also oversees all Medical Waste Transporters.

Date of Government Version: 12/02/2016 Date Data Arrived at EDR: 12/06/2016 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 86

Source: Department of Public Health Telephone: 916-558-1784

Last EDR Contact: 03/07/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Varies

NPDES: NPDES Permits Listing

A listing of NPDES permits, including stormwater.

Date of Government Version: 11/14/2016 Date Data Arrived at EDR: 11/15/2016 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 107

Source: State Water Resources Control Board

Telephone: 916-445-9379 Last EDR Contact: 02/15/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Quarterly

PEST LIC: Pesticide Regulation Licenses Listing

A listing of licenses and certificates issued by the Department of Pesticide Regulation. The DPR issues licenses and/or certificates to: Persons and businesses that apply or sell pesticides; Pest control dealers and brokers; Persons who advise on agricultural pesticide applications.

Date of Government Version: 12/06/2016 Date Data Arrived at EDR: 12/06/2016 Date Made Active in Reports: 03/03/2017

Number of Days to Update: 87

Source: Department of Pesticide Regulation

Telephone: 916-445-4038 Last EDR Contact: 03/07/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Quarterly

PROC: Certified Processors Database A listing of certified processors.

Date of Government Version: 03/13/2017 Date Data Arrived at EDR: 03/14/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 50

Source: Department of Conservation

Telephone: 916-323-3836 Last EDR Contact: 03/14/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

NOTIFY 65: Proposition 65 Records

Listings of all Proposition 65 incidents reported to counties by the State Water Resources Control Board and the Regional Water Quality Control Board. This database is no longer updated by the reporting agency.

Date of Government Version: 12/16/2016 Date Data Arrived at EDR: 12/22/2016 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 70

Source: State Water Resources Control Board

Telephone: 916-445-3846 Last EDR Contact: 04/03/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: No Update Planned

UIC: UIC Listing

A listing of wells identified as underground injection wells, in the California Oil and Gas Wells database.

Date of Government Version: 01/20/2017 Date Data Arrived at EDR: 03/14/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 50

Source: Deaprtment of Conservation Telephone: 916-445-2408 Last EDR Contact: 03/14/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Varies

WASTEWATER PITS: Oil Wastewater Pits Listing

Water officials discovered that oil producers have been dumping chemical-laden wastewater into hundreds of unlined pits that are operating without proper permits. Inspections completed by the Central Valley Regional Water Quality Control Board revealed the existence of previously unidentified waste sites. The water board?s review found that more than one-third of the region?s active disposal pits are operating without permission.

Date of Government Version: 04/15/2015 Date Data Arrived at EDR: 04/17/2015 Date Made Active in Reports: 06/23/2015

Number of Days to Update: 67

Source: RWQCB, Central Valley Region

Telephone: 559-445-5577 Last EDR Contact: 04/14/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Varies

WDS: Waste Discharge System

Sites which have been issued waste discharge requirements.

Date of Government Version: 06/19/2007 Date Data Arrived at EDR: 06/20/2007 Date Made Active in Reports: 06/29/2007

Number of Days to Update: 9

Source: State Water Resources Control Board

Telephone: 916-341-5227 Last EDR Contact: 02/17/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Quarterly

WIP: Well Investigation Program Case List

Well Investigation Program case in the San Gabriel and San Fernando Valley area.

Date of Government Version: 07/03/2009 Date Data Arrived at EDR: 07/21/2009 Date Made Active in Reports: 08/03/2009

Number of Days to Update: 13

Source: Los Angeles Water Quality Control Board

Telephone: 213-576-6726 Last EDR Contact: 03/24/2017

Next Scheduled EDR Contact: 07/10/2017

Data Release Frequency: Varies

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A Source: EDR, Inc.
Date Data Arrived at EDR: N/A Telephone: N/A
Date Made Active in Reports: N/A Last EDR Contact: N/A

Number of Days to Update: N/A Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A Source: EDR, Inc.
Date Data Arrived at EDR: N/A Telephone: N/A
Date Made Active in Reports: N/A Last EDR Contact: N/A

Number of Days to Update: N/A Next Scheduled EDR Contact: N/A

Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A Source: EDR, Inc.
Date Data Arrived at EDR: N/A Telephone: N/A
Date Made Active in Reports: N/A Last EDR Contact: N/A

Number of Days to Update: N/A Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Resources Recycling and Recovery in California.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/13/2014
Number of Days to Update: 196

Source: Department of Resources Recycling and Recovery Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LUST: Recovered Government Archive Leaking Underground Storage Tank

The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the State Water Resources Control Board in California.

Data Release Frequency: Varies

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/30/2013
Number of Days to Update: 182

Source: State Water Resources Control Board Telephone: N/A Last EDR Contact: 06/01/2012 Next Scheduled EDR Contact: N/A

COUNTY RECORDS

ALAMEDA COUNTY:

Contaminated Sites

A listing of contaminated sites overseen by the Toxic Release Program (oil and groundwater contamination from chemical releases and spills) and the Leaking Underground Storage Tank Program (soil and ground water contamination from leaking petroleum USTs).

Date of Government Version: 10/12/2016 Date Data Arrived at EDR: 10/14/2016 Date Made Active in Reports: 11/18/2016

Number of Days to Update: 35

Source: Alameda County Environmental Health Services

Telephone: 510-567-6700 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Semi-Annually

Underground Tanks

Underground storage tank sites located in Alameda county.

Date of Government Version: 04/10/2017 Date Data Arrived at EDR: 04/11/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 21

Source: Alameda County Environmental Health Services

Telephone: 510-567-6700 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 04/24/2047 Data Release Frequency: Semi-Annually

AMADOR COUNTY:

CUPA Facility List Cupa Facility List

> Date of Government Version: 03/06/2017 Date Data Arrived at EDR: 03/08/2017 Date Made Active in Reports: 04/14/2017

Number of Days to Update: 37

Source: Amador County Environmental Health

Telephone: 209-223-6439 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017

Data Release Frequency: Varies

BUTTE COUNTY:

CUPA Facility Listing
Cupa facility list.

Date of Government Version: 10/21/2016 Date Data Arrived at EDR: 10/26/2016 Date Made Active in Reports: 11/18/2016

Number of Days to Update: 23

Source: Public Health Department Telephone: 530-538-7149 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 07/24/2017
Data Release Frequency: No Update Planned

CALVERAS COUNTY:

CUPA Facility Listing
Cupa Facility Listing

Date of Government Version: 01/09/2017 Date Data Arrived at EDR: 01/11/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 50

Source: Calveras County Environmental Health

Telephone: 209-754-6399 Last EDR Contact: 03/27/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Quarterly

COLUSA COUNTY:

CUPA Facility List

Cupa facility list.

Date of Government Version: 09/02/2016 Date Data Arrived at EDR: 09/06/2016 Date Made Active in Reports: 10/14/2016

Number of Days to Update: 38

Source: Health & Human Services Telephone: 530-458-0396 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017 Data Release Frequency: Varies

CONTRA COSTA COUNTY:

Site List

List includes sites from the underground tank, hazardous waste generator and business plan/2185 programs.

Date of Government Version: 11/17/2016 Date Data Arrived at EDR: 11/22/2016 Date Made Active in Reports: 01/26/2017

Number of Days to Update: 65

Source: Contra Costa Health Services Department

Telephone: 925-646-2286 Last EDR Contact: 05/01/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Semi-Annually

DEL NORTE COUNTY:

CUPA Facility List Cupa Facility list

> Date of Government Version: 01/31/2017 Date Data Arrived at EDR: 02/03/2017 Date Made Active in Reports: 04/14/2017

Number of Days to Update: 70

Source: Del Norte County Environmental Health Division

Telephone: 707-465-0426 Last EDR Contact: 05/01/2017

Next Scheduled EDR Contact: 08/14/2017

Data Release Frequency: Varies

EL DORADO COUNTY:

CUPA Facility List CUPA facility list.

Date of Government Version: 11/22/2016 Date Data Arrived at EDR: 11/23/2016 Date Made Active in Reports: 01/17/2017

Number of Days to Update: 55

Source: El Dorado County Environmental Management Department

Telephone: 530-621-6623 Last EDR Contact: 05/01/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Varies

FRESNO COUNTY:

CUPA Resources List

Certified Unified Program Agency. CUPA's are responsible for implementing a unified hazardous materials and hazardous waste management regulatory program. The agency provides oversight of businesses that deal with hazardous materials, operate underground storage tanks or aboveground storage tanks.

Date of Government Version: 01/09/2017 Date Data Arrived at EDR: 01/11/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 50

Source: Dept. of Community Health Telephone: 559-445-3271 Last EDR Contact: 03/31/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Semi-Annually

HUMBOLDT COUNTY:

CUPA Facility List CUPA facility list.

> Date of Government Version: 01/04/2017 Date Data Arrived at EDR: 01/10/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 51

Source: Humboldt County Environmental Health

Telephone: N/A

Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

IMPERIAL COUNTY:

CUPA Facility List
Cupa facility list.

Date of Government Version: 01/23/2017 Date Data Arrived at EDR: 01/25/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 36

Source: San Diego Border Field Office Telephone: 760-339-2777

Last EDR Contact: 04/24/2017 Next Scheduled EDR Contact: 08/07/2017

Data Release Frequency: Varies

INYO COUNTY:

CUPA Facility List

Cupa facility list.

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 09/11/2013 Date Made Active in Reports: 10/14/2013

Number of Days to Update: 33

Source: Inyo County Environmental Health Services

Telephone: 760-878-0238 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/05/2017

Data Release Frequency: Varies

KERN COUNTY:

Underground Storage Tank Sites & Tank Listing Kern County Sites and Tanks Listing.

> Date of Government Version: 02/07/2017 Date Data Arrived at EDR: 02/10/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 81

Source: Kern County Environment Health Services Department

Telephone: 661-862-8700 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017 Data Release Frequency: Quarterly

KINGS COUNTY:

CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 12/14/2016 Date Data Arrived at EDR: 12/16/2016 Date Made Active in Reports: 12/22/2016

Number of Days to Update: 6

Source: Kings County Department of Public Health

Telephone: 559-584-1411 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

LAKE COUNTY:

CUPA Facility List Cupa facility list

> Date of Government Version: 01/18/2017 Date Data Arrived at EDR: 01/20/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 41

Source: Lake County Environmental Health

Telephone: 707-263-1164 Last EDR Contact: 04/17/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Varies

LOS ANGELES COUNTY:

San Gabriel Valley Areas of Concern

San Gabriel Valley areas where VOC contamination is at or above the MCL as designated by region 9 EPA office.

Date of Government Version: 03/30/2009 Date Data Arrived at EDR: 03/31/2009 Date Made Active in Reports: 10/23/2009

Number of Days to Update: 206

Source: EPA Region 9 Telephone: 415-972-3178 Last EDR Contact: 03/20/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: No Update Planned

HMS: Street Number List

Industrial Waste and Underground Storage Tank Sites.

Date of Government Version: 11/14/2016 Date Data Arrived at EDR: 11/18/2016 Date Made Active in Reports: 01/23/2017

Number of Days to Update: 66

Source: Department of Public Works

Telephone: 626-458-3517 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Semi-Annually

List of Solid Waste Facilities

Solid Waste Facilities in Los Angeles County.

Date of Government Version: 04/17/2017 Date Data Arrived at EDR: 04/18/2017 Date Made Active in Reports: 05/02/2017

Number of Days to Update: 14

Source: La County Department of Public Works

Telephone: 818-458-5185 Last EDR Contact: 04/18/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Varies

City of Los Angeles Landfills

Landfills owned and maintained by the City of Los Angeles.

Date of Government Version: 01/01/2016 Date Data Arrived at EDR: 01/26/2016 Date Made Active in Reports: 03/22/2016

Number of Days to Update: 56

Source: Engineering & Construction Division

Telephone: 213-473-7869 Last EDR Contact: 04/17/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Varies

Site Mitigation List

Industrial sites that have had some sort of spill or complaint.

Date of Government Version: 03/29/2016 Date Data Arrived at EDR: 04/06/2016 Date Made Active in Reports: 06/13/2016

Number of Days to Update: 68

Source: Community Health Services

Telephone: 323-890-7806 Last EDR Contact: 04/17/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Annually

City of El Segundo Underground Storage Tank

Underground storage tank sites located in El Segundo city.

Date of Government Version: 03/30/2015 Date Data Arrived at EDR: 04/02/2015 Date Made Active in Reports: 04/13/2015

Number of Days to Update: 11

Source: City of El Segundo Fire Department

Telephone: 310-524-2236 Last EDR Contact: 04/17/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Semi-Annually

City of Long Beach Underground Storage Tank

Underground storage tank sites located in the city of Long Beach.

Date of Government Version: 03/09/2017 Date Data Arrived at EDR: 03/10/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 54

Source: City of Long Beach Fire Department

Telephone: 562-570-2563 Last EDR Contact: 04/24/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Annually

City of Torrance Underground Storage Tank

Underground storage tank sites located in the city of Torrance.

Date of Government Version: 01/10/2017 Date Data Arrived at EDR: 01/13/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 110

Source: City of Torrance Fire Department

Telephone: 310-618-2973 Last EDR Contact: 04/10/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Semi-Annually

MADERA COUNTY:

CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 12/05/2016 Date Data Arrived at EDR: 12/09/2016 Date Made Active in Reports: 01/19/2017

Number of Days to Update: 41

Source: Madera County Environmental Health

Telephone: 559-675-7823 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

MARIN COUNTY:

Underground Storage Tank Sites

Currently permitted USTs in Marin County.

Date of Government Version: 03/31/2017 Date Data Arrived at EDR: 04/06/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 27

Source: Public Works Department Waste Management

Telephone: 415-499-6647 Last EDR Contact: 03/31/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Semi-Annually

MERCED COUNTY:

CUPA Facility List

CUPA facility list.

Date of Government Version: 12/02/2016 Date Data Arrived at EDR: 12/06/2016 Date Made Active in Reports: 01/17/2017

Number of Days to Update: 42

Source: Merced County Environmental Health

Telephone: 209-381-1094 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017

Data Release Frequency: Varies

MONO COUNTY:

CUPA Facility List

CUPA Facility List

Date of Government Version: 11/29/2016 Date Data Arrived at EDR: 12/05/2016 Date Made Active in Reports: 12/22/2016

Number of Days to Update: 17

Source: Mono County Health Department

Telephone: 760-932-5580 Last EDR Contact: 02/24/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Varies

MONTEREY COUNTY:

CUPA Facility Listing

CUPA Program listing from the Environmental Health Division.

Date of Government Version: 06/24/2016 Date Data Arrived at EDR: 06/27/2016 Date Made Active in Reports: 08/09/2016

Number of Days to Update: 43

Source: Monterey County Health Department

Telephone: 831-796-1297 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017

Data Release Frequency: Varies

NAPA COUNTY:

Sites With Reported Contamination

A listing of leaking underground storage tank sites located in Napa county.

Date of Government Version: 01/09/2017 Date Data Arrived at EDR: 01/11/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 50

Source: Napa County Department of Environmental Management

Telephone: 707-253-4269 Last EDR Contact: 03/09/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: No Update Planned

Closed and Operating Underground Storage Tank Sites

Underground storage tank sites located in Napa county.

Date of Government Version: 01/15/2008 Date Data Arrived at EDR: 01/16/2008 Date Made Active in Reports: 02/08/2008

Number of Days to Update: 23

Source: Napa County Department of Environmental Management

Telephone: 707-253-4269 Last EDR Contact: 03/09/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: No Update Planned

NEVADA COUNTY:

CUPA Facility List
CUPA facility list.

Date of Government Version: 11/07/2016 Date Data Arrived at EDR: 11/08/2016 Date Made Active in Reports: 12/22/2016

Number of Days to Update: 44

Source: Community Development Agency

Telephone: 530-265-1467 Last EDR Contact: 05/01/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Varies

ORANGE COUNTY:

List of Industrial Site Cleanups

Petroleum and non-petroleum spills.

Date of Government Version: 02/06/2017 Date Data Arrived at EDR: 02/10/2017 Date Made Active in Reports: 04/21/2017

Number of Days to Update: 70

Source: Health Care Agency Telephone: 714-834-3446 Last EDR Contact: 02/06/2017

Next Scheduled EDR Contact: 05/22/2017 Data Release Frequency: Annually

List of Underground Storage Tank Cleanups

Orange County Underground Storage Tank Cleanups (LUST).

Date of Government Version: 11/04/2016 Date Data Arrived at EDR: 11/11/2016 Date Made Active in Reports: 01/23/2017

Number of Days to Update: 73

Source: Health Care Agency Telephone: 714-834-3446 Last EDR Contact: 02/06/2017

Next Scheduled EDR Contact: 05/22/2017 Data Release Frequency: Quarterly

List of Underground Storage Tank Facilities

Orange County Underground Storage Tank Facilities (UST).

Date of Government Version: 02/06/2017 Date Data Arrived at EDR: 02/07/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 85

Source: Health Care Agency Telephone: 714-834-3446 Last EDR Contact: 02/07/2017

Next Scheduled EDR Contact: 05/22/2017 Data Release Frequency: Quarterly

PLACER COUNTY:

Master List of Facilities

List includes aboveground tanks, underground tanks and cleanup sites.

Date of Government Version: 09/02/2016 Date Data Arrived at EDR: 09/06/2016 Date Made Active in Reports: 10/14/2016

Number of Days to Update: 38

Source: Placer County Health and Human Services

Telephone: 530-745-2363 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Semi-Annually

RIVERSIDE COUNTY:

Listing of Underground Tank Cleanup Sites

Riverside County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 04/18/2017 Date Data Arrived at EDR: 04/20/2017 Date Made Active in Reports: 04/21/2017

Number of Days to Update: 1

Source: Department of Environmental Health

Telephone: 951-358-5055 Last EDR Contact: 03/20/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: Quarterly

Underground Storage Tank Tank List

Underground storage tank sites located in Riverside county.

Date of Government Version: 01/19/2017 Date Data Arrived at EDR: 01/25/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 98

Source: Department of Environmental Health

Telephone: 951-358-5055 Last EDR Contact: 03/20/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: Quarterly

SACRAMENTO COUNTY:

Toxic Site Clean-Up List

List of sites where unauthorized releases of potentially hazardous materials have occurred.

Date of Government Version: 11/07/2016 Date Data Arrived at EDR: 01/05/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 56

Source: Sacramento County Environmental Management

Telephone: 916-875-8406 Last EDR Contact: 04/04/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Quarterly

Master Hazardous Materials Facility List

Any business that has hazardous materials on site - hazardous material storage sites, underground storage tanks, waste generators.

Date of Government Version: 11/08/2016 Date Data Arrived at EDR: 01/05/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 56

Source: Sacramento County Environmental Management

Telephone: 916-875-8406 Last EDR Contact: 04/04/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Quarterly

SAN BERNARDINO COUNTY:

Hazardous Material Permits

This listing includes underground storage tanks, medical waste handlers/generators, hazardous materials handlers, hazardous waste generators, and waste oil generators/handlers.

Date of Government Version: 12/09/2016 Date Data Arrived at EDR: 12/13/2016 Date Made Active in Reports: 03/03/2017

Number of Days to Update: 80

Source: San Bernardino County Fire Department Hazardous Materials Division

Telephone: 909-387-3041 Last EDR Contact: 02/06/2017

Next Scheduled EDR Contact: 05/22/2017 Data Release Frequency: Quarterly

SAN DIEGO COUNTY:

Hazardous Materials Management Division Database

The database includes: HE58 - This report contains the business name, site address, business phone number, establishment 'H' permit number, type of permit, and the business status. HE17 - In addition to providing the same information provided in the HE58 listing, HE17 provides inspection dates, violations received by the establishment, hazardous waste generated, the quantity, method of storage, treatment/disposal of waste and the hauler, and information on underground storage tanks. Unauthorized Release List - Includes a summary of environmental contamination cases in San Diego County (underground tank cases, non-tank cases, groundwater contamination, and soil contamination are included.)

Date of Government Version: 10/05/2016 Date Data Arrived at EDR: 12/06/2016 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 86

Source: Hazardous Materials Management Division

Telephone: 619-338-2268 Last EDR Contact: 03/10/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Quarterly

Solid Waste Facilities

San Diego County Solid Waste Facilities.

Date of Government Version: 10/31/2015 Date Data Arrived at EDR: 11/07/2015 Date Made Active in Reports: 01/04/2016

Number of Days to Update: 58

Source: Department of Health Services

Telephone: 619-338-2209 Last EDR Contact: 04/24/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

Environmental Case Listing

The listing contains all underground tank release cases and projects pertaining to properties contaminated with hazardous substances that are actively under review by the Site Assessment and Mitigation Program.

Date of Government Version: 03/23/2010 Date Data Arrived at EDR: 06/15/2010 Date Made Active in Reports: 07/09/2010

Number of Days to Update: 24

Source: San Diego County Department of Environmental Health

Telephone: 619-338-2371 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: No Update Planned

SAN FRANCISCO COUNTY:

Local Oversite Facilities

A listing of leaking underground storage tank sites located in San Francisco county.

Date of Government Version: 09/19/2008 Date Data Arrived at EDR: 09/19/2008 Date Made Active in Reports: 09/29/2008

Number of Days to Update: 10

Source: Department Of Public Health San Francisco County

Telephone: 415-252-3920 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017 Data Release Frequency: Quarterly

Underground Storage Tank Information

Underground storage tank sites located in San Francisco county.

Date of Government Version: 02/28/2017 Date Data Arrived at EDR: 03/02/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 62

Source: Department of Public Health Telephone: 415-252-3920 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017
Data Release Frequency: Quarterly

SAN JOAQUIN COUNTY:

San Joaquin Co. UST

A listing of underground storage tank locations in San Joaquin county.

Date of Government Version: 12/21/2016 Date Data Arrived at EDR: 12/27/2016 Date Made Active in Reports: 02/14/2017

Number of Days to Update: 49

Source: Environmental Health Department

Telephone: N/A

Last EDR Contact: 03/20/2017

Next Scheduled EDR Contact: 07/03/2017 Data Release Frequency: Semi-Annually

SAN LUIS OBISPO COUNTY:

CUPA Facility List

Cupa Facility List.

Date of Government Version: 11/17/2016 Date Data Arrived at EDR: 11/21/2016 Date Made Active in Reports: 01/19/2017

Number of Days to Update: 59

Source: San Luis Obispo County Public Health Department

Telephone: 805-781-5596 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

SAN MATEO COUNTY:

Business Inventory

List includes Hazardous Materials Business Plan, hazardous waste generators, and underground storage tanks.

Date of Government Version: 06/02/2016 Date Data Arrived at EDR: 06/07/2016 Date Made Active in Reports: 06/22/2016

Number of Days to Update: 15

Source: San Mateo County Environmental Health Services Division

Telephone: 650-363-1921 Last EDR Contact: 03/09/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Annually

Fuel Leak List

A listing of leaking underground storage tank sites located in San Mateo county.

Date of Government Version: 03/15/2017 Date Data Arrived at EDR: 04/07/2017 Date Made Active in Reports: 04/21/2017

Number of Days to Update: 14

Source: San Mateo County Environmental Health Services Division

Telephone: 650-363-1921 Last EDR Contact: 03/27/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Semi-Annually

SANTA BARBARA COUNTY:

CUPA Facility Listing

CUPA Program Listing from the Environmental Health Services division.

Date of Government Version: 09/08/2011 Date Data Arrived at EDR: 09/09/2011 Date Made Active in Reports: 10/07/2011

Number of Days to Update: 28

Source: Santa Barbara County Public Health Department

Telephone: 805-686-8167 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

SANTA CLARA COUNTY:

Cupa Facility List Cupa facility list

Date of Government Version: 11/16/2016 Date Data Arrived at EDR: 11/21/2016 Date Made Active in Reports: 01/19/2017

Number of Days to Update: 59

Source: Department of Environmental Health

Telephone: 408-918-1973 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Varies

HIST LUST - Fuel Leak Site Activity Report

A listing of open and closed leaking underground storage tanks. This listing is no longer updated by the county. Leaking underground storage tanks are now handled by the Department of Environmental Health.

Date of Government Version: 03/29/2005 Date Data Arrived at EDR: 03/30/2005 Date Made Active in Reports: 04/21/2005

Number of Days to Update: 22

Source: Santa Clara Valley Water District

Telephone: 408-265-2600 Last EDR Contact: 03/23/2009

Next Scheduled EDR Contact: 06/22/2009 Data Release Frequency: No Update Planned

LOP Listing

A listing of leaking underground storage tanks located in Santa Clara county.

Date of Government Version: 03/03/2014 Date Data Arrived at EDR: 03/05/2014 Date Made Active in Reports: 03/18/2014

Number of Days to Update: 13

Source: Department of Environmental Health

Telephone: 408-918-3417 Last EDR Contact: 02/24/2017

Next Scheduled EDR Contact: 06/12/2017 Data Release Frequency: Annually

Hazardous Material Facilities

Hazardous material facilities, including underground storage tank sites.

Date of Government Version: 11/07/2016 Date Data Arrived at EDR: 11/10/2016 Date Made Active in Reports: 01/24/2017

Number of Days to Update: 75

Source: City of San Jose Fire Department

Telephone: 408-535-7694 Last EDR Contact: 05/05/2017

Next Scheduled EDR Contact: 08/21/2017 Data Release Frequency: Annually

SANTA CRUZ COUNTY:

CUPA Facility List

CUPA facility listing.

Date of Government Version: 11/16/2016 Date Data Arrived at EDR: 11/21/2016 Date Made Active in Reports: 01/19/2017

Number of Days to Update: 59

Source: Santa Cruz County Environmental Health

Telephone: 831-464-2761 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017

Data Release Frequency: Varies

SHASTA COUNTY:

CUPA Facility List

Cupa Facility List.

Date of Government Version: 12/13/2016 Date Data Arrived at EDR: 12/16/2016 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 76

Source: Shasta County Department of Resource Management

Telephone: 530-225-5789 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017

Data Release Frequency: Varies

SOLANO COUNTY:

Leaking Underground Storage Tanks

A listing of leaking underground storage tank sites located in Solano county.

Date of Government Version: 11/29/2016 Date Data Arrived at EDR: 12/21/2016 Date Made Active in Reports: 12/22/2016

Number of Days to Update: 1

Source: Solano County Department of Environmental Management

Telephone: 707-784-6770 Last EDR Contact: 03/09/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

Underground Storage Tanks

Underground storage tank sites located in Solano county.

Date of Government Version: 03/15/2017 Date Data Arrived at EDR: 03/17/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 47

Source: Solano County Department of Environmental Management

Telephone: 707-784-6770 Last EDR Contact: 03/09/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

SONOMA COUNTY:

Cupa Facility List

Cupa Facility list

Date of Government Version: 12/22/2016 Date Data Arrived at EDR: 12/27/2016 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 65

Source: County of Sonoma Fire & Emergency Services Department

Telephone: 707-565-1174 Last EDR Contact: 03/27/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Varies

Leaking Underground Storage Tank Sites

A listing of leaking underground storage tank sites located in Sonoma county.

Date of Government Version: 01/04/2017 Date Data Arrived at EDR: 01/06/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 55

Source: Department of Health Services

Telephone: 707-565-6565 Last EDR Contact: 03/27/2017

Next Scheduled EDR Contact: 07/10/2017 Data Release Frequency: Quarterly

SUTTER COUNTY:

Underground Storage Tanks

Underground storage tank sites located in Sutter county.

Date of Government Version: 12/02/2016 Date Data Arrived at EDR: 12/06/2016 Date Made Active in Reports: 01/10/2017

Number of Days to Update: 35

Source: Sutter County Department of Agriculture

Telephone: 530-822-7500 Last EDR Contact: 03/06/2017

Next Scheduled EDR Contact: 06/19/2017 Data Release Frequency: Semi-Annually

TUOLUMNE COUNTY:

CUPA Facility List

Cupa facility list

Date of Government Version: 01/25/2017 Date Data Arrived at EDR: 01/27/2017 Date Made Active in Reports: 03/02/2017

Number of Days to Update: 34

Source: Divison of Environmental Health

Telephone: 209-533-5633 Last EDR Contact: 04/24/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Varies

VENTURA COUNTY:

Business Plan, Hazardous Waste Producers, and Operating Underground Tanks

The BWT list indicates by site address whether the Environmental Health Division has Business Plan (B), Waste Producer (W), and/or Underground Tank (T) information.

Date of Government Version: 09/26/2016 Date Data Arrived at EDR: 10/27/2016 Date Made Active in Reports: 01/17/2017

Number of Days to Update: 82

Source: Ventura County Environmental Health Division

Telephone: 805-654-2813 Last EDR Contact: 04/24/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

Inventory of Illegal Abandoned and Inactive Sites

Ventura County Inventory of Closed, Illegal Abandoned, and Inactive Sites.

Date of Government Version: 12/01/2011 Date Data Arrived at EDR: 12/01/2011 Date Made Active in Reports: 01/19/2012

Number of Days to Update: 49

Source: Environmental Health Division

Telephone: 805-654-2813 Last EDR Contact: 03/31/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Annually

Listing of Underground Tank Cleanup Sites

Ventura County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 05/29/2008 Date Data Arrived at EDR: 06/24/2008 Date Made Active in Reports: 07/31/2008

Number of Days to Update: 37

Source: Environmental Health Division

Telephone: 805-654-2813 Last EDR Contact: 02/13/2017

Next Scheduled EDR Contact: 05/29/2017 Data Release Frequency: Quarterly

Medical Waste Program List

To protect public health and safety and the environment from potential exposure to disease causing agents, the Environmental Health Division Medical Waste Program regulates the generation, handling, storage, treatment and disposal of medical waste throughout the County.

Date of Government Version: 09/26/2016 Date Data Arrived at EDR: 10/27/2016 Date Made Active in Reports: 01/24/2017

Number of Days to Update: 89

Source: Ventura County Resource Management Agency

Telephone: 805-654-2813 Last EDR Contact: 04/24/2017

Next Scheduled EDR Contact: 08/07/2017 Data Release Frequency: Quarterly

Underground Tank Closed Sites List

Ventura County Operating Underground Storage Tank Sites (UST)/Underground Tank Closed Sites List.

Date of Government Version: 02/27/2017 Date Data Arrived at EDR: 03/15/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 49

Source: Environmental Health Division Telephone: 805-654-2813

Last EDR Contact: 03/15/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Quarterly

YOLO COUNTY:

Underground Storage Tank Comprehensive Facility Report Underground storage tank sites located in Yolo county.

Date of Government Version: 03/31/2017 Date Data Arrived at EDR: 04/06/2017 Date Made Active in Reports: 05/03/2017

Number of Days to Update: 27

Source: Yolo County Department of Health

Telephone: 530-666-8646 Last EDR Contact: 03/31/2017

Next Scheduled EDR Contact: 07/17/2017 Data Release Frequency: Annually

YUBA COUNTY:

CUPA Facility List

CUPA facility listing for Yuba County.

Date of Government Version: 10/28/2016 Date Data Arrived at EDR: 11/03/2016 Date Made Active in Reports: 12/15/2016

Number of Days to Update: 42

Source: Yuba County Environmental Health Department

Telephone: 530-749-7523 Last EDR Contact: 05/01/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 07/30/2013 Date Data Arrived at EDR: 08/19/2013 Date Made Active in Reports: 10/03/2013

Number of Days to Update: 45

Source: Department of Energy & Environmental Protection

Telephone: 860-424-3375 Last EDR Contact: 11/11/2016

Next Scheduled EDR Contact: 02/27/2017 Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2015 Date Data Arrived at EDR: 09/29/2016 Date Made Active in Reports: 01/03/2017

Number of Days to Update: 96

Source: Department of Environmental Protection

Telephone: N/A

Last EDR Contact: 04/11/2017

Next Scheduled EDR Contact: 07/24/2017 Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 01/30/2017 Date Data Arrived at EDR: 02/01/2017 Date Made Active in Reports: 02/13/2017

Number of Days to Update: 12

Source: Department of Environmental Conservation

Telephone: 518-402-8651 Last EDR Contact: 05/03/2017

Next Scheduled EDR Contact: 08/14/2017 Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2015
Date Data Arrived at EDR: 07/22/2016
Date Made Active in Reports: 11/22/2016

Number of Days to Update: 123

Source: Department of Environmental Protection

Telephone: 717-783-8990 Last EDR Contact: 04/18/2017

Next Scheduled EDR Contact: 07/31/2017 Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2013 Date Data Arrived at EDR: 06/19/2015 Date Made Active in Reports: 07/15/2015

Number of Days to Update: 26

Source: Department of Environmental Management

Telephone: 401-222-2797 Last EDR Contact: 02/21/2017

Next Scheduled EDR Contact: 06/05/2017 Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2015 Date Data Arrived at EDR: 04/14/2016 Date Made Active in Reports: 06/03/2016

Number of Days to Update: 50

Source: Department of Natural Resources

Telephone: N/A

Last EDR Contact: 03/13/2017

Next Scheduled EDR Contact: 06/26/2017 Data Release Frequency: Annually

Oil/Gas Pipelines

Source: PennWell Corporation

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Electric Power Transmission Line Data

Source: PennWell Corporation

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services,

a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary

and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Licensed Facilities Source: Department of Social Services

Telephone: 916-657-4041

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory Source: Department of Fish & Game Telephone: 916-445-0411

Current USGS 7.5 Minute Topographic Map Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK®-PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

TOWN & COUNTRY RETAIL 6310 W. THIRD STREET LOS ANGELES, CA 90036

TARGET PROPERTY COORDINATES

Latitude (North): 34.070699 - 34° 4' 14.52" Longitude (West): 118.360324 - 118° 21' 37.17"

Universal Tranverse Mercator: Zone 11 UTM X (Meters): 374473.9 UTM Y (Meters): 3770635.2

Elevation: 180 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map: 5630741 HOLLYWOOD, CA

Version Date: 2012

West Map: 5630733 BEVERLY HILLS, CA

Version Date: 2012

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principal investigative components:

- 1. Groundwater flow direction, and
- 2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General WSW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

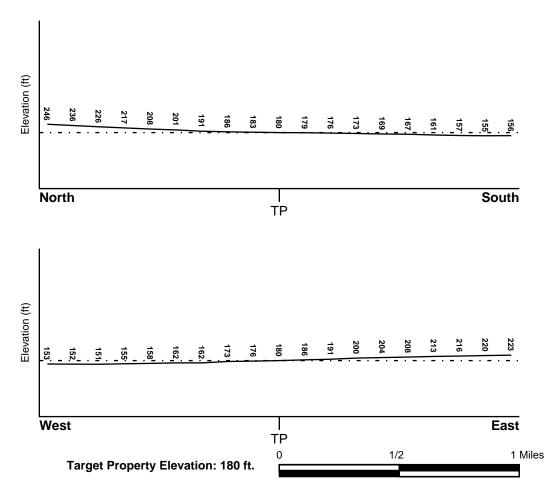

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Flood Plain Panel at Target Property **FEMA Source Type**

06037C1605F FEMA FIRM Flood data

Additional Panels in search area: **FEMA Source Type**

06037C1585F FEMA FIRM Flood data 06037C1615F FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

NWI Electronic NWI Quad at Target Property Data Coverage

HOLLYWOOD YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius: 1.25 miles Status: Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

	LOCATION	GENERAL DIRECTION
MAP ID	FROM TP	GROUNDWATER FLOW
A1	1/2 - 1 Mile WSW	S
		_

Α2 1/2 - 1 Mile WSW

For additional site information, refer to Physical Setting Source Map Findings.

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

GEOLOGIC AGE IDENTIFICATION

Era: Cenozoic Category: Stratifed Sequence

System: Quaternary Series: Quaternary

Code: Q (decoded above as Era, System & Series)

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

Soil Layer Information							
	Boui	ndary		Classif	ication		
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	Permeability Rate (in/hr)	Soil Reaction (pH)
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: sandy loam

gravelly - sandy loam

silt loam clay fine sand gravelly - sand

sand

fine sandy loam

Surficial Soil Types: sandy loam

gravelly - sandy loam

silt loam clay fine sand gravelly - sand

sand

fine sandy loam

Shallow Soil Types: fine sandy loam

gravelly - loam sandy clay sandy clay loam

clay silty clay sand

Deeper Soil Types: gravelly - sandy loam

sandy loam

very gravelly - sandy loam

stratified

very fine sandy loam weathered bedrock

sand

gravelly - fine sandy loam

silty clay loam clay loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE SEARCH DISTANCE (miles)

Federal USGS 1.000

Federal FRDS PWS Nearest PWS within 1 mile

State Database 1.000

FEDERAL USGS WELL INFORMATION

MAP ID WELL ID LOCATION FROM TP

No Wells Found

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID WELL ID LOCATION FROM TP

No PWS System Found

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

LOCATION MAP ID WELL ID FROM TP

No Wells Found

OTHER STATE DATABASE INFORMATION

STATE OIL/GAS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
	CAOG11000210801	0 - 1/8 Mile West
B2	CAOG11000210800	0 - 1/8 Mile ENE
A3	CAOG11000210332	0 - 1/8 Mile North
B4	CAOG11000210331	0 - 1/8 Mile NE
5	CAOG11000210780	0 - 1/8 Mile South
C6	CAOG11000210333	0 - 1/8 Mile NW
A7	CAOG11000210744	0 - 1/8 Mile WNW
D8	CAOG11000210576	1/8 - 1/4 Mile WSW
E9	CAOG11000210745	1/8 - 1/4 Mile SW
C10	CAOG11000210334	1/8 - 1/4 Mile NW
F11	CAOG11000210330	1/8 - 1/4 Mile ENE
G12	CAOG11000210798	1/8 - 1/4 Mile SE
D13	CAOG11000210590	1/8 - 1/4 Mile West
F14	CAOG11000210799	1/8 - 1/4 Mile East

LOOATION

		LOCATION
MAP ID	WELL ID	FROM TP
H15	CAOG11000210589	1/8 - 1/4 Mile WNW
16	CAOG11000210522	1/8 - 1/4 Mile NNW
E17	CAOG11000210574	1/8 - 1/4 Mile SW
I18	CAOG11000210777	1/8 - 1/4 Mile South
G19	CAOG11000210782	1/8 - 1/4 Mile SSE
E20	CAOG11000210244	1/8 - 1/4 Mile SSW
21	CAOG11000210710	1/8 - 1/4 Mile WSW
F22	CAOG11000210328	1/8 - 1/4 Mile East
H23	CAOG11000210335	1/8 - 1/4 Mile WNW
J24	CAOG11000210797	1/8 - 1/4 Mile ESE
25	CAOG11000210583	1/8 - 1/4 Mile SW
F26	CAOG11000210329	1/8 - 1/4 Mile ENE
H27	CAOG11000210575	1/8 - 1/4 Mile West
J28	CAOG11000210779	1/8 - 1/4 Mile ESE
K29	CAOG11000192175	1/4 - 1/2 Mile NE
K30	CAOG11000192176	1/4 - 1/2 Mile NE
I31	CAOG11000210781	1/4 - 1/2 Mile SSE
K32	CAOG11000192179	1/4 - 1/2 Mile NE
K33	CAOG11000192174	1/4 - 1/2 Mile NE
K34	CAOG11000192178	1/4 - 1/2 Mile NE
K35	CAOG11000189006	1/4 - 1/2 Mile NE
K36	CAOG11000192172	1/4 - 1/2 Mile NE
K37	CAOG11000192177	1/4 - 1/2 Mile NE
K38	CAOG11000214636	1/4 - 1/2 Mile NE
K39	CAOG11000192181	1/4 - 1/2 Mile NE
K40	CAOG11000192180	1/4 - 1/2 Mile NE
K41	CAOG11000188558	1/4 - 1/2 Mile NE
K42	CAOG11000214637	1/4 - 1/2 Mile NE
K43	CAOG11000192993	1/4 - 1/2 Mile NE
K44	CAOG11000192188	1/4 - 1/2 Mile NE
L45	CAOG11000210769	1/4 - 1/2 Mile SSE
K46	CAOG11000193039	1/4 - 1/2 Mile NE
K47	CAOG11000193040	1/4 - 1/2 Mile NE
K48	CAOG11000214223	1/4 - 1/2 Mile NE
K49	CAOG11000193024	1/4 - 1/2 Mile NE
K50	CAOG11000192184	1/4 - 1/2 Mile NE
K51	CAOG11000214224	1/4 - 1/2 Mile NE
K52	CAOG11000193256	1/4 - 1/2 Mile NE
K53	CAOG11000192187	1/4 - 1/2 Mile NE
K54	CAOG11000193262	1/4 - 1/2 Mile NE
M55	CAOG11000210523	1/4 - 1/2 Mile WNW
M56	CAOG11000210521	1/4 - 1/2 Mile NW
K57	CAOG11000193259	1/4 - 1/2 Mile NE
158	CAOG11000210787	1/4 - 1/2 Mile South
K59	CAOG11000192183	1/4 - 1/2 Mile NE
K60	CAOG11000193149	1/4 - 1/2 Mile NE
K61	CAOG11000193150	1/4 - 1/2 Mile NE
K62	CAOG11000189038	1/4 - 1/2 Mile NE
K63	CAOG11000193277	1/4 - 1/2 Mile NE
K64	CAOG11000193158	1/4 - 1/2 Mile NE
K65	CAOG11000192173	1/4 - 1/2 Mile NE
K66	CAOG11000193157	1/4 - 1/2 Mile NE
K67	CAOG11000193272	1/4 - 1/2 Mile NE
K68	CAOG11000192185	1/4 - 1/2 Mile NE
K69	CAOG11000193178	1/4 - 1/2 Mile NE
K70	CAOG11000192186	1/4 - 1/2 Mile NE
		

0.20.10	•	
MAP ID	WELL ID	LOCATION FROM TP
K71	CAOG11000193071	1/4 - 1/2 Mile NE
K73	CAOG11000193084	1/4 - 1/2 Mile NE
K72	CAOG11000193083	1/4 - 1/2 Mile NE
K74	CAOG11000193086	1/4 - 1/2 Mile NE
K75	CAOG11000192182	1/4 - 1/2 Mile NE
76	CAOG11000210579	1/4 - 1/2 Mile SSW
K77	CAOG11000193106	1/4 - 1/2 Mile NE
K78	CAOG11000193135	1/4 - 1/2 Mile NE
J79	CAOG11000210796	1/4 - 1/2 Mile East
L80	CAOG11000210794	1/4 - 1/2 Mile SE
J81	CAOG11000210795	1/4 - 1/2 Mile ESE
N82	CAOG11000210711	1/4 - 1/2 Mile WNW
83	CAOG11000210709	1/4 - 1/2 Mile SW
O84	CAOG11000210322	1/4 - 1/2 Mile East
P85	CAOG11000210712	1/4 - 1/2 Mile WSW
N86	CAOG11000210717	1/4 - 1/2 Mile West
87	CAOG11000210775	1/4 - 1/2 Mile South
O88	CAOG11000210323	1/4 - 1/2 Mile ENE
M89	CAOG11000210520	1/4 - 1/2 Mile WNW
P90	CAOG11000210713	1/4 - 1/2 Mile WSW
L91	CAOG11000210785	1/4 - 1/2 Mile SE
Q92	CAOG11000210784	1/4 - 1/2 Mile SE
R93	CAOG11000210524	1/4 - 1/2 Mile ENE
R94	CAOG11000210324	1/4 - 1/2 Mile ENE
95	CAOG11000210767	1/4 - 1/2 Mile ESE
P96	CAOG11000210716	1/4 - 1/2 Mile West
O97	CAOG11000210314	1/4 - 1/2 Mile East
O98	CAOG11000210315	1/4 - 1/2 Mile East
S99	CAOG11000210718	1/4 - 1/2 Mile WNW
Q100	CAOG11000210762	1/4 - 1/2 Mile SE
T101	CAOG11000210325	1/4 - 1/2 Mile NE
102	CAOG11000210773	1/4 - 1/2 Mile South
U103	CAOG11000210783	1/4 - 1/2 Mile SSE
R104	CAOG11000210316	1/4 - 1/2 Mile ENE
105	CAOG11000210636	1/4 - 1/2 Mile NNE
U106	CAOG11000210770	1/4 - 1/2 Mile SE
107	CAOG11000210714	1/4 - 1/2 Mile SW
Q108	CAOG11000210359	1/4 - 1/2 Mile SE
S109	CAOG11000210581	1/4 - 1/2 Mile West
R110	CAOG11000210317	1/4 - 1/2 Mile ENE
T111	CAOG11000210326	1/4 - 1/2 Mile NE
112	CAOG11000210720	1/4 - 1/2 Mile WSW
V113	CAOG11000210771	1/4 - 1/2 Mile East
V114	CAOG11000210527	1/4 - 1/2 Mile East
W115	CAOG11000210528	1/4 - 1/2 Mile East
X116	CAOG11000210776	1/4 - 1/2 Mile SE
X117	CAOG11000210357	1/4 - 1/2 Mile SE
W118	CAOG11000210529	1/4 - 1/2 Mile ENE
T119	CAOG11000210318	1/4 - 1/2 Mile ENE
Y120	CAOG11000210530	1/4 - 1/2 Mile ENE
S121	CAOG11000210719	1/4 - 1/2 Mile West
Y122	CAOG11000210531	1/4 - 1/2 Mile ENE
Z123	CAOG11000210327	1/4 - 1/2 Mile NE
T124	CAOG11000210319	1/4 - 1/2 Mile NE
125	CAOG11000210721	1/4 - 1/2 Mile WSW
126	CAOG11000210793	1/4 - 1/2 Mile ESE


MAP ID	WELL ID	LOCATION FROM TP
X127	CAOG11000210756	1/4 - 1/2 Mile ESE
X128	CAOG11000210778	1/4 - 1/2 Mile SE
AA129	CAOG11000210533	1/4 - 1/2 Mile EN
W130	CAOG11000210547	1/4 - 1/2 Mile Eas
Z131	CAOG11000210320	1/4 - 1/2 Mile NE
AB132	CAOG11000210356	1/4 - 1/2 Mile ESI
X133	CAOG11000210354	1/4 - 1/2 Mile SE
AB134	CAOG11000210761	1/4 - 1/2 Mile ESI
AA135	CAOG11000210534	1/4 - 1/2 Mile ENI
136	CAOG11000210366	1/2 - 1 Mile WNW
AB137	CAOG11000210763	1/2 - 1 Mile ESE
Z138	CAOG11000210321	1/2 - 1 Mile NE
AB139	CAOG11000210760 CAOG11000210586	1/2 - 1 Mile SE 1/2 - 1 Mile South
140 AC141	CAOG11000210586 CAOG11000210539	1/2 - 1 Mile Souti
142	CAOG11000210539 CAOG11000210722	1/2 - 1 Mile NE
AB143	CAOG11000210722 CAOG11000210747	1/2 - 1 Mile Vest
AD143	CAOG11000210747 CAOG11000210772	1/2 - 1 Mile Sc
AE145	CAOG11000210772 CAOG11000210751	1/2 - 1 Mile East
146	CAOG11000210731 CAOG11000210723	1/2 - 1 Mile USU
AB147	CAOG11000210725	1/2 - 1 Mile SE
AD147	CAOG11000210510	1/2 - 1 Mile East
AD149	CAOG11000210525	1/2 - 1 Mile East
AF150	CAOG11000210537	1/2 - 1 Mile East
AC151	CAOG11000210541	1/2 - 1 Mile NE
AF152	CAOG11000210536	1/2 - 1 Mile East
AG153	CAOG11000210353	1/2 - 1 Mile SE
AH154	CAOG11000210535	1/2 - 1 Mile ENE
AE155	CAOG11000210764	1/2 - 1 Mile ESE
AI156	CAOG11000210748	1/2 - 1 Mile ESE
157	CAOG11000210715	1/2 - 1 Mile SSW
AC158	CAOG11000210543	1/2 - 1 Mile NE
AH159	CAOG11000210538	1/2 - 1 Mile ENE
AG160	CAOG11000210754	1/2 - 1 Mile SE
AI161	CAOG11000210352	1/2 - 1 Mile ESE
AJ162	CAOG11000210665	1/2 - 1 Mile NE
AF163	CAOG11000210552	1/2 - 1 Mile East
AK164	CAOG11000210519	1/2 - 1 Mile NW
AD165	CAOG11000210551	1/2 - 1 Mile East
AF166	CAOG11000210554	1/2 - 1 Mile East
AG167	CAOG11000210752	1/2 - 1 Mile SE
168	CAOG11000210724	1/2 - 1 Mile WSW
AG169	CAOG11000210517	1/2 - 1 Mile SE
AL170	CAOG11000210540	1/2 - 1 Mile ENE
AC171	CAOG11000210545	1/2 - 1 Mile NE
AM172	CAOG11000210725	1/2 - 1 Mile West
AH173	CAOG11000210557	1/2 - 1 Mile ENE
AE174	CAOG11000210749	1/2 - 1 Mile ESE
AE175	CAOC11000210792	1/2 - 1 Mile ESE
AK176	CAOG11000210336	1/2 - 1 Mile NW 1/2 - 1 Mile ESE
AI177	CAOC11000210750	
AG178	CAOG11000210351 CAOG11000210565	1/2 - 1 Mile SE 1/2 - 1 Mile ENE
AH179		
AF180	CAOC11000210555	1/2 - 1 Mile East
AL181	CAOG11000210542	1/2 - 1 Mile ENE
AN182	CAOG11000210546	1/2 - 1 Mile NE

TAIL OIL OAU	VELL IN ORMATION	
MAP ID	WELL ID	LOCATION FROM TP
AO183	CAOG11000210553	1/2 - 1 Mile East
AO184	CAOG11000210550	1/2 - 1 Mile East
AM185	CAOG11000210308	1/2 - 1 Mile WNW
AJ186	CAOG11000210670	1/2 - 1 Mile NE
AI187	CAOG11000210765	1/2 - 1 Mile ESE
AL188	CAOG11000210566	1/2 - 1 Mile ENE
AP189	CAOG11000216606	1/2 - 1 Mile West
AP190	CAOG11000210727	1/2 - 1 Mile West
191	CAOG11000205260	1/2 - 1 Mile South
AP192	CAOG11000210728	1/2 - 1 Mile West
AQ193	CAOG11000210726	1/2 - 1 Mile West
AR194	CAOG11000210358	1/2 - 1 Mile ESE
AS195	CAOG11000210758	1/2 - 1 Mile SE
AT196	CAOG11000210371	1/2 - 1 Mile SSE
AN197	CAOG11000210544	1/2 - 1 Mile NE
AJ198	CAOG11000210707	1/2 - 1 Mile NE
AR199	CAOG11000210514	1/2 - 1 Mile SE
AS200	CAOG11000210513	1/2 - 1 Mile SE
AU201	CAOG11000210559	1/2 - 1 Mile East
AP202	CAOG11000210729	1/2 - 1 Mile WSW
AV203	CAOG11000210774	1/2 - 1 Mile East
AN204	CAOG11000210675	1/2 - 1 Mile NE
AR205	CAOG11000210757	1/2 - 1 Mile ESE
AU206	CAOG11000210567	1/2 - 1 Mile ENE
AO207	CAOG11000210549	1/2 - 1 Mile East
AM208	CAOG11000210734	1/2 - 1 Mile West
AW209	CAOG11000210568	1/2 - 1 Mile ENE
AO210	CAOG11000210570	1/2 - 1 Mile East
211	CAOG11000204851	1/2 - 1 Mile North
AR212	CAOG11000210755	1/2 - 1 Mile ESE
213	CAOG11000210705	1/2 - 1 Mile NE
AP214	CAOG11000210731	1/2 - 1 Mile West
AQ215	CAOG11000210732	1/2 - 1 Mile West
AT216 AX217	CAOG11000210370 CAOG11000210753	1/2 - 1 Mile SSE 1/2 - 1 Mile SE
AY217 AY218	CAOG11000210733 CAOG11000210307	1/2 - 1 Mile WNW
AW219	CAOG11000210307 CAOG11000210569	1/2 - 1 Mile ENE
AQ220	CAOG11000210303 CAOG11000210733	1/2 - 1 Mile LINE
AZ221	CAOG11000210733 CAOG11000210572	1/2 - 1 Mile West
AZ221 AZ222	CAOG11000210372	1/2 - 1 Mile NE
BA223	CAOG11000210556	1/2 - 1 Mile East
224	CAOG11000210766	1/2 - 1 Mile ESE
AX225	CAOG11000210515	1/2 - 1 Mile SE
AU226	CAOG11000210558	1/2 - 1 Mile East
AV227	CAOG11000210548	1/2 - 1 Mile East
AU228	CAOG11000210560	1/2 - 1 Mile East
AX229	CAOG11000210759	1/2 - 1 Mile ESE
AW230	CAOG11000210561	1/2 - 1 Mile ENE
AY231	CAOG11000210735	1/2 - 1 Mile West
BB232	CAOG11000210790	1/2 - 1 Mile ESE
AW233	CAOG11000210562	1/2 - 1 Mile ENE
234	CAOG11000210313	1/2 - 1 Mile WNW
BA235	CAOG11000210640	1/2 - 1 Mile East
236	CAOG11000210369	1/2 - 1 Mile SSE
BA237	CAOG11000210641	1/2 - 1 Mile East
BC238	CAOG11000210642	1/2 - 1 Mile East

MAP ID	WELL ID	LOCATION FROM TP
BD239	CAOG11000210737	1/2 - 1 Mile West
BD240	CAOG11000210736	1/2 - 1 Mile West
241	CAOG11000210700	1/2 - 1 Mile SW
	CAOG11000203317 CAOG11000210643	1/2 - 1 Mile Sw
BC242		
AZ243	CAOG11000210689	1/2 - 1 Mile ENE
BE244	CAOG11000210563	1/2 - 1 Mile ENE
245	CAOG11000210730	1/2 - 1 Mile WSW
BB246	CAOG11000210791	1/2 - 1 Mile ESE
BF247	CAOG11000210644	1/2 - 1 Mile ENE
AY248	CAOG11000210305	1/2 - 1 Mile WNW
BE249	CAOG11000210564	1/2 - 1 Mile ENE
BE250	CAOG11000210647	1/2 - 1 Mile ENE
251	CAOG11000210706	1/2 - 1 Mile NE
BC252	CAOG11000210639	1/2 - 1 Mile East
BD253	CAOG11000210741	1/2 - 1 Mile West
BG254	CAOG11000210738	1/2 - 1 Mile West
BH255	CAOG11000210688	1/2 - 1 Mile ENE
BF256	CAOG11000210677	1/2 - 1 Mile ENE
257	CAOG11000210251	1/2 - 1 Mile WSW
BE258	CAOG11000210678	1/2 - 1 Mile ENE
BI259	CAOG11000210312	1/2 - 1 Mile WNW
BJ260	CAOG11000210656	1/2 - 1 Mile East
BG261	CAOG11000210739	1/2 - 1 Mile West
BC262	CAOG11000210650	1/2 - 1 Mile East
BK263	CAOG11000210649	1/2 - 1 Mile East
BH264	CAOG11000210043	1/2 - 1 Mile ENE
265	CAOG11000210007	1/2 - 1 Mile South
BF266	CAOG11000210372 CAOG11000210646	1/2 - 1 Mile South
BH267	CAOG11000210646 CAOG11000210691	1/2 - 1 Mile ENE
BL268	CAOG11000210645	1/2 - 1 Mile ENE
BM269	CAOG11000210304	1/2 - 1 Mile WNW
BI270	CAOG11000210303	1/2 - 1 Mile WNW
BJ271	CAOG11000210807	1/2 - 1 Mile East
BJ272	CAOG11000210804	1/2 - 1 Mile East
BJ273	CAOG11000210815	1/2 - 1 Mile East
BN274	CAOG11000210704	1/2 - 1 Mile NE
BO275	CAOG11000210802	1/2 - 1 Mile East
276	CAOG11000210368	1/2 - 1 Mile SSE
BK277	CAOG11000210468	1/2 - 1 Mile East
278	CAOG11000210768	1/2 - 1 Mile ESE
BL279	CAOG11000210648	1/2 - 1 Mile ENE
BP280	CAOG11000210692	1/2 - 1 Mile ENE
BK281	CAOG11000210476	1/2 - 1 Mile ENE
BP282	CAOG11000210693	1/2 - 1 Mile ENE
BL283	CAOG11000210484	1/2 - 1 Mile ENE
BQ284	CAOG11000210311	1/2 - 1 Mile WNW
BM285	CAOG11000210740	1/2 - 1 Mile West
286	CAOG11000210788	1/2 - 1 Mile ESE
BO287	CAOG11000210805	1/2 - 1 Mile East
288	CAOG11000210638	1/2 - 1 Mile SE
BN289	CAOG11000210708	1/2 - 1 Mile NE
BL290	CAOG11000210493	1/2 - 1 Mile ENE
BP291	CAOG11000210501	1/2 - 1 Mile ENE
BM292	CAOG11000215204	1/2 - 1 Mile WNW
293	CAOG11000210742	1/2 - 1 Mile West
BR294	CAOG11000210742 CAOG11000210806	1/2 - 1 Mile East
DIVEOT	3/13/3/1/3/02/10/00	1/2 - I WIIIC Last

MAP ID	WELL ID	LOCATION FROM TP
BS295	CAOG11000210816	1/2 - 1 Mile East
BT296	CAOG11000210698	1/2 - 1 Mile ENE
297	CAOG11000210477	1/2 - 1 Mile ENE
298	CAOG11000210365	1/2 - 1 Mile SSE
299	CAOG11000210786	1/2 - 1 Mile East
BQ300	CAOG11000210306	1/2 - 1 Mile WNW
BT301	CAOG11000210703	1/2 - 1 Mile NE
BU302	CAOG11000210502	1/2 - 1 Mile ENE
BU303	CAOG11000210701	1/2 - 1 Mile ENE
BV304	CAOG11000210289	1/2 - 1 Mile WNW
BU305	CAOG11000210494	1/2 - 1 Mile ENE
BV306	CAOG11000210743	1/2 - 1 Mile West
BR307	CAOG11000210808	1/2 - 1 Mile East
308	CAOG11000210789	1/2 - 1 Mile ESE
BS309	CAOG11000210469	1/2 - 1 Mile East
310	CAOG11000210364	1/2 - 1 Mile SE
311	CAOG11000210309	1/2 - 1 Mile WNW
312	CAOG11000210291	1/2 - 1 Mile WNW

PHYSICAL SETTING SOURCE MAP - 4930273.2s

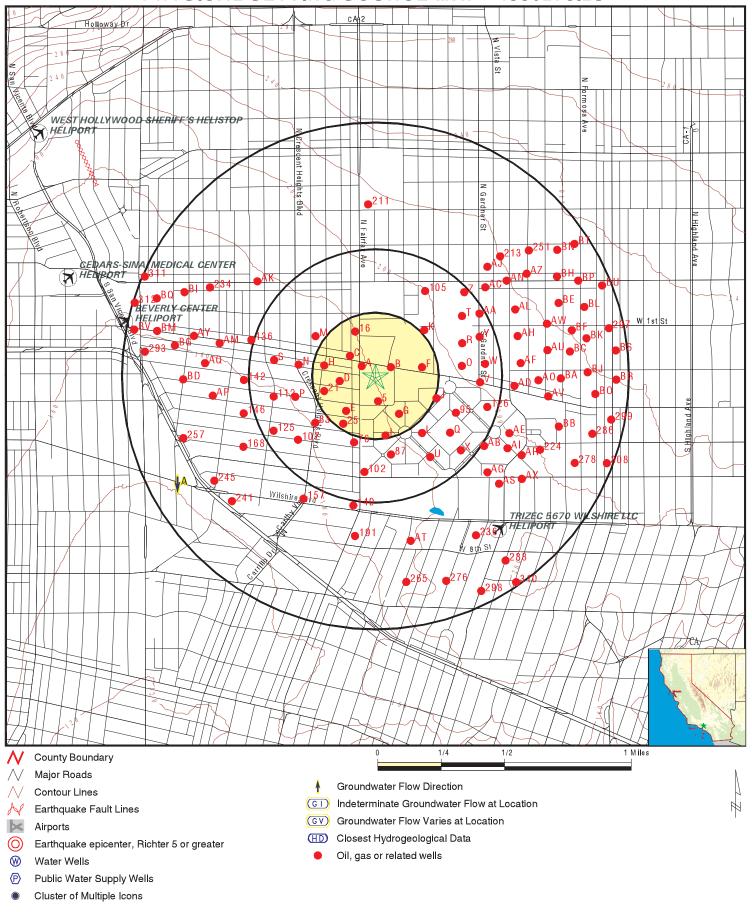

SITE NAME: Town & Country Retail ADDRESS: 6310 W. Third Street CLIENT: ARCADIS U.S., Inc. CONTACT: Janet Holtz Los Angeles CA 90036 INQUIRY #: 4930273.2s LAT/LONG: 34.070699 / 118.360324

DATE: May 08, 2017 2:42 pm

Map ID Direction Distance Elevation EDR ID Number Database A1 WSW 1/2 - 1 Mile Lower Site ID: I-16144 **AQUIFLOW** 38095 Groundwater Flow: S Shallow Water Depth: Not Reported Deep Water Depth: Not Reported Average Water Depth: 40 Date: 06/24/1991 A2 WSW 1/2 - 1 Mile Site ID: I-16144 **AQUIFLOW** 38094 Groundwater Flow: S Shallow Water Depth: Not Reported Lower Deep Water Depth: Not Reported

06/24/1991

Average Water Depth:

Date:

Map ID Direction Distance

Site id:

North 0 - 1/8 Mile

Distance Database EDR ID Number

A1
West OIL_GAS CAOG11000210801
0 - 1/8 Mile

District nun: 1 Api number: 03715230
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:102Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

B2
ENE
OIL_GAS
CAOG11000210800
0 - 1/8 Mile

District nun: 1 Api number: 03715229
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

CAOG11000210801

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Salt Lake Wellnumber: 99
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210800

A3

OIL_GAS

CAOG11000210332

District nun: 03714646 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Gilmore Oil Company Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments: Leasename: Not Reported

Wellnumber: 33 Epawell: Ν Hydraulica: Ν Spuddate: Not Reported

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210332 Site id:

B4 NE CAOG11000210331 OIL_GAS 0 - 1/8 Mile

Elevation:

03714645 District nun: Api number: Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Gilmore Oil Company Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Not Reported

Base meridian: SB Locationde: Not Reported

Gissourcec: hud

Not Reported Comments:

Not Reported Wellnumber: 27 Leasename: Epawell: Ν Hydraulica: Ν

Spuddate: Not Reported Confidenti: Ν

Welldeptha: 0 0 Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210331

South OIL GAS CAOG11000210780 0 - 1/8 Mile

District nun: Api number: 03715209 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Not Reported Base meridian: Elevation:

Locationde: Not Reported

Gissourcec: hud

Spuddate:

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 34 Epawell: Ν Hydraulica: Ν Not Reported

Confidenti: Ν 0 Welldeptha:

Redrillfoo: 0

Not Reported Abandonedd: Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210780 Site id:

C6 NW OIL_GAS CAOG11000210333 0 - 1/8 Mile

District nun: Api number: 03714647 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Gilmore Oil Company Operator name:

Los Angeles County name: Fieldname: Salt Lake Area name: Any Area Section: 20 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Locationde: Not Reported Gissourcec: hud

Not Reported Comments:

Not Reported Wellnumber: 39 Leasename: Ν Epawell: Ν Hydraulica:

Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0

Redrillfoo: 0

0 - 1/8 Mile

Gissourcec:

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210333

A7 WNW OIL_GAS CAOG11000210744

District nun: Api number: 03715173 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc. County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

hud

Comments: Not Reported

Not Reported Wellnumber: 140 Leasename: Epawell: Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210744 Site id:

Map ID Direction Distance

Direction
Distance
Database EDR ID Number

D8 WSW 1/8 - 1/4 Mile

WSW OIL_GAS CAOG11000210576

District nun: 1 Api number: 03714960
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:3Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210576

E9 SW OIL_GAS CAOG11000210745

1/8 - 1/4 MileDistrict nun: 1 Api number: 03715174

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 20
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 142

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

1/8 - 1/4 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210745

TC4930273.2s Page A-18

District nun: 1 Api number: 03714648
Blm well: N Redrill can: Not Reported

Dryhole: N Well status:

Operator name: Gilmore Oil Company

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210334

F11
ENE OIL_GAS CAOG11000210330
1/8 - 1/4 Mile

Wellnumber:

47

Not Reported

District nun: 1 Api number: 03714644
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 21
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210330

G12 SE OIL_GAS CAOG11000210798 1/8 - 1/4 Mile

District nun: 1 Api number: 03715227
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake

Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:90Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0

Redrillfoo: 0

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210798

D13
West
OIL_GAS CAOG11000210590
1/8 - 1/4 Mile

District nun: 1 Api number: 03714975
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake

Area name: Any Area Section: 20
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber: 22

Epawell: Not Reported Wellnumber: 22

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

hud

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210590

F14
East OIL_GAS CAOG11000210799
1/8 - 1/4 Mile

District nun: 1 Api number: 03715228
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported
Leasename: Salt Lake Wellnumber: 93

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG
Site id: CAOG11000210799

Map ID Direction Distance

Site id:

Database EDR ID Number

H15 WNW OIL_GAS CAOG11000210589 1/8 - 1/4 Mile

District nun: 1 Api number: 03714974 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Not Reported Wellnumber: 21 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0 Redrillfoo:

Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown POG Gissymbol:

CAOG11000210589

NNW OIL_GAS CAOG11000210522 1/8 - 1/4 Mile

Api number: 03714906 District nun: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

James F. Ross Operator name: Los Angeles Fieldname: Salt Lake County name: Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Not Reported Comments: Wellnumber: 3 Leasename: Ross Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown Gissymbol: AOG

CAOG11000210522 Site id:

E17 SW 1/8 - 1/4 Mile OIL_GAS CAOG11000210574

District nun: 03714958 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Not Reported Wellnumber: 1 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210574

I18 South CAOG11000210777 OIL_GAS 1/8 - 1/4 Mile

03715206 District nun: Api number: Blm well: Ν Redrill can: Not Reported

Dryhole: N Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range:

Base meridian: Not Reported SB Elevation:

Locationde: Not Reported Gissourcec: hud

Not Reported Comments:

Salt Lake Wellnumber: Leasename: 31 Epawell: Ν Hydraulica: Ν

Spuddate: Not Reported Confidenti: Ν Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210777

G19 OIL GAS CAOG11000210782

1/8 - 1/4 Mile District nun: Api number: 03715211 1

Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:37Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210782

E20 SSW OIL_GAS CAOG11000210244 1/8 - 1/4 Mile

District nun: 1 Api number: 03714541
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Arcturus Wellnumber: 201 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/8 - 1/4 Mile

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210244

21 WSW OIL_GAS CAOG11000210710

District nun: 1 Api number: 03715139
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 20
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

hud

Comments: Not Reported
Leasename: Not Reported Wellnumber: 37

Leasename: Not Reported Wellnumber: 37
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG
Site id: CAOG11000210710

Map ID Direction Distance

Distance Database EDR ID Number

F22 East 1/8 - 1/4 Mile

Gissourcec:

OIL_GAS CAOG11000210328

District nun: 1 Api number: 03714642
Blm well: N Redrill can: Not Reported
Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21

Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 15
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Directiona: Unknown Gissymbol: PO Site id: CAOG11000210328

H23 WNW OIL_GAS CAOG11000210335 1/8 - 1/4 Mile

District nun: 1 Api number: 03714649
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

hud

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported
Leasename: Not Reported Wellnumber: 55

Leasename: Not Reported Wellnumber: 55
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210335

J24
ESE OIL_GAS CAOG11000210797
1/8 - 1/4 Mile

District nun: 03715226 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 88 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210797

25 SW CAOG11000210583 OIL_GAS 1/8 - 1/4 Mile

03714967 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 01S 14W Township: Range:

Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Not Reported Wellnumber: Leasename: 6 Epawell: Ν Hydraulica: Ν

Spuddate: Confidenti: Ν Not Reported

Welldeptha: 0 Redrillfoo: 0

1/8 - 1/4 Mile

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210583

F26 OIL GAS CAOG11000210329

District nun: Api number: 03714643 1

Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ Gilmore Oil Company Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:16Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Site id:

1/8 - 1/4 Mile

Gissourcec:

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210329

H27
West OIL_GAS CAOG11000210575
1/8 - 1/4 Mile

District nun: 1 Api number: 03714959
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake

Area name: Any Area Section: 20
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 2
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

hud

CAOG11000210575

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

J28
ESE OIL_GAS CAOG11000210779

District nun: 1 Api number: 03715208
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported
Leasename: Salt Lake Wellnumber: 33

Epawell: N Hydraulica: N
Confidenti: N Souddate: Net Reported

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG
Site id: CAOG11000210779

Map ID Direction Distance

Distance Database EDR ID Number

K29 NE 1/4 - 1/2 Mile

NE OIL_GAS CAOG11000192175

District nun: 1 Api number: 03715050

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 200.731

Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename:MetropolitanWellnumber:6Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192175

K30
NE
OIL_GAS
CAOG11000192176
1/4 - 1/2 Mile

District nun: 1 Api number: 03715051
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14WBase meridian:SBElevation:197.993

Base meridian: SB Elevation: 197 Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename:MetropolitanWellnumber:7Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192176

I31
SSE
OIL_GAS CAOG11000210781
1/4 - 1/2 Mile

District nun: 03715210 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Not Reported

Elevation:

Not Reported Locationde:

Gissourcec: hud Not Reported Comments:

Leasename: Salt Lake Wellnumber: Epawell: Ν Hydraulica:

Ν Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210781 Site id:

K32 NE CAOG11000192179 OIL_GAS 1/4 - 1/2 Mile

36

03715054 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: 199.006 SB Elevation:

Locationde: Not Reported

Gissourcec: gps

64002239.ssf Comments:

Wellnumber: Leasename: U-93 4 Epawell: Ν Hydraulica: Ν

Spuddate: Confidenti: Ν Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG

Directionally drilled Directiona: Gissymbol: Site id: CAOG11000192179

K33 OIL GAS CAOG11000192174 1/4 - 1/2 Mile

District nun: Api number: 03715049 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status:

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: 201.708

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename:MetropolitanWellnumber:5Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192174

K34
NE
OIL_GAS
CAOG11000192178
1/4 - 1/2 Mile

District nun: 1 Api number: 03715053
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range: 199.089 Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename:U-93Wellnumber:3Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192178

K35 NE OIL_GAS CAOG11000189006

District nun: 1 Api number: 03702077
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: 197.196

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename: U-93 Wellnumber: 2 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000189006

Map ID Direction Distance

Database EDR ID Number

K36 NE

OIL_GAS CAOG11000192172 1/4 - 1/2 Mile

District nun: 1 Api number: 03715047 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

McFarland Energy, Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 199.932

Not Reported Locationde: Gissourcec: gps

64002239.ssf Comments:

Metropolitan Wellnumber: 3 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Directionally drilled POG Gissymbol: CAOG11000192172 Site id:

K37 NE

1/4 - 1/2 Mile

03715052 Api number: District nun: 1 Ν Redrill can: Blm well: Not Reported Dryhole: Ν Well status:

Operator name: McFarland Energy, Inc.

Los Angeles

Fieldname: Salt Lake County name: Any Area Area name: Section: 21 01S 14W Township: Range: Elevation: 199.679 Base meridian: SB

Locationde: Not Reported

Gissourcec: gps 64002239.ssf Comments:

Wellnumber: Leasename: U-93 1 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG CAOG11000192177 Site id:

K38 NE 1/4 - 1/2 Mile OIL_GAS CAOG11000214636

OIL_GAS

CAOG11000192177

District nun: 03721193 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB

Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Comments: Not Reported

Leasename: U-168 Wellnumber: 1 Epawell: Ν Hydraulica: Ν Spuddate: Not Reported

Confidenti: Ν Welldeptha: 0

Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Directionally drilled POG Directiona: Gissymbol: CAOG11000214636

K39 NE CAOG11000192181 OIL_GAS 1/4 - 1/2 Mile

03715129 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: 198.315 SB Elevation:

Locationde: Not Reported

Gissourcec: gps Comments:

64002239.ssf Wellnumber: Leasename: Gilmore Epawell: Ν Hydraulica: Ν

Spuddate: Not Reported Confidenti: Ν

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Not Reported Completion: Directionally drilled POG

Directiona: Gissymbol: Site id: CAOG11000192181

K40 OIL GAS CAOG11000192180 1/4 - 1/2 Mile

District nun: Api number: 03715055 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status:

Operator name: McFarland Energy, Inc. County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 199.656

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename: U-93 Wellnumber: 5 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192180

K41
NE
OIL_GAS
CAOG11000188558
1/4 - 1/2 Mile

District nun: 1 Api number: 03700024
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range: 198.643 Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename: U-93 Wellnumber: 6
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000188558

K42 NE OIL_GAS CAOG11000214637

District nun: 1 Api number: 03721194
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:U-168Wellnumber:2Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000214637

Map ID Direction Distance

Distance Database EDR ID Number

K43 NE 1/4 - 1/2 Mile

Gissourcec:

OIL_GAS CAOG11000192993

District nun: 1 Api number: 03720017

Blm well: N Redrill can: Not Reported

Dryhole: N Well status:

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 198.228

Locationde: Not Reported Gissourcec: aps

Gissourcec: gps Comments: 64002239.ssf

Leasename:MetropolitanWellnumber:8Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion:

Abandonedd: Not Reported Completion: Not Reported Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192993

K44 NE 1/4 - 1/2 Mile

District nun: 1 Api number: 03715136
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

gps

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14WPase meridion:SRFlevation:195 474

Base meridian: SB Elevation: 195.474
Locationde: Not Reported

Comments: 64002239.ssf
Leasename: Metropolitan Wellnumber: 2

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192188

L45
SSE OIL_GAS CAOG11000210769

OIL_GAS

CAOG11000192188

District nun: 03715198 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Not Reported

Elevation:

Not Reported Locationde:

Gissourcec: hud Not Reported Comments:

Leasename: Salt Lake Wellnumber: 23 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210769

K46 NE CAOG11000193039 OIL_GAS 1/4 - 1/2 Mile

03720149 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: 198.347 SB Elevation:

Locationde: Not Reported

Gissourcec: gps Comments:

64002239.ssf Wellnumber: Leasename: Gilmore 9 Epawell: Ν Hydraulica: Ν

Spuddate: Confidenti: Ν Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported PWD Unknown

Directiona: Gissymbol: Site id: CAOG11000193039

K47 OIL GAS CAOG11000193040 1/4 - 1/2 Mile

03720149 District nun: Api number: 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status:

Operator name: McFarland Energy, Inc. County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: 198.347

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename:GilmoreWellnumber:9Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: PWD

Site id: CAOG11000193040

K48
NE
OIL_GAS
CAOG11000214223
1/4 - 1/2 Mile

District nun: 1 Api number: 03721227
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: U-168 Wellnumber: 3
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000214223

K49
NE OIL_GAS CAOG11000193024

1/4 - 1/2 MileDistrict nun: 1 Api number: 03720119

Blm well: N Redrill can: Not Reported Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: 200.284

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf Leasename: Metropolitan

Leasename:MetropolitanWellnumber:9Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG Site id: CAOG11000193024

Map ID Direction Distance

Database EDR ID Number

K50

OIL_GAS CAOG11000192184 1/4 - 1/2 Mile

District nun: 1 Api number: 03715132 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

McFarland Energy, Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 196.958

Not Reported Locationde:

Gissourcec: gps 64002239.ssf Comments:

Gilmore Wellnumber: 5 Leasename:

Epawell: Hydraulica: Ν Ν Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Directionally drilled POG Gissymbol:

CAOG11000192184 Site id:

K51 NE

OIL_GAS CAOG11000214224 1/4 - 1/2 Mile

Api number: 03721228 District nun: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: McFarland Energy, Inc.

Los Angeles Fieldname: Salt Lake County name: Any Area Area name: Section: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Not Reported Comments:

Wellnumber: 2 Leasename: U-169 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000214224 Site id:

K52 NE 1/4 - 1/2 Mile

OIL_GAS CAOG11000193256

District nun: 1 Api number: 03721090 Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 197.855

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf Leasename: Oakwood

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

CAOG11000193256

K53 NE OIL_GAS CAOG11000192187 1/4 - 1/2 Mile

Wellnumber:

2

District nun: 1 Api number: 03715135
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: 198.101 SB Elevation:

Locationde: Not Reported

Gissourcec: gps Comments: 640

Comments: 64002239.ssf
Leasename: Metropolitan Wellnumber: 1
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Directionally drilled Gissymbol: POG

Directiona: Directionally drilled Gissymbol: POG Site id: CAOG11000192187

K54
NE
OIL_GAS
CAOG11000193262
1/4 - 1/2 Mile

District nun: 1 Api number: 03721100
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: McFarland Energy, Inc. County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: 197.607

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename:OakwoodWellnumber:4Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000193262

M55
WNW OIL_GAS CAOG11000210523
1/4 - 1/2 Mile

District nun: 1 Api number: 03714907
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: James F. Ross
County name: Los Angeles Fieldname: Salt Lake

Area name: Any Area Section: 20
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Ross Wellnumber: 4
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210523

M56

OIL_GAS

CAOG11000210521

District nun: 1 Api number: 03714905
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: James F. Ross
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 20

Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported
Gissourcec: hud

Comments: Not Reported
Leasename: Ross Wellnumber: 2

Leasename: Ross Wellnumber: 2
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG
Site id: CAOG11000210521

Map ID Direction Distance

Distance Database EDR ID Number

K57 NE 1/4 - 1/2 Mile

OIL_GAS CAOG11000193259

District nun: 1 Api number: 03721094

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 197.983

Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename:OakwoodWellnumber:3Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000193259

I58 South 1/4 - 1/2 Mile

OIL_GAS CAOG11000210787

District nun: 1 Api number: 03715216
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 42 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210787

K59 NE 1/4 - 1/2 Mile

OIL_GAS CAOG11000192183

District nun: 1 Api number: 03715131
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 198.789

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf Leasename: Gilmore

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Confidenti: N Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

CAOG11000192183

K60
NE
OIL_GAS
CAOG11000193149
1/4 - 1/2 Mile

Wellnumber:

3

District nun: 1 Api number: 03720577
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: 199.691 SB Elevation:

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf
Leasename: Gilmore Wellnumber: 12
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Directionally drilled Gissymbol: POG

Directiona: Directionally drilled Gissymbol: POG Site id: CAOG11000193149

K61
NE
OIL_GAS
CAOG11000193150
1/4 - 1/2 Mile

District nun: 1 Api number: 03720607
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc. County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: 200.373

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename:GilmoreWellnumber:13Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000193150

K62
NE
OIL_GAS
CAOG11000189038
1/4 - 1/2 Mile

District nun: 1 Api number: 03702957

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range: 196.23 Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename: Gilmore Wellnumber: 8
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000189038

K63
NE OIL_GAS CAOG11000193277

District nun: 1 Api number: 03721131
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: 197.189

Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename:OakwoodWellnumber:6Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directional: Directionally drilled Gissymbol: POG

Site id: CAOG11000193277

Map ID Direction Distance

Database EDR ID Number

K64 NE 1/4 - 1/2 Mile

OIL_GAS CAOG11000193158

District nun: 1 Api number: 03720662 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

McFarland Energy, Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 201.391

Not Reported Locationde:

Gissourcec: gps 64002239.ssf Comments:

Gilmore Wellnumber: 16 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported 0

Welldeptha: Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Directionally drilled **PWD** Gissymbol: CAOG11000193158 Site id:

K65

OIL_GAS CAOG11000192173 NE 1/4 - 1/2 Mile

Api number: 03715048 District nun: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: McFarland Energy, Inc.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 21 01S 14W Township: Range:

201.429 Base meridian: SB Elevation: Locationde: Not Reported

Gissourcec: gps 64002239.ssf Comments:

Wellnumber: 4 Leasename: Metropolitan Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

CAOG11000192173 Site id:

K66 NE 1/4 - 1/2 Mile OIL_GAS CAOG11000193157

District nun: 1 Api number: 03720647
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 200.299

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf Leasename: Gilmore

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

CAOG11000193157

K67
NE OIL_GAS CAOG11000193272
1/4 - 1/2 Mile

Wellnumber:

15

District nun: 1 Api number: 03721119
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: 196.429 SB Elevation:

Locationde: Not Reported

Gissourcec: gps Comments: 640

Comments: 64002239.ssf
Leasename: Oakwood Wellnumber: 5
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000193272

K68 NE OIL GAS CAOG11000192185

District nun: 1 Api number: 03715133
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 200.163

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename:GilmoreWellnumber:6Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192185

K69
NE
OIL_GAS
CAOG11000193178
1/4 - 1/2 Mile

District nun: 1 Api number: 03720826
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range: 198.09 Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename: Oakwood Wellnumber: 1
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000193178

K70
NE
OIL_GAS
CAOG11000192186
1/4 - 1/2 Mile

District nun: 1 Api number: 03715134
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: 198.928

Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename: Gilmore Wellnumber: 7
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000192186

Map ID Direction Distance

Database EDR ID Number

K71 NE

OIL_GAS CAOG11000193071 1/4 - 1/2 Mile

District nun: 1 Api number: 03720251 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

McFarland Energy, Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 198.427

Not Reported Locationde: Gissourcec:

gps 64002239.ssf Comments:

Gilmore Wellnumber: 10 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Directionally drilled POG Gissymbol:

CAOG11000193071 Site id:

K73 NE OIL_GAS CAOG11000193084 1/4 - 1/2 Mile

03720314 Api number: District nun: 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Ν Well status:

Operator name: McFarland Energy, Inc.

Los Angeles Fieldname: Salt Lake County name: Any Area Area name: Section: 21 01S 14W Township: Range: Elevation: 197.339 Base meridian: SB

Locationde: Not Reported

Gissourcec: gps

64002239.ssf Comments: Leasename: Gilmore

Wellnumber: 4 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: **PWD**

CAOG11000193084 Site id:

K72 NE 1/4 - 1/2 Mile OIL_GAS CAOG11000193083

District nun: 1 Api number: 03720314
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 197.339

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf Leasename: Gilmore

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: PWD

Site id: CAOG11000193083

K74
NE
OIL_GAS
CAOG11000193086
1/4 - 1/2 Mile

Wellnumber:

4

District nun: 1 Api number: 03720354
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: 197.946 SB Elevation:

Locationde: Not Reported

Gissourcec: gps

Comments: 64002239.ssf

Leasename: U-93 Wellnumber: 7
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Welldeptha: 0

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000193086

K75 NE OIL GAS CAOG11000192182

1/4 - 1/2 Mile

District nun: 1 Api number: 03715130

Bim well: N Redrill can: Not Reported

Dryhole: N Well status:
Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: 198.414

Locationde: Not Reported

Gissourcec: gps

Not Reported

Comments: 64002239.ssf

Leasename:GilmoreWellnumber:2Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000192182

76
SSW
OIL_GAS CAOG11000210579
1/4 - 1/2 Mile

District nun: 1 Api number: 03714963
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname:

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 4
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210579

K77
NE OIL_GAS CAOG11000193106

District nun: 1 Api number: 03720388
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: McFarland Energy, Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: 200.872

Locationde: Not Reported

Gissourcec: gps Comments: 64002239.ssf

Leasename: Gilmore Wellnumber: 14
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Directionally drilled Gissymbol: POG

Site id: CAOG11000193106

Map ID Direction Distance

Database **EDR ID Number**

K78 1/4 - 1/2 Mile

OIL_GAS CAOG11000193135

11

District nun: 1 Api number: 03720509 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

McFarland Energy, Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: 206.5

Not Reported Locationde: Gissourcec: gps

64002239.ssf Comments: Gilmore Wellnumber: Leasename:

Epawell: Hydraulica: Ν N Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000193135

J79

OIL_GAS CAOG11000210796 East 1/4 - 1/2 Mile

03715225 District nun: Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Operator name: Chevron U.S.A. Inc.

Los Angeles Fieldname: Salt Lake County name: Any Area Area name: Section: 21 01S 14W Township: Range: Not Reported

Base meridian: SB Elevation: Locationde: Not Reported

Gissourcec: hud

Not Reported Comments: Wellnumber: Leasename: Salt Lake

87 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210796 Site id:

OIL_GAS CAOG11000210794

District nun: 1 Api number: 03715223
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:67Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210794

J81
ESE OIL_GAS CAOG11000210795
1/4 - 1/2 Mile

District nun: 1 Api number: 03715224
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud Comments: Not Re

Comments: Not Reported
Leasename: Salt Lake Wellnumber: 81
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210795

N82
WNW OIL_GAS CAOG11000210711
1/4 - 1/2 Mile

District nun: 1 Api number: 03715140
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:40Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210711

83 SW OIL_GAS CAOG11000210709 1/4 - 1/2 Mile

District nun: 1 Api number: 03715138

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:35Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210709

O84
East OIL_GAS CAOG11000210322
1/4 - 1/2 Mile

District nun: 1 Api number: 03714636
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported
Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber: 9

Epawell: N Hydraulica: N Confidenti: N Spuddate: N Not Reported

Confidenti: N Spuddate: Not Reporte Welldeptha: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210322 Gissymbol: POG

Map ID Direction Distance

Site id:

1/4 - 1/2 Mile

Distance Database EDR ID Number

P85
WSW OIL_GAS CAOG11000210712
1/4 - 1/2 Mile

District nun: 1 Api number: 03715141

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 43
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210712

N86
West OIL_GAS CAOG11000210717
1/4 - 1/2 Mile

District nun: 1 Api number: 03715146
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: B

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber:

Leasename: Not Reported Wellnumber: 58
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210717

87 South OIL_GAS CAOG11000210775

TC4930273.2s Page A-51

District nun: 03715204 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 29 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210775

O88 ENE CAOG11000210323 OIL_GAS 1/4 - 1/2 Mile

03714637 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Gilmore Oil Company Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range:

Base meridian: Not Reported SB Elevation:

Locationde: Not Reported Gissourcec: hud

Not Reported Comments:

Not Reported Wellnumber: Leasename: 10 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210323

M89 OIL GAS CAOG11000210520

District nun: Api number: 03714904 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status:

James F. Ross Operator name:

Salt Lake County name: Los Angeles Fieldname: Area name: Any Area Section: 20 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Ross Wellnumber: Α Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

0 Welldeptha: Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210520

P90 wsw OIL_GAS CAOG11000210713 1/4 - 1/2 Mile

District nun: Api number: 03715142 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Locationde: Not Reported Gissourcec: hud

Not Reported Comments:

Not Reported Wellnumber: 44 Leasename: Ν Epawell: Ν Hydraulica:

Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0 Redrillfoo: 0

Not Reported Completion: Abandonedd:

Not Reported

Directiona: POG Unknown Gissymbol: Site id: CAOG11000210713

OIL_GAS CAOG11000210785 1/4 - 1/2 Mile

Api number: 03715214 District nun: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc. County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 40 Leasename: Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

CAOG11000210785 Site id:

Map ID Direction Distance

Database EDR ID Number

Q92

SE 1/4 - 1/2 Mile OIL_GAS CAOG11000210784

District nun: 1 Api number: 03715213 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 39 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210784

R93 ENE

OIL_GAS CAOG11000210524 1/4 - 1/2 Mile

District nun: Api number: 03714908 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status:

Operator name: Shell Western Exploration & Production Inc.

Fieldname: Salt Lake County name: Los Angeles Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB

Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Not Reported Comments: Wellnumber: Leasename: Verne Community

1 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210524 Site id:

R94

ENE 1/4 - 1/2 Mile OIL_GAS CAOG11000210324

District nun: 03714638 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Gilmore Oil Company Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Not Reported Wellnumber: 11 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210324

95 ESE CAOG11000210767 OIL_GAS 1/4 - 1/2 Mile

03715196 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range:

Base meridian: Not Reported SB Elevation:

Locationde: Not Reported Gissourcec: hud

Not Reported Comments:

Salt Lake Wellnumber: 21 Leasename: Epawell: Ν Hydraulica: Ν

Spuddate: Not Reported Confidenti: Ν

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210767

P96 OIL GAS CAOG11000210716 West

District nun: Api number: 03715145 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Chevron U.S.A. Inc. Operator name:

hud

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename:Not ReportedWellnumber:57Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210716

O97
East OIL_GAS CAOG11000210314
1/4 - 1/2 Mile

District nun: 1 Api number: 03714628
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 1
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210314

O98
East OIL_GAS CAOG11000210315

District nun: 1 Api number: 03714629
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P
Operator name: Gilmore Oil Company

County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

hud

Comments: Not Reported
Leasename: Not Reported Wellnumber: 2

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG
Site id: CAOG11000210315

Map ID Direction Distance

Database EDR ID Number

Elevation:

S99 WNW 1/4 - 1/2 Mile

OIL_GAS CAOG11000210718

District nun: 1 Blm well: Ν Dryhole: Ν Api number: 03715147 Redrill can: Not Reported

Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W Not Reported

Base meridian: SB Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Not Reported Wellnumber: 59 Leasename: Epawell: Hydraulica: Ν Ν Spuddate: Not Reported

Confidenti: Ν Welldeptha: 0 Redrillfoo:

Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown POG Gissymbol:

Site id: CAOG11000210718

Q100

SE 1/4 - 1/2 Mile OIL_GAS CAOG11000210762

03715191 Api number: District nun: 1 Ν Redrill can: Blm well: Not Reported Dryhole: Ν Well status:

Operator name: Chevron U.S.A. Inc.

Los Angeles Fieldname: Salt Lake County name: Any Area Area name: Section: 21 01S 14W Township: Range: Elevation: Not Reported

Base meridian: SB Locationde: Not Reported

Gissourcec: hud

Not Reported Comments: Wellnumber: 16 Leasename: Salt Lake Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

CAOG11000210762 Site id:

T101

NE 1/4 - 1/2 Mile OIL_GAS CAOG11000210325

District nun: 1 Api number: 03714639
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Gilmore Oil Company

Los Angeles County name: Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Leasename:Not ReportedWellnumber:12Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210325

102 South OIL_GAS CAOG11000210773 1/4 - 1/2 Mile

District nun: 1 Api number: 03715202
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: B

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Salt Lake Wellnumber: 27
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210773

U103
SSE
OIL_GAS CAOG11000210783
1/4 - 1/2 Mile

District nun: 1 Api number: 03715212
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name:Chevron U.S.A. Inc.County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21

Township:01SRange:14WBase meridian:SBElevation:Not Reported

Locationde: Not Reported

Gissourcec: hud

Spuddate:

Not Reported

Comments: Not Reported

Leasename:Salt LakeWellnumber:38Epawell:NHydraulica:N

Confidenti: N Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210783

R104
ENE OIL_GAS CAOG11000210316
1/4 - 1/2 Mile

District nun: 1 Api number: 03714630
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 3
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210316

105 NNE OIL_GAS CAOG11000210636

District nun: 1 Api number: 03715056
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

 Operator name:
 Macco Corp.

 County name:
 Los Angeles
 Fieldname:
 Salt Lake

 Area name:
 Any Area
 Section:
 21

 Township:
 01S
 Range:
 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:1Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210636

Map ID Direction Distance

Database EDR ID Number

U106

SE 1/4 - 1/2 Mile OIL_GAS CAOG11000210770

District nun: 1 Api number: 03715199 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 24 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0 Abandonedd: Not Reported Completion:

Not Reported Directiona: Unknown POG Gissymbol:

Site id: CAOG11000210770

107

Comments:

OIL_GAS CAOG11000210714 SW 1/4 - 1/2 Mile

Api number: 03715143 District nun: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: Chevron U.S.A. Inc.

Not Reported

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Wellnumber: 46 Leasename: Not Reported

Epawell: Ν Hydraulica: Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210714 Site id:

Q108 SE 1/4 - 1/2 Mile

OIL_GAS CAOG11000210359

District nun: 1 Api number: 03714684
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14WBase meridian:SBElevation:Not Reported

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:416Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210359

\$109
West OIL_GAS CAOG11000210581
1/4 - 1/2 Mile

District nun: 1 Api number: 03714965
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 5
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

1/4 - 1/2 Mile

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210581

R110
ENE OIL GAS CAOG11000210317

District nun: 1 Api number: 03714631
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 4
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210317

T111
NE OIL_GAS CAOG11000210326
1/4 - 1/2 Mile

District nun: 1 Api number: 03714640
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 13
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210326

112
WSW OIL_GAS CAOG11000210720

District nun: 1 Api number: 03715149
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 20
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported
Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber: 63

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG
Site id: CAOG11000210720

Map ID Direction Distance

Distance Database EDR ID Number

V113 East 1/4 - 1/2 Mile

1/4 - 1/2 Mile

OIL_GAS CAOG11000210771

District nun: 1 Api number: 03715200

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:25Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210771

V114
East OIL_GAS CAOG11000210527

District nun: 1 Api number: 03714911
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber:

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210527

W115
East OIL_GAS CAOG11000210528
1/4 - 1/2 Mile

3

District nun: 1 Api number: 03714912
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Leasename:Not ReportedWellnumber:4Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N
Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210528

X116
SE OIL_GAS CAOG11000210776
1/4 - 1/2 Mile

District nun: 1 Api number: 03715205
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 30 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210776

X117 SE OIL GAS CAOG11000210357

District nun: 1 Api number: 03714682
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:413Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210357

W118
ENE OIL_GAS CAOG11000210529
1/4 - 1/2 Mile

District nun: 1 Api number: 03714913

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 5
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/4 - 1/2 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210529

T119
ENE OIL_GAS CAOG11000210318

District nun: 1 Api number: 03714632
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company
County name: Los Angeles Fieldname: Salt Lake

Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:5Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210318

Map ID Direction Distance

Database EDR ID Number

Y120 **ENE** 1/4 - 1/2 Mile

OIL_GAS CAOG11000210530

District nun: 1 Api number: 03714914 Blm well: Ν Redrill can: Not Reported

Well status: Dryhole: Ν

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Not Reported Wellnumber: 6 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: Abandonedd: Not Reported Completion:

Not Reported Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210530

S121 West

1/4 - 1/2 Mile

OIL_GAS CAOG11000210719

District nun: Api number: 03715148 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Operator name: Chevron U.S.A. Inc.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 20 01S 14W Township: Range:

Not Reported Base meridian: SB Elevation: Locationde: Not Reported

Gissourcec: hud

Not Reported Comments:

Wellnumber: 60 Leasename: Not Reported Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

CAOG11000210719 Site id:

Y122 ENE 1/4 - 1/2 Mile

OIL_GAS CAOG11000210531

District nun: 1 Api number: 03714915
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Leasename:Not ReportedWellnumber:7Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210531

Z123
NE
OIL_GAS
CAOG11000210327
1/4 - 1/2 Mile

District nun: 1 Api number: 03714641
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 14

Epawell: N Hydraulica: N

Epaweii: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210327

T124
NE OIL_GAS CAOG11000210319
1/4 - 1/2 Mile

District nun: 1 Api number: 03714633
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Gilmore Oil Company

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:6Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210319

125 WSW OIL_GAS CAOG11000210721 1/4 - 1/2 Mile

District nun: 1 Api number: 03715150
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname:

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

hud

Not Reported

Leasename:Not ReportedWellnumber:65Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Gissourcec:

Comments:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210721

126
ESE OIL_GAS CAOG11000210793

District nun: 1 Api number: 03715222
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Leasename: Salt Lake Wellnumber: 61

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG
Site id: CAOG11000210793

Map ID Direction Distance

Database **EDR ID Number**

X127 ESE 1/4 - 1/2 Mile

OIL_GAS CAOG11000210756

District nun: 1 Api number: 03715185 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 10 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0 Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown POG Gissymbol:

Site id: CAOG11000210756

X128

OIL_GAS CAOG11000210778 1/4 - 1/2 Mile

03715207 Api number: District nun: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: Chevron U.S.A. Inc.

Los Angeles Fieldname: Salt Lake County name: Any Area Area name: Section: 21 01S 14W Township: Range:

Not Reported Base meridian: SB Elevation: Locationde: Not Reported

Gissourcec: hud

Not Reported Comments: Wellnumber: 32 Leasename: Salt Lake

Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG CAOG11000210778 Site id:

AA129 ENE 1/4 - 1/2 Mile OIL_GAS CAOG11000210533

District nun: 03714917 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments: Leasename: Not Reported

Wellnumber: 9 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Gissymbol: POG Directiona: Unknown

CAOG11000210533 Site id:

W130 CAOG11000210547 East OIL_GAS 1/4 - 1/2 Mile

Spuddate:

Not Reported

03714931 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Not Reported Wellnumber: 23 Leasename: Epawell: Ν Hydraulica: Ν

Not Reported Confidenti: Ν Spuddate:

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210547

Z131 OIL GAS CAOG11000210320 1/4 - 1/2 Mile

District nun: Api number: 03714634 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Gilmore Oil Company Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Not Reported Base meridian: Elevation:

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 7
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210320

AB132
ESE OIL_GAS CAOG11000210356
1/4 - 1/2 Mile

District nun: 1 Api number: 03714681
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 411
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/4 - 1/2 Mile

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210356

X133 SE OIL_GAS CAOG11000210354

District nun: 1 Api number: 03714679
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:409Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210354

Map ID Direction

Distance Database EDR ID Number

AB134
ESE OIL_GAS CAOG11000210761
1/4 - 1/2 Mile

District nun: 1 Api number: 03715190
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:15Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210761

AA135
ENE OIL_GAS CAOG11000210534
1/4 - 1/2 Mile

District nun: 1 Api number: 03714918
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 10 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210534

136
WNW OIL_GAS CAOG11000210366
1/2 - 1 Mile

District nun: 03714691 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Utah California Consolidated Co. Operator name:

Los Angeles County name: Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments: Leasename: Not Reported

Wellnumber: 1 Epawell: Ν Hydraulica: Ν Spuddate: Not Reported

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210366 Site id:

AB137 ESE CAOG11000210763 OIL_GAS 1/2 - 1 Mile

03715192 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Salt Lake Wellnumber: 17 Leasename: Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210763

Z138 OIL GAS CAOG11000210321

District nun: Api number: 03714635 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Gilmore Oil Company Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Not Reported Comments:

Leasename: Not Reported Wellnumber: 8 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

0 Welldeptha: Redrillfoo: 0

Not Reported Abandonedd: Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210321 Site id:

AB139

South

Gissourcec:

SE 1/2 - 1 Mile OIL_GAS CAOG11000210760

District nun: Api number: 03715189 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Operator name: Chevron U.S.A. Inc. County name: Los Angeles Fieldname: Salt Lake

Area name: Any Area Section: 21 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation: Locationde:

Not Reported Gissourcec: hud

Not Reported Comments: Wellnumber: 14 Leasename: Salt Lake

Epawell: N Hydraulica: N

Confidenti: Spuddate: Not Reported Ν Welldeptha: 0

Redrillfoo: 0

Not Reported Completion: Not Reported Abandonedd: Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210760

140

OIL_GAS

CAOG11000210586

1/2 - 1 Mile 03714970 District nun: Api number: 1

Blm well: Ν Redrill can: Not Reported Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake, South

Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Comments: Not Reported Not Reported Wellnumber: 10 Leasename:

hud

Epawell: Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG CAOG11000210586 Site id:

TC4930273.2s Page A-74

Map ID Direction Distance

Distance Database EDR ID Number

AC141
NE
OIL_GAS
CAOG11000210539
1/2 - 1 Mile

District nun: 1 Api number: 03714923
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Leasename:Not ReportedWellnumber:15Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210539

142
West OIL_GAS CAOG11000210722

District nun: 1 Api number: 03715151
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 20 01S 14W Township: Range: Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:82Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210722

AB143
SE OIL_GAS CAOG11000210747
1/2 - 1 Mile

District nun: 1 Api number: 03715176
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

Los Angeles County name: Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: Not Reported hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 1
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210747

AD144
East OIL_GAS CAOG11000210772
1/2 - 1 Mile

District nun: 1 Api number: 03715201
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Salt Lake Wellnumber: 26
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210772

AE145
ESE OIL_GAS CAOG11000210751
1/2 - 1 Mile

District nun: 1 Api number: 03715180
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Spuddate:

Not Reported

Comments: Not Reported

Leasename:Salt LakeWellnumber:5Epawell:NHydraulica:N

Confidenti: N Welldeptha: 0

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210751

146
WSW OIL_GAS CAOG11000210723
1/2 - 1 Mile

District nun: 1 Api number: 03715152

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 84
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: PWF

Site id: CAOG11000210723

AB147 SE OIL_GAS CAOG11000210516

District nun: 1 Api number: 03714899
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported
Leasename: Salt Lake Wellnumber: 405

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210516

Map ID Direction Distance

Distance Database EDR ID Number

AD148
East OIL_GAS CAOG11000210525
1/2 - 1 Mile

District nun: 1 Api number: 03714909
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 1

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210525

AD149
East OIL_GAS CAOG11000210526
1/2 - 1 Mile

District nun: 1 Api number: 03714910
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 2
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210526

AF150
East OIL_GAS CAOG11000210537
1/2 - 1 Mile

District nun: 1 Api number: 03714921
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Leasename:Not ReportedWellnumber:13Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210537

AC151 NE OIL_GAS CAOG11000210541 1/2 - 1 Mile

District nun: 1 Api number: 03714925

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: A

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Comments: Not

Comments: Not Reported

Leasename: Not Reported Wellnumber: 17

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210541

AF152
East OIL_GAS CAOG11000210536
1/2 - 1 Mile

District nun: 1 Api number: 03714920
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename: Not Reported Wellnumber: 12 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210536

AG153

1/2 - 1 Mile

SE OIL_GAS CAOG11000210353 1/2 - 1 Mile

District nun: 1 Api number: 03714678
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 408
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210353

AH154
ENE OIL_GAS CAOG11000210535

District nun: 1 Api number: 03714919
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:11Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210535

Map ID Direction Distance

Distance Database EDR ID Number

AE155 ESE 1/2 - 1 Mile

ESE OIL_GAS CAOG11000210764

District nun: 1 Api number: 03715193
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:18Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210764

Al156
ESE OIL_GAS CAOG11000210748

District nun: 1 Api number: 03715177
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:2Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210748

157
SSW OIL_GAS CAOG11000210715
1/2 - 1 Mile

District nun: 03715144 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 20 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments: Leasename: Not Reported

Wellnumber: 49 Epawell: Ν Hydraulica: Ν Not Reported

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210715 Site id:

AC158 NE CAOG11000210543 OIL_GAS

Spuddate:

03714927 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Not Reported

Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Not Reported Wellnumber: Leasename: 19 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Not Reported Completion: POG

Directiona: Unknown Gissymbol: Site id: CAOG11000210543

AH159 ENE 1/2 - 1 Mile OIL GAS CAOG11000210538

District nun: Api number: 03714922 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename: Not Reported Wellnumber: 14
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210538

AG160

SE OIL_GAS CAOG11000210754 1/2 - 1 Mile

District nun: 1 Api number: 03715183
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported
Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:8Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210754

Al161
ESE OIL_GAS CAOG11000210352
1/2 - 1 Mile

District nun: 1 Api number: 03714677
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

hud

Comments: Not Reported
Leasename: Salt Lake Wellnumber: 407

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210352

Map ID Direction Distance

Distance Database EDR ID Number

AJ162 NE 1/2 - 1 Mile

NE OIL_GAS CAOG11000210665

District nun: 1 Api number: 03715085
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 27
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210665

AF163
East OIL_GAS CAOG11000210552
1/2 - 1 Mile

District nun: 1 Api number: 03714936
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Clark Wellnumber: 105 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210552

AK164
NW OIL_GAS CAOG11000210519
1/2 - 1 Mile

District nun: 03714903 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

James F. Ross Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments: Leasename: Not Reported

Epawell: Ν Hydraulica: Ν Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

AOG Directiona: Unknown Gissymbol:

CAOG11000210519 Site id:

AD165 CAOG11000210551 OIL_GAS East 1/2 - 1 Mile

Wellnumber:

82

03714935 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Wellnumber: 104 Leasename: Clark Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported POG Unknown

Directiona: Gissymbol: Site id: CAOG11000210551

AF166 OIL GAS CAOG11000210554 East

District nun: Api number: 03714938 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Not Reported Base meridian: Elevation:

Locationde: Not Reported

Not Reported Comments:

Leasename: Clark Wellnumber: 107 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

0 Welldeptha: Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210554

AG167

SE 1/2 - 1 Mile OIL_GAS CAOG11000210752

District nun: Api number: 03715181 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Operator name: Chevron U.S.A. Inc. County name: Los Angeles Fieldname:

Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Not Reported Locationde: Gissourcec: hud

Not Reported Comments: 6

Wellnumber: Leasename: Salt Lake Epawell: N Hydraulica: Ν

Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0 Redrillfoo: 0

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol:

CAOG11000210752

168 WSW

Site id:

Site id:

OIL_GAS CAOG11000210724 1/2 - 1 Mile

District nun: Api number: 03715153 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status: Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde: Gissourcec: hud

Comments: Not Reported

Not Reported Wellnumber: 86 Leasename: Epawell: Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210724

Map ID Direction Distance

Distance Database EDR ID Number

AG169 SE 1/2 - 1 Mile

District nun: 1 Api number: 03714900
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:401Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210517

AL170
ENE OIL_GAS CAOG11000210540
1/2 - 1 Mile

District nun: 1 Api number: 03714924
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

Not Reported

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Leasename: Not Reported Wellnumber: 16

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Comments:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210540

AC171
NE OIL_GAS CAOG11000210545
1/2 - 1 Mile

OIL_GAS

CAOG11000210517

District nun: 1 Api number: 03714929
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Leasename:Not ReportedWellnumber:21Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210545

AM172
West OIL_GAS CAOG11000210725
1/2 - 1 Mile

District nun: 1 Api number: 03715154
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not F

Comments: Not Reported
Leasename: Not Reported Wellnumber: 99
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210725

AH173
ENE OIL_GAS CAOG11000210557
1/2 - 1 Mile

District nun: 1 Api number: 03714941
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Not Reported Comments:

Leasename: Clark Wellnumber: 110 Epawell: Ν Hydraulica:

Confidenti: Not Reported Ν Spuddate:

0 Welldeptha: Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210557

AE174 ESE 1/2 - 1 Mile OIL_GAS CAOG11000210749

District nun: Api number: 03715178 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range: Not Reported Base meridian: SB Elevation:

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Wellnumber: 3 Leasename: Salt Lake Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210749

AE175 ESE OIL_GAS CAOG11000210792 1/2 - 1 Mile

District nun: Api number: 03715221 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc. County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 54 Leasename: Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210792 Site id:

Map ID Direction Distance

Distance Database EDR ID Number

AK176 NW 1/2 - 1 Mile

OIL_GAS CAOG11000210336

District nun: 1 Api number: 03714650

Blm well: N Redrill can: Not Reported

Dryhole: N Well status:

Operator name: Gilmore Oil Company

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:17Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:83Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210336

Al177
ESE OIL_GAS CAOG11000210750

 1/2 - 1 Mile

 District nun:
 1
 Api number:
 03715179

 Blm well:
 N
 Redrill can:
 Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:4Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210750

AG178

SE OIL_GAS CAOG11000210351 1/2 - 1 Mile

District nun: 03714676 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments: Leasename: Salt Lake

Epawell: Ν Hydraulica: Ν Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210351 Site id:

AH179 ENE CAOG11000210565 OIL_GAS 1/2 - 1 Mile

Wellnumber:

406

03714949 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Comments:

Not Reported Wellnumber: 118 Leasename: Clark Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG

Directiona: Unknown Gissymbol: Site id: CAOG11000210565

AF180 OIL GAS CAOG11000210555 East 1/2 - 1 Mile

District nun: Api number: 03714939 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename:ClarkWellnumber:108Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210555

AL181
ENE OIL_GAS CAOG11000210542
1/2 - 1 Mile

District nun: 1 Api number: 03714926
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 18
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210542

AN182 NE OIL_GAS CAOG11000210546

District nun: 1 Api number: 03714930
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:22Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210546

Map ID Direction Distance

Database EDR ID Number

AO183 East 1/2 - 1 Mile OIL_GAS CAOG11000210553

District nun: 1 Api number: 03714937 Blm well: Ν Redrill can: Not Reported

Well status: Dryhole: Ν

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud

Comments: Not Reported Clark Wellnumber: Leasename:

106 Epawell: Hydraulica: Ν N

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo:

1/2 - 1 Mile

Not Reported Abandonedd: Not Reported Completion:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210553

AO184 OIL_GAS CAOG11000210550 East

District nun: Api number: 03714934 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status:

Operator name: Southern California Edison Co.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Wellnumber: 103 Leasename: Clark Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown Gissymbol: AOG

CAOG11000210550 Site id:

AM185 WNW 1/2 - 1 Mile OIL_GAS CAOG11000210308

District nun: 03714622 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Garbutt Oil Co. (A. M. Stephens Co.) Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Not Reported Wellnumber: 6 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Welldeptha: 0 Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

CAOG11000210308 Site id:

0

AJ186 NE CAOG11000210670 OIL_GAS 1/2 - 1 Mile

Spuddate:

Not Reported

03715090 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 16 14W 01S Township: Range:

Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Not Reported Wellnumber: 32 Leasename: Epawell: Ν Hydraulica: Ν

Spuddate: Not Reported Confidenti: Ν

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210670

AI187 ESE 1/2 - 1 Mile OIL GAS CAOG11000210765

District nun: Api number: 03715194 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 19 Epawell: Ν Hydraulica:

Confidenti: Not Reported Ν Spuddate:

0 Welldeptha: Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210765

AL188 ENE 1/2 - 1 Mile OIL_GAS CAOG11000210566

District nun: Api number: 03714950 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Wellnumber: 119 Leasename: Clark Epawell: Ν Hydraulica: N

Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210566

AP189 OIL_GAS CAOG11000216606 West

District nun: Api number: 03726469 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: unk Comments: Not Reported

Wellnumber: 103 Leasename: New Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

CAOG11000216606 Site id:

Map ID Direction

Distance Database EDR ID Number

AP190
West OIL_GAS CAOG11000210727
1/2 - 1 Mile

District nun: 1 Api number: 03715156
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:102Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210727

191
South OIL_GAS CAOG11000205260
1/2 - 1 Mile

District nun: 1 Api number: 03706336
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 29
Township: 01S Range: 14W

Base meridian:

SB

Range:

144W

Reported

Not Reported

Locationde: Not Reported
Gissourcec: hud

Comments: Not Reported

Leasename: Seibu Corehole Wellnumber: 1

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: PDH Site id: CAOG11000205260

AP192
West OIL_GAS CAOG11000210728
1/2 - 1 Mile

District nun: 03715157 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status: В

Operator name: Chevron U.S.A. Inc.

Los Angeles County name: Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W SB

Base meridian: Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud Comments:

Not Reported Leasename: Not Reported Wellnumber: Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Gissymbol: AOG Directiona: Unknown

CAOG11000210728 Site id:

AQ193 West 1/2 - 1 Mile CAOG11000210726 OIL_GAS

103

03715155 District nun: Api number: Blm well: Ν Redrill can: Not Reported

Dryhole: N Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 01S 14W Township: Range:

Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud

Not Reported Comments: Not Reported Wellnumber: 101 Leasename: Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210726

AR194 ESE 1/2 - 1 Mile OIL GAS CAOG11000210358

District nun: Api number: 03714683 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: В

Chevron U.S.A. Inc. Operator name: Salt Lake County name: Los Angeles Fieldname:

Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Not Reported Base meridian: Elevation:

Locationde: Not Reported

Comments: Not Reported

Leasename:Salt LakeWellnumber:415Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210358

AS195

SE OIL_GAS CAOG11000210758 1/2 - 1 Mile

District nun: 1 Api number: 03715187
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14WBase meridian:SBElevation:Not Reported

Base meridian: SB Elevation: Not Report Locationde: Not Reported

Gissourcec: Not Reported

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 12 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210758

AT196
SSE OIL_GAS CAOG11000210371

District nun: 1 Api number: 03714696
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Wilshire Oil Producers Co.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 28
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 2
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210371

Map ID Direction Distance

1/2 - 1 Mile

Distance Database EDR ID Number

AN197
NE OIL_GAS CAOG11000210544
1/2 - 1 Mile

District nun: 1 Api number: 03714928
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14WBase meridian:SBElevation:Not Reported

Base meridian: SB Elevation:
Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:20Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210544

AJ198
NE OIL_GAS CAOG11000210707

District nun: 1 Api number: 03715127
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 69
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210707

AR199
SE OIL_GAS CAOG11000210514
1/2 - 1 Mile

District nun: 03714897 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde: Gissourcec: hud

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 403 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210514

Site id:

AS200 SE CAOG11000210513 OIL_GAS 1/2 - 1 Mile

03714896 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Salt Lake Wellnumber: 402 Leasename: Epawell: Ν Hydraulica: Ν

Spuddate: Confidenti: Ν Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: **POG**

Site id: CAOG11000210513

AU201

OIL GAS CAOG11000210559 East 1/2 - 1 Mile

District nun: Api number: 03714943 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Not Reported Locationde:

Comments: Not Reported

Leasename:ClarkWellnumber:112Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210559

AP202 WSW OIL_GAS CAOG11000210729 1/2 - 1 Mile

District nun: 1 Api number: 03715158
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 104
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Gissourcec:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210729

AV203
East OIL_GAS CAOG11000210774

District nun: 1 Api number: 03715203
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:28Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG
Site id: CAOG11000210774

Map ID Direction Distance

Distance Database EDR ID Number

AN204
NE OIL_GAS CAOG11000210675
1/2 - 1 Mile

District nun: 1 Api number: 03715095
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 37
Epawell: N Hydraulica: N

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210675

AR205
ESE OIL_GAS CAOG11000210757

District nun: 1 Api number: 03715186
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 11 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210757

AU206
ENE OIL_GAS CAOG11000210567
1/2 - 1 Mile

District nun: 03714951 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Clark Wellnumber: 120 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210567 Site id:

AO207 CAOG11000210549 OIL_GAS East 1/2 - 1 Mile

03714933 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Not Reported

Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Wellnumber: 102 Leasename: Clark Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: Site id: CAOG11000210549

AM208 West 1/2 - 1 Mile OIL GAS CAOG11000210734

District nun: Api number: 03715163 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Not Reported Comments:

Leasename: Not Reported Wellnumber: 117 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

0 Welldeptha: Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210734

AW209 ENE 1/2 - 1 Mile OIL_GAS CAOG11000210568

District nun: Api number: 03714952 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: hud Comments: Not Reported

Wellnumber: 121 Leasename: Clark Epawell: Ν Hydraulica: N

Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210568

AO210 OIL_GAS CAOG11000210570 East

03714954 District nun: Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range: Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Comments: Not Reported

Wellnumber: 123 Leasename: Clark Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

CAOG11000210570 Site id:

Map ID Direction Distance

Distance Database EDR ID Number

211
North
OIL_GAS CAOG11000204851
1/2 - 1 Mile

District nun: 1 Api number: 03705693
Blm well: N Redrill can: Not Reported

Dryhole: Y Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Any FieldArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Fairfax High School CoreholeWellnumber:1Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: PDH

Site id: CAOG11000204851

AR212
ESE OIL_GAS CAOG11000210755
1/2 - 1 Mile

District nun: 1 Api number: 03715184
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Salt Lake Wellnumber: 9
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210755

213
NE
OIL_GAS
CAOG11000210705
1/2 - 1 Mile

District nun: 03715125 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 16 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments: Leasename: Not Reported

Wellnumber: 67 Epawell: Ν Hydraulica: Ν Spuddate: Not Reported

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

AP214 West CAOG11000210731 OIL_GAS 1/2 - 1 Mile

03715160 District nun: Api number: Blm well: Ν Redrill can: Not Reported

Dryhole: N Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 01S 14W Township: Range: Not Reported

Base meridian: SB Elevation:

CAOG11000210705

Locationde: Not Reported

Gissourcec: hud Comments:

Not Reported Not Reported Wellnumber: 114 Leasename: Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210731

AQ215 West 1/2 - 1 Mile OIL GAS CAOG11000210732

District nun: Api number: 03715161 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Spuddate:

Comments: Not Reported

Leasename: Not Reported Wellnumber: 115 Epawell: Ν Hydraulica: Not Reported

Confidenti: Ν 0 Welldeptha:

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210732

AT216 SSE 1/2 - 1 Mile OIL_GAS CAOG11000210370

District nun: Api number: 03714695 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole:

Operator name: Wilshire Oil Producers Co.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 28 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Locationde: Not Reported Gissourcec:

hud Not Reported Comments:

Not Reported Wellnumber: Leasename:

Epawell: Ν Hydraulica: Ν Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Not Reported Completion: Not Reported Abandonedd:

PDH Directiona: Unknown Gissymbol:

Site id: CAOG11000210370

AX217 SE OIL_GAS CAOG11000210753

Api number: 03715182 District nun: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde: Gissourcec: hud

Comments: Not Reported

Salt Lake Wellnumber: 7 Leasename: Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

CAOG11000210753 Site id:

Map ID Direction Distance

istance Database EDR ID Number

AY218
WNW OIL_GAS CAOG11000210307
1/2 - 1 Mile

District nun: 1 Api number: 03714621
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:5Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210307

AW219
ENE OIL_GAS CAOG11000210569

District nun: 1 Api number: 03714953
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Clark Wellnumber: 122 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210569

AQ220
West OIL_GAS CAOG11000210733
1/2 - 1 Mile

District nun: 1 Api number: 03715162
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: Not Reported hud

Comments: Not Reported

Site id:

Leasename: Not Reported Wellnumber: 116
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210733

AZ221
NE OIL_GAS CAOG11000210572
1/2 - 1 Mile

District nun: 1 Api number: 03714956
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Yavneh Corehole Wellnumber: 1
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210572

AZ222
NE OIL_GAS CAOG11000210686
1/2 - 1 Mile

District nun: 1 Api number: 03715106
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 16
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename:Not ReportedWellnumber:48Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210686

BA223
East OIL_GAS CAOG11000210556
1/2 - 1 Mile

District nun: 1 Api number: 03714940
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Clark Wellnumber: 109
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210556

224
ESE OIL_GAS CAOG11000210766

District nun: 1 Api number: 03715195
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:20Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Map ID Direction Distance

Distance Database EDR ID Number

AX225 SE 1/2 - 1 Mile

SE OIL_GAS CAOG11000210515

District nun: 1 Api number: 03714898
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:404Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210515

AU226
East OIL_GAS CAOG11000210558
1/2 - 1 Mile

District nun: 1 Api number: 03714942
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

Not Reported

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Leasename: Clark Wellnumber: 111
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Comments:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210558

AV227
East OIL_GAS CAOG11000210548
1/2 - 1 Mile

District nun: 1 Api number: 03714932
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:ClarkWellnumber:101Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210548

AU228
East OIL_GAS CAOG11000210560
1/2 - 1 Mile

District nun: 1 Api number: 03714944
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Clark Wellnumber: 113
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210560

AX229
ESE OIL_GAS CAOG11000210759
1/2 - 1 Mile

District nun: 1 Api number: 03715188
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 13 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

0 Welldeptha: Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210759

AW230 ENE 1/2 - 1 Mile OIL_GAS CAOG11000210561

District nun: Api number: 03714945 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Wellnumber: 114 Leasename: Clark Epawell: Ν Hydraulica: N

Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210561

AY231 West OIL_GAS CAOG11000210735

District nun: Api number: 03715164 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Not Reported Wellnumber: Leasename: Epawell: Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210735 Site id:

118

Map ID Direction

1/2 - 1 Mile

Distance Database EDR ID Number

BB232
ESE OIL_GAS CAOG11000210790
1/2 - 1 Mile

District nun: 1 Api number: 03715219
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:50Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210790

AW233
ENE OIL_GAS CAOG11000210562

District nun: 1 Api number: 03714946
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Clark Wellnumber: 115 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210562

234
WNW OIL_GAS CAOG11000210313
1/2 - 1 Mile

District nun: 1 Api number: 03714627
Blm well: N Redrill can: Not Reported

Dryhole: N Well status:

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 12 Epawell: N Hydraulica: N

Confidenti: N Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210313

BA235
East OIL_GAS CAOG11000210640
1/2 - 1 Mile

Spuddate:

Not Reported

District nun: 1 Api number: 03715060
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 2
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210640

236
SSE OIL_GAS CAOG11000210369
1/2 - 1 Mile

District nun: 1 Api number: 03714694
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Utah California Consolidated Co.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 28
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Spuddate:

Not Reported

Comments: Not Reported

Leasename:Not ReportedWellnumber:101Epawell:NHydraulica:N

Confidenti: N Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210369

BA237
East OIL_GAS CAOG11000210641
1/2 - 1 Mile

District nun: 1 Api number: 03715061
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 3
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210641

BC238
East OIL_GAS CAOG11000210642

District nun: 1 Api number: 03715062
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:4Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Map ID Direction

Distance Database EDR ID Number

BD239
West OIL_GAS CAOG11000210737
1/2 - 1 Mile

District nun: 1 Api number: 03715166
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:121Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210737

BD240
West OIL_GAS CAOG11000210736
1/2 - 1 Mile

District nun: 1 Api number: 03715165
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Leasename: Not Reported Wellnumber: 120

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Comments:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210736

Not Reported

241 SW OIL_GAS CAOG11000205317 1/2 - 1 Mile

District nun: 03706478 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 20 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud Not Reported Comments:

Leasename: **Tower Corehole**

Wellnumber: 1 Epawell: Hydraulica: Ν Spuddate: Not Reported

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

PDH Directiona: Unknown Gissymbol:

CAOG11000205317

BC242 CAOG11000210643 OIL_GAS East 1/2 - 1 Mile

03715063 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range:

Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Not Reported Wellnumber: Leasename: 5 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210643

AZ243 ENE 1/2 - 1 Mile OIL GAS CAOG11000210689

District nun: Api number: 03715109 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 16 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename:Not ReportedWellnumber:51Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210689

BE244
ENE OIL_GAS CAOG11000210563
1/2 - 1 Mile

District nun: 1 Api number: 03714947
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Southern California Edison Co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Clark Wellnumber: 116
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210563

245
WSW OIL_GAS CAOG11000210730

District nun: 1 Api number: 03715159
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 20 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 108
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Map ID Direction

Site id:

Distance Database EDR ID Number

BB246 OIL_GAS CAOG11000210791 **ESE** 1/2 - 1 Mile

District nun: 1 Api number: 03715220 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 51 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0 Abandonedd: Not Reported Completion:

CAOG11000210791

Not Reported Directiona: POG Unknown Gissymbol:

BF247 ENE OIL_GAS CAOG11000210644 1/2 - 1 Mile

Api number: 03715064 District nun: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: Rancho La Brea Oil co.

Los Angeles Salt Lake County name: Fieldname: Any Area Section: Area name: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Not Reported Comments: Wellnumber: Leasename: Not Reported

6 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

CAOG11000210644 Site id:

AY248 WNW 1/2 - 1 Mile OIL_GAS CAOG11000210305

District nun: 03714619 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Garbutt Oil Co. (A. M. Stephens Co.) Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Not Reported Wellnumber: 3 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210305 Site id:

BE249 CAOG11000210564 OIL_GAS ENE 1/2 - 1 Mile

Spuddate:

Not Reported

03714948 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Southern California Edison Co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Wellnumber: Leasename: Clark 117 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210564

BE250 ENE 1/2 - 1 Mile OIL GAS CAOG11000210647

District nun: Api number: 03715067 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename: Not Reported Wellnumber: 9
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210647

251
NE
OIL_GAS
CAOG11000210706
1/2 - 1 Mile

District nun: 1 Api number: 03715126
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:68Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210706

BC252
East OIL_GAS CAOG11000210639

District nun: 1 Api number: 03715059
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported
Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber: 1

Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Map ID Direction

Site id:

Distance Database EDR ID Number

BD253
West OIL_GAS CAOG11000210741
1/2 - 1 Mile

District nun: 1 Api number: 03715170

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:136Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

BG254
West OIL_GAS CAOG11000210738
1/2 - 1 Mile

District nun: 1 Api number: 03715167
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

CAOG11000210741

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: Not Reported

Comments: Not Reported

Leasename: Not Reported Wellnumber: 130

Enawell: Hydraulica: N

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210738

BH255
ENE OIL_GAS CAOG11000210688
1/2 - 1 Mile

District nun: 1 Api number: 03715108
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Rancho La Brea Oil co.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 15 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Not Reported

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210688

BF256
ENE OIL_GAS CAOG11000210677
1/2 - 1 Mile

Elevation:

Wellnumber:

50

Not Reported

District nun: 1 Api number: 03715097
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 39
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210677

257
WSW OIL_GAS CAOG11000210251
1/2 - 1 Mile

District nun: 1 Api number: 03714549
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: B

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename:RodeoWellnumber:1Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210251

BE258
ENE OIL_GAS CAOG11000210678
1/2 - 1 Mile

District nun: 1 Api number: 03715098
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 40 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210678

BI259
WNW OIL_GAS CAOG11000210312

District nun: 1 Api number: 03714626
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud Comments: Not Reported

Leasename: Not Reported Wellnumber: 11 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Map ID Direction

Distance Database EDR ID Number

BJ260 East 1/2 - 1 Mile OIL_GAS CAOG11000210656

District nun: 1 Api number: 03715076 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Not Reported Wellnumber: 18 Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown POG Gissymbol:

Site id: CAOG11000210656

BG261 West 1/2 - 1 Mile OIL_GAS CAOG11000210739

03715168 District nun: Api number: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: Chevron U.S.A. Inc.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 20 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Not Reported Comments: Wellnumber: Leasename: Not Reported

131 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0 Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG CAOG11000210739 Site id:

BC262 East 1/2 - 1 Mile OIL_GAS CAOG11000210650

District nun: 03715070 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

Leasename: Not Reported Wellnumber: 12 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Gissymbol: POG Directiona: Unknown CAOG11000210650

BK263 CAOG11000210649 OIL_GAS East 1/2 - 1 Mile

03715069 District nun: Api number: Blm well: Ν Redrill can: Not Reported

Dryhole: N Well status:

Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range: Base meridian: Not Reported SB

Elevation: Locationde: Not Reported

Gissourcec: hud

Not Reported Comments:

Not Reported Wellnumber: Leasename: 11 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 0 Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210649

BH264 ENE 1/2 - 1 Mile OIL GAS CAOG11000210687

District nun: Api number: 03715107 1

Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ Rancho La Brea Oil co. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename: Not Reported Wellnumber: 49
Epawell: N Hydraulica: N

Confidenti: N Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210687

265
South OIL_GAS CAOG11000210372
1/2 - 1 Mile

Spuddate:

Not Reported

District nun: 1 Api number: 03714697
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Wilshire Oil Producers Co.
County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 28
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 3
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210372

BF266
ENE OIL_GAS CAOG11000210646

District nun: 1 Api number: 03715066

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 8
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Map ID Direction

Site id:

Distance Database EDR ID Number

BH267
ENE OIL_GAS CAOG11000210691
1/2 - 1 Mile

District nun: 1 Api number: 03715111

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 53
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210691

BL268
ENE OIL_GAS CAOG11000210645
1/2 - 1 Mile

District nun: 1 Api number: 03715065

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber: 7

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210645

BM269
WNW OIL_GAS CAOG11000210304
1/2 - 1 Mile

District nun: 1 Api number: 03714618
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: A

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 2
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210304

BI270
WNW OIL_GAS CAOG11000210303
1/2 - 1 Mile

District nun: 1 Api number: 03714617
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 1
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: APM

Site id: CAOG11000210303

BJ271
East OIL_GAS CAOG11000210807
1/2 - 1 Mile

District nun: 1 Api number: 03715236
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 235 Epawell: Ν Hydraulica: Not Reported Spuddate:

Confidenti: Ν 0 Welldeptha:

Redrillfoo: 0

BJ273

Gissourcec:

Redrillfoo:

East

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210807 Site id:

BJ272 East 1/2 - 1 Mile OIL_GAS CAOG11000210804

District nun: Api number: 03715233 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Operator name: Chevron U.S.A. Inc. County name: Los Angeles Fieldname:

Salt Lake Area name: Any Area Section: 21 14W Township: 01S Range: Not Reported Base meridian: SB Elevation:

Not Reported Locationde:

Gissourcec: hud Not Reported Comments:

Wellnumber: 217 Leasename: Salt Lake Epawell: N Hydraulica: N

Confidenti: Spuddate: Not Reported Ν

Welldeptha: 0 Redrillfoo: 0

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol: Site id: CAOG11000210804

1/2 - 1 Mile District nun: Api number: 03715244 1

Blm well: Ν Redrill can: Not Reported

Dryhole: Well status: Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Comments: Not Reported Salt Lake Wellnumber: 252 Leasename:

hud

0

Epawell: Ν Hydraulica: Ν

Confidenti: Spuddate: Not Reported Welldeptha: 0

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210815 Site id:

OIL_GAS

CAOG11000210815

Map ID Direction Distance

Site id:

Gissourcec:

Distance Database EDR ID Number

BN274
NE OIL_GAS CAOG11000210704
1/2 - 1 Mile

District nun: 1 Api number: 03715124
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Not ReportedWellnumber:66Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

BO275
East OIL_GAS CAOG11000210802
1/2 - 1 Mile

District nun: 1 Api number: 03715231

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

hud

CAOG11000210704

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename:Salt LakeWellnumber:200Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210802

276
SSE
OIL_GAS CAOG11000210368
1/2 - 1 Mile

District nun: 1 Api number: 03714693
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: Utah California Consolidated Co.

County name: Los Angeles Fieldname: Salt Lake, South

Area name: Any Area Section: 28
Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Lease aname:Lease 2Wellnumber:3Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210368

BK277
East OIL_GAS CAOG11000210468
1/2 - 1 Mile

District nun: 1 Api number: 03714851
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Salt Lake Wellnumber: 270 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG Site id: CAOG11000210468

276 ESE OIL_GAS CAOG11000210768 1/2 - 1 Mile

District nun: 1 Api number: 03715197
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: B

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename:Salt LakeWellnumber:22Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210768

BL279
ENE OIL_GAS CAOG11000210648
1/2 - 1 Mile

District nun: 1 Api number: 03715068
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 10 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210648

BP280
ENE OIL_GAS CAOG11000210692

District nun: 1 Api number: 03715112

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported
Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 54
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Map ID Direction

Site id:

Distance Database EDR ID Number

BK281
ENE OIL_GAS CAOG11000210476
1/2 - 1 Mile

District nun: 1 Api number: 03714859
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename:Salt LakeWellnumber:287Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0
Abandonedd: Not Reported Completion: Not Reported

CAOG11000210476

Directiona: Unknown Gissymbol: POG

BP282
ENE OIL_GAS CAOG11000210693
1/2 - 1 Mile

District nun: 1 Api number: 03715113
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Rancho La Brea Oil co.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:16Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Not Reported Wellnumber: 55
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210693

BL283
ENE OIL_GAS CAOG11000210484
1/2 - 1 Mile

District nun: 1 Api number: 03714867
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Salt Lake

Epawell: N Hydraulica: N Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210484

BQ284
WNW OIL_GAS CAOG11000210311
1/2 - 1 Mile

Wellnumber:

305

10

Ν

District nun: 1 Api number: 03714625
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported
Leasename: Not Reported Wellnumber:
Epawell: N Hydraulica:

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210311

BM285
West OIL_GAS CAOG11000210740
1/2 - 1 Mile

District nun: 1 Api number: 03715169
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Gissourcec: unk

Spuddate:

Not Reported

Comments: Not Reported

Leasename:Not ReportedWellnumber:132Epawell:NHydraulica:N

Confidenti: N Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210740

286
ESE OIL_GAS CAOG11000210788
1/2 - 1 Mile

District nun: 1 Api number: 03715217

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 43
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210788

BO287
East OIL_GAS CAOG11000210805

District nun: 1 Api number: 03715234
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: B

Operator name:Chevron U.S.A. Inc.County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Salt Lake Wellnumber: 218
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Map ID Direction Distance

Database EDR ID Number

288 SE 1/2 - 1 Mile OIL_GAS CAOG11000210638

District nun: 1 Api number: 03715058 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status: В Ν

J. C. Pollock Operator name: Los Angeles County name: Fieldname: Any Field Area name: Any Area Section: 28 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Not Reported Wellnumber: Leasename: Epawell: Hydraulica: Ν Ν

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown AOG Gissymbol:

Site id: CAOG11000210638

BN289 OIL_GAS CAOG11000210708 NE 1/2 - 1 Mile

03715128 Api number: District nun: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: Rancho La Brea Oil co.

Los Angeles Salt Lake County name: Fieldname: Any Area Area name: Section: 15 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported Gissourcec: hud

Not Reported Comments: Wellnumber: 70 Leasename: Not Reported

Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0 Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG CAOG11000210708 Site id:

BL290 ENE 1/2 - 1 Mile OIL_GAS CAOG11000210493

District nun: 1 Api number: 03714876
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: F

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: Not Reported hud

Comments: Not Reported

Leasename:Salt LakeWellnumber:322Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210493

BP291
ENE OIL_GAS CAOG11000210501
1/2 - 1 Mile

District nun: 1 Api number: 03714884
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:15Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud
Comments: Not Reported

Leasename: Salt Lake Wellnumber: 340 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210501

BM292
WNW OIL_GAS CAOG11000215204
1/2 - 1 Mile

District nun: 1 Api number: 03723912
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Unknown Operator

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Comments: Not Reported

Leasename: Unknown Well Wellnumber: 1
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000215204

293
West OIL_GAS CAOG11000210742
1/2 - 1 Mile

District nun: 1 Api number: 03715171
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 14W Township: 01S Range: Not Reported Base meridian: SB Elevation:

Locationde: Not Reported Gissourcec: hud

Comments: Not Reported

Leasename: Not Reported Wellnumber: 137 Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210742

BR294
East OIL_GAS CAOG11000210806
1/2 - 1 Mile

District nun: 1 Api number: 03715235

Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.
County name: Los Angeles Fieldname: Salt Lake
Area name: Any Area Section: 21

Township: 01S Range: 14W
Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename: Salt Lake Wellnumber: 219
Epawell: N Hydraulica: N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Map ID Direction

Distance Database EDR ID Number

BS295 East 1/2 - 1 Mile

OIL_GAS CAOG11000210816

Api number:

District nun: 1 Blm well: Ν

Redrill can: Not Reported

03715245

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 254 Leasename: Epawell: Hydraulica: Ν N Spuddate: Not Reported

Confidenti: Ν Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210816

BT296 ENE

OIL_GAS CAOG11000210698 1/2 - 1 Mile

Spuddate:

03715118 District nun: Api number: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: Rancho La Brea Oil co.

Los Angeles Salt Lake County name: Fieldname: Any Area Section: Area name: 16 01S 14W Township: Range: Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Not Reported Comments:

Not Reported Wellnumber: 60 Leasename: Epawell: Ν Hydraulica:

Confidenti: Ν Welldeptha: 0

Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210698 Site id:

297 **ENE** 1/2 - 1 Mile

OIL_GAS CAOG11000210477

Not Reported

District nun: 1 Api number: 03714860
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 Township: 01S Range: 14W Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported Leasename: Salt Lake

Leasename:Salt LakeWellnumber:289Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210477

298
SSE OIL_GAS CAOG11000210365
1/2 - 1 Mile

District nun: 1 Api number: 03714690
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: B

Operator name: Union Oil Company of California

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 28 01S 14W Township: Range: Base meridian: Not Reported SB Elevation:

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:MasselinWellnumber:5Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported Welldeptha: 0

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210365

299
East OIL_GAS CAOG11000210786
1/2 - 1 Mile

District nun: 1 Api number: 03715215
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:21Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Not Reported Comments:

Leasename: Salt Lake Wellnumber: 41 Epawell: Ν Hydraulica: Ν

Confidenti: Not Reported Ν Spuddate:

0 Welldeptha: Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210786

BQ300 WNW 1/2 - 1 Mile OIL_GAS CAOG11000210306

District nun: Api number: 03714620 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation:

Locationde: Not Reported

Gissourcec: hud Not Reported Comments:

Not Reported Wellnumber: 4 Leasename: Epawell: Ν Hydraulica: Ν

Confidenti: Not Reported Ν Spuddate:

Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Not Reported Completion: Not Reported Abandonedd:

POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210306

BT301 OIL_GAS CAOG11000210703

District nun: Api number: 03715123 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Rancho La Brea Oil co.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 16 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Not Reported Leasename:

Wellnumber: 65 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0

Redrillfoo:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol:

CAOG11000210703 Site id:

Map ID Direction

Distance Database EDR ID Number

BU302 OIL_GAS CAOG11000210502 **ENE** 1/2 - 1 Mile

District nun: 1 Api number: 03714885 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 15 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 341 Leasename: Epawell: Hydraulica: Ν N

Confidenti: Ν Spuddate: Not Reported Welldeptha: 0

Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: POG Unknown Gissymbol: Site id: CAOG11000210502

BU303 OIL_GAS CAOG11000210701 **ENE** 1/2 - 1 Mile

03715121 Api number: District nun: 1 Ν Redrill can: Blm well: Not Reported

Dryhole: Ν Well status:

Operator name: Rancho La Brea Oil co.

Los Angeles Salt Lake County name: Fieldname: Any Area Section: Area name: 16 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Not Reported Comments: Not Reported Wellnumber: Leasename:

63 Epawell: Ν Hydraulica: Not Reported

Confidenti: Ν Spuddate: Welldeptha: 0

Redrillfoo: 0 Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: POG

CAOG11000210701 Site id:

BV304 WNW 1/2 - 1 Mile OIL_GAS CAOG11000210289

District nun: 03714603 Api number: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W Base meridian: SB Not Reported

Elevation:

Not Reported Locationde: Gissourcec: hud

Not Reported Comments:

Leasename: Beverly Wellnumber: 1 Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Site id:

Abandonedd: Not Reported Completion: Not Reported

POG Directiona: Unknown Gissymbol: CAOG11000210289

BU305 ENE 1/2 - 1 Mile CAOG11000210494 OIL_GAS

03714877 District nun: Api number: Ν Redrill can: Blm well: Not Reported

Dryhole: N Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 21 01S 14W Township: Range:

Base meridian: Not Reported SB Elevation: Locationde: Not Reported

Gissourcec: hud

Not Reported Comments:

Salt Lake Wellnumber: 324 Leasename: Epawell: Ν Hydraulica: Ν

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported POG Directiona: Unknown Gissymbol:

Site id: CAOG11000210494

BV306 West 1/2 - 1 Mile OIL GAS CAOG11000210743

District nun: Api number: 03715172 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status: Ρ Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 20 Township: 01S Range: 14W

SB Base meridian: Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Spuddate:

Not Reported Comments:

Leasename: Not Reported Wellnumber: 139 Epawell: Ν Hydraulica: Not Reported

Confidenti: Ν 0 Welldeptha: Redrillfoo: 0

Not Reported Abandonedd: Completion: Not Reported

Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210743

BR307 East 1/2 - 1 Mile OIL_GAS CAOG11000210808

District nun: Api number: 03715237 Redrill can: Blm well: Ν Not Reported

Well status: Dryhole: Ν

Operator name: Chevron U.S.A. Inc. County name: Los Angeles Fieldname: Salt Lake

Area name: Any Area Section: 22 14W Township: 01S Range:

Not Reported Base meridian: SB Elevation: Not Reported Locationde:

Gissourcec: hud

Not Reported Comments:

237 Wellnumber: Leasename: Salt Lake Epawell: N Hydraulica: N

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

1/2 - 1 Mile

Comments:

Not Reported Completion: Not Reported Abandonedd:

Directiona: POG Unknown Gissymbol:

Site id: CAOG11000210808

308 ESE OIL_GAS CAOG11000210789

Api number: 03715218 District nun: 1 Blm well: Ν Redrill can: Not Reported

Dryhole: Well status:

Operator name: Chevron U.S.A. Inc.

County name: Los Angeles Fieldname: Salt Lake Any Area Area name: Section: 21 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported

Not Reported Locationde: Gissourcec: hud

Salt Lake Wellnumber: 46 Leasename:

Not Reported

Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG CAOG11000210789 Site id:

Map ID Direction Distance

Database EDR ID Number

BS309 East 1/2 - 1 Mile OIL_GAS CAOG11000210469

District nun: 1 Api number: 03714852 Blm well: Ν Redrill can: Not Reported

Dryhole: Ν Well status:

Chevron U.S.A. Inc. Operator name:

County name: Los Angeles Fieldname: Salt Lake Area name: Any Area Section: 22 Township: 01S Range: 14W

Base meridian: SB Elevation: Not Reported Not Reported Locationde:

Gissourcec: hud Comments: Not Reported

Salt Lake Wellnumber: 272 Leasename: Epawell: Hydraulica: Ν N

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown POG Gissymbol:

Site id: CAOG11000210469

310 SE 1/2 - 1 Mile OIL_GAS CAOG11000210364

Api number: 03714689 District nun: 1 Ν Redrill can: Not Reported Blm well:

Dryhole: Well status:

Union Oil Company of California Operator name:

Los Angeles Any Field County name: Fieldname: Any Area Area name: Section: 28 01S 14W Township: Range:

Base meridian: SB Elevation: Not Reported Locationde: Not Reported

Gissourcec: hud

Not Reported Comments:

Wellnumber: Leasename: Masselin 4 Epawell: Ν Hydraulica:

Confidenti: Ν Spuddate: Not Reported

Welldeptha: 0 Redrillfoo: 0

Not Reported Abandonedd: Not Reported Completion:

Directiona: Unknown Gissymbol: AOG

CAOG11000210364 Site id:

311 WNW OIL_GAS CAOG11000210309 1/2 - 1 Mile

District nun: 1 Api number: 03714623
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: I

Operator name: Garbutt Oil Co. (A. M. Stephens Co.)

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:Not ReportedWellnumber:7Epawell:NHydraulica:NConfidenti:NSpuddate:Not Reported

Confidenti: N Welldeptha: 0

Redrillfoo: 0

1/2 - 1 Mile

Abandonedd: Not Reported Completion: Not Reported

Directiona: Unknown Gissymbol: AOG

Site id: CAOG11000210309

312 WNW OIL_GAS CAOG11000210291

District nun: 1 Api number: 03714605
Blm well: N Redrill can: Not Reported

Dryhole: N Well status: P

Operator name: Chevron U.S.A. Inc.

County name:Los AngelesFieldname:Salt LakeArea name:Any AreaSection:20Township:01SRange:14W

Base meridian: SB Elevation: Not Reported

Locationde: Not Reported

Gissourcec: hud

Comments: Not Reported

Leasename:BeverlyWellnumber:3Epawell:NHydraulica:N

Confidenti: N Spuddate: Not Reported

Welldeptha: 0
Redrillfoo: 0

Abandonedd: Not Reported Completion: Not Reported Directiona: Unknown Gissymbol: POG

Site id: CAOG11000210291

TC4930273.2s Page A-148

AREA RADON INFORMATION

State Database: CA Radon

Radon Test Results

Zipcode	Num Tests	> 4 pCi/L		
90036	48	1		

Federal EPA Radon Zone for LOS ANGELES County: 2

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for LOS ANGELES COUNTY, CA

Number of sites tested: 63

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor Living Area - 2nd Floor	0.711 pCi/L Not Reported	98% Not Reported	2% Not Reported	0% Not Reported
Basement	0.933 pCi/L	100%	0%	0%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory Source: Department of Fish & Game

Telephone: 916-445-0411

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Water Well Database

Source: Department of Water Resources

Telephone: 916-651-9648

California Drinking Water Quality Database Source: Department of Public Health

Telephone: 916-324-2319

The database includes all drinking water compliance and special studies monitoring for the state of California since 1984. It consists of over 3,200,000 individual analyses along with well and water system information.

OTHER STATE DATABASE INFORMATION

California Oil and Gas Well Locations Source: Department of Conservation

Telephone: 916-323-1779

Oil and Gas well locations in the state.

RADON

State Database: CA Radon

Source: Department of Health Services

Telephone: 916-324-2208 Radon Database for California

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency

(USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at

private sources such as universities and research institutions.

EPA Radon Zones Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor

radon levels.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

California Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary fault lines, prepared in 1975 by the United State Geological Survey. Additional information (also from 1975) regarding activity at specific fault lines comes from California's Preliminary Fault Activity Map prepared by the California Division of Mines and Geology.

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.


APPENDIX E

Supporting Documentation

CVS	UNIT 6360	SQUARE FEET	START	LEASE END 11/30/2019	\$79,000.00	RENT SQ. FOOT \$3.43	MONTHLY RENT SCHEDULE		OPTIONS	% RENT	SECURITY DEPOSIT
		23,040					12/1/2019 12/1/2024	\$90,833.33 \$105,666.67	2-5-YR 12/01/19 to 11/30/24 12/01/24 to 11/30/29	2%	None
WHOLE FOODS	6350	41,158	1/1/2002	2/28/2022	\$161,443.92	\$3.92	3/1/2022 3/1/2027 3/1/2032	\$177,588.31 \$195,347.14 \$214,881.86	3-5-YR 03/01/2022 to 02/28/2027 03/01/2027 to 02/28/2032 03/01/2032 to 02/28/2036	1.50%	None
WHOLE FOODS	Patio		1/1/2002	2/28/2022	\$1,259.71						None
K-MART CORPORATION	6310-6320	138,147	4/1/1978	8/31/2017	\$30,416.67	\$0.22			None		None
CITIBANK	300 Fairfax	11,249	4/1/1973	3/31/2018	\$41,445.80	\$3.68			None	N/A	None
PAYLESS SHOESOURCE	6324	3,804	1/11/1995	7/31/2017	\$13,204.55	\$3.47			None	5%	None
ANDRE'S	6332-17,18,19	5,245	3/1/1988	4/30/2018	\$24,634.50	\$4.70	1/1/2018	\$25,250.36	None	N/A	\$933.34
ANDRE'S STORAGE	19A	840	3/11/1988	4/30/2018	No Rent Charge						\$20,000 Letter of Credit)

TENANT	UNIT 370 S. Fairfax	SQUARE FEET	START	LEASE END 10/31/2019	\$4,590.00	RENT SQ. FOOT \$2.41	MONTHLY RENT SCHEDULE		OPTIONS	% RENT	SECURITY DEPOSIT
LORI SALE and JEAN KWOLEK		1,908					11/1/2017 11/1/2018	\$4,681.80 \$4,775.43	None	N/A	\$4,500.00
MANNEQUINES BOUTIQUE, INC.	6322 W. 3rd	1504	6/1/2016	8/31/2017	\$4,500.00	\$2.99					\$4,500.00
NEWSSTAND	6330 W. 3rd	666	3/1/2008	Month-to-Month	\$5,545.85	\$8.33			None		\$5,000.00
WIGS TODAY	6328 W. 3rd	934	3/1/2008	Month-to-Moth	\$6,307.35	\$6.75			None		\$5,604.00
VAN WAGNER	Billboard		9/19/1999	Month to Month	\$4,300				None		
A-1 KEYS	Kiosk		10/18/2000	Month-to-Month	\$905.18				None		\$550.00
MAJESTIC CAR WASH AUTO SPA CONNECTION	8017 W. 3rd.	24,050	9/1/1964	6/30/2029	\$14,000	\$0.58	07/01/19-06/30/24 07/01/24-06/30/29	\$18,000 \$22,000	None		\$10,000.00
ARTYOM HARUTYUNYAN	6330 1/2	100	4/12/2013	Month-to-Month	\$1,155.68	\$11.56			None		\$700.00
KIDS RIDE			6/1/1999	N/A	\$1.00						
SAN DIEGO PAYPHONE			8/1/2000	N/A	\$1.00						
STARLITE MEDIA	Signs		9/18/2003	5/31/2017	\$385.00				None		

252,645

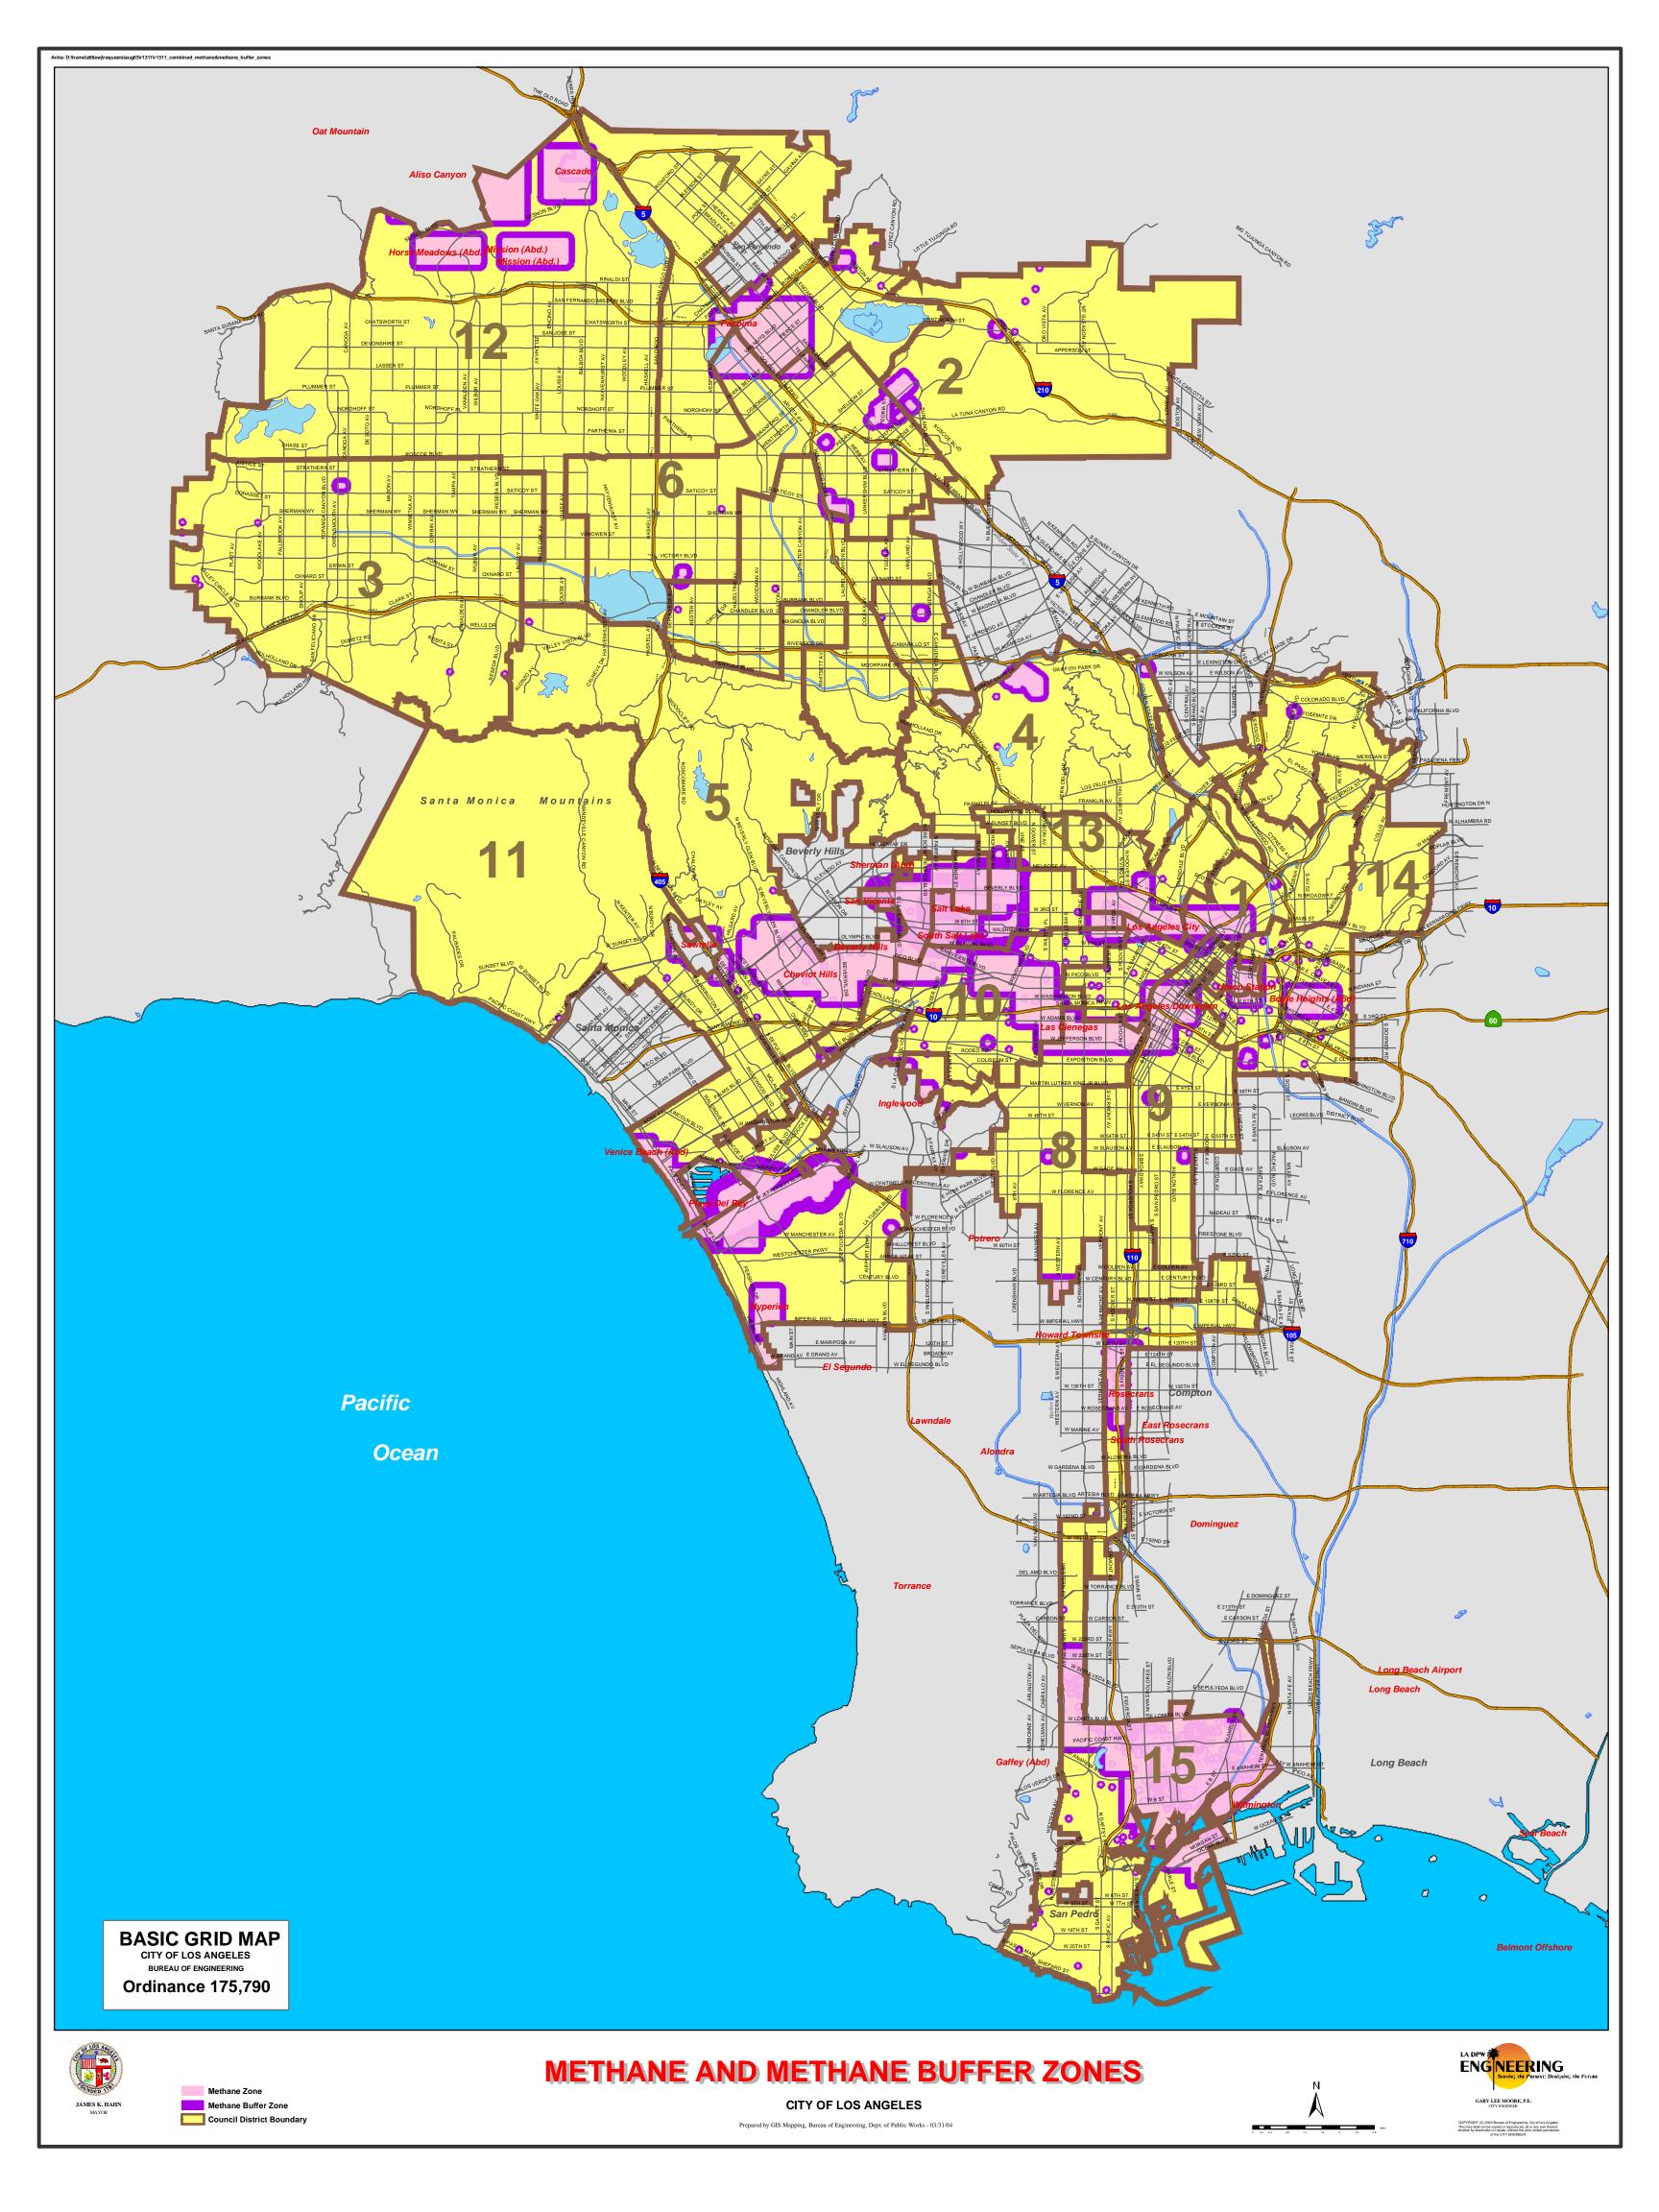



Arcadis U.S., Inc.

320 Commerce

Suite 200

Irvine, California 92602

Tel 714 730 9052

Fax 714 730 9345

www.arcadis.com